Ref. No.	Date	Time	Location	Construction Noise Level, dB(A)	Parameter	Action Level	Limit Level dB(A)	Follow-up action	
						when one		Possible reason:	Operation of Hydromill tench cutter in close proximity to the monitornig statoin was observed as the major
X_16N0037	7-Jun-16	14:40	M1a-Harbour Road Sports Centre	82	Leq(30min)	documented complaint was received.	75		noise contribution at Ex- Wan Chai Swimming Pool (adjacent to Harbour Road Sports Centre) under non WDII-CWB Contractor.
						. soomea.		Action taken / to be taken:	Repeat measurement to confirm result and reviewed the trend of noise measurement. Analysis of contractor's working procedure.
								Remarks / Other Obs:	Excavation works at Portion 5 was conducted under Contract HK/2009/02 around the concerned location during the time of measurement while operation of Hydromill tench cutter in close proximity to the monitornig statoin at Ex- Wan Chai Swimming Pool (adjacent to Harbour Road Sports Centre
									immediately opposite to the monitoring station) under non WDII-CWB Contractor was observed as the major noise contribution during monitoring. As such, the exceedance was considered as non-Project related.
X_16N038	7-Jun-16	14:40	M1a-Harbour Road Sports Centre	82	Leq(30min)	when one documented complaint was received.	75	Possible reason:	Operation of Hydromill tench cutter in close proximity to the monitornig statoin was observed as the major noise contribution at Ex- Wan Chai Swimming Pool (adjacent to Harbour Road Sports Centre) under non WDII-CWB Contractor.
								Action taken / to be taken:	Repeat measurement to confirm result and reviewed the trend of noise measurement. Analysis of contractor's working procedure.
								Remarks / Other Obs:	Backfilling works were conducted under Contract HK/2009/01 at Area 8 (West of Wan Chai Ferry Pier) during the time of measurement while operation of Hydromill trench cutter in close proximity to the monitornig station at Ex-Wan Chai Swimming Pool at Ex-Wan Chai Swimming Pool (adjacent to Harbour Road Sports Centre immediately opposite to the monitoring station) under non WDII-CWB
									Contractor was observed as the major noise contribution during monitoring. As such, the exceedance was considered as non-Project related.
			M6 - HK Baptist			when one		Possible reason:	Traffic nearby was observed during monitoring and was considered as the major noise contribution.
X_16N039	7-Jun-16	10:45	Church Henrietta Secondary School	67	Leq(30min)	documented complaint was received.	65		
								Action taken / to be taken:	Repeated measurement to confirm result and reviewed the trend of noise measurement. Analysis of contractor's working procedure.
								Remarks / Other Obs:	No work was conducted under Contract HY/2009/19 during the time of measurement and it was observed that traffic noise was a major noise source during monitoring. It is concluded that the exceedance was not due to project but to traffic noise nearby.
						when one		Possible reason:	Operation of Hydromill tench cutter in close proximity to the monitornig statoin was observed as the major
X_16N0041	13-Jun-16	14:35	M1a-Harbour Road Sports Centre	85	Leq(30min)	documented complaint was received.	75		noise contribution at Ex- Wan Chai Swimming Pool (adjacent to Harbour Road Sports Centre) under non WDII-CWB Contractor.
						. soomea.		Action taken / to be taken:	Repeat measurement to confirm result and reviewed the trend of noise measurement. Analysis of contractor's working procedure.
								Remarks / Other Obs:	Excavation works at Portion 5 was conducted under Contract HK/2009/02 around the concerned location during the time of measurement while operation of Hydromill tench cutter in close proximity to the monitornig statoin at Ex- Wan Chai Swimming Pool (adjacent to Harbour Road Sports Centre
									immediately opposite to the monitoring station) under non WDII-CWB Contractor was observed as the major noise contribution during monitoring. As such, the exceedance was considered as non-Project related.
X_16N042	13-Jun-16	14:35	M1a-Harbour Road Sports Centre	85	Leq(30min)	when one documented complaint was received.	75	Possible reason:	Operation of Hydromill tench cutter in close proximity to the monitornig statoin was observed as the major noise contribution at Ex- Wan Chai Swimming Pool (adjacent to Harbour Road Sports Centre) under non WDII-CWB Contractor.
						received.		Action taken / to be taken:	Repeat measurement to confirm result and reviewed the trend of noise measurement. Analysis of contractor's working procedure.
								Remarks / Other Obs:	Backfilling works were conducted under Contract HK/2009/01 at Area 8 (West of Wan Chai Ferry Pier) during the time of measurement while operation of Hydromill trench cutter in close proximity to the
									monitornig statoin at Ex- Wan Chai Swimming Pool at Ex- Wan Chai Swimming Pool (adjacent to Harbour Road Sports Centre immediately opposite to the monitoring station) under non WDII-CWB Contractor was observed as the major noise contribution during monitoring. As such, the exceedance
									was considered as non-Project related.



Ref. No.	Date	Time	Location	Construction Noise Level, dB(A)	Parameter	Action Level	Limit Level dB(A)	Follow-up action	
X_16N043	13-Jun-16	11:00	M6 - HK Baptist Church Henrietta Secondary School	67	Leq(30min)	when one documented complaint was received.	65	Possible reason:	Traffic nearby was observed during monitoring and was considered as the major noise contribution.
								Action taken / to be taken:	Repeated measurement to confirm result and reviewed the trend of noise measurement. Analysis of contractor's working procedure.
								Remarks / Other Obs:	No work was conducted under Contract HY/2009/19 during the time of measurement and it was observed that traffic noise was a major noise source during monitoring. It is concluded that the exceedance was not due to project but to traffic noise nearby.
X_16N0045	21-Jun-16	15:27	M1a-Harbour Road Sports Centre	78	Leq(30min)	when one documented complaint was received.	75	Possible reason:	Operation of breaker opposite to the monitoring statoin was observed as the major noise contribution under non WDII-CWB Contractor.
								Action taken / to be taken:	Repeat measurement to confirm result and reviewed the trend of noise measurement. Analysis of contractor's working procedure.
								Remarks / Other Obs:	Excavation works at Portion 5 was conducted under Contract HK/2009/02 around the concerned location during the time of measurement while breaking works opposite to the monitoring station under non WDII-CWB Contractor was observed as the major noise contribution during monitoring. As such, the exceedance was considered as non-Project related.
X_16N046	21-Jun-16	15:27	M1a-Harbour Road Sports Centre	78	Leq(30min)	when one documented complaint was received.	75	Possible reason:	Operation of breaker opposite to the monitoring statoin was observed as the major noise contribution under non WDII-CWB Contractor.
								Action taken / to be taken:	Repeat measurement to confirm result and reviewed the trend of noise measurement. Analysis of contractor's working procedure.
								Remarks / Other Obs:	Backfilling works was conducted under Contract HK/2009/01 at Area 8 (West of Wan Chai Ferry Pier) during the time of measurement while breaking works opposite to monitoring station under non WDII-CWB Contractor was observed as the major noise contribution during monitoring. As such, the exceedance was considered as non-Project related.
X_16N047	21-Jun-16	9:48	M6 - HK Baptist Church Henrietta Secondary School	69	Leq(30min)	when one documented complaint was received.	65	Possible reason:	Traffic nearby was observed during monitoring and was considered as the major noise contribution while external wall renovation at City Garden next to monitoring station was observed.
								Action taken / to be taken:	Repeated measurement to confirm result and reviewed the trend of noise measurement. Analysis of contractor's working procedure.
								Remarks / Other Obs:	Only rebar fixing and shifting of launching girder for segement placing were conducted under Contract HY/2009/19 around the monitoring location and nearby traffic noise was observed as major noise source during monitoring. In addition, external wall renovation at City Garden was observed. In view of the above, the exceedance was considere as non-Project related.

Lam Geotechnics Limited

Ref no.	Date	Tidal	Location	Parameters (Unit)	Measured	Action Level	Limit Level	Follow-up action	
X_16C034	18-Jun-16	Mid-ebb	C7	DO(mg/l)	4.30	3.02		Possible reason:	Natural variation or changes of water quality in the vicinity of water abstraction location for the water quality monitoring station.
				Turbidity	9.47	11.35	12.71	Action taken/ to be taken:	Immediate repeated in-situ measurement had conducted to confirm the exceedances. Checking with contractor works and review previous monitoring data.
				ss	19.50	18.42	27.54	Remarks/ Other Obs:	No marine activity was conducted under Contract HY/2009/15 at Causeway Bay Typhoon Shelter on the monitoring date. In view of no marine construction activity, the exceedance was considered not related to Contract HY/2009/15 construction works. No marine activity was conducted under Contract HY/2010/08 on the monitoring date. Installed silt screen was in place. In view of the above, and no exceedance was recorded on the subsequent monitoring, it was considered that the exceedance was not project related.
X_16C035	24-Jun-16	Mid-ebb	C7	DO(mg/l)	5.07	3.02	2.44	Possible reason:	Natural variation or changes of water quality in the vicinity of water abstraction location for the water quality monitoring station.
				Turbidity	16.18	11.35	12.71	Action taken/ to be taken:	Immediate repeated in-situ measurement had conducted to confirm the exceedances. Checking with contractor works and review previous monitoring data.
				SS	20.00	18.42	27.54	Remarks/ Other Obs:	No marine activity was conducted under Contract HY/2009/15 at Causeway Bay Typhoon Shelter on the monitoring date. In view of no marine construction activity, the exceedance was considered not related to Contract HY/2009/15 construction works. No marine activity was conducted under Contract HY/2010/08 on the monitoring date. Installed silt screen was in place. In view of the above, and no exceedance was recorded on the subsequent monitoring, it was considered that the exceedance was not project related.

Lam Geotechnics Limited

Ref no.	Date	Tidal	Location	Depth	Parameters (Unit)	Measured	Action Level	Limit Level	Follow-up action	
X 16D0014	1-Jun-16		Ex-WPCWA SE	Bottom	DO(mg/I)	3.58	3.76		Possible reason:	Possible in relation to the upstream organic discharge.
					3,				Action taken/ to be taken:	Repeated the measurement to confirm the result. No odour nuisance was noted during the DO monitoring. Checking with Contractor works and review previous monitoring data.
									Remarks/ Other Obs:	No marine activity was conducted at TPCWAW under HY/2009/15 on the monitoring date. Upstream discharge from nearby culvert was noted. In view of no marine activity and no exceedance was recorded on the subsequent monitoring, the exceedance was considered not related to the Project works.
X_16D0015	10-Jun-16	Mid-ebb	Ex-WPCWA SW	Middle	DO(mg/l)	3.10	3.19	3.10	Possible reason:	Possible in relation to the upstream organic discharge.
									Action taken/ to be taken:	Repeated the measurement to confirm the result. No odour nuisance was noted during the DO monitoring. Checking with Contractor works and review previous monitoring data.
									Remarks/ Other Obs:	No marine activity was conducted at TPCWAW under HY/2009/15 on the monitoring date. Upstream discharge from nearby culvert was noted. In view of no marine activity and no exceedance was recorded on the subsequent monitoring, the exceedance was considered not related to the Project works.
X_16D0016	16-Jun-16	Mid-ebb	Ex-WPCWA SW	Surface	DO(mg/l)	2.35	3.19	3.10	Possible reason:	Possible in relation to the upstream organic discharge.
									Action taken/ to be taken: Remarks/ Other Obs:	Repeated the measurement to confirm the result. No odour nuisance was noted during the DO monitoring. Checking with Contractor works and review previous monitoring data. No marine activity was conducted at TPCWAW under HY/2009/15 on the monitoring date. Upstream
										discharge from nearby culvert was noted. In view of no marine activity, the exceedance was considered not related to the Project works.
X_16D0017	18-Jun-16	Mid-ebb	Ex-WPCWA SW	Middle	DO(mg/l)	2.22	3.19	3.10	Possible reason:	Possible in relation to the upstream organic discharge.
									Action taken/ to be taken:	Repeated the measurement to confirm the result. No odour nuisance was noted during the DO monitoring. Checking with Contractor works and review previous monitoring data.
									Remarks/ Other Obs:	No marine activity was conducted at TPCWAW under HY/2009/15 on the monitoring date. Upstream discharge from nearby culvert was noted. In view of no marine activity and no exceedance was recorded on the subsequent monitoring, the exceedance was considered not related to the Project works.
X_16D0018	24-Jun-16	Mid-ebb	Ex-WPCWA SW	Surface	DO(mg/l)	1.57	3.19	3.10	Possible reason:	Possible in relation to the upstream organic discharge.
									Action taken/ to be taken:	Repeated the measurement to confirm the result. No odour nuisance was noted during the DO monitoring. Checking with Contractor works and review previous monitoring data.
									Remarks/ Other Obs:	No marine activity was conducted at TPCWAW under HY/2009/15 on the monitoring date. Upstream discharge from nearby culvert was noted. In view of no marine activity and no exceedance was recorded on the subsequent monitoring, the exceedance was considered not related to the Project works.
					1	1				