



Ref. No.	Date	Time	Location	Construction Noise Level, dB(A)	Parameter	Action Level	Limit Level dB(A)	Follow-up action
X_18N013	6-Mar-18	15:35	M6-HK Baptist Church Henrietta Secondary School	77	Leq(30min)	when one documented complaint was received.	70	<p>Possible reason: Concurrent breaking and saw cutting works on IECL opposite to Henrietta Secondary School was considered as the major noise contribution.</p> <p>Action taken / to be taken: Immediate repeat measurement was conducted to confirm the result at the same location. The construction noise level of repeated measurement at the same location on the same date was: <b>06 March 2018 at 16:05 77dB(A)</b>. Contractor was advised to prepare and submit the remediation plan for the concerned construction works according to the Event and Action Plan.</p> <p>Remarks / Other Obs: Additional monitoring was conducted on <b>08 March 2018 at 10:50</b> during non-examination period and the construction noise level was found to be at <b>69 dB(A)</b> and no further exceedance was recorded.</p> <p>Concurrent breaking and saw cutting works on IECL opposite to Henrietta Secondary School under Contract HY/2009/19 was conducted during the measurement on 06 March 2018 and the noise contribution from the concurrent operation was observed as the major noise contribution. Hence, the exceedance was considered as Project related. Remedial actions including saw cutting works alone without concurrent operation of breaker and provision of additional temporary noise barrier for cutting works were implemented by the Contractor and no further exceedances was recorded during the additional monitoring on 08 March 2018. The Contractor of HY/2009/19 was advised to avoid future concurrent operation of major noise emanating works such as breaking and saw cutting works to avoid potential cumulative impact.</p>



Ref. No.	Date	Time	Location	Measured TSP Level	Unit	Action Level	Limit Level	Follow-up action
X_18A005	26-May-18	13:00	CMA2a - Causeway Bay Community Centre	433.9	1hr TSP (ug/m <sup>3</sup> )	323.4	500.0	<p><b>Possible reason:</b> TSP level potentially in relate to the nearby non WDII-CWB project construction works around the monitoring station.</p> <p><b>Action taken / to be taken:</b> Reviewed the trend of air quality measurement across monitoring stations. Analysis of contractor's working procedures.</p> <p><b>Remarks / Other Obs:</b> No construction works was conducted under HY/2009/19 on the monitoring date and no particular observation regarding to air quality impact was observed during sampling Meanwhile, non WDII-CWB Project construction works was observed opposite to the monitoring station.</p> <p>In view of the above, the exceedance was considered to be not related to the Project works under Contract HY/2009/19 and potentially contributed by non-WDII-CWB project construction works was observed opposite to the monitoring station. Nevertheless, the Contractor of HY/2009/19 was reminded to provided regularly dust suppression measures if any potential dust generating operation around the concerned location would be required to avoid any potential cumulative air quality impact.</p>



Ref. No.	Date	Time	Location	Measured TSP Level	Unit	Action Level	Limit Level	Follow-up action
X_18A004	26-May-18	13:00	CMA2a - Causeway Bay Community Centre	433.9	1hr TSP (ug/m <sup>3</sup> )	323.4	500.0	<p><b>Possible reason:</b> TSP level potentially in relate to the nearby non WDII-CWB project construction works around the monitoring station.</p> <p><b>Action taken / to be taken:</b> Reviewed the trend of air quality measurement across monitoring stations. Analysis of contractor's working procedures.</p> <p><b>Remarks / Other Obs:</b> Plastering work, tile fixing work, Green roof installation works and Equipment and System testing works was conducted under HY/2011/08 at EVB on the monitoring date and no particular observation regarding to air quality impact was observed during sampling Meanwhile, non WDII-CWB Project construction works was observed opposite to the monitoring station.</p> <p>In view of the above, the exceedance was considered to be not related to the Project works under Contract HY/2011/08 and potentially contributed by non-WDII-CWB project construction works was observed opposite to the monitoring station. Nevertheless, the Contractor of HY/2011/08 was reminded to provide regularly dust suppression measures if any potential dust generating operation around the concerned location would be required to avoid any potential cumulative air quality impact.</p>