



CONTRACT NO: HK/2011/07

**WANCHAI DEVELOPMENT PHASE II AND CENTRAL
WANCHAI BYPASS
SAMPLING, FIELD MEASUREMENT AND TESTING WORK
(STAGE 2)**

**ENVIRONMENTAL PERMIT NO. EP-364/2009/C,
FURTHER ENVIRONMENTAL PERMIT NOS. FEP-01/364/2009,
FEP-02/364/2009, FEP-05/364/2009/A, FEP-06/364/2009/A, FEP-
07/364/2009/A, FEP-08/364/2009/A, FEP-09/364/2009/B, FEP-
10/364/2009/B AND FEP-11/364/2009/B**

MONTHLY ENVIRONMENTAL MONITORING & AUDIT REPORT

- AUGUST 2014 -

CLIENTS:

**Civil Engineering and Development
Department**

and

Highways Department

PREPARED BY:

Lam Geotechnics Limited

11/F Centre Point
181-185 Gloucester Road,
Wanchai, H.K.

Telephone: (852) 2882-3939
Facsimile: (852) 2882-3331
E-mail: info@lamenviro.com
Website: <http://www.lamenviro.com>

CERTIFIED BY:

Raymond Dai
Environmental Team Leader

DATE:

10 September 2014

Ref.: AACWBIECEM00_0_5666L.14

10 September 2014

By Post and Fax (2691 2649)

AECOM Asia Company Limited
11/F, Tower 2
Grand Central Plaza
138 Shatin Rural Committee Road
Shatin, New Territories
Hong Kong

Attention: Mr. Conrad Ng

Dear Sir,

Re: Wan Chai Development Phase II and Central-Wan Chai Bypass
Monthly Environmental Monitoring and Audit Report (August 2014) for EP-364/2009/C,
FEP-01/364/2009, FEP-02/364/2009, FEP-05/364/2009/A, FEP-06/364/2009/A,
FEP-07/364/2009/A, FEP-08/364/2009/A, FEP-09/364/2009/B, FEP-10/364/2009/B & FEP-
11/364/2009/B

Reference is made to the Environmental Team's submission of the captioned Monthly Environmental Monitoring and Audit (EM&A) Report for August 2014 received by email on 10 September 2014.

Please be informed that we have no adverse comment on the captioned submission. We write to verify the captioned submission in accordance with Condition 3.4 in the captioned Environmental Permits.

Thank you very much for your kind attention and please do not hesitate to contact the undersigned should you have any queries.

Yours sincerely,



David Yeung
Independent Environmental Checker

c.c. HyD
CEDD
AECOM
Lam

Mr. Eddy Wu
Mr. Jason Cheung
Mr. Francis Leong / Mr. Stephen Lai
Mr. Raymond Dai

by fax: 2714 5289
by fax: 2577 5040
by fax: 2691 2649
by fax: 2882 3331

Q:\Projects\AACWBIECEM00\Corr\AACWBIECEM00_0_5666L.14.doc



TABLE OF CONTENTS

EXECUTIVE SUMMARY	4
1 INTRODUCTION	12
1.1 Scope of the Report	12
1.2 Structure of the Report.....	12
2 PROJECT BACKGROUND	14
2.1 Background	14
2.2 Scope of the Project and Site Description	14
2.3 Division of the Project Responsibility	15
2.4 Project Organization and Contact Personnel.....	16
3 STATUS OF REGULATORY COMPLIANCE	23
3.1 Status of Environmental Licensing and Permitting under the Project.....	25
4 MONITORING REQUIREMENTS	39
4.1 Noise Monitoring	39
4.2 Air Monitoring.....	41
5.0 MONITORING RESULTS.....	43
5.1 Noise Monitoring Results	44
5.2 Real Time Noise Monitoring Results.....	46
5.3 Air Monitoring Results	48
5.4 Waste Monitoring Results.....	50
6.0 COMPLIANCE AUDIT	55
6.1 Noise Monitoring	55
6.2 Air Monitoring	56
6.3 Review of the Reasons for and the Implications of Non-compliance.....	57
6.4 Summary of action taken in the event of and follow-up on non-compliance	57
7.0 CUMULATIVE CONSTRUCTION IMPACT DUE TO THE CONCURRENT PROJECTS.....	57
8.0 ENVIROMENTAL SITE AUDIT	59
9.0 COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTION	63
10 CONCLUSION.....	65

LIST OF TABLES

Table 2.1	Schedule 2 Designated Projects under this Project
Table 2.2	Details of Individual Contracts under the Project
Table 2.3	Contact Details of Key Personnel
Table 3.1	Summary of the current status on licences and/or permits on environmental protection pertinent to the Project
Table 3.4	Cumulative Summary of Valid Licences and Permits under Contract no. HK/2009/01
Table 3.5	Summary of submission status under FEP-02/364/2009
Table 3.6	Cumulative Summary of Valid Licences and Permits under Contract no. HK/2009/02
Table 3.7	Summary of submission status under FEP-01/364/2009
Table 3.8	Cumulative Summary of Valid Licences and Permits under Contract no. HY/2009/18
Table 3.9	Summary of submission status under FEP-05/364/2009/A
Table 3.10	Cumulative Summary of Valid Licences and Permits under Contract no. HY/2009/15
Table 3.11	Summary of submission status under FEP-06/364/2009/A
Table 3.12	Cumulative Summary of Valid License and Permits under Contract no. HY/2009/19
Table 3.13	Summary of submission status under FEP-07/364/2009/A
Table 3.14	Cumulative Summary of Valid Licences and Permits under Contract no. HK/2010/06
Table 3.15	Summary of submission status under FEP-08/364/2009/B
Table 3.16	Cumulative Summary of Valid License and Permits under Contract no. HK/2012/08
Table 3.17	Summary of submission status under FEP-09/364/2009/B
Table 3.18	Cumulative Summary of Valid License and Permits under Contract no. HY/2010/08
Table 3.19	Summary of submission status under FEP-10/364/2009/B
Table 3.20	Cumulative Summary of Valid License and Permits under Contract no. HY/2011/08
Table 4.1	Noise Monitoring Stations
Table 4.2	Real Time Noise Monitoring Stations
Table 4.3	Air Monitoring Stations
Table 5.1	Noise Monitoring Stations for Contract no. HY/2009/18
Table 5.2	Noise Monitoring Station for Contract no HK/2009/01 and HK/2009/02
Table 5.3	Noise Monitoring Stations for Contract no. HY/2009/15
Table 5.4	Noise Monitoring Stations for Contract no. HY/2009/19
Table 5.5	Noise Monitoring Stations for Contract no. HY/2010/08
Table 5.7	Real Time Noise Monitoring Stations for Contract no. HY/2009/19
Table 5.9	Air Monitoring Stations for Contract no. HY/2009/18
Table 5.10	Air Monitoring Station for Contract no. HK/2009/01
Table 5.11	Air Monitoring Station for Contract no. HK/2009/02
Table 5.12	Air Monitoring Station for Contract no. HY/2009/15
Table 5.13	Air Monitoring Stations for Contract no. HY/2009/19
Table 5.15	Details of Waste Disposal for Contract no. HK/2009/01
Table 5.16	Details of Waste Disposal for Contract no. HK/2009/02
Table 5.17	Details of Waste Disposal for Contract no. HY/2009/18
Table 5.18	Details of Waste Disposal for Contract no. HY/2009/15
Table 5.19	Details of Waste Disposal for Contract no. HY/2009/19
Table 5.20	Details of Waste Disposal for Contract no. HK/2010/06
Table 5.21	Details of Waste Disposal for Contract no. HK/2012/08
Table 5.22	Details of Waste Disposal for Contract no. HY/2010/08
Table 5.23	Details of Waste Disposal for Contract no. HY/2011/08
Table 8.1	Summary of Environmental Inspections for Contract no. HY/2009/15
Table 8.3	Summary of Environmental Inspections for Contract no. HK/2009/19
Table 8.4	Summary of Environmental Inspections for Contract no. HK/2009/01
Table 8.5	Summary of Environmental Inspections for Contract no. HK/2009/02
Table 8.7	Summary of Environmental Inspections for Contract no. HK/2012/08
Table 8.8	Summary of Environmental Inspections for Contract no. HY/2010/08
Table 9.1	Cumulative Statistics on Complaints

Table 9.2 *Cumulative Statistics on Successful Prosecutions*

Table 10.1 *Summary of Key Construction Activities of Individual Contract(s) to be commenced in Coming Reporting Month*

LIST OF FIGURES

<u>Figure 2.1</u>	Project Layout
<u>Figure 2.2</u>	Project Organization Chart
<u>Figure 4.1</u>	Locations of Environmental Monitoring Stations

LIST OF APPENDICES

<u>Appendix 3.1</u>	Environmental Mitigation Implementation Schedule
<u>Appendix 4.1</u>	Action and Limit Level
<u>Appendix 4.2</u>	Copies of Calibration Certificates
<u>Appendix 5.1</u>	Monitoring Schedule for Reporting Month and Coming month
<u>Appendix 5.2</u>	Noise Monitoring Results and Graphical Presentations
<u>Appendix 5.3</u>	Air Quality Monitoring Results and Graphical Presentations
<u>Appendix 5.4</u>	Real-time Noise Monitoring Results and Graphical Presentations
<u>Appendix 6.1</u>	Event Action Plans
<u>Appendix 6.2</u>	Notification of Exceedance
<u>Appendix 9.1</u>	Complaint Log
<u>Appendix 10.1</u>	Construction Programme of Individual Contracts

EXECUTIVE SUMMARY

- i. This is the Environmental Monitoring and Audit (EM&A) Monthly Report – [August 2014](#) specific for Environmental Permit no. EP-364/2009/C, Further Environmental Permit nos. FEP-01/364/2009, FEP-02-364/2009, FEP-05/364/2009/A, FEP-06/364/2009/A FEP-07/364/2009/A, FEP-08/364/2009/A, FEP-09/364/2009/B, FEP-10/364/2009/B and FEP-11/364/2009/B. The EM&A report is prepared by the Environmental Team (ET) employed under Contract No. HK/2011/07 – Wan Chai Development Phase II and Central Wanchai Bypass – Sampling, Field Measurement and Testing Works (Stage 2). This report presents the environmental monitoring findings and information recorded during the period of [August 2014](#). The cut-off date of reporting is at 27th of each reporting month.
- ii. In the reporting month, the principal work activities of individual contracts are included as follows:

Contract no. HY/2009/18 - Central - Wan Chai Bypass (CWB) - Central Interchange under FEP-05/364/2009/A

- [Excavation of trial pit](#)
- [Transplanting of trees](#)
- [Drainage works](#)
- [Tunnel works including scaffolding erection, excavation, OHVD installation, roadside barriers, top and base slab construction](#)
- [Trough structure construction and associated drilling and grouting](#)
- [Road works](#)
- [Bridges construction](#)

Contract no. HK/2009/01 - Wan Chai Development Phase II - Central - Wan Chai Bypass at Hong Kong Convention and Exhibition Centre - Tunnel Works under FEP-02/364/2009

- [Stage 1 construction of tunnel structures](#)
- [Stage 2 installation of pre-bored H-piles](#)
- [Stage 2 installation of sheet pile at exhaust duct](#)
- [Installation of dewatering well in Stage 2](#)
- [Stage 2 excavations and ELS works](#)
- [Demolition works of existing HKCEC pump house \(Kiu Lok Portion\)](#)
- [Demolition of 10 nos. pump cells at Convention Avenue](#)
- [Stage 3 construction of D-Wall](#)
- [Stage 3 installation of pre-bored H-piles](#)
- [Discharge cooling mainlaying works for BI, BG & BF](#)
- [S8B and S9 saltwater mainlaying works](#)

Contract no. HK/2009/02 - Wan Chai Development Phase II - Central - Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

- Backfilling work for tunnel
- Loading transfer of utility bridge for DSD Sewage Outfall pipes and WSD Intake Culvert
- Removal of Strut
- Excavation for Tunnel Portion
- Installation of dewatering system
- Bored piling works

Contract no. HY/2009/15 - Central-Wanchai Bypass – Tunnel (Causeway Bay Typhoon Shelter Section) under FEP-06/364/2009/A

- Dismantling of struts and backfilling at TS4 & TPCWAE
- Mined Tunnel drill-and-break works and installation of steel ribs at East and West Portal

Contract no. HY/2009/19 - Central - Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/A

- Road works at Watson Road
- Bored piling (Land)
- Removal/Installation of strut at ELS
- Construction of Dolphin Cap
- ELS for Cut & Cover Tunnel and EVB
- Excavation of ELS continue
- Laying of 1350 ϕ pipe
- Pre-bored H-pile for Admin. Building continue
- Parapet construction continue
- Wing slab extension continue
- Construction of TD bridge continue
- Construction of Bridge E
- Construction of Bridge F4 and F5
- Dismantling of Launching Girder
- Construction of Pump Sump E
- Installation of Noise Barrier/enclosure
- Modification of existing crosshead at Pier 17-18

Contract no. HK/2010/06 - Wan Chai Development Phase II - Central - Wan Chai Bypass over MTR Tsuen Wan Line under FEP-08/364/2009/A

- Cross wall sealing
- Concreting of turret openings

Contract no. HK/2012/08 – Wan Chai Development Phase II – Central- Wan Chai Bypass at Wan Chai West under FEP-09/364/2009B

- Diaphragm wall construction
- Site survey



Contract no. HY/2010/08 –Central - Wan Chai Bypass (CWB) –Tunnel (Slip Road 8) under FEP-10/364/2009B

- Tree & root pruning works
- Tree transplanting works,
- Tree works within off-site nursery compound,
- Drainage improvement works,
- Sheet piling works,
- Excavation and Lateral Support for U-structure,
- Erection of noise absorption sheetings,
- Pipe piling, ground pre-treatment, pre-boring works & jet grouting works,
- Utility diversion &
- Construction of Bowling Green Office.

Contract no. HY/2011/08 –Central - Wan Chai Bypass (CWB) –Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning under FEP-11/364/2009B

- No physical construction activity on site

Noise Monitoring

- iii. Noise monitoring during daytime was conducted at M1a - Harbour Road Sports Center; M2b - Noon-day gun area; M3a - Tung Lo Wan Fire Station; M4b - Victoria Center; M5b - City Garden, M6 - HK Baptist Church Henrietta Secondary School, M7e and M7w - International Finance Centre Eastern and Western End of Podium, and M8 - City Hall on a weekly basis.
- iv. One limit level exceedances at M6 - HK Baptist Church Henrietta Secondary School were recorded on 28 July 2014 in this reporting month. The exceedances were concluded as non-project related.
- v. One limit level exceedances at M2b - Noon Day Gun Area was recorded on 5 August 2014 in this reporting month. The exceedance was concluded as project related.
- vi. 24-hour real time noise monitoring was conducted at RTN1 - FEHD Hong Kong Transport Section Whitfield Depot for construction activities at IEC bridge deck. No limit level exceedance was recorded in the reporting month.
- vii. 24-hour real time noise monitoring was conducted at RTN2a - Hong Kong Electric Centre. No project related exceedance was recorded in the reporting month.
- viii. 24-hour real time noise monitoring was conducted at RTN3 - Yu Lee Mo Fan Memorial School. No limit level exceedance was recorded in the reporting month.
- ix. 24-hour real time noise monitoring was conducted at RTN4 - Causeway Bay Community Centre. No limit level exceedance was recorded in the reporting month.
- x. Liaison was conducted with HK Baptist Church Henrietta Secondary School and Po Leung Kuk Yu Lee Mo Fan Memorial School regarding the set up of RTN3 real time noise monitoring station. Po Leung Kuk Yu Lee Mo Fan Memorial School grant permission for set up on 4 Sep 2012 and station set up was performed on 14 Sep 2012.
- xi. Real time noise monitoring station at Oil Street Community Liaison Centre (RTN2- Oil Street Community Centre) was relocated from Oil Street Community Liaison Centre to Hong Kong Electric (RTN2a- Electric Centre) on 5 Oct 2012 which is a representative of the noise sensitive receiver City Garden. The baseline noise level of RTN2a will adopt the results derived from the baseline noise monitoring conducted in Electric Centre from 4 December 2009 to 17 December 2009.
- xii. Real-time noise baseline capturing was conducted from 21 Sep 2012 to 04 Oct 2012 at RTN3-Po Leung Kuk Yu Lee Mo Fan Memorial School.
- xiii. Real-time Noise Monitoring at RTN3- Po Leung Kuk Yu Lee Mo Fan Memorial School was commenced since 06 Oct 2012.
- xiv. Causeway Bay Community Centre has granted permission for set up of real time noise monitoring station on 21 Dec 2012 and station set up was performed on 27 Dec 2012. The Baseline noise level of RTN4- Causeway Bay Community Centre will adopt the results from the baseline noise monitoring report for EP/364/2009 in 22 April 2010 in which approved by EPD.
- xv. According to clause 3.1 stated in EP-364/2009/B, "the real-time monitoring system shall be in place no later than two weeks before the commencement date of demolition works of the existing Island Eastern Corridor". IEC demolition associated construction works was commenced on 3 Feb 2013 and Real time noise monitoring at RTN4-Causeway Bay Community Centre was commenced on 13 Jan 2013.

- xvi. Real-time noise monitoring station RTN1-FEHD Whitfield Depot was finely adjusted from 2/F to roof-top at FEHD Whitfield Depot on 24 June 2013 with respect to the commencement of advance works for IEC parapet demolition.
- xvii. With respect to the completion of Victoria Car Park refurbishment, the noise monitoring at M4b-Victoria Center was reverted from 3/F to 2/F since 24 June 2014.

Air Monitoring

- xviii. Due to electricity interruption, the following 24hr TSP monitoring events were rescheduled in the reporting month,
24hr TSP monitoring at CMA1b was rescheduled from 14 August 2014 and 20 August 2014 to 15 August 2014 to 21 August 2014 respectively.
24hr TSP monitoring at CMA5a was rescheduled from 14 August 2014 and 20 August 2014 to 15 August 2014 to 21 August 2014 respectively.
24hr TSP monitoring at MA1e was rescheduled from 26 August 2014 to 27 August 2014.
- xix. Due to extension of site boundary by contractor of HY/2009/19, location of air monitoring station CMA1b – Oil Street Community Liaison Centre has been finely adjusted on 21 April 2012.
- xx. The location ID of air monitoring station CMA1b was updated as Oil Street Site Office in April 2013.
- xxi. 1-hour and 24-hour Total Suspended Particulates (TSP) monitoring were conducted at CMA1b – Oil Street Site Office; CMA2a - Causeway Bay Community Center; CMA3a - CWB PRE Site Office Area; CMA4a – Society for the Prevention of Cruelty to Animals; CMA5a - Children Garden opposite to Pedestrian Plaza; MA1e and MA1w – International Finance Centre eastern and western podium on every six days basis.

Complaints, Notifications of Summons and Successful Prosecutions

- xxii. One environmental complaint (ICC Case Ref.: 2-360638977) dated 31 July 2014 regarding noise concern referred by RSS was received by ET on 01 August 2014.
- xxiii. The complainant reported that at 01:20hrs on 30 July 2014, the complainant was woken up by the noise of sand and gravel movements at area opposite to the Harbour Heights.
- xxiv. According to the relevant site records, before 2300hrs on 29 July 2014, EVB excavation at the works area around Watson Road was conducted under HY/2009/19. (Total 1 no. of dump truck, 1 no. of excavator, 3 nos. of generators and 23 nos. of dewatering pumps were in operation at the above period). From around 23:00hrs on 29 July 2014 to 01:00hrs on 30 July 2014, dewatering works at works area around Watson Road was conducted under HY/2009/19. Total 23 nos. of dewatering pumps were operating at the above period.
In addition, mobilization of PMEs was performed at works area around Watson Road under HY/2009/19 from 00:45hrs to 01:30hrs on 30 July 2014. Total 1 no. of excavation machine and 1 no. of dump truck were in operation. After reviewing relevant records and information verified by RSS and the Construction Noise Permit (CNP) no.GW-RS0152-14, it was considered the below condition of CNP GW-RS0152-14 was not fulfilled by the Contractor of HY/2009/19. From around 00:45hrs to 01:30hrs on 30 July 2014, the operation of PME(s) (1

no. of excavator and 1 no. of dump truck) under the Contractor of HY/2009/19 on-site could not follow any given PME grouping requirement(s) as stated in condition 3.a. and condition 3.d. in no.GW-RS0152-14.

- xxv. Notwithstanding the above, according to the information provided by the RSS, the excavator and dump truck were mobilized away from the edge of the temporary ELS structure towards the area opposite to the Harbour Heights after 23:00hrs under safety consideration.
- xxvi. The Contractor of HY/2009/19 was advised to review the arrangement and location for retaining and securing PME(s)/ plants to minimize the movements of PME or plants after completion of works such that the Construction Noise Permit would be followed.

Site Inspections and Audit

- xxvii. The Environmental Team (ET) conducted weekly site inspections for Contract no. HY/2009/15, HY/2009/18, HY/2009/19, HY/2010/08, HK/2009/01, HK/2009/02, HK/2012/08 and HK/2010/06 in this reporting period. Construction of bored pile E3B under HY/2009/17 was confirmed completed and the respective work area under FEP was inspected under HY/2009/19 from 19 Dec 2012 onwards. The Contractors rectified major observations and recommendations made during the audit sessions. No non-conformance was identified during the site inspections.

Future Key Issues

xxviii. In the coming reporting month, the principal work activities of individual contracts are anticipated as follows:

Contract no. HY/2009/18 – Central – Wan Chai Bypass (CWB) – Central Interchange under FEP-05/364/2009/A

- Excavation of trial pit
- Transplanting of trees
- Drainage works
- Tunnel works including scaffolding erection, excavation, OHVD installation, roadside barriers, top and base slab construction, extract sheet pile, waterproofing and backfill
- Trough structure construction and associated drilling and grouting
- Road works
- Bridges construction

Contract no. HK/2009/01 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention and Exhibition Centre – Tunnel Works under FEP-02/364/2009

- Stage 1 construction of tunnel structures
- Stage 2 excavation and ELS works
- Stage 3 construction of D-Wall
- Demolition of the remaining East Bridge
- pre-bored H piles
- Excavation work
- Pipe laying for discharge cooling main BF

Contract no. HK/2009/02 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

- Backfilling to Tunnel Portion 1.
- Utility bridge load transfer for Box Culvert N1 & Cooling Watermain
- Excavate and installation of ELS.
- Pump test for continuing Tunnel Portion 2 excavation.
- Bored pile construction.

Contract no. HY/2009/15 – Central-Wanchai Bypass – Tunnel (Causeway Bay Typhoon Shelter Section) under FEP-06/364/2009/A

- Post tunnel construction at TS1 and TS2
- Mined Tunnel drill-and-break works at East and West Portal
- Permanent lining structure at West Portal of Mined Tunnel

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/A

- Road works at Watson Road
- Bored piling (Land)
- Removal/ Installation of strut at ELS
- Construction of Dolphin Cap
- ELS for Cut & Cover Tunnel and EVB
- Excavation of ELS continue
- Laying of 1350 ϕ pipe
- Pre-bored H-pile for Admin. Building continue
- Parapet construction continue
- Construction of TD bridge continue
- Construction of Bridge E
- Construction of Bridge F4 and F5
- Construction of Pump Sump E
- Installation of Noise Barrier/enclosure
- Modification of existing crosshead at Pier 17-18
- IECL Road modification and removal of Median Barrier

Contract no. HK/2010/06 - Wan Chai Development Phase II - Central - Wan Chai Bypass over MTR Tsuen Wan Line under FEP-08/364/2009/A

- Sealing at turret openings

Contract no. HK/2012/08 – Wan Chai Development Phase II – Central- Wan Chai Bypass at Wan Chai West under FEP-09/364/2009/B

- Diaphragm wall construction
- Site survey

Contract no. HY/2010/08 –Central - Wan Chai Bypass (CWB) –Tunnel (Slip Road 8) under FEP-10/364/2009B

- Tree & root pruning works
- Tree transplanting works,
- Tree works within off-site nursery compound,
- Drainage improvement works,
- Sheet piling works,
- Excavation and Lateral Support for U-structure,
- Erection of noise absorption sheetings,
- Pipe piling, ground pre-treatment, pre-boring works & jet grouting works,
- Utility diversion,
- Construction of Bowling Green Office and
- Temporary Traffic Arrangement & paving works for Victoria Park Road.

Contract no. HY/2011/08 – Central - Wan Chai Bypass (CWB) –Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning under FEP-11/364/2009B

- No physical construction activity on site

1 INTRODUCTION

1.1 Scope of the Report

- 1.1.1. Lam Geotechnics Limited (LGL) has been appointed to work as the Environmental Team (ET) under Environmental Permit no. EP-364/2009/C and Further Environmental permit nos. FEP-01/364/2009, FEP-02/364/2009, FEP-05/364/2009/A, FEP-06/364/2009/A, FEP-07/364/2009/A, FEP-08/364/2009/A, FEP-09/364/2009/B, FEP-10/364/2009B and FEP-11/364/2009B to implement the Environmental Monitoring and Audit (EM&A) programme as stipulated in the EM&A Manual of the approved Environmental Impact Assessment (EIA) Report for Wan Chai Development phase II and Central-Wan Chai Bypass (Register No.: AEIAR-125/2008) and in the EM&A Manual of the approved EIA Report for Central-Wan Chai Bypass and Island Eastern Corridor Link (Register No. AEIAR-014/2001).
- 1.1.2. This report presents the environmental monitoring and auditing work carried out in accordance to the Section 10.3 of EM&A Manual and “*Environmental Monitoring and Audit Requirements*” under Particular Specification Section 27.
- 1.1.3. This report documents the finding of EM&A works for Environmental Permit (EP) no. EP-364/2009/B, Further Environmental Permit (FEP) nos. FEP-01-364/2009, FEP-02/364/2009, FEP-05/364/2009/A, FEP-06/364/2009/A, FEP-07/364/2009/A, FEP-08/364/2009/A, FEP-09/364/2009B, FEP-10/364/2009B and FEP-11/364/2009B during the period [July 2014 to August 2014](#). The cut-off date of reporting is at 27th of each reporting month

1.2 Structure of the Report

- Section 1** ***Introduction*** – details the scope and structure of the report.
- Section 2** ***Project Background*** – summarizes background and scope of the project, site description, project organization and contact details of key personnel during the reporting period.
- Section 3** ***Status of Regulatory Compliance*** – summarizes the status of valid Environmental Permits / Licenses during the reporting period.
- Section 4** ***Monitoring Requirements*** – summarizes all monitoring parameters, monitoring methodology and equipment, monitoring locations, monitoring frequency, criteria and respective event and action plan and monitoring programmes.
- Section 5** ***Monitoring Results*** – summarizes the monitoring results obtained in the reporting period.
- Section 6** ***Compliance Audit*** – summarizes the auditing of monitoring results, all exceedances environmental parameters.



- Section 7** ***Cumulative Construction Impact due to the Concurrent Projects*** – summarizes the relevant cumulative construction impact due to the concurrent activities of the concurrent Projects.
- Section 8** ***Site Inspection*** – summarizes the findings of weekly site inspections undertaken within the reporting period, with a review of any relevant follow-up actions within the reporting period.
- Section 9** ***Complaints, Notification of summons and Prosecution*** – summarizes the cumulative statistics on complaints, notification of summons and prosecution
- Section 10** ***Conclusion***

2 PROJECT BACKGROUND

2.1 Background

- 2.1.1. “Wan Chai Development phase II and Central-Wan Chai Bypass” and “Central-Wan Chai Bypass and Island Eastern Corridor Link” (hereafter called “the Project”) are Designated Project (DP) under the Environmental Impact Assessment Ordinance (Cap. 499) (EIAO). The Environmental Impact Assessment (EIA) Reports for Central-Wan Chai Bypass and Island Eastern Corridor Link (Register No. AEIAR-041/2001) and Wan Chai Development phase II and Central-Wan Chai Bypass (Register No.: AEIAR-125/2008) have been approved on 31 August 2001 and 11 December 2008 respectively.
- 2.1.2. The key purpose of Wan Chai Development Phase II (WDII) is to provide land at Wan Chai North and North Point for construction of the Central-Wan Chai Bypass and Island Eastern Corridor Link (CWB). Land formed under the project will be developed as a world-class waterfront promenade joining that at the new Central waterfront for public enjoyment.
- 2.1.3. There is a compelling and present need for the CWB to provide relief to the very congested east-west Connaught Road Central/Harcourt Road / Gloucester Road Corridor (the Corridor) which is currently operating beyond its capacity. The CWB will provide relief to the existing congestion along the Corridor and cater for the anticipated growth of traffic on Hong Kong Island. Without the CWB and its access roads, there will not be sufficient capacity to serve the heavy traffic demands at both strategic and local levels.

2.2 Scope of the Project and Site Description

- 2.2.1. Design and Construction of Central – Wan Chai Bypass and Island Eastern Corridor Link under the Project involves the construction and operation of a trunk road and its road tunnel more than 800m in length between portals that is shown at Figure 2.1.
- 2.2.2. The study area encompasses existing developments from Central to North Point. The scope of the Central-Wanchai Bypass (CWB) and Island Eastern Corridor Link (IECL) includes:
- A dual three-lane trunk road, approximately 4.5 km in length, and tunnel approximately 3.7 km in length defined from the connection with the existing Rumsey Street Flyover in Central, through to a connection with the existing Island Eastern Corridor to the east of the Causeway Bay Typhoon Shelter (CBTS);
 - The Central Interchange near the Rumsey Street Flyover to provide road connections to the Central area;
 - Tunnel control buildings and ventilation buildings;
 - Slip roads to connect the CWB to the local road system in the Wan Chai North and Causeway Bay area;
 - Associated road lighting, road signing, traffic control and surveillance system; and
 - Other associated works.

2.2.3. The project also contains various Schedule 2 DPs that, under the EIAO, require Environmental Permits (EPs) to be granted by the DEP before they may be either constructed or operated. **Table 2.1** summarises the five individual DPs under this Project. **Figure 2.1** shows the locations of these Schedule 2 DPs.

Table 2.1 Schedule 2 Designated Projects under this Project

Item	Designated Project	EIAO Reference	Reason for inclusion
DP1	Central-Wanchai Bypass (CWB) including its road tunnel and slip roads	Schedule 2, Part I, A.1 and A.7	Trunk road and road tunnel more than 800 m in length
DP2	Road P2 and other roads which are classified as primary/district distributor roads	Schedule 2, Part I, A.1	Primary / district distributor roads
DP3	Reclamation works including associated dredging works	Schedule 2, Part I, C.1 and C.12	Reclamation more than 5 ha in size and a dredging operation less than 100 m from a seawater intake point
DP5	Wan Chai East Sewage Outfall	Schedule 2, Part I, F.5 and F.6	Submarine sewage pipelines with a total diameter more than 1,200 mm and include a submarine sewage outfall
DP6	Dredging for the Cross-harbour Water Mains from Wan Chai to Tsim Sha Tsui	Schedule 2, Part I, C.12	A dredging operation less than 100 m from a seawater intake point

2.3 Division of the Project Responsibility

2.3.1. Due to the multi-contract nature of the Project, there are a number of contracts sub-dividing the whole works area into different work areas to be commenced. Contractors of individual contracts will be required by the EP holder to apply Further Environmental Permits such that the impact monitoring stations are sub-divided accordingly to facilitate the implementation of EM&A programme and to streamline the EM&A reporting for individual FEP holders correspondingly.

2.3.2. The details of individual contracts are summarized in **Table 2.2**.

Table 2.2 Details of Individual Contracts under the Project

Contract No.	Contract Title	Associated DP(s)	Construction Commencement Date
HY/2009/17	Central – Wan Chai Bypass (CWB) at FEHD Whitfield Depot – Advanced piling works.	DP1	5 October 2010
HY/2009/18	Central – Wan Chai Bypass (CWB) – Central Interchange	DP1	21 April 2011
04/HY/2006	Reconstruction of Bus Terminus near Man Yiu Street and Man Kwong Street	DP1	September 2010 (Completed)
HK/2009/01	Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention and Exhibition Centre – Tunnel Works	DP1, DP2	25 August 2011

Contract No.	Contract Title	Associated DP(s)	Construction Commencement Date
HK/2009/02	Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East(CWB Tunnel)	DP1	26 April 2011
HY/2009/15	Central-Wanchai Bypass – Tunnel (Causeway Bay Typhoon Shelter Section)	DP1,DP3	13 July 2011
HY/2009/19	Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link	DP1	24 March 2011
HK/2010/06	Wan Chai Development Phase II- Central-Wan Chai Bypass over MTR Tsuen Wan Line	DP3	22 March 2011
HK/2012/08	Wan Chai Development Phase II- Central-Wan Chai Bypass at Wan Chai West	DP1,DP2, DP3	10 March 2014
HY/2010/08	Central- Wanchai Bypass Tunnel – Tunnel (Slip Road 8)	DP1, DP2, DP3	21 March 2013
HY/2011/08	Central - Wan Chai Bypass (CWB) – Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning	DP1	To be commenced tentatively on 4 th quarter in 2014.

2.4 Project Organization and Contact Personnel

2.4.1. Civil Engineering and Development Department and Highways Department are the overall project controllers for the Wan Chai Development Phase II and Central-Wan Chai Bypass respectively. For the construction phase of the Project, Project Engineer, Contractor(s), Environmental Team and Independent Environmental Checker are appointed to manage and control environmental issues.

2.4.2. The proposed project organization and lines of communication with respect to environmental protection works are shown in **Figure 2.2**. Key personnel and contact particulars are summarized in **Table 2.3**:

Table 2.3 Contact Details of Key Personnel

Party	Role	Post	Name	Contact No.	Contact Fax
AECOM	Engineer's Representative for WDII	Principal Resident Engineer	Mr. Frankie Fan	2587 1778	2587 1877
	Engineer's Representative for CWB	Principal Resident Engineer	Mr. Peter Poon	3922 3388	3912 3010
Lam Woo & CO., LTD.	Contractor under Contract no. HY/2009/17	General Manager	Mr. Thomas Tang	6111 5351	2566 7522
		Contractor's Representative	Mr. Chung Man Shek	2566 4866	
		Site Agent	Mr. Tong Au	9725 5874	

Party	Role	Post	Name	Contact No.	Contact Fax
		Environmental Officer	Dr. Priscilla Choy	9161 7287	
		Environmental Supervisor	Mr. Tam Chun Pong	6461 3062	
Chun Wo – Leader Joint Venture	Contractor under Contract no. HK/2009/01	Site Agent	Mr. Simon Liu	2162 9909	2634 1626
		Construction Manager	Mr. Terry Wong	9757 9846	
		Deputy Site Agent	Mr. Andy Yu	9648 4896	
		Construction Manager	Mr. Wyman Wong	9627 2467	
		Construction Manager	Mr. Jack Chu	9775 2467	
		Environmental Officer	Ms. Wendy Ng	9103 2370	
		Assistant Environmental Engineer	Ms. Connie Chan	9047 6148	
Chun Wo – CRGL Joint Venture	Contractor under Contract no. HK/2009/02	Site Agent	Mr. K.K. Yuen	3658-3002	2827 9996
		Project Manager	Mr. Alfred Leung	3658-3022	
		Quality & Environmental Manager (Environmental Officer)	Mr. C.P. Ho	3658-3000	
Chun Wo - CRGL - MBEC_Joint Venture	Contractor under Contract no. HY/2009/19	Project Manager	Mr. David Lau	3758 8879	2570 8013
		Site Agent	Mr. Paul Yu	9456 9819	
		Environmental Manager / Environmental Officer	Mr. M.H. Isa	9884 0810	
		Environmental Engineer	Mr. Calvin Leung	9286 9208	
		Construction Manager (Marine)	Mr. William Luk	9610 1101	
		Construction Manager (Land)	Mr. Patrick Cheung	9643 3012	
		Construction Manager (Land)	Mr. Eric Fong	6191 9337	
		Operation Manager (Land)	Mr. Yung Kwok Wah	9834 1010	
Leighton Contractors	Contractor under Contract	Site Agent	Mr. Desmond Sze	2214 7700	2140 6799

Party	Role	Post	Name	Contact No.	Contact Fax
(Asia) Limited	no. HY/2009/18	Deputy Site Agent	Mr. Roger Wong	2214 7703	
		Environmental Officer	Ms. Lighting Chan	2823 1161	
		Environmental Engineer	Mr. David Hung	2214 7721	
		Assistant Environmental Engineer	Mr. Penny Yiu	2214 7738	
		Environmental Supervisor	Mr. K. P. Lai	6461 4660	
		Environmental Supervisor	Mr. Ray Cheng	2214 7742	
		Environmental Supervisor	Mr. K. W. Lee	6461 4623	
		Environmental Supervisor	Mr. Dorothy Shing	2214 7705	
		Environmental Supervisor	Mr. C. Y. Au Yeung	6461 8631	
China State Construction Engineering (HK) Ltd.	Contractor under Contract no. HY/2009/15	Project Director	Mr. K C Cheung	2823 7813	2865 5229
		Site Manager	Mr. J.H. Chen	3557 6368	2566 2192
		Contractor's Representative	Mr. Gene Cheung	3557 6395	
		Head of construction	Mr. Roger Cheung	3557 6371	
		Environmental Officer	Mr. Andy Mak	3557 6215	
		Environmental Supervisor	Ms. Esther Choi	35576348	
Gammon - Leader JV	Contractor under Contract no. HK/2010/06	Project Manager	Mr. Paul Lui	9095 7922	2529 2880
		Site Agent	Mr. Eric Yip	2529 2068	
		Environmental Officer	Mr. Clement Pang	9481 6024	
		Environmental Supervisor	Mr. Jacky Cheung	9735 9200	
China State-Leader JV	Contractor under Contract no. HK/2012/08	Project Director	Mr. Andrew TSE	9137 1811	2877 1522
		Project Manager	Mr. Victor WU	9193 8871	
		Deputy Project Manager	Mr. George CHEUNG	9268 1918	
		Site Agent	Mr. Paul LUI	9095 7922	
		Environmental Officer	Mr. James MA	9130 9549	
		Environmental Supervisor	Mr. Ching Man, CHAN	6050 4919	



Party	Role	Post	Name	Contact No.	Contact Fax
China State	Contractor under Contract no.HY/2010/08	Project Director	Cheung Kit Cheung	3557 6399	2566 8061
		Project Manager	Chan Ying Lun	9812 0592	
		Deputy Project Manager	Chris Leung	3467 4299	
		Site Agent	Dr. Dave Chan	3467 4277	
		Environmental Officer	Mr. C.M. Wong	3557 6464	
		Environmental Supervisor	Mr. Louis Lam Tsz Kwan	3557 6470	
Leighton Joint Venture	Contractor under Contract no. HY/2011/08	Project Manager	Paul Evans	2823 1111	21406799
		Site Agent	Colman Wong	9730 0806	
		Environmental Officer	David Hung	9765 6151	
		Environmental Supervisor	Penny Yiu	2214 7738	
ENVIRON Hong Kong Limited	Independent Environmental Checker (IEC)	Independent Environmental Checker (IEC)	Mr. David Yeung	3465 2888	3465 2899
Lam Geotechnics Limited	Environmental Team (ET)	Environmental Team Leader (ETL)	Mr. Raymond Dai	2882 3939	2882 3331

2.4.3. In this reporting month, the principal work activities of individual contracts are included as follows:

Contract no. HY/2009/18 - Central - Wan Chai Bypass (CWB) - Central Interchange under FEP-05/364/2009/A

- Excavation of trial pit
- Transplanting of trees
- Drainage works
- Tunnel works including scaffolding erection, excavation, OHVD installation, roadside barriers, top and base slab construction
- Trough structure construction and associated drilling and grouting
- Road works
- Bridges construction

Contract no. HK/2009/01 - Wan Chai Development Phase II - Central - Wan Chai Bypass at Hong Kong Convention and Exhibition Centre - Tunnel Works under FEP-02/364/2009

- Stage 1 construction of tunnel structures
- Stage 2 installation of pre-bored H-piles
- Stage 2 installation of sheet pile at exhaust duct
- Installation of dewatering well in Stage 2
- Stage 2 excavations and ELS works
- Demolition works of existing HKCEC pump house (Kiu Lok Portion)
- Demolition of 10 nos. pump cells at Convention Avenue
- Stage 3 construction of D-Wall
- Stage 3 installation of pre-bored H-piles
- Discharge cooling mainlaying works for BI, BG & BF
- S8B and S9 saltwater mainlaying works

Contract no. HK/2009/02 - Wan Chai Development Phase II - Central - Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

- Backfilling work for tunnel
- Loading transfer of utility bridge for DSD Sewage Outfall pipes and WSD Intake Culvert
- Removal of Strut
- Excavation for Tunnel Portion
- Installation of dewatering system
- Bored piling works

Contract no. HY/2009/15 - Central-Wanchai Bypass – Tunnel (Causeway Bay Typhoon Shelter Section) under FEP-06/364/2009/A

- Dismantling of struts and backfilling at TS4 & TPCWAE
- Mined Tunnel drill-and-break works and installation of steel ribs at East and West Portal

Contract no. HY/2009/19 - Central - Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/A

- Road works at Watson Road
- Bored piling (Land)
- Removal/Installation of strut at ELS
- Construction of Dolphin Cap
- ELS for Cut & Cover Tunnel and EVB
- Excavation of ELS continue
- Laying of 1350 ϕ pipe
- Pre-bored H-pile for Admin. Building continue
- Parapet construction continue
- Wing slab extension continue
- Construction of TD bridge continue
- Construction of Bridge E
- Construction of Bridge F4 and F5
- Dismantling of Launching Girder
- Construction of Pump Sump E
- Installation of Noise Barrier/enclosure
- Modification of existing crosshead at Pier 17-18

Contract no. HK/2010/06 - Wan Chai Development Phase II - Central - Wan Chai Bypass over MTR Tsuen Wan Line under FEP-08/364/2009/A

- Cross wall sealing
- Concreting of turret openings

Contract no. HK/2012/08 – Wan Chai Development Phase II – Central- Wan Chai Bypass at Wan Chai West under FEP-09/364/2009B

- Diaphragm wall construction
- Site survey

Contract no. HY/2010/08 – Central - Wan Chai Bypass (CWB) – Tunnel (Slip Road 8) under FEP-10/364/2009B

- Tree & root pruning works
- Tree transplanting works,
- Tree works within off-site nursery compound,
- Drainage improvement works,
- Sheet piling works,
- Excavation and Lateral Support for U-structure,
- Erection of noise absorption sheetings,
- Pipe piling, ground pre-treatment, pre-boring works & jet grouting works,
- Utility diversion &
- Construction of Bowling Green Office.



Contract no. HY/2011/08 –Central - Wan Chai Bypass (CWB) –Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning under FEP-11/364/2009B

- No physical construction activity on site

2.4.4. In coming reporting month, the principal work activities of individual contracts are anticipated as follows:

Contract no. HY/2009/18 – Central – Wan Chai Bypass (CWB) – Central Interchange under FEP-05/364/2009/A

- Excavation of trial pit
- Transplanting of trees
- Drainage works
- Tunnel works including scaffolding erection, excavation, OHVD installation, roadside barriers, top and base slab construction, extract sheet pile, waterproofing and backfill
- Trough structure construction and associated drilling and grouting
- Road works
- Bridges construction

Contract no. HK/2009/01 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention and Exhibition Centre – Tunnel Works under FEP-02/364/2009

- Stage 1 construction of tunnel structures
- Stage 2 excavation and ELS works
- Stage 3 construction of D-Wall
- Demolition of the remaining East Bridge
- pre-bored H piles
- Excavation work
- Pipe laying for discharge cooling main BF

Contract no. HK/2009/02 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

- Backfilling to Tunnel Portion 1.
- Utility bridge load transfer for Box Culvert N1 & Cooling Watermains
- Excavate and installation of ELS.
- Pump test for continuing Tunnel Portion 2 excavation.
- Bored pile construction.

Contract no. HY/2009/15 – Central-Wanchai Bypass – Tunnel (Causeway Bay Typhoon Shelter Section) under FEP-06/364/2009/A

- Post tunnel construction at TS1 and TS2
- Mined Tunnel drill-and-break works at East and West Portal
- Permanent lining structure at West Portal of Mined Tunnel

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/A

- Road works at Watson Road
- Bored piling (Land)
- Removal/ Installation of strut at ELS
- Construction of Dolphin Cap
- ELS for Cut & Cover Tunnel and EVB

- Excavation of ELS continue
- Laying of 1350 ϕ pipe
- Pre-bored H-pile for Admin. Building continue
- Parapet construction continue
- Construction of TD bridge continue
- Construction of Bridge E
- Construction of Bridge F4 and F5
- Construction of Pump Sump E
- Installation of Noise Barrier/enclosure
- Modification of existing crosshead at Pier 17-18
- IECL Road modification and removal of Median Barrier

Contract no. HK/2010/06 - Wan Chai Development Phase II - Central - Wan Chai Bypass over MTR Tsuen Wan Line under FEP-08/364/2009/A

- Sealing at turret openings

Contract no. HK/2012/08 – Wan Chai Development Phase II – Central- Wan Chai Bypass at Wan Chai West under FEP-09/364/2009/B

- Diaphragm wall construction
- Site survey

Contract no. HY/2010/08 –Central - Wan Chai Bypass (CWB) –Tunnel (Slip Road 8) under FEP-10/364/2009B

- Tree & root pruning works
- Tree transplanting works,
- Tree works within off-site nursery compound,
- Drainage improvement works,
- Sheet piling works,
- Excavation and Lateral Support for U-structure,
- Erection of noise absorption sheetings,
- Pipe piling, ground pre-treatment, pre-boring works & jet grouting works,
- Utility diversion,
- Construction of Bowling Green Office and
- Temporary Traffic Arrangement & paving works for Victoria Park Road.

Contract no. HY/2011/08 – Central - Wan Chai Bypass (CWB) –Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning under FEP-11/364/2009B

- No physical construction activity on site

3 STATUS OF REGULATORY COMPLIANCE

3.1 Status of Environmental Licensing and Permitting under the Project

3.1.1. A summary of the current status on licences and/or permits on environmental protection pertinent to the Project is shown in **Table 3.1**.

Table 3.1 Summary of the current status on licences and/or permits on environmental protection pertinent to the Project

Permits and/or Licences	Reference No.	Issued Date	Status
Environmental Permit	EP-356/2009	30 Jul 2009	Valid
Environmental Permit	EP-364/2009	17 Aug 2009	Superseded
Environmental Permit	EP-364/2009/A	4 Aug 2010	Superseded
Environmental Permit	EP-364/2009/B	20 Sep 2012	Superseded
Environmental Permit	EP-364/2009/C	11 Jul 2014	Valid
Environmental Permit	EP-376/2009	13 Nov 2010	Valid
Further Environmental Permit	FEP-01/356/2009	18 Feb 2010	Surrendered
Further Environmental Permit	FEP-02/356/2009	24 Mar 2010	Valid
Further Environmental Permit	FEP-03/356/2009	24 Mar 2010	Valid
Further Environmental Permit	FEP-04/356/2009	15 Nov 2010	Valid
Further Environmental Permit	FEP-05/356/2009	24 Mar 2011	Valid
Further Environmental Permit	FEP-06/356/2009	5 March 2013	Valid
Further Environmental Permit	FEP-07/356/2009	26 July 2013	Valid
Further Environmental Permit	FEP-01/364/2009	24 Mar 2010	Valid
Further Environmental Permit	FEP-02/364/2009	21 Apr 2010	Valid
Further Environmental Permit	FEP-03/364/2009	12 July 2010	Surrendered
Further Environmental Permit	FEP-04/364/2009/A	14 Oct 2010	Surrendered
Further Environmental Permit	FEP-05/364/2009/A	15 Nov 2010	Valid
Further Environmental Permit	FEP-06/364/2009/A	22 Nov 2010	Valid
Further Environmental Permit	FEP-07/364/2009/A	25 Feb 2011	Valid
Further Environmental Permit	FEP-08/364/2009/A	15 June 2012	Valid
Further Environmental Permit	FEP-09/364/2009/B	5 March 2013	Valid
Further Environmental Permit	FEP-10/364/2009/B	26 July 2013	Valid



Further Environmental Permit	FEP-11/364/2009/B	2 May 2014	Valid
------------------------------	-------------------	------------	-------

- 3.1.2. Due to the multi-contract nature of the Project, the status of permits and/or licences under the individual contract(s) are presented as below:

Contract no. HY/2009/17 – Central – Wan Chai Bypass (CWB) at FEHD Whitfield Depot – Advanced piling works under FEP-03/364/2009

- 3.1.3. The construction works was completed and the FEP was surrendered by the Contractor on 25 April 2013.

Contract no. 04/HY/2006 – Reconstruction of Bus Terminus near Man Yiu Street and Man Kwong Street under FEP-04/364/2009/A

- 3.1.4. The construction works was completed, and the FEP was surrendered by the Contractor on 11 February 2011.

Contract no. HK/2009/01 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention and Exhibition Centre – Tunnel Works under FEP-02/364/2009

- 3.1.5. Summary of the current status on licences and/or permits on environmental protection pertinent and submission under FEP-02/364/2009 for contract no. HK/2009/01 are shown in **Table 3.4** and **Table 3.5**

Table 3.4 Cumulative Summary of Valid Licences and Permits under Contract no. HK/2009/01

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Further Environmental Permit	FEP-02/356/2009	24 Mar 2010	N/A	Valid
	FEP-02/364/2009	21 Apr 2010	N/A	Valid
Notification of Works Under APCO	313088	06 Jan 2010	N/A	Valid
Construction Noise Permit (CNP) for non-piling equipment	GW-RS0111-14	11 Feb 2014	15 Feb 2014 to 14 Aug 2014	Cancelled
	GW-RS0200-14	18 Mar 2014	21 Mar 2014 to 15 Sept 2014	Valid
	GW-RS0317-14	7 Apr 2014	8 Apr 2014 to 7 Oct 2014	Valid
	GW-RS0362-14	17 Apr 2014	20 Apr 2014 to 8 Oct 2014	Valid
	GW-RS0381-14	8 Apr 2014	9 May 2014 to 11 Nov 2014	Valid
	GW-RS0435-14	30 Apr 2014	13 May 2014 to 12 Nov 2014	Valid
	GW-RS0437-14	7 May 2014	8 May 2014 to 7 Nov 2014	Valid
	GW-RS0451-14	5 May 2014	12 May 2014 to 11 Nov 2014	Valid
	GW-RS0462-14	17 Apr 2014	18 Apr 2014 to 17 Oct 2014	Valid
	GW-RS0498-14	22 May 2014	24 May 2014 to 22 Nov 2014	Cancelled
	GW-RS0875-14	21 Aug 2014	23 Aug 2014 to 21 Feb 2015	Valid
	GW-RS0765-14	30 Jul 2014	15 Aug 2014 to 15 Feb 2015	Valid
Discharge Licence	WT00009641-2011	24 Jul 2011	31 Jul 2016	Valid

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
	WT00006220-2010	18 Mar 2010	31 Mar 2015	Valid
	WT00018110-2014	6 Jan 2014	31 Mar 2015	Valid
Billing account under Waste Disposal Ordinance	7010069	21 Jan 2010	N/A	Valid
Registration as a Chemical Waste Producer	WPN5213-134-C3585-01	21 Jan 2010	N/A	Valid

Table 3.5 Summary of submission status under FEP-02/364/2009

EP Condition	Submission	Date of Submission
Condition 2.7 & 2.8	Works Schedule and Location Plan	18 May 2011
Condition 2.6	Environmental Management Organization Chart	18 May 2011
Condition 1.12	Commencement Date of Works	20 Jun 2011
Condition 2.9	Noise Management Plan	10 Jun 2011
Condition 2.11	Landscape Plan (Rev.1)	31 Oct 2013

Contract no. HK/2009/02 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

3.1.6. Summary of the current status on licences and/or permits on environmental protection pertinent and submission under FEP-01/364/2009 for contract no. HK/2009/02 are shown in **Table 3.6** and **Table 3.7**.

Table 3.6 Cumulative Summary of Valid Licences and Permits under Contract no. HK/2009/02

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Further Environmental Permit	FEP-03/356/2009	24 Mar 2010	N/A	Valid
	FEP-01/364/2009	24 Mar 2010	N/A	Valid
Notification of Works Under APCO	313962	2 Feb 2010	N/A	Valid
Construction Noise Permit (CNP) for non-pilling equipment	GW-RS0067-14	29 Jan 2014	15 Feb 2014 to 14 Aug 2014	Expired
	GW-RS0112-14	13 Feb 2014	16 Feb 2014 to 13 Aug 2014	Expired
	GW-RS0161-14	7 Mar 2014	11 Mar 2014 to 10 Sep 2014	Valid
	GW-RS0162-14	7 Mar 2014	20 Mar 2014 to 19 Sep 2014	Valid
	GW-RS0233-14	21 Mar 2014	25 Mar 2014 to 24 Sep 2014	Valid
	GW-RS0269-14	28 Mar 2014	7 Apr 2014 to 6 Oct 2014	Valid
	GW-RS0319-14	7 Apr 2014	18 Apr 2014 to 17 Oct 2014	Valid
	GW-RS0407-14	25 Apr 2014	28 Apr 2014 to 16 Oct 2014	Valid
	GW-RS0421-14	30/4/2014	30 Apr 2014 to 15 Oct 2014	Valid
	GW-RS0460-14	9/5/2014	10 May 2014 to 9 Nov 2014	Valid
	GW-RS0491-14	16/5/2014	17 May 2014 to 16 Nov 2014	Valid
	GW-RS0494-14	16/5/2014	22 May 2014 to 21 Nov 2014	Valid
	GW-RS0482-14	13/5/2014	14 May 2014 to 6 Nov 2014	Valid

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
	GW-RS0461-14	9/5/2014	10 May 2014 to 9 Nov 2014	Valid
	GW-RS0422-14	30/4/2014	2 May 2014 to 16 Oct 2014	Valid
	GW-RS0515-14	26/5/2014	29 May 2014 to 25 Nov 2014	Valid
	GW-RE0565-14	30/5/2014	30 May 2014 to 29 Nov 2014	Valid
	GW-RS0637-14	26/6/2014	02 July 2014 to 01 Jan 2015	Valid
	GW-RS0742-14	25 July 2014	15 Aug 2014 to 14 Feb 2015	Valid
	GW-RS0745-14	25 July 2014	14 Aug 2014 to 13 Feb 2015	Valid
	GW-RS0840-14	18/8/2014	02 Aug 2014 to 12 Feb 2015	Valid
Discharge Licenses	WT00006249- 2010	22 Mar 2010	31 Mar 2015	Valid
	WT00006436- 2010	15 Apr 2010	30 Apr 2015	Valid
	WT00006673- 2010	14 May 2010	31 Mar 2015	Cancelled
	WT00006757- 2010	28 May 2010	31 May 2015	Valid
	WT00007129- 2010	28 July 2010	31 Jul 2015	Valid
	WT00008982- 2011	26 April 2011	30 April 2016	Valid
	WT00009691- 2011	1 Aug 2011	31 July 2016	Valid
Billing Account under Waste Disposal Ordinance (Land)	7010255	10 Feb 2010	N/A	Valid
Registration as Chemical Waste Producer (Wan Chai)	WPN5213-135- C3593-01	10 Mar 2010	N/A	Valid
Registration as Chemical Waste Producer (TKO 137)	WPN5213-839- C3593-02	22 Sep 2010	N/A	Valid

Table 3.7 Summary of submission status under FEP-01/364/2009

EP Condition	Submission	Date of Submission
Condition 2.7 and 2.8	Works Schedule and Location Plan	14 Jun 2011
Condition 2.6	Environmental Management Organization Chart	14 Jun 2011
Condition 1.12	Commencement Date of Works	21 Jun 2011
Condition 2.11	Landscape Plan (Revision B)	20 Nov 2012
Condition 2.9	Noise Management Plan (Revision A)	13 Jan 2012

Contract no. HY/2009/18 – Central – Wan Chai Bypass (CWB) – Central Interchange under FEP-05/364/2009/A

3.1.7. Summary of the current status on licences and/or permits on environmental protection pertinent and submission under FEP-05/364/2009A for contract no. HY/2009/18 are shown in Table 3.8 and Table 3.9.

Table 3.8 Cumulative Summary of Valid Licences and Permits under Contract no. HY/2009/18

Permit / Licence / Notification / Approval	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Further Environmental Permit	FEP-05/364/2009/A	15 Nov 2010	Permit issued	Valid
Notification of Works Under APCO	322293	07 Oct 2010	Notified	Valid
Construction Noise Permit (CNP) for non-piling equipment	GW-RS0219-14	18 Mar 2014	19 Mar 2014 - 16 Aug 2014	Cancelled
	GW-RS0053-14	21 Jan 2014	03 Feb 2014 to 01 Aug 2014	Cancelled
	GW-RS0379-14	15 Apr 2014	03 May 2014 to 01 Nov 2014	Valid
	GW-RS0426-14	29 April 2014	08 May 2014 – 07 Nov 2014	Cancelled
	GW-RS0428-14	29 April 2014	15 May 2014 – 14 Nov 2014	Valid
	GW-RS0469-14	12 May 2014	14 May 2014 – 07 Nov 2014	Valid
	GW-RS0585-14	05 June 2014	09 June 2014 – 14 Nov 2014	Valid
	GW-RS0694-14	04 July 2014	07 July 2014 – 03 Jan 2015	Valid
	GW-RS0830-14	07 Aug 2014	08 Aug 2014 – 03 Jan 2015	Cancelled

Permit / Licence / Notification / Approval	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
	GW-RS0858-14	13 Aug 2014	17 Aug 2014 – 28 Sep 2014	Valid
Discharge Licenses	WT00012998-2012	25 May 2012	31 Jan 2016	Valid
	WT00013967-2012	17 Sep 2012	30 Sep 2017	Valid
	WT00014966-2013	08 Jan 2013	31 Jan 2018	Valid
Registration as a Waste Producer	WPN: 8335-121-L1048-04	17 Dec 2010	N/A	Registration completed
Billing Account under Waste Disposal Ordinance (Land)	Account No.: 7011587	11 Oct 2010	Account approved	Valid

Table 3.9 Summary of submission status under FEP-05/364/2009/A

EP Condition	Submission	Date of Submission
Condition 2.9	Noise Management Plan	01 March 2011
Condition 2.10	Landscape Plan (Rev. 6)	19 May 2014

Contract no. HY/2009/15 – Central-Wanchai Bypass – Tunnel (Causeway Bay Typhoon Shelter Section) under FEP-06/364/2009/A

3.1.8. Summary of the current status on licences and/or permits on environmental protection pertinent and submission under FEP-06/364/2009/A for contract no. HY/2009/15 are shown in **Table 3.10** and **Table 3.11**

Table 3.10 Cumulative Summary of Valid Licences and Permits under Contract no. HY/2009/15

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Further Environmental Permit	FEP-04/356/2009	22 Nov 2010	N/A	Valid
	FEP-06/364/2009/A	22 Nov 2010	N/A	Valid
Notification of Works Under APCO	321822	24 Sep 2010	N/A	Valid
Construction Noise Permit (CNP) for non-piling equipment	GW-RS0333-14	4 Apr 2014	7 Apr 2014 to 6 Oct 2014	Cancelled
	GW-RS0106-14	14 Feb 2014	16 Feb 2014 to 9 Aug 2014	Cancelled
	GW-RS0429-14	30 Apr 2014	4 May 2014 to 3 Nov 2014	Cancelled

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
	GW-RS0401-14	28 Apr 2014	30 Apr 2014 to 23 Oct 2014	Valid
	GW-RS0592-14	9 Jun 2014	11 Jun 2014 to 4 Dec 2014	Valid
	GW-RS0702-14	9 Jul 2014	11 Jul 2014 to 07 Jan 2015	Valid
	GW-RS0600-14	11 Jun 2014	02 Jul 2014 to 07 Jan 2015	Valid
	GW-RS0649-14	26 Jun 2014	1 Jul 2014 to 31 Dec 2014	Cancelled
	GW-RS0721-14	16 Jul 2014	18 Jul 2014 to 15 Jan 2015	Valid
Registration as a Chemical Waste Producer	WPN: 5213-147-C1169-35	15 Nov 2010	N/A	Valid
Billing Account under Waste Disposal Ordinance	7011553	30 Sep 2010	27 Sep 2010 to 27 Jan 2016	Valid
Water Discharge License (TS1)	WT00008780-2011	24 Nov 2011	24 Nov 2011 to 31 Mar 2016	Valid
Water Discharge License (Discharge at CHT area)	WT00019250-2014	6 Jun 2014	6 Jun 2014 to 31 May 2016	Valid
Water Discharge License (Discharge at TS2)	WT00014974-2013	10 Jan 2013	10 Jan 2013 to 31 Jan 2015	Valid
Water Discharge License (Discharge at TPCWAE)	WT00018167-2014	17 Jan 2014	17 Jan 2014 to 31 Dec 2015	Valid
Water Discharge License (Discharge at TS4)	WT00018542-2014	17 Mar 2014	17 Mar 2014 to 31 Jan 2016	Valid

Table 3.11 Summary of submission status under FEP-06/364/2009/A

EP Condition	Submission	Date of Submission
Condition 2.6	Management Organization of Main Construction Companies	11 Mar 2011
	Amendment for Management Organization of Main Construction Companies	16 May 2011
Condition 2.7	Works Schedule	15 Mar 2011
Condition 2.8	Location Plan	15 Mar 2011
Condition 2.9	Noise Management Plan	6 May 2011
Condition 2.10	Landscape Plan	19 May 2014

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/A

3.1.9. The current status on licences and/or permits on environmental protection pertinent and submission under FEP-07/364/2009/A for contract no. HY/2009/19 are shown in **Table 3.12** and **Table 3.13**

Table 3.12 Cumulative Summary of Valid Licences and Permits under Contract no. HY/2009/19

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Further Environmental Permit	FEP-07/364/2009/A	25 Feb 2011	N/A	Valid
Notification of Works Under APCO	326160	24 Jan 2011	N/A	Valid
Registration as a Waste Producer	7012306	10 Feb 2011	N/A	Valid
Registration as Chemical Waste Producer	5213-151-C3654-01	24 Mar 2011	N/A	Valid
Application for Vessel Disposal	7012306	21 July 2011	N/A	Valid
Construction Noise Permits (CNP)	GW-RS0072-14	04 Feb 2014	06-Feb-14 to 02-Aug-14	Cancelled
	GW-RS0073-14	04 Feb 2014	06-Feb-14 to 02-Aug-14	Cancelled
	GW-RS0152-14	04 Mar 2014	6 Mar 2014 to 27 Aug 2014	Expired
	GW-RS0506-14	21 May 2014	23 May 2014 to 14 Nov 2014	Cancelled
	GW-RS0507-14	21 May 2014	23 May 2014 to 14 Nov 2014	Valid
	GW-RS0752-14	21 Jul 2014	23 July 2014 to 20 Jan 2014	Valid
	GW-RS0814-14	08 Aug 2014	08 Aug 2014 to 05 Feb 2015	Valid
	GW-RS0826-14	12 Aug 2014	14 Aug 2014 to 11 Feb 2015	Valid
Dumping Permit (Tunnel) (Type 1 – Open Sea Disposal)	EP/MD/15-035	18 Jun 2014	18 Jun 2014 to 17 Dec 2014	Valid
Dumping Permit (Tunnel) (Type 1 – Open Sea Disposal (Dedicate Sites) & Type 2 – Confined Marine Disposal)	EP/MD/15-072	06 Aug 2014	05 Aug 2014 to 05 Sep 2014	Valid

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Water Discharge Licence	WT00010093-2011	17-Aug-12	30-Sep-16	Valid
	WT00010865-2011	3-Nov-11	30-Nov-16	Valid

Table 3.13 Summary of submission status under FEP-07/364/2009/A

EP Condition	Submission	Date of Submission
Condition 2.13	Landscape Plan (Rev.3)	19 May 2014
Condition 2.9	Noise Management Plan (Rev.4)	5 July 2014

Contract no. HK/2010/06 - Wan Chai Development Phase II – Central –Wanchai Bypass over MTR Tsuen Wan Line

3.1.10. The current status on licences and/or permits on environmental protection pertinent and submission under FEP-08/364/2009/A for contract no. HK/2010/06 showed in **Table 3.14** and **Table 3.15**.

Table 3.14 Cumulative Summary of Valid Licences and Permits under Contract no. HK/2010/06

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Further Environmental Permit	FEP-08/364/2009/A	15 June 2012	N/A	Valid
Notification of Works Under APCO	326344	18 Jan 2011	N/A	Valid
Construction Noise Permit (CNP) for non-pilling works	N/A	N/A	N/A	N/A

Table 3.15 Summary of submission status under FEP-08/364/2009

EP Condition	Submission	Date of Submission
Condition 2.9	Noise Management Plan	26 Nov 2012

Contract no. HK/2012/08 – Wan Chai Development Phase II – Central- Wan Chai Bypass at Wan Chai West

3.1.11 The current status on licences and/or permits on environmental protection pertinent and submission under FEP-09/264/2009/B for contract no. HK/2012/08 showed in **Table 3.16 and Table 3.17**

Table 3.16 Cumulative Summary of Valid Licences and Permits under Contract no. HK/2012/08

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Further Environmental Permit	FEP-09/364/2009/B	5 March 2013	N/A	Valid
Notification of Works Under APCO	355439	4 Feb 2013	N/A	Valid
Registration as a Chemical Waste Producer	5213-134-C3790-01	8 Mar 2013	N/A	Valid
Billing Account under Waste Disposal Ordinance	7016883	18 Feb 2013	18 Jul 2017	Valid
Construction Noise Permit	GW-RS0293-14	1 Apr 2014	1 Apr 2014 to 30 Sep 2014	Valid
Water Discharge Licence	WT00018223-2014	28 Jan 2014	31 Jan 2019	Valid

Table 3.17 Summary of submission status under FEP-09/364/2009

EP Condition	Submission	Date of Submission
Condition 2.9	Noise Management Plan (Rev.2)	9 July 2013
Condition 2.14	Landscape Plan (Rev.3)	1 August 2014

Contract no. HY/2010/08 –Central – Wanchai Bypass Tunnel – Tunnel (Slip Road 8)

3.1.12 The current status on licences and/or permits on environmental protection pertinent and submission under FEP-09/264/2009/B for contract no. HK/2012/08 showed in **Table 3.18 and Table 3.19**

Table 3.18 Cumulative Summary of Valid Licences and Permits under Contract no. HY/2010/08

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Further Environmental Permit	FEP-10/364/2009/B	2013-07-26	NA	Valid
Notification of Works Under APCO	357176	2013-04-02	NIL	Valid
Registration as a Chemical Waste Producer	WPN5213-147-C1169-44	2013-03-27	NIL	Valid
Billing Account under Waste Disposal Ordinance	7017170	2013-03-27	NIL	Valid
Water Discharge License	WT0001651-2013	2013-07-09	2018-07-28	Valid
Construction Noise Permit (CNP) for non-pilling works	GW-RS0599-14	09 Jun 2014	11 Jun 2014 to 6 Dec 2014	Valid
	GW-RS0701-14	04 Jul 2014	5 Jul 2014 to 31 Dec 2014	Valid
	GW-RS0186-14	11 Mar 2014	11 Mar 2014 to 06 Sep 2014	Valid
	GW-RS0194-14	14 Mar 2014	18 Mar 2014 to 13 Sep 2014	Valid
	GW-RS0201-14	18 Mar 2014	24 Mar 2014 to 18 Sep 2014	Valid
	GW-RS0468-14	13 May 2014	13 May 2014 to 10 Nov 2014	Cancelled
	GW-RS0489-14	21 May 2014	07 Jun 2014 to 28 Jul 2014	Expired
	GW-RS0659-14	26 Jun 2014	5 Jul 2014 to 28 Jul 2014	Expired
	GW-RS0835-14	15 Aug 2014	17 Aug 2014 to 31 Oct 2014	Valid
	GW-RS0854-14	15 Aug 2014	23 Aug 2014 to 06 Oct 2014	Valid
	GW-RS0867-14	18 Aug 2014	23 Aug 2014 to 19 Feb 2104	Valid
Construction Noise Permit (CNP) for pilling works	PP-RS0011-14	2014-05-05	01 June 2014 to 30 Sep 2014	Valid

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
	PP-RS0014-14	2014-07-04	05 Jul 2014 to 03 Jan 2015	Valid

Table 3.19 Summary of submission status under FEP-10/364/2009

EP Condition	Submission	Date of Submission
Condition 2.9	Noise Management Plan (Rev.3)	03 January 2014
Condition 2.14	Landscape Plan (Rev2)	19 May 2014

Contract no. HY/2011/08 –Central - Wan Chai Bypass (CWB) –Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning under FEP-11/364/2009B

3.1.13 The current status on licenses and/or permits on environmental protection pertinent and submission under FEP-09/264/2009/B for contract no. HK/2012/08 showed in **Table 3.20 and Table 3.21**

Table 3.20 Cumulative Summary of Valid Licences and Permits under Contract no. HY/2011/08

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Further Environmental Permit	FEP-11/364/2009/B	2 May 2014	N/A	Valid
Notification of Works Under APCO	355439	4 Feb 2013	N/A	Valid
Registration as a Chemical Waste Producer	5213-134-C3790-01	8 Mar 2013	N/A	Valid
Billing Account under Waste Disposal Ordinance	7016883	18 Feb 2013	18 Jul 2017	Valid

Table 3.21 Summary of submission status under FEP-11/364/2009

EP Condition	Submission	Date of Submission
Condition 2.9	Noise Management Plan (Rev.3)	21 July 2014
Condition 2.14	Landscape Plan (Rev2)	21 July 2014

4 MONITORING REQUIREMENTS

4.1 Noise Monitoring

NOISE MONITORING STATIONS

- 4.1.1. The noise monitoring stations for the Project are listed and shown in **Table 4.1** and **Figure 4.1**. **Appendix 4.1** shows the established Action/Limit Levels for the monitoring works.

Table 4.1 Noise Monitoring Stations

Station	Description
M1a	Harbour Road Sports Centre
M2b	Noon-day Gun Area
M3a	Tung Lo Wan Fire Station
M4b	Victoria Centre
M5b	City Garden
M6	HK Baptist Church Henrietta Secondary School
*M7e	International Finance Centre (Eastern End of Podium)
M7w	International Finance Centre (Western End of Podium)
*M8	City Hall

* Remark 1: Location ID has been updated from M7 to M8 for City Hall

* Remark 2: M7e has become a reference station starting from 7 Aug 2012

REAL TIME NOISE MONITORING STATIONS

- 4.1.2. Review of feasibility on the real time noise monitoring stations was conducted in July with IEC. Station, RTN1a, Tung Lo Wan fireboat Station was found not appropriate to be a monitoring station for monitoring the IECL Piling works and Demolition after visited.

- 4.1.3. The noise monitoring stations for the Project are listed and shown in **Table 4.2** and **Figure 4.1**. **Appendix 4.1** shows the established Action/Limit Levels for the monitoring works.

Table 4.2 Real Time Noise Monitoring Stations

District	Station	Description
Tin Hau	RTN1	FEHD Hong Kong Transport Section Whitfield Depot
North Point	RTN2a	Electric Centre
North Point	RTN3	Po Leung Kuk Yu Lee Mo Fan Memorial School
Tin Hau	RTN4	Causeway Bay Community Centre

NOISE MONITORING PARAMETERS, FREQUENCY AND DURATION

- 4.1.4. The construction noise level shall be measured in terms of the A-weighted equivalent continuous sound pressure level (L_{eq}). L_{eq} (30 minutes) shall be used as the monitoring parameter for the time period between 0700 and 1900 hours on normal weekdays. For all other time periods, L_{eq} (5 minutes) shall be employed for comparison with the Noise Control Ordinance (NCO) criteria. Supplementary information for data auditing, statistical results such as L_{10} and L_{90} shall also be obtained for reference.
- 4.1.5. Noise monitoring shall be carried out at all the designated monitoring stations. The monitoring frequency shall depend on the scale of the construction activities. The following is an initial guide on the regular monitoring frequency for each station on a weekly basis when noise generating activities are underway:
- One set of measurements between 0700 and 1900 hours on normal weekdays.
- 4.1.6. Real time noise shall be carried out at the designated monitoring stations. The following is an initial guide on the regular monitoring frequency for each station on a 24 hours daily basis when noise generating activities are underway:
- One set of measurements between 0700 and 1900 hours on normal weekdays.
 - One set of measurements between 1900 and 2300 hours on normal weekdays and 0700 and 2300 hours on public holidays.
 - One set of measurements between 2300 and 0700 hours on next day on everyday.
- 4.1.7. If construction works are extended to include works during the hours of 1900 – 0700 as well as public holidays and Sundays, additional weekly impact monitoring shall be carried out during respective restricted hours periods. Applicable permits under NCO shall be obtained by the Contractor.

MONITORING EQUIPMENT

- 4.1.8. As referred to in the Technical Memorandum TM issued under the NCO, sound level meters in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications shall be used for carrying out the noise monitoring. Immediately prior to and following each noise measurement the accuracy of the sound level meter shall be checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Measurements may be accepted as valid only if the calibration level from before and after the noise measurement agree to within 1.0 dB.
- 4.1.9. Noise measurements shall not be made in fog, rain, wind with a steady speed exceeding 5 m/s or wind with gusts exceeding 10 m/s. The wind speed shall be checked with a portable wind speed meter capable of measuring the wind speed in m/s.
- 4.1.10. The sound level meter shall be checked using an acoustic calibrator generating a known sound pressure level at a known frequency before deployment to the site and during each site visit. Measurements will be accepted as valid only if the calibration level from before and after the noise measurement agree to within 1.0 dB.

Air Monitoring

AIR QUALITY MONITORING STATIONS

- 4.2.1. The air monitoring stations for the Project are listed and shown in **Table 4.3** and **Figure 4.1**. **Appendix 4.1** shows the established Action/Limit Levels for the monitoring works.

Table 4.3 Air Monitoring Stations

Station ID	Monitoring Location	Description
CMA1b	Oil Street Site Office**	North Point (Re-commenced on 14 November 2011)
CMA2a	Causeway Bay Community Centre	Causeway Bay
CMA3a	CWB PRE Site Office *	Causeway Bay
CMA4a	Society for the Prevention of Cruelty to Animals	Wan Chai
CMA5a	Children Garden opposite to Pedestrian Plaza	Wan Chai
MA1e	International Finance Centre (Eastern End of Podium)	Central
MA1w	International Finance Centre (western End of Podium)	Central

Remarks*: As per the ENPC meeting in March 2011, the monitoring stations CMA3a – Future CWB site office at Wanchai Waterfront Promenade was renamed as remark.

Remarks**: The location ID of monitoring station CMA1b was updated as “Oil Street Site Office” in April 2013.

AIR MONITORING PARAMETERS, FREQUENCY AND DURATION

- 4.2.2. One-hour and 24-hour TSP levels should be measured to indicate the impacts of construction dust on air quality. The 24-hour TSP levels shall be measured by following the standard high volume sampling method as set out in the Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50), Appendix B.
- 4.2.3. All relevant data including temperature, pressure, weather conditions, elapsed-time meter reading for the start and stop of the sampler, identification and weight of the filter paper, and any other local atmospheric factors affecting or affected by site conditions, etc., shall be recorded down in detail.
- 4.2.4. For regular impact monitoring, the sampling frequency of at least once in every six-days, shall be strictly observed at all the monitoring stations for 24-hour TSP monitoring. For 1-hour TSP monitoring, the sampling frequency of at least three times in every six-days should be undertaken when the highest dust impact occurs.

SAMPLING PROCEDURE AND MONITORING EQUIPMENT

4.2.5. High volume samplers (HVSs) in compliance with the following specifications shall be used for carrying out the 1-hour and 24-hour TSP monitoring:

- 0.6 – 1.7 m³ per minute adjustable flow range;
- Equipped with a timing / control device with +/- 5 minutes accuracy for 24 hours operation;
- Installed with elapsed-time meter with +/- 2 minutes accuracy for 24 hours operation;
- Capable of providing a minimum exposed area of 406 cm²;
- Flow control accuracy: +/- 2.5% deviation over 24-hour sampling period;
- Equipped with a shelter to protect the filter and sampler;
- Incorporated with an electronic mass flow rate controller or other equivalent devices;
- Equipped with a flow recorder for continuous monitoring;
- Provided with a peaked roof inlet;
- Incorporated with a manometer;
- Able to hold and seal the filter paper to the sampler housing at horizontal position;
- Easily changeable filter; and
- Capable of operating continuously for a 24-hour period.

4.2.6. Initial calibration of dust monitoring equipment shall be conducted upon installation and thereafter at bi-monthly intervals. The transfer standard shall be traceable to the internationally recognized primary standard and be calibrated annually. The concern parties such as IEC shall properly document the calibration data for future reference. All the data should be converted into standard temperature and pressure condition.

LABORATORY MEASUREMENT / ANALYSIS

4.2.7. A clean laboratory with constant temperature and humidity control, and equipped with necessary measuring and conditioning instruments to handle the dust samples collected, shall be available for sample analysis, and equipment calibration and maintenance. The laboratory should be HOKLAS accredited.

4.2.8. Filter paper of size 8" x 10" shall be labelled before sampling. It shall be a clean filter paper with no pinholes, and shall be conditioned in a humidity-controlled chamber for over 24-hours and be pre-weighed before use for the sampling.

4.2.9. After sampling, the filter paper loaded with dust shall be kept in a clean and tightly sealed plastic bag. The filter paper shall then be returned to the laboratory for reconditioning in the humidity controlled chamber followed by accurate weighing by an electronic balance with readout down to 0.1 mg. The balance shall be regularly calibrated against a traceable standard.

4.2.10. All the collected samples shall be kept in a good condition for 6 months before disposal.

4.2.11. Current calibration certificates of equipments are presented in **Appendix 4.2.**

5.0 MONITORING RESULTS

5.0.1. The environmental monitoring will be implemented based on the division of works areas of each designated project managed under different contracts with separate FEP applied by individual contractors. Overall layout showing work areas of various contracts, latest status of work commencement and monitoring stations is shown in **Figure 2.1** and **Figure 4.1**. The monitoring results are presented in according to the Individual Contract(s).

5.0.2. In the reporting month, the concurrent contracts are as follows:

- Contract no. HY/2009/15 – Central-Wanchai Bypass – Tunnel (Causeway Bay Typhoon Shelter Section)
- Contract no. HY/2009/18 – Central – Wan Chai Bypass (CWB) – Central Interchange
- Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link
- Contract no. HY/2010/08 – Central- Wanchai Bypass Tunnel (Slip Road 8 Section)
- Contract no. HK/2009/01 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention and Exhibition Centre
- Contract no. HK/2009/02 - Wan Chai Development Phase II – Central - Wan Chai Bypass at Wan Chai East
- Contract no. HK/2010/06 - Wan Chai Development Phase II – Central - Wan Chai Bypass over MTR Tsuen Wan Line
- Contract no. HK/2012/08 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai West
- Contract no. HY/2011/08 – Central - Wan Chai Bypass (CWB)– Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning

5.0.3. The environment monitoring schedules for reporting month and coming month are presented in **Appendix 5.1**.

5.1 Noise Monitoring Results

- 5.1.1 Monitoring for report of review baseline noise level was performed from 11 April 2011 to 8 June 2011. Then the report was submitted on the 20 June 2011, verified by IEC on 18 July 2011 and was approved by ER by January 2012. The new baseline is used for the noise calculation starting from January 2012.

Contract no. HY/2009/18 – Central – Wan Chai Bypass (CWB) – Central Interchange under FEP-05/364/2009/A

- 5.1.2 Noise monitoring for the Central Interchange works under contract no. HY/2009/18 was commenced on 22 April 2011. The proposed division of noise monitoring stations for Contract no. HY/2009/18 are summarized in **Table 5.1** below:

Table 5.1 Noise Monitoring Stations for Contract no. HY/2009/18

Station	Description
*M7e	International Finance Centre (Eastern End of Podium)
M7w	International Finance Centre (Western End of Podium)
M8	City Hall

* Remark: M7e has become a reference station starting from 7 Aug 2012

- 5.1.3 No action or limit level exceedance was recorded in this reporting month.
- 5.1.4 Noise monitoring results measured in this reporting period are reviewed and summarized. Details of noise monitoring results and graphical presentation can be referred in **Appendix 5.2**.

Contract no. HK/2009/01 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention and Exhibition Centre – Tunnel Works under FEP-02/364/2009 and Contract no. HK/2009/02 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

- 5.1.5 The commencement of construction works for Contract no. HK/2009/01 under FEP-02/364/2009 is on 25 August 2011 and HK/2009/02 under FEP-01/364/2009 is on 26 April 2011. The proposed division of noise monitoring stations are summarized in **Table 5.2** below.

Table 5.2 Noise Monitoring Station for Contract no HK/2009/01 and HK/2009/02

Station	Description
M1a	Harbour Road Sports Centre

- 5.1.6 No action or limit level exceedance was recorded in this reporting month.
- 5.1.7 Noise monitoring results measured in this reporting period are reviewed and summarized. Details of noise monitoring results and graphical presentation can be referred in **Appendix 5.2**.

Contract no. HY/2009/15 – Central-Wanchai Bypass – Tunnel (Causeway Bay Typhoon Shelter Section) under FEP-06/364/2009/A

- 5.1.8 The commencement of construction works for Contract no. HY/2009/15 under FEP-06/364/2009/A was on 13 July 2011. Noise monitoring was commenced on 13 July 2011. The proposed divisions of noise monitoring stations are summarized in **Table 5.3** below.

Table 5.3 Noise Monitoring Stations for Contract no. HY/2009/15

Station	Description
M2b	Noon Gun Area
M3a	Tung Lo Wan Fire Station

- 5.1.9 One limit level exceedances were recorded on 05 August 2014 at M2b – Noon Day Gun Area in the reporting month.
- 5.1.10 Barge operation and concrete breaking works at TS4 under HY/2009/15 were observed during monitoring on 05 August 2014. It was considered that the operation of derrick barge and nearby breaking works at TS4 were the major noise contribution. As such, the limit level exceedance was concluded as project related. Rectification measures including provision of noise blanket for breakers and provision of noise screen for engine at the derrick barge were implemented by the contractor. Additional monitoring was conducted and no exceedance was identified.
- 5.1.11 Noise monitoring results measured in this reporting period are reviewed and summarized. Details of noise monitoring results and graphical presentation can be referred in **Appendix 5.2**.

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/A

- 5.1.12 Noise monitoring for the tunnel works under contract no. HY/2009/19 was commenced on 24 April 2011. The proposed division of noise monitoring stations are summarized in **Table 5.4** below.

Table 5.4 Noise Monitoring Stations for Contract no. HY/2009/19

Station	Description
M4b	Victoria Centre
M5b	City Garden
M6	HK Baptist Church Henrietta Secondary School

- 5.1.13 One limit level exceedances were recorded on 28 July 2014 at M6 – HK Baptist Church Henrietta Secondary School in the reporting month.

5.1.14 Major traffic noise observed during monitoring on 28 July 2014 and it was considered as the major noise contribution. As such, the limit level exceedances were concluded as non-project related.

5.1.15 Noise monitoring results measured in this reporting period are reviewed and summarized. Details of noise monitoring results and graphical presentation can be referred in **Appendix 5.2**. Details of the Notification of Exceedance can be referred in **Appendix 6.2**.

Contract no. HY/2010/08 – Central-Wanchai Bypass –Wanchai Bypass Tunnel (Slip Road 8 Section) under FEP-09/364/2009/B

5.1.16 The commencement of construction works for Contract no. HY/2010/08 under FEP-10/364/2009/B was on 02 September 2013. Noise monitoring was commenced on 02 September 2013. The proposed divisions of noise monitoring stations are summarized in **Table 5.5** below.

Table 5.5 Noise Monitoring Stations for Contract no. HY/2010/08

Station	Description
M3a	Tung Lo Wan Fire Station

5.1.17 No action or limit level exceedance was recorded in this reporting month.

5.1.18 Noise monitoring results measured in this reporting period are reviewed and summarized. Details of noise monitoring results and graphical presentation can be referred in **Appendix 5.2**.

5.2 Real Time Noise Monitoring Results

5.2.1. As confirmed by CWB RSS, the IECL parapet removal operations and associated construction work will commence in June 2013. Liaison was conducted with HK Baptist Church Henrietta Secondary School, Po Leung Kuk Yu Lee Mo Fan Memorial School and Causeway Bay Community Centre regarding the set up of RTN3 real time noise monitoring station.

5.2.2. Causeway Bay Community Centre has granted permission for set up on 21 Dec 2012 and station set up was performed on 27 Dec 2012. The baseline noise level of RTN4- Causeway Bay Community Centre will adopt the results from the baseline noise monitoring report for EP/364/2009 in 22 April 2010 in which approved by EPD.

5.2.3. Real time noise monitoring at RTN4-Causeway Bay Community Centre was commenced on 13 Jan 2013.

5.2.4. Po Leung Kuk Yu Lee Mo Fan Memorial School grant permission for set up on 4 Sep 2012 and station set up was performed on 14 Sep 2012. Real time noise baseline capturing was conducted during time period without construction work from 21 Sep 2012 to 04 Oct 2012.

- 5.2.5. Real time noise monitoring at RTN3 – Po Leung Kuk Yu Lee Mo Fan Memorial School was commenced since 06 Oct 2012.
- 5.2.6. Oil Street Community Liaison Centre was confirmed to be demolished in mid-October by CWB RSS. This presented a need for relocation of RTN2 – Oil Street Community Liaison Centre. After liaison with Hong Kong Electric, permission was granted on 21 Sep 2012 for real time noise monitoring set up at City Garden Electric Centre (RTN2a – Electric Centre), which is a representative of the noise sensitive receiver City Garden.
- 5.2.7. RTN2 previously located at oil Street Community Liaison Centre was relocated to Hong Kong Electric Centre on 5 Oct 2012, which is a representative of the noise sensitive receiver City Garden. The baseline noise level of RTN2a will adopt the results derived from the baseline noise monitoring conducted at Electric Centre from 4 December 2009 to 17 December 2009.
- 5.2.8. Real-time noise monitoring station RTN1-FEHD Whitfield Depot was finely adjusted from 2/F to roof-top at FEHD Whitfield Depot on 24 June 2013 with respect to the commencement of advance works for IEC parapet demolition.

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/A

- 5.2.9. The proposed division of noise monitoring stations are summarized in **Table 5.7** below. Real time noise monitoring for major construction works under contract no. HY/2009/19 was commenced on 24 April 2011.

Table 5.7 Real Time Noise Monitoring Stations for Contract no. HY/2009/19

Location ID	District	Description
RTN1	Tin Hau	FEHD Hong Kong Transport Section Whitfield Depot
RTN2a	North Point	Electric Centre
RTN3	North Point	Po Leung Kuk Yu Lee Mo Fan Memorial School
RTN4	Tin Hau	Causeway Bay Community Centre

** Real time noise monitoring results and graphical presentation during night time period are for information only.*

**Real-time noise monitoring results and graphical presentation for RTN3 during restricted hours are for information only as no night classes were conducted at the educational institute.*

- 5.2.10. No limit level exceedance was recorded at RTN1-FEHD Hong Kong Transport Section Whitfield Depot in the reporting month.
- 5.2.11. Limit level exceedances were recorded at RTN2a-Electric Centre during daytime on 5, 13, 16, 21 and 23 August 2014 and during restricted hours on 1 August 2014 in the reporting month. After checking with Contractor, bored piling was conducted at the concerned location on 5, 13 and 16 during the recorded period and bored piling and breaking works was conducted on 21 and 23 August 2014, contractor mitigation measures including erection of temporary noise barrier was in place. In view of the exceedances are non-continuous, the exceedances are considered to be non-project related and contributed by nearby IEC traffic. On 1 August 2014,

bored piling was conducted at the concerned location during the monitoring period. Temporary noise barrier was implemented by the Contractor and the CNP GW-RS0752-14 was in place and complied. The exceedance was considered as non-project related and considered to be contributed by nearby IEC traffic.

- 5.2.12. No limit level exceedances were recorded at RTN3-Yue Lee Mo Fan Memorial School in the reporting month.
- 5.2.13. No limit level exceedance was recorded at RTN4-Causeway Bay Community Centre in the reporting month.
- 5.2.14. Real time noise monitoring results measured in this reporting period are reviewed and summarized. Details of real time noise monitoring results and graphical presentation can be referred to **Appendix 5.4.**

5.3 Air Monitoring Results

Contract no. HY/2009/18 – Central – Wan Chai Bypass (CWB) – Central Interchange under FEP-05/364/2009/A

- 5.3.1 Air monitoring for the Central Interchange works under contract no. HY/2009/18 was commenced on 21 April 2011. The proposed division of air monitoring stations are summarized in **Table 5.9** below.

Table 5.9 Air Monitoring Stations for Contract no. HY/2009/18

Station	Description
MA1e	International Finance Centre (Eastern End of Podium)
MA1w	International Finance Centre (Western End of Podium)

- 5.3.2 No exceedance was recorded in the reporting month. Air quality monitoring results measured in this reporting period are reviewed and summarized. Details of air monitoring results and graphical presentation can be referred in **Appendix 5.3.**

Contract no. HK/2009/01 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention and Exhibition Centre – Tunnel Works under FEP-02/364/2009

- 5.3.3 The commencement of construction works for Contract no. HK/2009/01 under FEP-02/364/2009 is on 25 August 2011. Air quality monitoring was commenced on 25 August 2011. The proposed division of air monitoring stations are summarized in **Table 5.10** below.

Table 5.10 Air Monitoring Station for Contract no. HK/2009/01

Station	Description
CMA5a	Children Playgrounds opposite to Pedestrian Plaza

- 5.3.4 No exceedance was recorded in the reporting month. Air quality monitoring results measured in this reporting period are reviewed and summarized. Details of air monitoring results and graphical presentation can be referred in **Appendix 5.3**.

Contract no. HK/2009/02 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

- 5.3.5 The commencement of construction works for HK/2009/02 under FEP-01/364/2009 is on 26 April 2011. The proposed division of air monitoring stations are summarized in **Table 5.11** below.

Table 5.11 Air Monitoring Station for Contract no. HK/2009/02

Station	Description
CMA4a	Society for the Prevention of Cruelty to Animals

- 5.3.6 No exceedance was recorded in the reporting month. Air quality monitoring results measured in this reporting period are reviewed and summarized. Details of air monitoring results and graphical presentation can be referred in **Appendix 5.3**.

Contract no. HY/2009/15 – Central-Wanchai Bypass – Tunnel (Causeway Bay Typhoon Shelter Section) under FEP-06/364/2009/A

- 5.3.7 The commencement of construction works for Contract no. HY/2009/15 under FEP-06/364/2009/A was on 13 July 2011. Air quality monitoring was commenced on 14 July 2011. The proposed division of air monitoring stations are summarized in **Table 5.12** below.

Table 5.12 Air Monitoring Station for Contract no. HY/2009/15

Station	Description
CMA3a	CWB PRE Site Office

- 5.3.8 No exceedance was recorded in the reporting month. Air quality monitoring results measured in this reporting period are reviewed and summarized. Details of air monitoring results and graphical presentation can be referred in **Appendix 5.3**.

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/A

- 5.3.9 The proposed division of air monitoring stations are summarized in **Table 5.13** below. Air monitoring for the tunnel works under contract no. HY/2009/19 was commenced on 26 April 2011.

Table 5.13 Air Monitoring Stations for Contract no. HY/2009/19

Station	Description
CMA1b	Oil Street Site Office
CMA2a	Causeway Bay Community Centre

- 5.3.10 No exceedance was recorded in the reporting month. Air quality monitoring results measured in this reporting period are reviewed and summarized. Details of air monitoring results and graphical presentation can be referred in **Appendix 5.3**.

5.4 Waste Monitoring Results

Contract no. HK/2009/01 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention and Exhibition Centre – Tunnel Works under FEP-02/364/2009

- 5.4.1. Inert C&D wastes and non-inert C&D wastes were disposed in this reporting month. Details of the waste flow table are summarized in **Table 5.15**.

Table 5.15 Details of Waste Disposal for Contract no. HK/2009/01

Waste Type	Quantity this month, m ³	Cumulative-to-Date, m ³	Disposal / Dumping Grounds
Inert C&D materials disposed	4026.18	68290.425	TKO137, TM38
Inert C&D materials recycled	4516.5	19383.5	N/A
Non-inert C&D materials disposed	48.72	1706.89	SENT Landfill
Non-inert C&D materials recycled	31584	298147	N/A
Chemical waste disposed	Nil	10350	N/A

Contract no. HK/2009/02 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

- 5.4.2. Inert C&D & non-inert C&D wastes were disposed of in this reporting month. Details of the waste flow table are summarized in **Table 5.16**.

Table 5.16 Details of Waste Disposal for Contract no. HK/2009/02

Waste Type	Quantity this month	Cumulative Quantity-to-Date	Disposal / Dumping Grounds
Inert C&D materials disposed, m ³	932.935	267421.627	TKO137 / TM 38
Inert C&D materials recycled, m ³	Nil	18161	n/a
Non-inert C&D materials disposed, m ³	37.49	1614.483	SENT Landfill
Non-inert C&D materials recycled, m ³	Nil	N/A	N/A
Chemical waste disposed, kg	Nil	14395	SENT Landfill

Contract no. HY/2009/18 – Central – Wan Chai Bypass (CWB) – Central Interchange under FEP-05/364/2009/A

- 5.4.3. Inert C&D and non-inert C&D waste was disposed of in this reporting month. Details of the waste flow table are summarized in **Table 5.17**.

Table 5.17 Details of Waste Disposal for Contract no. HY/2009/18

Waste Type*	Quantity this month, (m3)	Cumulative-to-Date, (m3)	Disposal / Dumping Grounds
Inert C&D materials disposed	1027.11	109571.88	T.K.O. 137, TM 38
Inert C&D materials recycled	42.15	58577.15	N/A
Non-inert C&D materials disposed	68.56	2435.6	SENT Landfill
Non-inert C&D materials recycled (tonnes)	43.49	515.81	N/A
Chemical waste disposed (kg)	Nil	4440	N/A

Contract no. HY/2009/15 – Central-Wanchai Bypass – Tunnel (Causeway Bay Typhoon Shelter Section) under FEP-06/364/2009/A

- 5.4.4. Inert & Non-inert C&D wastes were disposed of in this reporting month. Details of the waste flow table are summarized in **Table 5.18**.

Table 5.18 Details of Waste Disposal for Contract no. HY/2009/15

Waste Type	Quantity this month(m ³)	Cumulative Quantity-to-Date(m ³)	Disposal / Dumping Grounds
Inert C&D materials disposed, m ³	23520.6 Nil	529053.77 243456.3	Tuen Mun Area 38 TKO137 FB
Inert C&D materials recycled, m ³	Nil	301133.2	HY/2009/11 ex-PCWA TS4 /TS2 WDII Lun Ku Tan
Non-inert C&D materials disposed, m ³	108.89	2341.04	SENT Landfill
Non-inert C&D materials recycled, m ³	130	5494852.2	Xun Xiang Metalware Skylight Recycle (paper)
Chemical waste disposed, kg	Nil	22755	Dunwell Group

Waste Type	Quantity this month(m ³)	Cumulative Quantity-to-Date(m ³)	Disposal / Dumping Grounds
Marine Sediment (Type1-Open Sea Disposal (Dedicate Sites) & Type 2 – Confined Marine Disposal), m ³	Nil	5684	South of the Brothers

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/A

- 5.4.5. Inert and Non-inert C&D wastes were disposed of in this reporting month. Details of the waste flow table are summarized in **Table 5.19**.

Table 5.19 Details of Waste Disposal for Contract no. HY/2009/19

Waste Type*	Quantity this month, m ³	Cumulative-to-Date, m ³	Disposal / Dumping Grounds
Inert C&D materials disposed	34977.91	556843.11	N/A
Inert C&D materials recycled	Nil	67763.46	N/A
Non-inert C&D materials disposed	63.97	1703.98	SENT Landfill
Non-inert C&D materials recycled	Nil	375.65	N/A
Chemical waste disposed	0.17	6.97	N/A
Marine Sediment (Tunnel) (Type-1 Open Sea Disposal), m ³	Nil	19804	South of Cheung Chau
Marine Sediment (Tunnel) (Type 1- Open Sea Disposal (Dedicated Sites) & Type 2 – Confined Marine Disposal), m ³	Nil	29059	East of Sha Chau

Contract no. HK/2010/06 Wan Chai Development Phase II - Central-Wan Chai Bypass over MTR Tsuen Wan Line under FEP-08/364/2009/A

- 5.4.6. Non-inert C&D wastes were disposed of in this reporting month. Details of the waste flow table are summarized in **Table 5.20**.

Table 5.20 Details of Waste Disposal for Contract no. HK/2010/06

Waste Type*	Quantity this month, m ³	Cumulative-to-Date, m ³	Disposal / Dumping Grounds
Inert C&D materials disposed	NIL	NIL	TM38
Inert C&D materials recycled	NIL	NIL	N/A
Non-inert C&D materials disposed	Nil	362.21	SENT
Non-inert C&D materials recycled	Nil	79510	Recyclers
Chemical waste disposed	Nil	0.4	N/A

Contract no. HK/2012/08 Wan Chai Development Phase II - Central-Wan Chai Bypass at Wan Chai West under FEP-09/364/2009/B

- 5.4.7. No inert and Non-inert C&D wastes were disposed of in this reporting month. Details of the waste flow table are summarized in **Table 5.21**.

Table 5.21 Details of Waste Disposal for Contract no. HK/2012/08

Waste Type*	Quantity this month, m ³	Cumulative-to-Date, m ³	Disposal / Dumping Grounds
Inert C&D materials disposed	3381	8792	N/A
Inert C&D materials recycled	Nil	Nil	N/A
Non-inert C&D materials disposed	85	155	N/A
Non-inert C&D materials recycled	Nil	Nil	N/A
Chemical waste disposed	Nil	Nil	N/A

Contract no. HY/2010/08 Central – Wan Chai Bypass (CWB) – Tunnel (Slip Road 8) under FEP-10/364/2009/B

- 5.4.8. No inert and Non-inert C&D wastes were disposed of in this reporting month. Details of the waste flow table are summarized in **Table 5.22**.

Table 5.22 Details of Waste Disposal for Contract no. HY/2010/08

Waste Type*	Quantity this month, m ³	Cumulative-to-Date, m ³	Disposal / Dumping Grounds
Inert C&D materials disposed	1971 Nil	12266.4 363	TM 38 TKO area 137
Inert C&D materials recycled	Nil	Nil	Nil
Non-inert C&D materials disposed	22	486	SENT
Non-inert C&D materials recycled	Nil	Nil	Nil
Chemical waste disposed	400	535	Nil

Contract no. HY/2011/08 Central –Central - Wan Chai Bypass (CWB) –Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning under FEP-11/364/2009B

- 5.4.9. No inert and Non-inert C&D wastes were disposed of in this reporting month. Details of the waste flow table are summarized in **Table 5.23**.

Table 5.23 Details of Waste Disposal for Contract no. HY/2011/08

Waste Type*	Quantity this month, m ³	Cumulative-to-Date, m ³	Disposal / Dumping Grounds
Inert C&D materials disposed	Nil	Nil	Nil
Inert C&D materials recycled	Nil	Nil	Nil
Non-inert C&D materials disposed	Nil	Nil	Nil
Non-inert C&D materials recycled	Nil	Nil	Nil
Chemical waste disposed	Nil	Nil	Nil

6.0 COMPLIANCE AUDIT

- 6.0.1. The Event Action Plan for construction noise, air qualities are presented in **Appendix 6.1**.

6.1 Noise Monitoring

Contract no. HY/2009/18 – Central – Wan Chai Bypass (CWB) – Central Interchange under FEP-05/364/2009/A

- 6.1.1. No exceedance was recorded in the reporting month.

Contract no. HK/2009/01 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention Exhibition Centre – Tunnel Works under FEP-02/364/2009

- 6.1.2. No exceedance was recorded in the reporting month.

Contract no. HK/2009/02 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

- 6.1.3. No exceedance was recorded in the reporting month.

Contract no. HY/2009/15 – Central-Wanchai Bypass – Tunnel (Causeway Bay Typhoon Shelter Section) under FEP-06/364/2009/A

- 6.1.4. One limit level exceedances were recorded on 05 August 2014 at M2b – Noon Day Gun Area in the reporting month.

- 6.1.5. Barge operation and concrete breaking works at TS4 under HY/2009/15 were observed during monitoring on 05 August 2014. It was considered that the operation of derrick barge and nearby breaking works at TS4 were the major noise contribution. As such, the limit level exceedance was concluded as project related. Rectification measures including provision of noise blanket for breakers and provision of noise screen for engine at the derrick barge were implemented by the contractor. Additional monitoring was conducted and no exceedance was identified.

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/A

- 6.1.6. One limit level exceedances were recorded on 28 July 2014 at M6 – HK Baptist Church Henrietta Secondary School in the reporting month. Investigations found that on 28 July 2014, traffic noise was major contribution in the noise monitoring and exceedances were not related to the Project.

Contract no. HY/2010/08 – Central-Wanchai Bypass – Tunnel (Slip Road 8 Section) under FEP-10/364/2009/B

- 6.1.7. No exceedance was recorded in the reporting month.

Real Time Noise Monitoring

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/A

- 6.1.8. No limit level exceedance was recorded at RTN1-FEHD Hong Kong Transport Section Whitfield Depot in the reporting month.
- 6.1.9. Limit level exceedances were recorded at RTN2a-Electric Centre during daytime on 5, 13, 16, 21 and 23 August 2014 and during restricted hours on 1 August 2014 in the reporting month. After checking with Contractor, bored piling was conducted at the concerned location on 5, 13 and 16 during the recorded period and bored piling and breaking works was conducted on 21 and 23 August 2014, contractor mitigation measures including erection of temporary noise barrier was in place. In view of the exceedances are non-continuous, the exceedances are considered to be non-project related and contributed by nearby IEC traffic. On 1 August 2014, bored piling was conducted at the concerned location during the monitoring period. Temporary noise barrier was implemented by the Contractor and the CNP GW-RS0752-14 was in place and complied. The exceedance was considered as non-project related and considered to be contributed by nearby IEC traffic.
- 6.1.10. No limit level exceedances were recorded at RTN3-Yue Lee Mo Fan Memorial School in the reporting month.
- 6.1.11. No limit level exceedance was recorded at RTN4-Causeway Bay Community Centre in the reporting month.

6.2 Air Monitoring

Contract no. HY/2009/18 – Central – Wan Chai Bypass (CWB) – Central Interchange under FEP-05/364/2009/A

- 6.2.1. No exceedance was recorded in the reporting month.

Contract no. HK/2009/01 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention and Exhibition Centre – Tunnel Works under FEP-02/364/2009

- 6.2.2. No exceedance was recorded in the reporting month.

Contract no. HK/2009/02 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

- 6.2.3. No exceedance was recorded in the reporting month.

Contract no. HY/2009/15 – Central-Wanchai Bypass – Tunnel (Causeway Bay Typhoon Shelter Section) FEP-06/364/2009/A

- 6.2.4. No exceedance was recorded in the reporting month.

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/A

- 6.2.1. No exceedance was recorded in the reporting month.

6.3 Review of the Reasons for and the Implications of Non-compliance

6.3.1. There was no non-compliance from the site audits in the reporting period. The observations and recommendations made in each individual site audit session were presented in Section 8.

6.3.2. No non-compliances from monitoring was recorded in the reporting month.

6.4 Summary of action taken in the event of and follow-up on non-compliance

6.4.1 There was no particular action taken since no non-compliance was recorded from the site audits in the reporting period.

7.0 CUMULATIVE CONSTRUCTION IMPACT DUE TO THE CONCURRENT PROJECTS

7.0.1. According to Condition 3.4 of the EP-364/2009/C, this section addresses the relevant cumulative construction impact due to the concurrent activities of the current projects including the Central Reclamation Phase III (CRIII), Wan Chai Development Phase II (WDII), Central-WanChai Bypass (CWB), Island Eastern Corridor Link projects (IECL) and Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East (CWB Tunnel).

7.0.2. According to the Final EM&A Report of Central Reclamation Phase III (CRIII) for Contract HK 12/02, the major construction activities were completed by end of January 2014 and no construction activities were undertaken thereafter and the water quality monitoring was completed in October 2011. As such, it is considered that there were no cumulative construction impact due to the concurrent activities of the current projects with the Central Reclamation Phase III (CRIII) undertaken by contractor HK12/02 in the reporting month.

7.0.3. According to the construction programme of Central-Wanchai Bypass at Wanchai West at the Central Reclamation Phase III area, Diaphragm wall construction and pipe pile wall construction were performed in August 2014 reporting month. As no project related exceedance were recorded during the reporting period, cumulative construction impact due to the concurrent activities of the current projects with the Central Reclamation Phase III (CRIII) was considered as insignificant.

7.0.4. According to the construction programme of Wan Chai Development Phase II, Central-Wan Chai Bypass and Island Eastern Corridor Link projects, the major construction activity under Wan Chai Development Phase II were marine works at HKCEC areas, tunnel works at Wan Chai East and filling works at Wan Chai West. The major construction activities under Central-Wan Chai Bypass and Island Eastern Corridor Link Projects were bridge construction and tunnel works at Central Interchange, land base bored pilling works at Victoria Park Road and ELS, segment launching works and tunnel works at North Point area. The major environmental impact was water quality impact at Causeway Bay and Wan Chai. Marine-based construction activities were filling works at WanChai West and removal of temporary reclamation at TS4, TS2 and EX-PCWA at Wan Chai East in the reporting month.



- 7.0.5. No significant air impact from construction activities was anticipated in the reporting month. Besides, project related exceedances recorded during the air and noise environmental monitoring events in the reporting month were rectified. Thus, it is evaluated that the cumulative construction impact from the concurrent projects including Central Reclamation Phase III (CRIII), Wan Chai Development Phase II (WDII), Central-WanChai Bypass (CWB), Island Eastern Corridor Link projects (IECL) was insignificant.

8.0 ENVIRONMENTAL SITE AUDIT

- 8.0.1. During this reporting month, weekly environmental site audits were conducted for Contracts no. HY/2009/15, HY/2009/18, HY/2009/19, HK/2012/08, HK/2009/01, HK/2009/02, HY/2010/08 and HK/2010/06. No non-conformance was identified during the site audits. The Contractors rectified major observations and recommendations made during the audit sessions. No non-conformance was identified during the site inspections.
- 8.0.2. Five site inspections for Contract no. HY/2009/15 was carried out during this reporting period. The results of these inspections and outcomes are summarized in **Table 8.1**.

Table 8.1 Summary of Environmental Inspections for Contract no. HY/2009/15

Item	Date	Observations	Action taken by Contractor	Outcome
140729_01	29 Jul 14	Provide impermeable layer at the dredging work area as per method statement (TS4)	No further dredging works was conducted.	Completion as observed on 26 Aug 2014
140729_02	29 Jul 14	Deploy the silt curtain properly to prevent seepage of muddy effluent and conduct regular checking of condition of deployment	The condition of the silt curtain was improved	Completion as observed on 5 Aug 2014
140805_01	5 Aug 14	Drip tray should be provided for chemical containers (TS4)	Chemical container has been removed.	Completion as observed on 12 Aug 2014
140805_02	5 Aug 14	Silt curtain shall be properly deployed around the derrick barge (TS4)	The condition of the silt curtain was improved	Completion as observed on 26 Aug 2014
140805_03	5 Aug 14	Acoustic blanket shall be provided to breakers (TS2)	Acoustic screen have been provided to breaker.	Completion as observed on 12 Aug 2014
140805_04	5 Aug 14	Removal of floating refuse and oil or grease within embayed water	Floating refuse and oil or grease was cleared	Completion as observed on 12 Aug 2014
140812_01	12 Aug 14	Floating refuses and oil formed on waterbody shall be cleared (TS4, Ex-pcwa)	Floating refuse and oil or grease was cleared	Completion as observed on 19 Aug 2014
140812_02	12 Aug 14	Drip tray or waste collection point shall be provided to chemical waste (TS4)	Chemical container has been removed.	Completion as observed on 19 Aug 2014
140812_03	12 Aug 14	Silt curtain shall be provided to surround the temporary cut slope to prevent muddy seepage (TS2, Ex-pcwa)	Protection to temporary cut slope was provided	Completion as observed on 26 Aug 2014

Item	Date	Observations	Action taken by Contractor	Outcome
140819_01	19 Aug 14	Provide noise screen or acoustic blanket to beaker (TS4)	Acoustic screen have been provided to beaker.	Completion as observed on 26 Aug 2014
140826_01	26 Aug 14	Wastewater collection point shall be properly connected to prevent surface overflow of construction effluent (TS4)	Wastewater collection point has been rectified, no further surface runoff was observed	Completion as observed on 2 September 2014
140826_02	26 Aug 14	Silt curtain shall be provided to the D-wall cutting and filled material excavation to mitigate turbid dispersion (TS4)	No further muddy dispersion/ seepage was observed and the D-wall cutting area was provided with silt curtain	Completion as observed on 2 September 2014
140826_03	26 Aug 14	Floating refuses and scum shall be cleaned (TS4, EX-PCWA)	Floating refuse and scum was cleared	Completion as observed on 2 September 2014
140826_04	26 Aug 14	Protection shall be provided to tempoary cut slope to mitigate muddy dispersion (EX-PCWA)	Protection to tempoary cut slope was provided	Completion as observed on 2 September 2014

8.0.3. Four site inspections for Contract no. HY/2009/18 was carried out during this reporting period. No observation was found in the reporting month.

8.0.4. Five site inspections for Contract no. HY/2009/19 was carried out during this reporting period. The results of these inspections and outcomes are summarized in Table 8.3.

Table 8.3 Summary of Environmental Inspections for Contract no. HK/2009/19

Item	Date	Observations	Action taken by Contractor	Outcome
140827_01	27 Aug 14	Provide dust mitigation measures to dusty surface (TD Bridge)	Watering was provided to dusty surfaces	Completion as observed on 3 September 2014

8.0.5. Five site inspections for Contract no. HK/2009/01 was carried out during this reporting period. The results of these inspections and outcomes are summarized in **Table 8.4**

Table 8.4 Summary of Environmental Inspections for Contract no. HK/2009/01

Item	Date	Observations	Action taken by Contractor	Outcome
140806_01	6 Aug 14	Drip tray should be provided for oil container	The oil container was taken away and stored in a proper storage area.	Completion as observed on 13 August 2014
140813_01	13 Aug 14	Chemical containers shall be placed and stored properly at Area 8	Chemical containers were stored properly in designated area.	Completion as observed on 21 August 2014

Item	Date	Observations	Action taken by Contractor	Outcome
140827_01	27 Aug 14	Drip tray should be provided for oil container at Stage 2 area	Drip tray was provided for oil container at Stage 2 area.	Completion as observed on 3 September 2014

8.0.6. Four site inspections for Contract no. HK/2009/02 was carried out during this reporting period. The results of these inspections and outcomes are summarized in **Table 8.5**

Table 8.5 Summary of Environmental Inspections for Contract no. HK/2009/02

Item	Date	Observations	Action taken by Contractor	Outcome
140731_01	31 Jul 14	Floating refuse shall be cleaned up such that the possible of odour nuisance could be minimized.	Floating refuses were cleared.	Completion as observed on 8 Aug 2014
140807_01	7 Aug 14	Empty oil cans shall be taken away (Portion 3&4)	The oil can was stored in a proper designated area.	Completion as observed on 14 Aug 2014
140820_01	20 Aug 14	Drip trays should be provided for oil chemical containers at Portion 2	Drip tray was provided for oil chemical containers at Portion 2.	Completion as observed on 28 Aug 2014

8.0.7. Five site inspections for Contract no. HK/2010/06 was carried out during this reporting period. No observation was found in the reporting month.

8.0.8. Five site inspection for Contract no. HK/2012/08 was carried out during this reporting period. The results of these inspections and outcomes are summarized in **Table 8.7**

Table 8.7 Summary of Environmental Inspections for Contract no. HK/2012/08

Item	Date	Observations	Action taken by Contractor	Outcome
140730_01	30 Jul 14	Drip tray should be provided for oil cans.	Drip tray was provided for oil cans	Completion as observed on 5 August 2014
140826_01	26 Aug 14	It is required to identify the source of muddy water seepage and conduct proper action to prevent any seepage into the ocean.	The source of seepage has been identified and action was taken to prevent any potential seepage.	Completion as observed on 2 Sep 2014

8.0.9. Four site inspection for Contract no. HY/2010/08 was carried out during this reporting period. The results of these inspections and outcomes are summarized in **Table 8.8**

Table 8.8 Summary of Environmental Inspections for Contract no. HY/2010/08

Item	Date	Observations	Action taken by Contractor	Outcome
140731_01	31 Jul 14	Clear the chemical waste container (Victoria Park)	Chemical waste container have been removed	Completion as observed on 8 Aug 2014
140808_01	8 Aug 14	Silt curtain should be properly deployed to mitigate against muddy seepage (Victoria Park Road)	The condition of the silt curtain was improved and properly deployed	Completion as observed on 14 Aug 2014
140821_01	21 Aug 14	Silt curtain enclosing the dredging operation shall be properly deployed (TS3)	Silt curtain for dredging operation was rectified	Completion as observed on 28 Aug 2014

9.0 COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTION

- 9.0.1. One environmental complaint (ICC Case Ref.: 2-360638977) dated 31 July 2014 regarding noise concern referred by RSS was received by ET on 01 August 2014.
- 9.0.2. The complainant reported that at 01:20hrs on 30 July 2014, the complainant was woken up by the noise of sand and gravel movements at area opposite to the Harbour Heights.
- 9.0.3. According to the relevant site records, before 2300hrs on 29 July 2014, EVB excavation at the works area around Watson Road was conducted under HY/2009/19. (Total 1 no. of dump truck, 1 no. of excavator, 3 nos. of generators and 23 nos. of dewatering pumps were in operation at the above period). From around 23:00hrs on 29 July 2014 to 01:00hrs on 30 July 2014, dewatering works at works area around Watson Road was conducted under HY/2009/19. Total 23 nos. of dewatering pumps were operating at the above period.
- 9.0.4. In addition, mobilization of PME(s) was performed at works area around Watson Road under HY/2009/19 from 00:45hrs to 01:30hrs on 30 July 2014. Total 1 no. of excavation machine and 1 no. of dump truck were in operation. After reviewing relevant records and information verified by RSS and the Construction Noise Permit (CNP) no.GW-RS0152-14, it was considered the below condition of CNP GW-RS0152-14 was not fulfilled by the Contractor of HY/2009/19. From around 00:45hrs to 01:30hrs on 30 July 2014, the operation of PME(s) (1 no. of excavator and 1 no. of dump truck) under the Contractor of HY/2009/19 on-site could not follow any given PME grouping requirement(s) as stated in condition 3.a. and condition 3.d. in no.GW-RS0152-14.
- 9.0.5. Notwithstanding the above, according to the information provided by the RSS, the excavator and dump truck were mobilized away from the edge of the temporary ELS structure towards the area opposite to the Harbour Heights after 23:00hrs under safety consideration.
- 9.0.6. The Contractor of HY/2009/19 was advised to review the arrangement and location for retaining and securing PME(s)/ plants to minimize the movements of PME or plants after completion of works such that the Construction Noise Permit would be followed.
- 9.0.7. The details of cumulative complaint log and updated summary of complaints are presented in **Appendix 9.1**
- 9.0.8. Cumulative statistic on complaints and successful prosecutions are summarized in **Table 9.1** and **Table 9.2** respectively.

Table 9.1 Cumulative Statistics on Complaints

Reporting Period	No. of Complaints
August 2014	1
Sep 2010 – July 2014	30
Total	31



Table 9.2 Cumulative Statistics on Successful Prosecutions

Environmental Parameters	Cumulative No. Brought Forward	No. of Successful Prosecutions this month (Offence Date)	Cumulative No. Project-to-Date
Air	-	0	0
Noise	-	0	0
Water	-	0	0
Waste	-	0	0
Total	-	0	0

10 CONCLUSION

10.0.1. The EM&A programme was carried out in accordance with the EM&A Manual requirements, minor alterations to the programme proposed were made in response to changing circumstances.

10.0.2. The scheduled construction activities and the recommended mitigation measures for the coming month are listed in **Table 10.1**. The construction programmes of individual contracts are provided in **Appendix 10.1**.

Table 10.1 Summary of Key Construction Activities of Individual Contract(s) to be commenced in Coming Reporting Month

Contract No.	Key Construction Works	Recommended Mitigation Measures
HY/2009/15	- Post tunnel construction at TS1 and TS2 - Mined Tunnel drill-and-break works at East and West Portal - Permanent lining structure at West Portal of Mined Tunnel	- Dust control during dust generating activities - Provide protection works and adequate drainage system to ensure no direct discharge into public drainage system or the nearby water.
HY/2009/18	- Excavation of trial pit - Transplanting of trees - Drainage works - Tunnel works including scaffolding erection, excavation, OHVD installation, roadside barriers, top and base slab construction, extract sheet pile, waterproofing and backfill - Trough structure construction and associated drilling and grouting - Road works - Bridges construction	- Noise level shall be controlled by reducing the breaking operation rate. - Dust control during dust generating activities - Provide protection works to ensure no runoff out of site area or direct discharge into public drainage system. - Appropriate plants and measures should be taken to ensure adequate protections are provided for trees being transplanted.

HY2009/19	• Road works at Watson Road • Bored piling (Land) • Removal/ Installation of strut at ELS • Construction of Dolphin Cap • ELS for Cut & Cover Tunnel and EVB • Excavation of ELS continue • Laying of 1350ϕ pipe • Pre-bored H-pile for Admin. Building continue • Parapet construction continue • Construction of TD bridge continue • Construction of Bridge E • Construction of Bridge F4 and F5 • Construction of Pump Sump E • Installation of Noise Barrier/enclosure • Modification of existing crosshead at Pier 17-18 • IECL Road modification and removal of Median Barrier	• Noise level shall be controlled by reducing the breaking operation rate. • Noise barrier shall be implemented • Dust control during dust generating works • Provide protection works and adequate drainage system to ensure no direct discharge into public drainage system or the sea.
HK2009/01	• Stage 1 construction of tunnel structures • Stage 2 excavation and ELS works • Stage 3 construction of D-Wall • Demolition of the remaining East Bridge • pre-bored H piles • Excavation work • Pipe laying for discharge cooling main BF	• Noise level shall be controlled by reducing no. of plants working in parallel. • Well maintained enclosures for grouting mixing plants. • Provide protection works and adequate drainage system to ensure no direct discharge into public drainage system or the sea. • Dust control during dust generating works

HK/2009/02	• Backfilling to Tunnel Portion 1. • Utility bridge load transfer for Box Culvert N1 & Cooling Watermain • Excavate and installation of ELS. • Pump test for continuing Tunnel Portion 2 excavation. • Bored pile construction.	• Dust control during dust generating works • Provision of protection to ensure no runoff out of site area or direct discharge into public drainage system.
HK/2010/06	• Sealing at turret openings	• Dust control during dust generating works.
HK/2012/08	• Diaphragm wall construction • Site survey	• Dust control during dust generating works • Provide protection works and adequate drainage system to ensure no direct discharge into public drainage system.
HY/2010/08	• Tree & root pruning works • Tree transplanting works, • Tree works within off-site nursery compound, • Drainage improvement works, • Sheet piling works, • Excavation and Lateral Support for U-structure, • Erection of noise absorption sheetings, • Pipe piling, ground pre-treatment, pre-boring works & jet grouting works, • Utility diversion, • Construction of Bowling Green Office and • Temporary Traffic Arrangement & paving works for Victoria Park Road.	• Provide protection works and adequate drainage system to ensure no direct discharge into public drainage system. • Appropriate plants and measures should be taken to ensure adequate protections are provided for trees being transplanted and retained on site.
HY/2011/08	• No physical construction activities	• Nil




- 10.0.3. The construction works of Contract no. 04/HY/2006 – Reconstruction of Bus Terminus near Man Yiu Street and Man Kwong Street under FEP-04/364/2009/A was completed, and the FEP was surrendered by the Contractor on 11 February 2011.
- 10.0.4. The construction works of Contract no. HY/2009/17 - Advance piling works at Whitfield Depot under FEP-03/264/2009 was completed, and the FEP was surrendered by the Contractor and found in order by EPD on 25 April 2013.



Figure 2.1

Project Layout

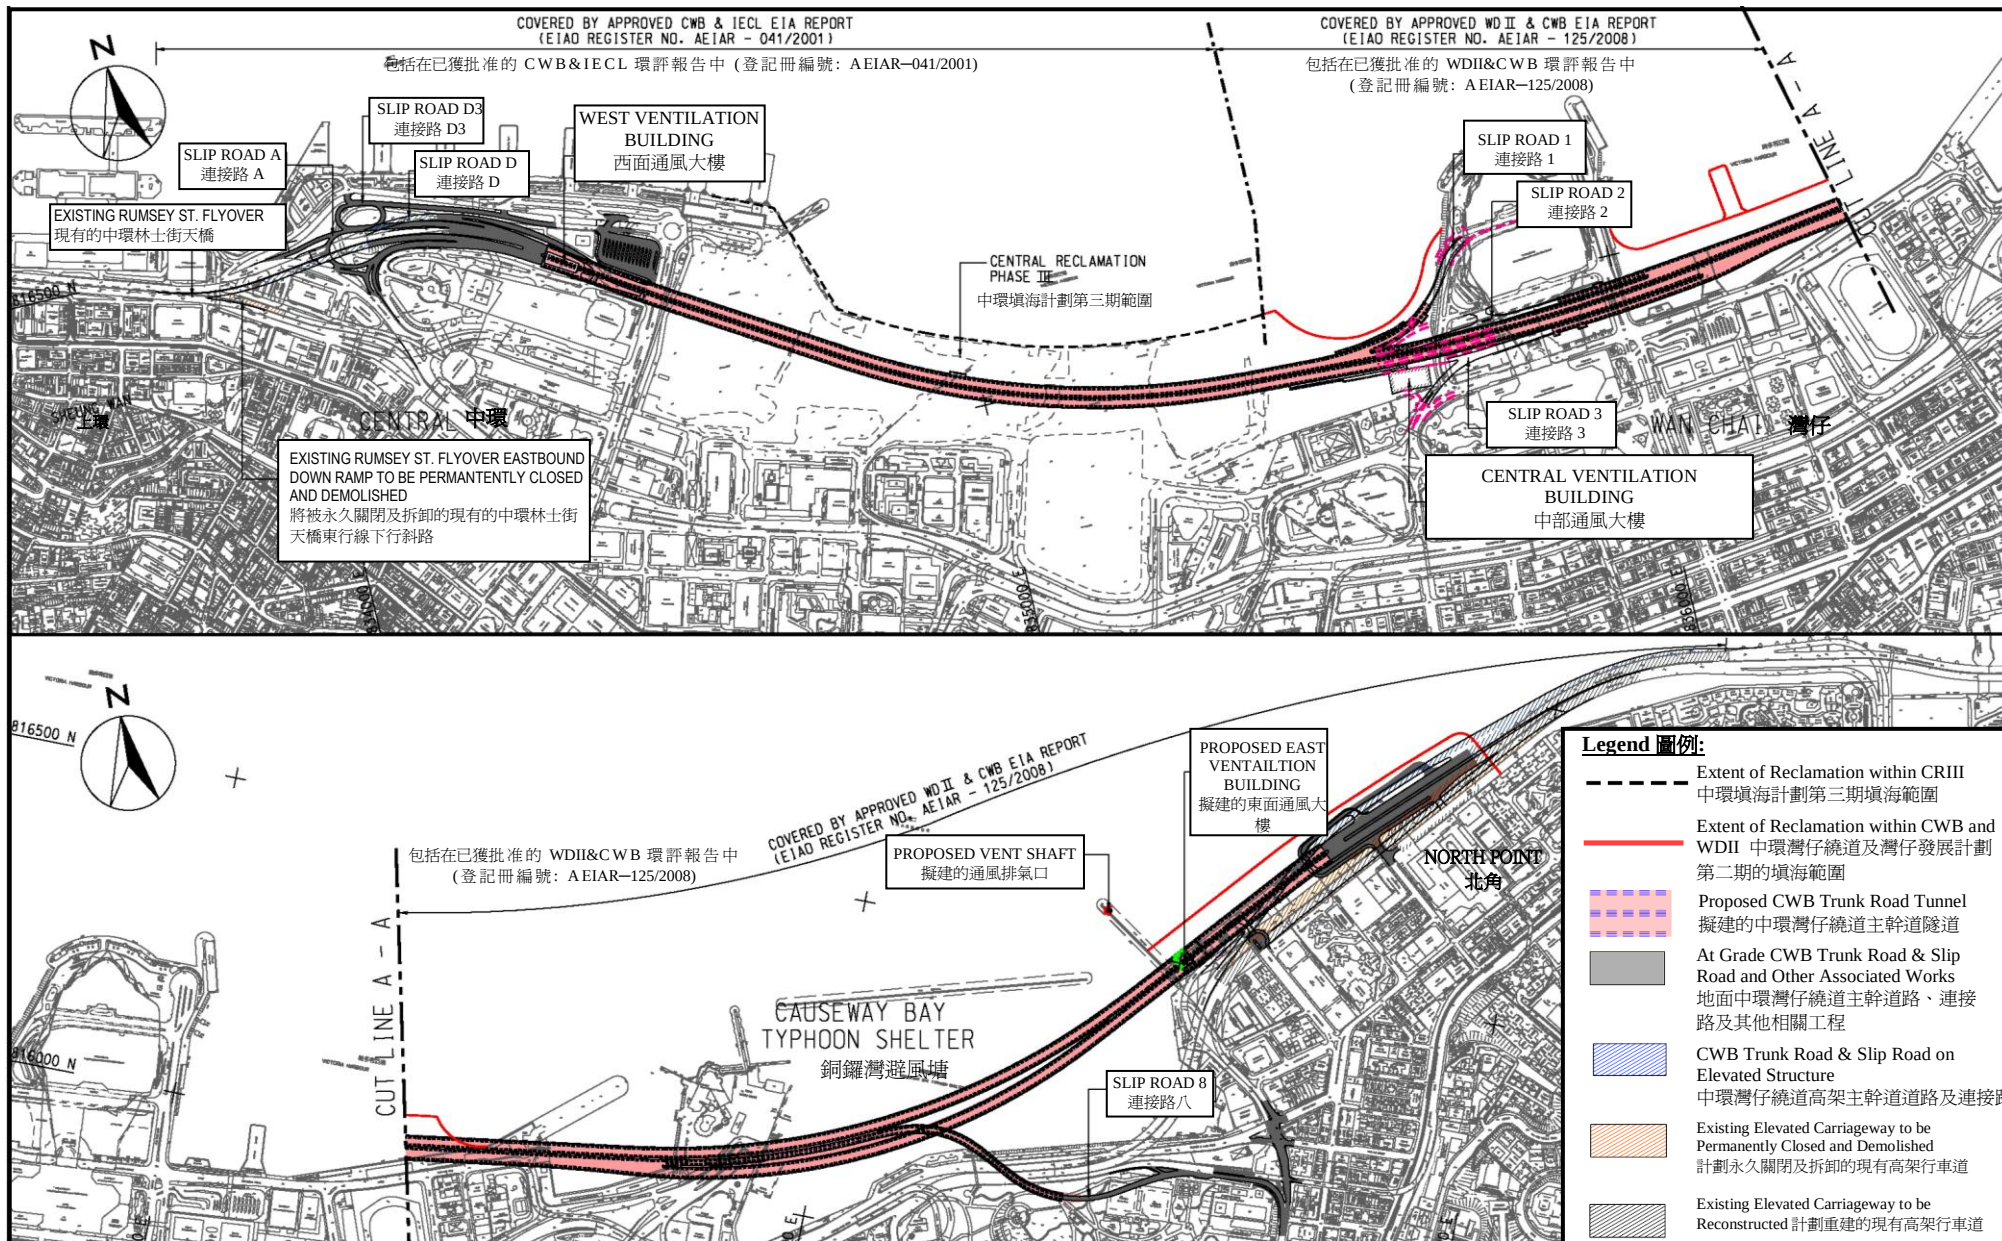


Project Title: Central-Wanchai Bypass (CWB) Including Its Road Tunnel and Slip Roads
工程項目名稱: 中環灣仔繞道包括其行車隧道及連接路

Environmental Permit No.: EP-364/2009/B
環境許可證編號: EP-364/2009/B

Figure 1: Location of the Project
圖 1: 工程項目位置

(This figure was prepared based on Figure 1.1 of the Application for Environmental Permit (Application No.: AEP-364/2009))
(本圖是根據環境許可證的申請(申請書編號 AEP-364/2009 圖 1.1 編製))

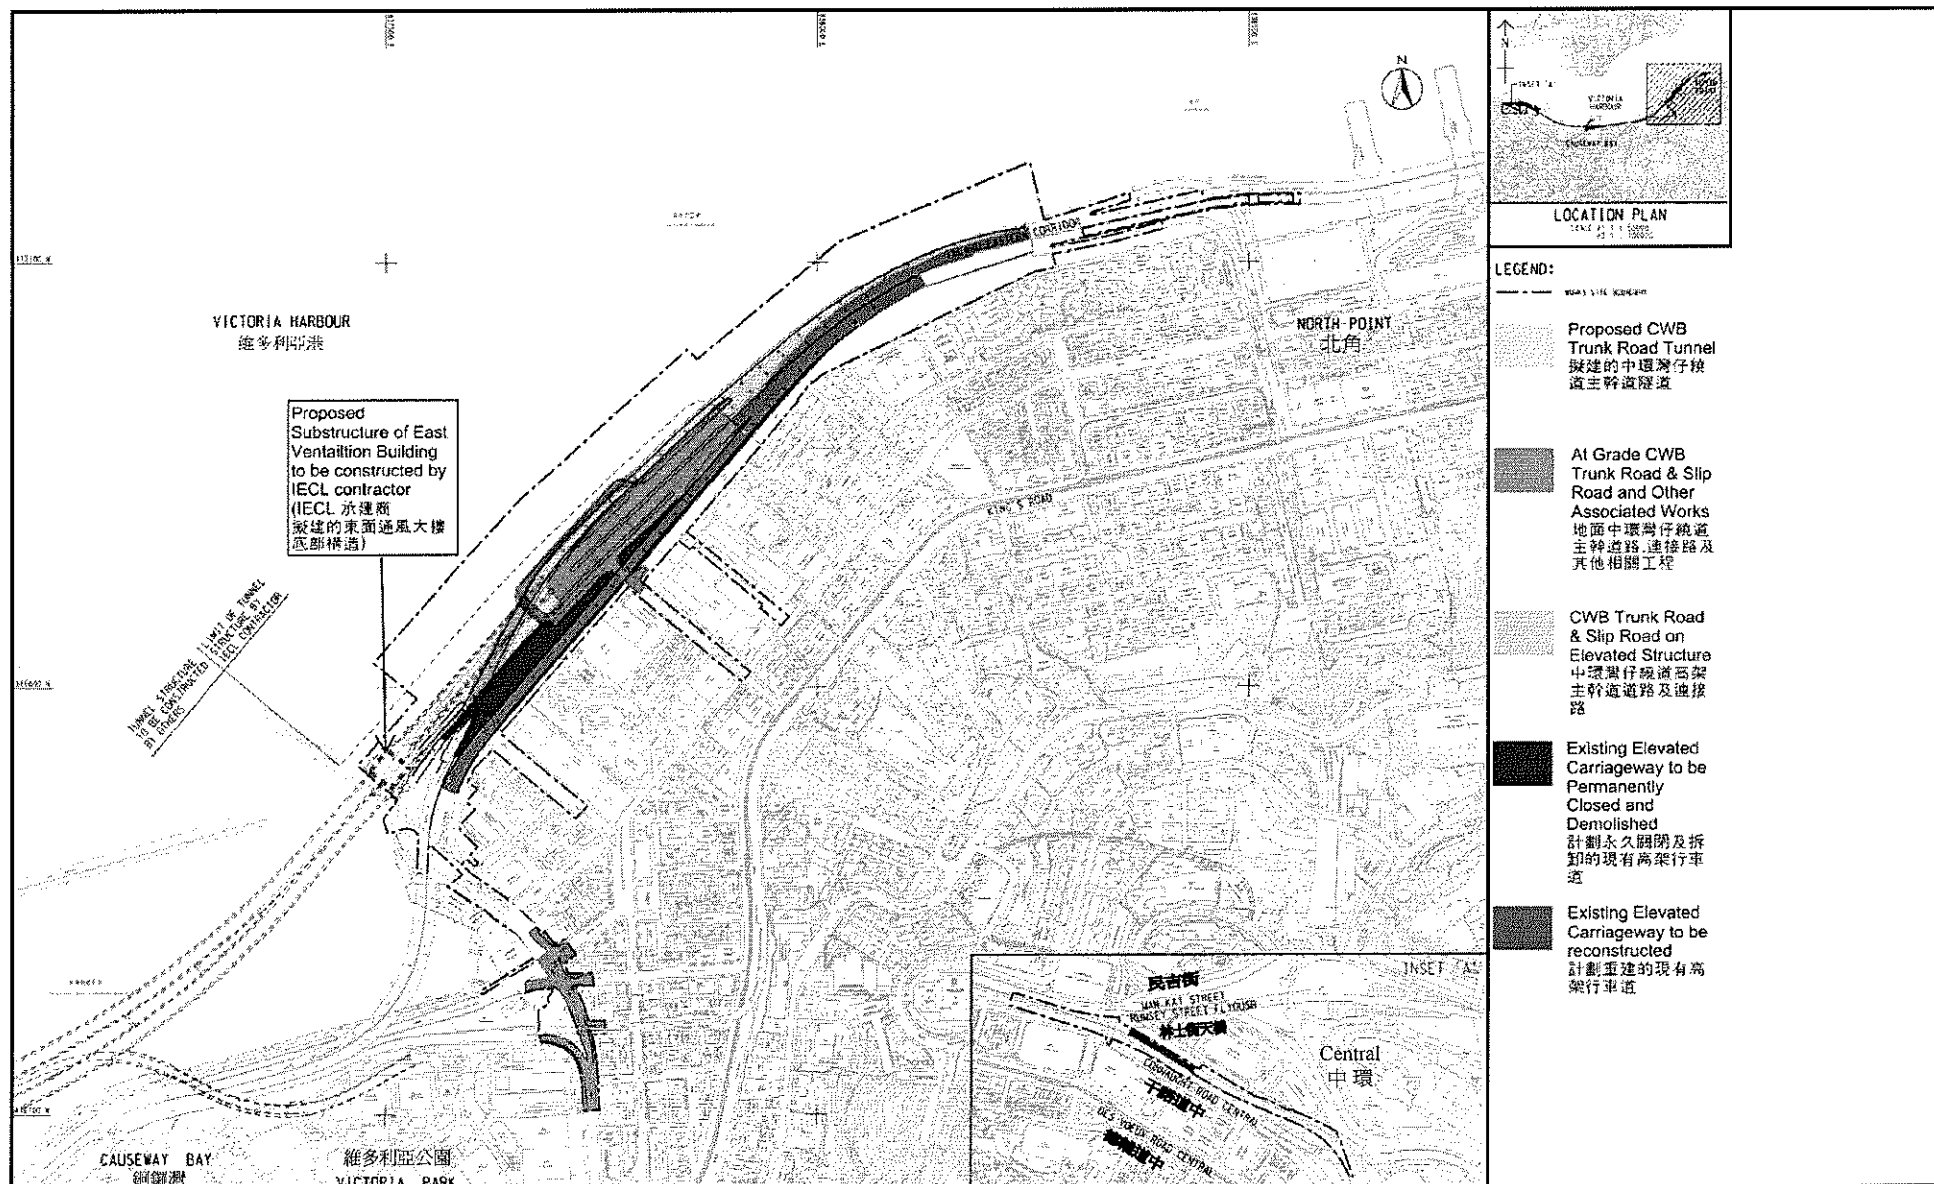

Project Title: Central-Wanchai Bypass (CWB) – Tunnel (North Point Section) and Island Eastern Corridor Link
 工程項目名稱：中環灣仔繞道—北角段隧道及東區走廊連接路
 Environmental Permit No. : FEP-07-364/2009/A
 環境許可證編號 : FEP-07-364/2009/A

Figure 1b: General Layout Plan
 圖 1b: 工程項目佈局圖

(This figure was prepared based on Sketch No. 60095653/IEC/DF0006 of Application for Further Environmental Permit (Application No.: FEP-120/2011))
 (本圖是根據申請新的環境許可證 (申請書編號 FEP-120/2011) 圖 60095653/IEC/DF0006 編製)



Figure 2.2

Project Organization Chart



Project Organization Chart


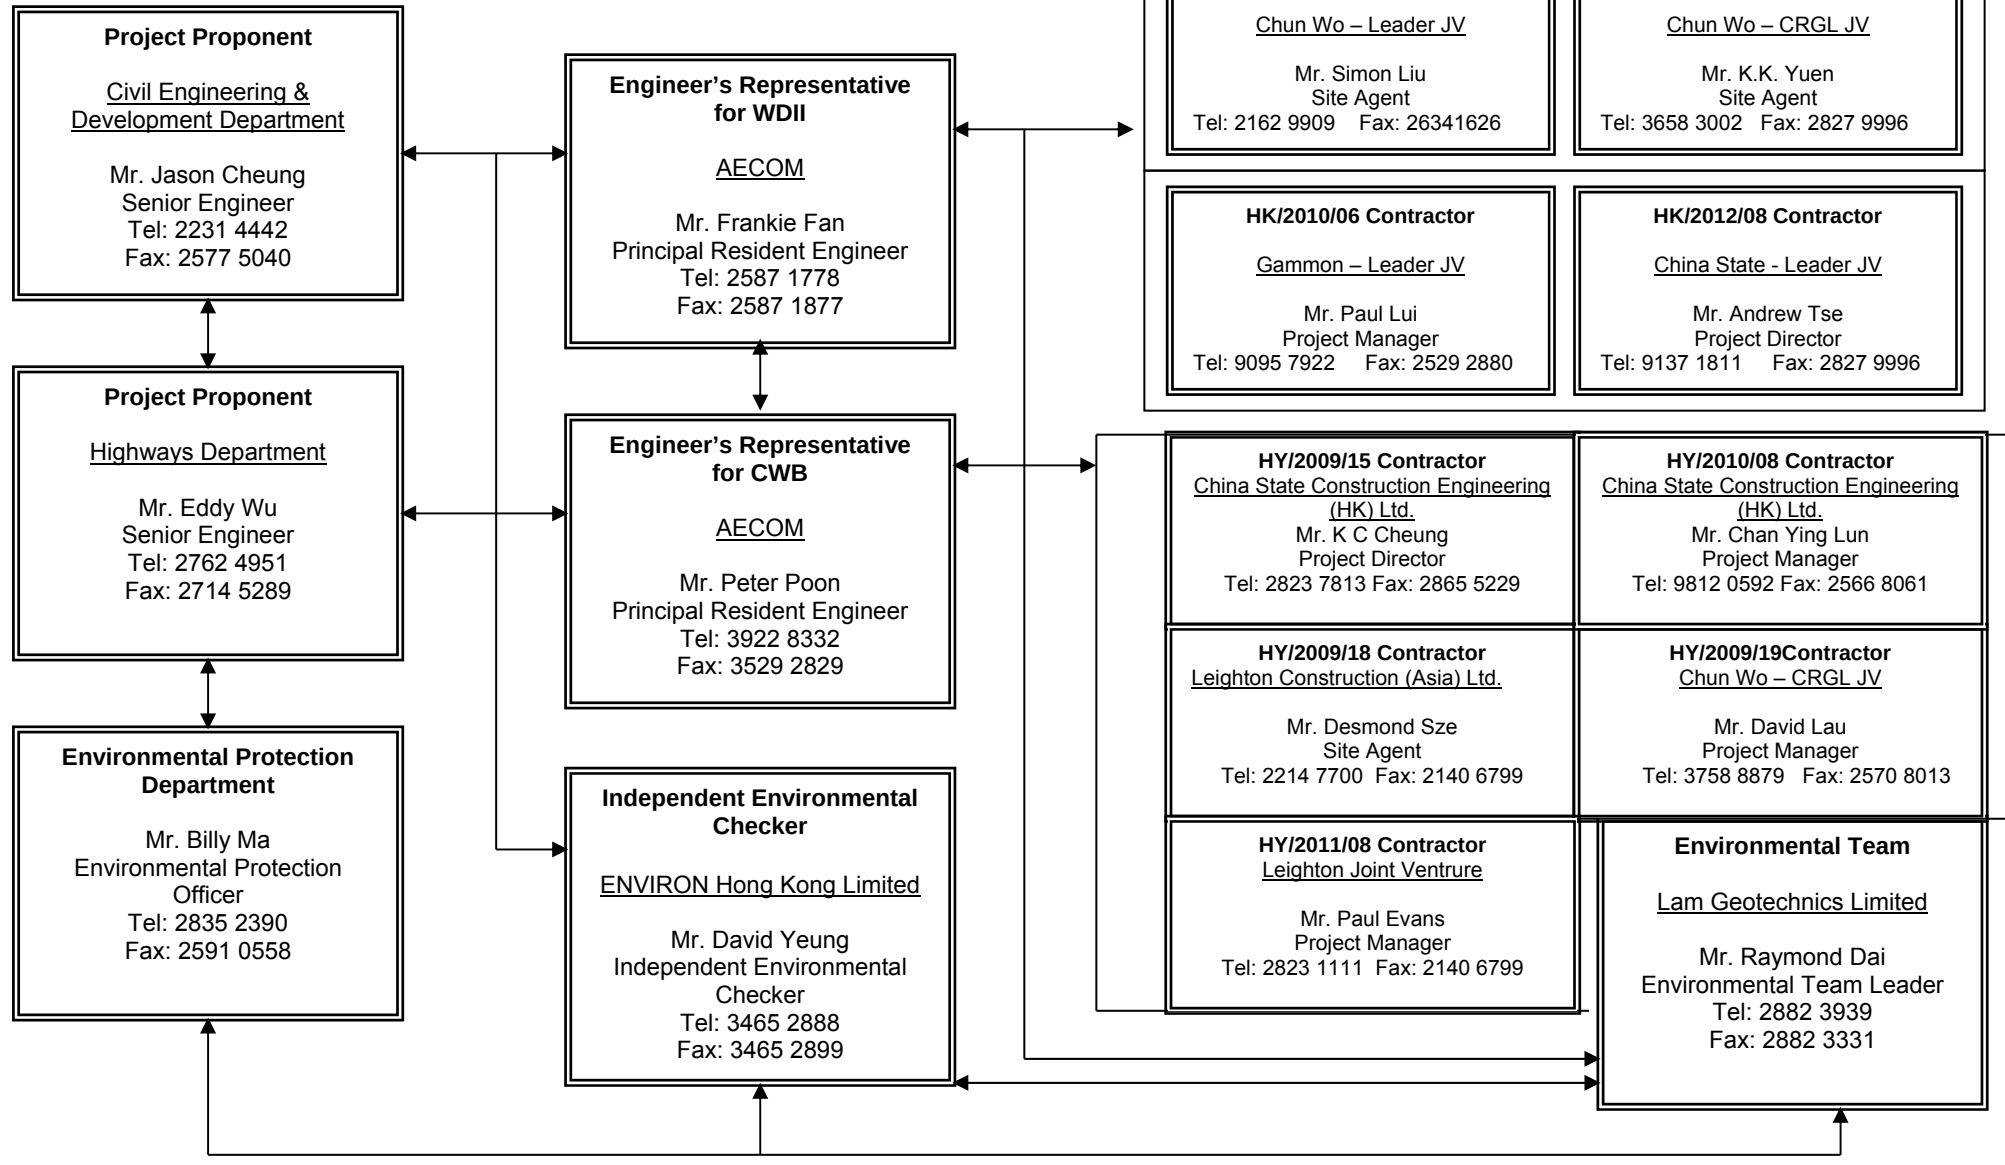




Figure 4.1

Locations of Monitoring Stations



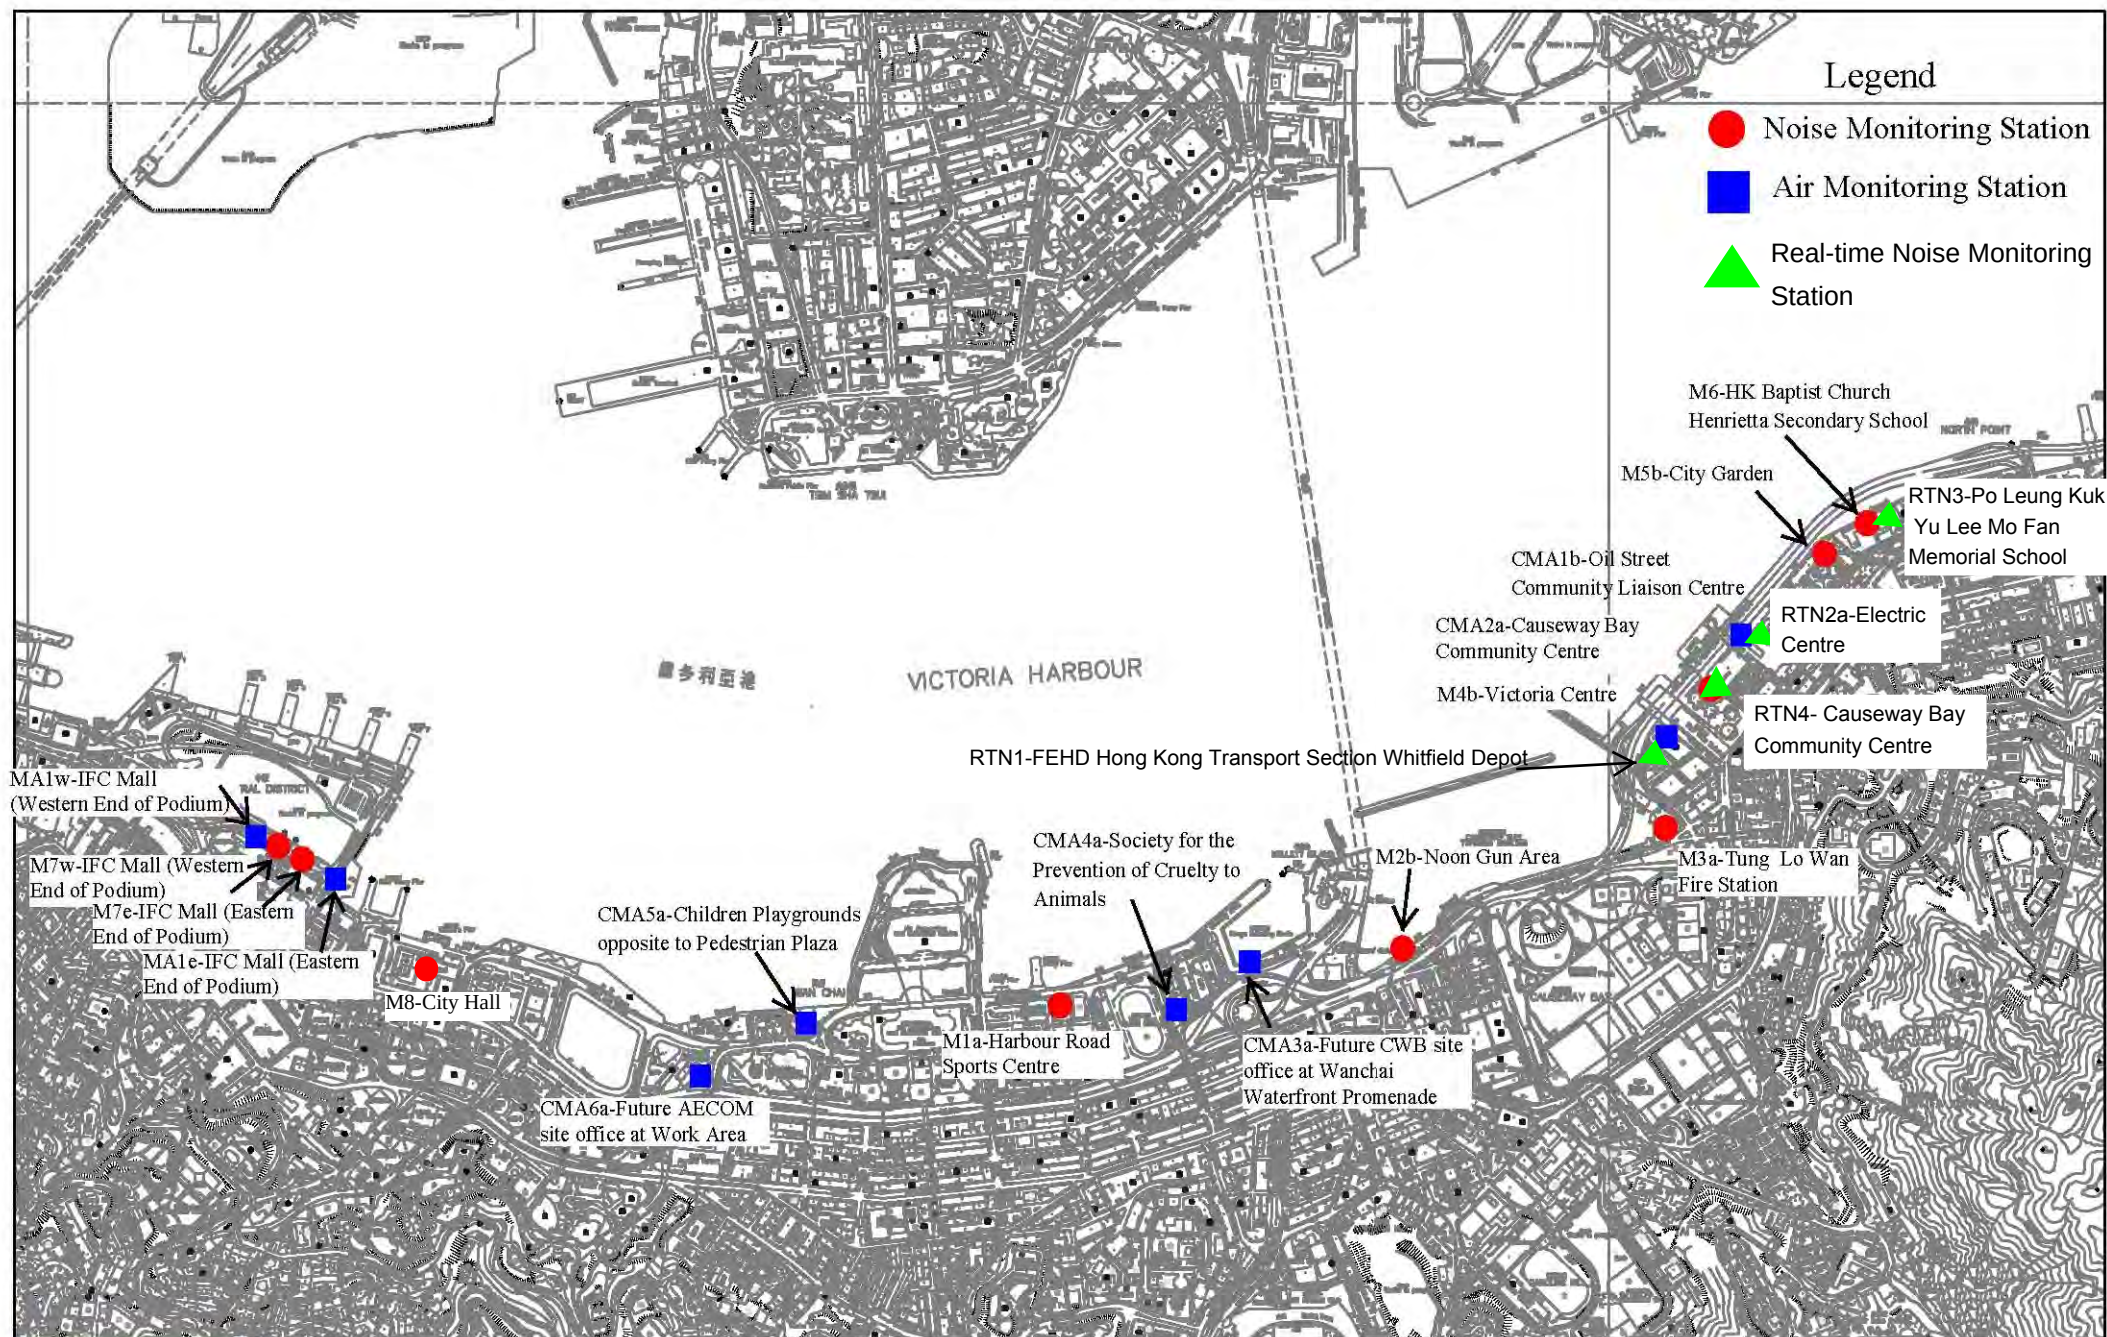

Appendix 3.1

Environmental Mitigation Implementation Schedule

IMPLEMENTATION SCHEDULE OF THE PROPOSED MITIGATION MEASURES**Table A.1 Implementation Schedule for Air Quality Control**

WDII & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
				Des	C	O	Dec	
Construction Phase								
S3.6.5	Four times a day watering of the work site with active operations.	Work site / during construction	Contractor		√			EIAO-TM
S3.8.1	Implementation of dust suppression measures stipulated in Air Pollution Control (Construction Dust) Regulation. The following mitigation measures, good site practices and a comprehensive dust monitoring and audit programme are recommended to minimise cumulative dust impacts. - Strictly limit the truck speed on site to below 10 km per hour and water spraying to keep the haul roads in wet condition; - Watering during excavation and material handling; - Provision of vehicle wheel and body washing facilities at the exit points of the site, combined with cleaning of public roads where necessary; and - Tarpaulin covering of all dusty vehicle loads transported to, from and between site locations.	Work site / during construction	Contractor		√			
Operational Phase								
S3.6.53 – S3.6.54	The design parameters of the East and Central Ventilation Buildings as set in Tables 3.10 and 3.11 of Volume 1 of the WDII & CWB EIA Report.	East and Central Ventilation Buildings / During operation of the Trunk Road	HyD			√		
S3.10.2	Air quality monitoring for the operation performance of the East Ventilation Building and associated East Vent Shaft will be conducted.	East Vent Shaft / During operation of the East Ventilation Building and associated East Vent Shaft	HyD			√		EIAO-TM

* Des - Design, C - Construction, O – Operation, and Dec - Decommissioning

Table A.2 Implementation Schedule for Noise Control

WDII & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
				Des	C	O	Dec	
Construction Phase								
S4.9.3	Good Site Practice: - Only well-maintained plant shall be operated on-site and plant shall be serviced regularly during the construction program. - Silencers or mufflers on construction equipment shall be utilized and shall be properly maintained during the construction program. - Mobile plant, if any, shall be sited as far away from NSRs as possible. - Machines and plant (such as trucks) that may be in intermittent use shall be shut down between works periods or shall be throttled down to a minimum. - Plant known to emit noise strongly in one direction shall, wherever possible, be orientated so that the noise is directed away from the nearby NSRs. - Material stockpiles and other structures shall be effectively utilized, wherever practicable, in screening noise from on-site construction activities.	Work Sites / During Construction	Contractor		√			EIAO-TM, NCO
S4.8.1 – S4.8.11	Use of quiet powered mechanical equipment, movable noise barrier and temporary noise barrier for the following tasks: - Slip road 8 tunnel - Construction of diaphragm wall and substructures of the tunnel approach ramp - Excavation - Construction of slabs - Backfill	Work Sites / During Construction	Contractor		√			EIAO-TM, NCO

WDII & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
				Des	C	O	Dec	
	- Demolition and construction of substructures for the IEC - Demolition works of existing piers and crossheads of the marine section of the existing IEC Use of PME grouping for the following tasks: - At-grade road construction - Substructure for IECL connection							
Operation Phase								
S4.8.12 – S4.8.23	For Existing NSRs - about 235m length of noise semi-enclosure with transparent panel covering the westbound slip road from the IEC - about 230m length of noise semi-enclosure with transparent panel covering the main carriageways (eastbound and westbound) of the CWB and IEC - about 135m length of 5.5m high cantilevered noise barrier with 4.5m cantilever inclined at 45° with transparent panel on the eastbound slip road to the IEC (amended under EP-364/2009/A) - about 95m length of 5.5m high cantilevered noise barrier with 1m cantilever inclined at 45° with transparent panel on the eastbound slip road to the IEC - about 350m length of 3.5m high vertical noise barrier with transparent panel on the eastbound slip road to the IEC - low noise road surfacing for the trunk road (except tunnel section and beneath the landscaped deck at the eastern portal area)) with speed limit of 70 km/hour	Near North Point / Before commencement of operation of road project	HyD	√	√	√		EIAO-TM

WDII & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
				Des	C	O	Dec	
	For Future/Planned NSRs - about 265m length of noise semi-enclosure with transparent panel covering the westbound slip road from the IEC - The openable windows of the temple, if any, should be orientated so as to avoid direct line of sight to the existing Victoria Park Road as far as practicable.	In between the Electric Centre (next to City Garden) and CDA(1) site / Before occupation of Planned NSRs in CDA and CDA(1) sites. Near Causeway Bay Fire Station / During detailed design of the re-provisioned Tin Hau Temple	HyD Project Proponent for the re-provisioned Tin Hau Temple	√ √	√ #			

* Des - Design, C - Construction, O – Operation, and Dec - Decommissioning

Only the steel frame for this section of noise semi-enclosure would be erected in advance during the construction of the westbound slip road.

Table A.4 Implementation Schedule for Waste Management

WDII & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
				Des	C	O	Dec	
Construction Phase								
S6.5.14	Floating Refuse During the construction phase, the project proponent’s contractor will be responsible for the collection of any refuse within their works area. Floating booms will be provided on the water surface to confine the refuse from the working barges as well as to avoid the accumulation of pollutants within temporary embayment as mentioned in Table D9.3.	Work site / During the construction period	Contractor		√			
S6.6.1	Good Site Practices Recommendations for good site practices during the construction activities include: • nomination of an approved person, such as a site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site; • training of site personnel in proper waste management and chemical waste handling procedures; • provision of sufficient waste disposal points and regular collection for disposal; • appropriate measures to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers; • regular cleaning and maintenance programme for drainage systems, sumps and oil interceptors; and • a recording system for the amount of wastes generated, recycled and disposed of (including the disposal sites).	Work site / During the construction period	Contractor		√			Waste Disposal Ordinance (Cap.354)

WDII & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
				Des	C	O	Dec	
S6.6.2	<i>Waste Reduction Measures</i> Waste reduction is best achieved at the planning and design stage, as well as by ensuring the implementation of good site practices. Recommendations to achieve waste reduction include: • segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal; • to encourage collection of aluminium cans, PET bottles and paper, separate labelled bins shall be provided to segregate these wastes from other general refuse generated by the work force; • any unused chemicals or those with remaining functional capacity shall be recycled; • use of reusable non-timber formwork, such as in casting the tunnel box sections, to reduce the amount of C&D material. • prior to disposal of C&D waste, it is recommended that wood, steel and other metals shall be separated for re-use and / or recycling to minimise the quantity of waste to be disposed of to landfill; • proper storage and site practices to minimise the potential for damage or contamination of construction materials; and • plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	Work site / During planning and design stage, and construction stage	Contractor	√	√			

WDII & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
				Des	C	O	Dec	
S6.6.4	<i>General Refuse</i> General refuse shall be stored in enclosed bins or compaction units separate from C&D material. A licensed waste collector shall be employed by the contractor to remove general refuse from the site, separately from C&D material. A collection area shall be provided where wastes can be stored and loaded prior to removal from site. An enclosed and covered area is recommended to reduce the occurrence of 'wind blow' light material.	Work site / During the construction period	Contractor		√			Public Health and Municipal Services Ordinance (Cap. 132)
S6.6.5	<i>Chemical Wastes</i> After use, chemical wastes (for example, cleaning fluids, solvents, lubrication oil and fuel) shall be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Spent chemicals shall be collected by a licensed collector for disposal at the CWTF or other licensed facility in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.	Work site / During the construction period	Contractor		√			Waste Disposal (Chemical Waste) (General) Regulation Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes
S6.6.6	<i>Construction and Demolition Material</i> C&D material shall be sorted on-site into inert C&D material (that is, public fill) and C&D waste. All the suitable inert C&D material shall be broken down to 250 mm in size for reuse as public fill in the WDII reclamation. C&D waste, such as wood, glass, plastic, steel and other metals shall be reused or recycled and, as a last resort, disposed of to landfill. A suitable area shall be designated to facilitate the sorting process and a temporary stockpiling area will be required for the separated materials.	Work site / During the construction period	Contractor		√			ETWB TCW No. 33/2002, 31/2004, 19/2005

WDII & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
				Des	C	O	Dec	
S6.6.7	In order to monitor the disposal of public fill and C&D waste at public fill reception facilities and landfills, respectively, and to control fly tipping, a trip-ticket system shall be included as one of the contractual requirements and implemented by the Environmental Team undertaking the environmental monitoring and audit work. An Independent Environment Checker shall be responsible for auditing the results of the system.	Work site / During the construction period	Contractor and Independent Environmental Checker		√			ETWB TCW No. 31/2004
S6.6.8	<i>Bentonite Slurry</i> The disposal of residual used bentonite slurry shall follow the good practice guidelines stated in ProPECC PN 1/94 "Construction Site Drainage" and listed as follows: • If the disposal of a certain residual quantity cannot be avoided, the used slurry may be disposed of at the marine spoil grounds subject to obtaining a marine dumping licence from EPD on a case-by-case basis. • If the used bentonite slurry is intended to be disposed of through the public drainage system, it shall be treated to the respective effluent standards applicable to foul sewers, storm drains or the receiving waters as set out in the Technical Memorandum of Standards for Effluents Discharged into Drainage and Sewerage Systems, Inland and Coastal Waters. • If the used bentonite slurry is intended to be disposed to public fill reception facilities, it will be mixed with dry soil on site before disposal.	Work site / During the construction period	Contractor		√			ProPECC PN 1/94

* Des - Design, C - Construction, O – Operation, and Dec - Decommissioning

Table A.5 Implementation Schedule for Land Contamination

WDII & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
				Des	C	O	Dec	
Construction and Operation Phase								
S.7.1.1	As no potential contaminative land uses were identified within the Study Area, adverse land contamination impacts associated with the construction and operation of the Project is not expected. As such, environmental protection and mitigation measures are considered not necessary and will not be covered in this EM&A Manual.	-	-					-

* Des - Design, C - Construction, O – Operation, and Dec - Decommissioning

Table A.7 Implementation Schedule for Landscape and Visual

WDII & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures		Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
					Des	C	O	Dec	
Construction Phase									
Table 10.5	CM1	Topsoil, where identified, shall be stripped and stored for re-use in the construction of the soft landscape works, where practical.	Work site / During Construction Phase	Contractor	√	√			EIAO TM
Table 10.5	CM2	Existing trees to be retained on site shall be carefully protected during construction.	Work site / During Construction Phase	Contractor	√	√			EIAO TM
Table 10.5	CM3	Trees unavoidably affected by the works shall be transplanted where practical.	Work site / During Construction Phase	Contractor	√	√			EIAO TM
Table 10.5	CM4	Compensatory tree planting shall be provided to compensate for felled trees.	Work site / During Construction Phase	Contractor	√	√			EIAO TM
Table 10.5	CM5	Control of night-time lighting.	Work site / During Construction Phase	Contractor		√			EIAO TM
Table 10.5	CM6	Erection of decorative screen hoarding compatible with the surrounding setting.	Work site / During Construction Phase	Contractor		√			EIAO TM
Operation Phase									
Table 10.6, Figure 10.5.1-10.5.5	OM1	Aesthetic design of buildings and road-related structures, including viaducts, vent buildings, subways, footbridges and noise barriers and enclosure.	Work site / During Design Stage and Operation Phases	HyD	√	√	√		ETWB TCW 2/2004
Table 10.6, Figure 10.5.1-10.5.5	OM3	Buffer Tree and Shrub Planting to screen proposed roads and associated structures.	Work site / During Design Stage and Operation Phases	HyD	√	√	√		ETWB TCW 2/2004
Table 10.6, Figure 10.5.1-10.5.5	OM5	Aesthetic streetscape design.	Work site / During Design Stage and Operation Phases	HyD	√	√	√		ETWB TCW 2/2004
Table 10.6, Figure 10.5.1-10.5.5	OM6	Aesthetic design of roadside amenity areas.	Work site / During Design Stage and Operation Phases	HyD	√	√	√		ETWB TCW 2/2004

*Des - Design, C - Construction, O – Operation, and Dec - Decommissioning



Appendix 4.1

Action and Limit Level



Action and Limit Level

Action and Limit Level for Noise Monitoring

Time Period	Action Level	Limit Level
07:00 – 19:00 hours on normal weekdays	When one documented complaint is received.	75 dB(A)/ 70 dB(A)/ 65 dB(A) ^{Note 1}

Note 1:

- 70dB(A) and 65 dB(A) for schools during normal teaching periods and school examination periods, respectively.
- If works are to be carried out during the restricted hours, the conditions stipulated in the Construction Noise Permit (CNP) issued by the Noise Control Authority have to be followed.

Action and Limit Level for Air Monitoring

Monitoring Location	1-hour TSP Level in $\mu\text{g}/\text{m}^3$		24-hour TSP Level in $\mu\text{g}/\text{m}^3$	
	Action Level	Limit Level	Action Level	Limit Level
CMA1b	320.1	500	176.7	260
CMA2a	323.4	500	169.5	260
CMA3a	311.3	500	171.0	260
CMA4a	312.5	500	171.2	260
CMA5a	332.0	500	181.0	260
MA1e	325.1	500	173.4	260
MA1w	325.1	500	173.4	260



Appendix 4.2

Copies of Calibration Certificates



CERTIFICATE OF CALIBRATION

Certificate No.: 14CA0529 01-01 Page 1 of 2

Item tested

Description:	Sound Level Meter (Type 1)	Microphone
Manufacturer:	B & K	B & K
Type/Model No.:	2236	4188
Serial/Equipment No.:	2100736	2157055
Adaptors used:	-	-

Item submitted by

Customer Name: Lam Geotechnics Limited
Address of Customer: -
Request No.: -
Date of receipt: 29-May-2014

Date of test: 29-May-2014

Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Multi function sound calibrator	B&K 4226	2288444	22-Jun-2014	CIGISMEC
Signal generator	DS 360	33873	09-Apr-2015	CEPREI
Signal generator	DS 360	61227	09-Apr-2015	CEPREI

Ambient conditions

Temperature: 22 ± 1 °C
Relative humidity: 60 ± 10 %
Air pressure: 1000 ± 10 hPa

Test specifications

- 1, The Sound Level Meter has been calibrated in accordance with the requirements as specified in BS 7580: Part 1: 1997 and the lab calibration procedure SMTP004-CA-152.
- 2, The electrical tests were performed using an electrical signal substituted for the microphone which was removed and replaced by an equivalent capacitance within a tolerance of $\pm 20\%$.
- 3, The acoustic calibration was performed using an B&K 4226 sound calibrator and corrections was applied for the difference between the free-field and pressure responsiveness of the Sound Level Meter.


Test results

This is to certify that the Sound Level Meter conforms to BS 7580: Part 1: 1997 for the conditions under which the test was performed.

Details of the performed measurements are presented on page 2 of this certificate.

Actual Measurement data are documented on worksheets.

Approved Signatory:

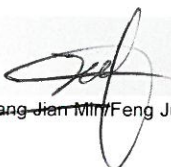
Huang Jian Min / Feng Jun Qi

Date: 30-May-2014

Company Chop:



Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.



CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.: 14CA0529 01-01

Page 2 of 2

1, Electrical Tests

The electrical tests were performed using an equivalent capacitance substituted for the microphone. The results are given in below with test status and the estimated uncertainties. The "Pass" means the result of the test is inside the tolerances stated in the test specifications. The "-" means the result of test is outside these tolerances.

Test:	Subtest:	Status:	Expanded Uncertainty (dB)	Coverage Factor
Self-generated noise	A	Pass	0.3	2.1
	C	Pass	1.0	
	Lin	Pass	2.0	
Linearity range for Leq	At reference range, Step 5 dB at 4 kHz	Pass	0.3	2.2
	Reference SPL on all other ranges	Pass	0.3	
	2 dB below upper limit of each range	Pass	0.3	
	2 dB above lower limit of each range	Pass	0.3	
	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
Linearity range for SPL	A	Pass	0.3	
	C	Pass	0.3	
	Lin	Pass	0.3	
	Single Burst Fast	Pass	0.3	
Time weightings	Single Burst Slow	Pass	0.3	
	Single 100µs rectangular pulse	Pass	0.3	
Peak response	Crest factor of 3	Pass	0.3	
R.M.S. accuracy	Single burst 5 ms at 2000 Hz	Pass	0.3	
Time weighting I	Repeated at frequency of 100 Hz	Pass	0.3	
	1 ms burst duty factor 1/10 ³ at 4kHz	Pass	0.3	
Time averaging	1 ms burst duty factor 1/10 ⁴ at 4kHz	Pass	0.3	
	Single burst 10 ms at 4 kHz	Pass	0.4	
Pulse range	Single burst 10 ms at 4 kHz	Pass	0.4	
Sound exposure level	SPL	Pass	0.3	
Overload indication	Leq	Pass	0.4	

2, Acoustic tests

The complete sound level meter was calibrated on the reference range using a B&K 4226 acoustic calibrator with 1000Hz and SPL 94 dB. The sensitivity of the sound level meter was adjusted. The test result at 125 Hz and 8000 Hz are given in below with test status and the estimated uncertainties.

Test:	Subtest	Status	Expanded Uncertainty (dB)	Coverage Factor
Acoustic response	Weighting A at 125 Hz	Pass	0.3	
	Weighting A at 8000 Hz	Pass	0.5	

3, Response to associated sound calibrator

N/A

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

Calibrated by:

Date:

Fung Chi Yip
29-May-2014

Checked by:

Date:

Lam Tze Wai
30-May-2014

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.



CERTIFICATE OF CALIBRATION

Certificate No.: 14CA0529 01-02

Page: 1 of 2

Item tested

Description: Acoustical Calibrator (Class 1)
Manufacturer: Rion Co., Ltd.
Type/Model No.: NC-73
Serial/Equipment No.: 10465798
Adaptors used: -

Item submitted by

Customer: Lam Geotechnics Limited
Address of Customer: -
Request No.: -
Date of receipt: 29-May-2014

Date of test: 30-May-2014

Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Lab standard microphone	B&K 4180	2412857	13-May-2015	SCL
Preamplifier	B&K 2673	2239857	10-Apr-2015	CEPREI
Measuring amplifier	B&K 2610	2346941	08-Apr-2015	CEPREI
Signal generator	DS 360	61227	09-Apr-2015	CEPREI
Digital multi-meter	34401A	US36087050	17-Dec-2014	CEPREI
Audio analyzer	8903B	GB41300350	07-Apr-2015	CEPREI
Universal counter	53132A	MY40003662	11-Apr-2015	CEPREI

Ambient conditions

Temperature: $22 \pm 1^\circ\text{C}$
Relative humidity: $60 \pm 10\%$
Air pressure: $1000 \pm 10\text{ hPa}$

Test specifications

- The Sound Calibrator has been calibrated in accordance with the requirements as specified in IEC 60942 1997 Annex B and the lab calibration procedure SMTP004-CA-156.
- The calibrator was tested with its axis vertical facing downwards at the specific frequency using insert voltage technique.
- The results are rounded to the nearest 0.01 dB and 0.1 Hz and have not been corrected for variations from a reference pressure of 1013.25 hectoPascals as the maker's information indicates that the instrument is insensitive to pressure changes.

Test results

Details of the performed measurements are presented on **page 2** of this certificate.

Approved Signatory:

Huang Jian Min/Feng Jun Qi

Date: 30-May-2014

Company Chop:

Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.





ORIFICE TRANSFER STANDARD CERTIFICATION WORKSHEET TE-5025A

Date - Jul 14, 2014 Rootsmeter S/N 0438320 Ta (K) - 298
Operator Tisch Orifice I.D. - 0005 Pa (mm) - 749.3

PLATE OR Run #	VOLUME START (m3)	VOLUME STOP (m3)	DIFF VOLUME (m3)	DIFF TIME (min)	METER DIFF Hg (mm)	ORFICE DIFF H2O (in.)
1	NA	NA	1.00	1.3870	3.2	2.00
2	NA	NA	1.00	0.9830	6.4	4.00
3	NA	NA	1.00	0.8760	7.9	5.00
4	NA	NA	1.00	0.8340	8.8	5.50
5	NA	NA	1.00	0.6860	12.7	8.00

DATA TABULATION

Vstd	(x axis) Qstd	(y axis)	Va	(x axis) Qa	(y axis)
0.9817	0.7078	1.4042	0.9957	0.7179	0.8919
0.9775	0.9944	1.9859	0.9915	1.0086	1.2613
0.9754	1.1135	2.2203	0.9894	1.1294	1.4101
0.9743	1.1683	2.3286	0.9882	1.1849	1.4790
0.9692	1.4128	2.8084	0.9830	1.4330	1.7837
Qstd slope (m) = 1.99175			Qa slope (m) = 1.24720		
intercept (b) = -0.00041			intercept (b) = -0.00026		
coefficient (r) = 0.99991			coefficient (r) = 0.99991		
y axis = SQRT[H2O(Pa/760) (298/Ta)]			y axis = SQRT[H2O(Ta/Pa)]		

CALCULATIONS

Vstd = Diff. Vol [(Pa-Diff. Hg)/760] (298/Ta)
Qstd = Vstd/Time

Va = Diff Vol [(Pa-Diff Hg)/Pa]
Qa = Va/Time

For subsequent flow rate calculations:

Qstd = 1/m{ [SQRT(H2O(Pa/760) (298/Ta))] - b}
Qa = 1/m{ [SQRT H2O(Ta/Pa)] - b}



Lam Geotechnics Limited

Calibration Data for High Volume Sampler (TSP Sampler)

Location : CMA1b

Equipment no. : EL452

Calibration Date : 2-Jul-14

Calibration Due Date : 2-Sep-14

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	302	Kelvin	Pressure, P _a
			1009 mmHg

Orifice Transfer Standard Information					
Equipment No.	EL086	Slope, m _c	2.01968	Intercept, b _c	-0.02746
Last Calibration Date	15-Jul-13	$(H \times P_a / 1013.3 \times 298 / T_a)^{1/2}$ $= m_c \times Q_{std} + b_c$			
Next Calibration Date	15-Jul-14				

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC (W(P _a /1013.3x298/T _a) ^{1/2} /35.31) Y-axis
	(up)	(down)	(difference)			
1	6.3	6.3	12.6	1.7557	60	59.4747
2	5.0	5.0	10.0	1.5656	49	48.5710
3	4.0	4.0	8.0	1.4018	40	39.6498
4	2.7	2.7	5.4	1.1541	26	25.7724
5	1.2	1.2	2.4	0.7739	12	11.8949

By Linear Regression of Y on X

Slope, m = 48.8251 Intercept, b = -27.8761

Correlation Coefficient* = 0.9947

Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : _____

Calibrated by : Henry Lau

Date : 2-Jul-14

Checked by : Pauline Wong

Date : 2-Jul-14



Lam Geotechnics Limited

Calibration Data for High Volume Sampler (TSP Sampler)

Location : CMA2a

Equipment no. : EL449

Calibration Date : 2-Jul-14

Calibration Due Date : 2-Sep-14

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	302	Kelvin	Pressure, P _a
			1009 mmHg

Orifice Transfer Standard Information					
Equipment No.	EL086	Slope, m _c	2.01968	Intercept, b _c	-0.02746
Last Calibration Date	15-Jul-13	$\left(H \times P_a / 1013.3 \times 298 / T_a \right)^{1/2}$ $= m_c \times Q_{std} + b_c$			
Next Calibration Date	15-Jul-14				

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.)	Continuous Flow Recorder, W (CFM)	IC (W(P _a /1013.3x298/T _a) ^{1/2} /35.31)
	H (inches of water)					
	(up)	(down)	(difference)	X-axis		Y-axis
1	6.1	6.1	12.2	1.7279	60	59.4747
2	4.7	4.7	9.4	1.5183	54	53.5273
3	3.7	3.7	7.4	1.3487	48	47.5798
4	2.3	2.3	4.6	1.0662	40	39.6498
5	1.4	1.4	2.8	0.8349	30	29.7374

By Linear Regression of Y on X

Slope, m = 32.7993 Intercept, b = 3.3810

Correlation Coefficient* = 0.9971

Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : _____

Calibrated by : Henry Lau

Date : 2-Jul-14

Checked by : Pauline Wong

Date : 2-Jul-14



Lam Geotechnics Limited

Calibration Data for High Volume Sampler (TSP Sampler)

Location : CMA3a

Equipment no. : EL333

Calibration Date : 21-Jun-14

Calibration Due Date : 21-Aug-14

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	301	Kelvin	Pressure, P _a
			1003 mmHg

Orifice Transfer Standard Information					
Equipment No.	EL086	Slope, m _c	2.01968	Intercept, b _c	-0.02746
Last Calibration Date	15-Jul-13	$\left(H \times P_a / 1013.3 \times 298 / T_a \right)^{1/2}$ $= m_c \times Q_{std} + b_c$			
Next Calibration Date	15-Jul-14				

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC (W(P _a /1013.3x298/T _a) ^{1/2} /35.31) Y-axis
	(up)	(down)	(difference)			
1	5.5	5.5	11.0	1.6392	61	60.3860
2	4.4	4.4	8.8	1.4676	52	51.4766
3	3.7	3.7	7.4	1.3469	43	42.5672
4	2.4	2.4	4.8	1.0874	26	25.7383
5	1.5	1.5	3.0	0.8626	14	13.8591

By Linear Regression of Y on X

Slope, m = 61.3367 Intercept, b = -39.7515

Correlation Coefficient* = 0.9987

Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : _____

Calibrated by : Felix Li

Date : 21-Jun-14

Checked by : Pauline Wong

Date : 21-Jun-14



Lam Geotechnics Limited

Calibration Data for High Volume Sampler (TSP Sampler)

Location : CMA3a

Equipment no. : EL333

Calibration Date : 22-Aug-14

Calibration Due Date : 22-Oct-14

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	303	Kelvin	Pressure, P _a
			1009 mmHg

Orifice Transfer Standard Information					
Equipment No.	EL086	Slope, m _c	1.99175	Intercept, b _c	-0.00041
Last Calibration Date	14-Jul-14	$\left(H \times P_a / 1013.3 \times 298 / T_a \right)^{1/2}$ $= m_c \times Q_{std} + b_c$			
Next Calibration Date	14-Jul-15				

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC (W(P _a /1013.3x298/T _a) ^{1/2} /35.31) Y-axis
	(up)	(down)	(difference)			
1	5.6	5.6	11.2	1.6630	62	61.3557
2	4.3	4.3	8.6	1.4573	51	50.4700
3	3.8	3.8	7.6	1.3699	44	43.5428
4	2.5	2.5	5.0	1.1112	27	26.7194
5	1.4	1.4	2.8	0.8316	15	14.8441

By Linear Regression of Y on X

Slope, m = 57.5058 Intercept, b = -34.6006

Correlation Coefficient* = 0.9959

Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : _____

Calibrated by : Felix Li

Date : 22-Aug-14

Checked by : Pauline Wong

Date : 22-Aug-14



Lam Geotechnics Limited

Calibration Data for High Volume Sampler (TSP Sampler)

Location : CMA4a Calibration Date : 2-Jul-14
 Equipment no. : EL390 Calibration Due Date : 2-Sep-14

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	302	Kelvin	Pressure, P _a
			1009 mmHg

Orifice Transfer Standard Information					
Equipment No.	EL086	Slope, m _c	2.01968	Intercept, b _c	-0.02746
Last Calibration Date	15-Jul-13	$\left(H \times P_a / 1013.3 \times 298 / T_a \right)^{1/2}$ $= m_c \times Q_{std} + b_c$			
Next Calibration Date	15-Jul-14				

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std}	Continuous Flow	IC
	H (inches of water)			(m ³ / min.)	Recorder, W	(W(P _a /1013.3x298/T _a) ^{1/2} /35.31)
	(up)	(down)	(difference)	X-axis	(CFM)	Y-axis
1	6.2	6.2	12.4	1.7419	60	59.4747
2	5.3	5.3	10.6	1.6115	52	51.5448
3	4.1	4.1	8.2	1.4190	43	42.6236
4	2.7	2.7	5.4	1.1541	24	23.7899
5	1.4	1.4	2.8	0.8349	12	11.8949
By Linear Regression of Y on X						
Slope, m		=	53.7477		Intercept, b	= -34.8156
Correlation Coefficient*		=	0.9945			
Calibration Accepted		=	Yes/No**			

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : _____

Calibrated by : Felix Li Checked by : Pauline Wong
 Date : 2-Jul-14 Date : 2-Jul-14



Lam Geotechnics Limited

Calibration Data for High Volume Sampler (TSP Sampler)

Location : CMA5a

Equipment no. : EL380

Calibration Date : 21-Jun-14

Calibration Due Date : 21-Aug-14

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	301	Kelvin	Pressure, P _a
			1003 mmHg

Orifice Transfer Standard Information					
Equipment No.	EL086	Slope, m _c	2.01968	Intercept, b _c	-0.02746
Last Calibration Date	15-Jul-13	$\left(H \times P_a / 1013.3 \times 298 / T_a \right)^{1/2}$ $= m_c \times Q_{std} + b_c$			
Next Calibration Date	15-Jul-14				

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC (W(P _a /1013.3x298/T _a) ^{1/2} /35.31) Y-axis
	(up)	(down)	(difference)			
1	5.6	5.6	11.2	1.6539	61	60.3860
2	4.8	4.8	9.6	1.5323	52	51.4766
3	3.5	3.5	7.0	1.3104	42	41.5772
4	2.3	2.3	4.6	1.0648	26	25.7383
5	1.2	1.2	2.4	0.7729	13	12.8691

By Linear Regression of Y on X

Slope, m = 53.8279 Intercept, b = -29.7835

Correlation Coefficient* = 0.9974

Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : _____

Calibrated by : Felix Li

Date : 21-Jun-14

Checked by : Pauline Wong

Date : 21-Jun-14



Lam Geotechnics Limited

Calibration Data for High Volume Sampler (TSP Sampler)

Location : CMA5a

Equipment no. : EL380

Calibration Date : 22-Aug-14

Calibration Due Date : 22-Oct-14

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	303	Kelvin	Pressure, P _a
			1009 mmHg

Orifice Transfer Standard Information					
Equipment No.	EL086	Slope, m _c	1.99175	Intercept, b _c	-0.00041
Last Calibration Date	14-Jul-14	$\left(H \times P_a / 1013.3 \times 298 / T_a \right)^{1/2}$ $= m_c \times Q_{std} + b_c$			
Next Calibration Date	14-Jul-15				

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC (W(P _a /1013.3x298/T _a) ^{1/2} /35.31) Y-axis
	(up)	(down)	(difference)			
1	5.8	5.8	11.6	1.6924	60	59.3765
2	4.7	4.7	9.4	1.5235	54	53.4389
3	3.6	3.6	7.2	1.3334	41	40.5739
4	2.4	2.4	4.8	1.0888	28	27.7090
5	1.3	1.3	2.6	0.8014	15	14.8441

By Linear Regression of Y on X

Slope, m = 51.6826 Intercept, b = -27.3733

Correlation Coefficient* = 0.9971

Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : _____

Calibrated by : Felix Li

Date : 22-Aug-14

Checked by : Pauline Wong

Date : 22-Aug-14



Lam Geotechnics Limited

Calibration Data for High Volume Sampler (TSP Sampler)

Location : MA1e

Equipment no. : EL455

Calibration Date : 21-Jun-14

Calibration Due Date : 21-Aug-14

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	301	Kelvin	Pressure, P _a
			1003 mmHg

Orifice Transfer Standard Information					
Equipment No.	EL086	Slope, m _c	2.01968	Intercept, b _c	-0.02746
Last Calibration Date	15-Jul-13	$\left(H \times P_a / 1013.3 \times 298 / T_a \right)^{1/2}$ $= m_c \times Q_{std} + b_c$			
Next Calibration Date	15-Jul-14				

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC (W(P _a /1013.3x298/T _a) ^{1/2} /35.31) Y-axis
	(up)	(down)	(difference)			
1	6.5	6.5	13.0	1.7808	57	56.4262
2	4.2	4.2	8.4	1.4342	48	47.5168
3	3.3	3.3	6.6	1.2728	42	41.5772
4	2.1	2.1	4.2	1.0181	32	31.6779
5	1.4	1.4	2.8	0.8338	28	27.7182

By Linear Regression of Y on X

Slope, m = 31.5589 Intercept, b = 0.9687

Correlation Coefficient* = 0.9958

Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : _____

Calibrated by : Felix Li

Date : 21-Jun-14

Checked by : Pauline Wong

Date : 21-Jun-14



Lam Geotechnics Limited

Calibration Data for High Volume Sampler (TSP Sampler)

Location : MA1e

Equipment no. : EL455

Calibration Date : 22-Aug-14

Calibration Due Date : 22-Oct-14

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	303	Kelvin	Pressure, P _a
			1009 mmHg

Orifice Transfer Standard Information					
Equipment No.	EL086	Slope, m _c	1.99175	Intercept, b _c	-0.00041
Last Calibration Date	14-Jul-14	$\left(H \times P_a / 1013.3 \times 298 / T_a \right)^{1/2}$ $= m_c \times Q_{std} + b_c$			
Next Calibration Date	14-Jul-15				

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC (W(P _a /1013.3x298/T _a) ^{1/2} /35.31) Y-axis
	(up)	(down)	(difference)			
1	6.4	6.4	12.8	1.7778	59	58.3869
2	4.0	4.0	8.0	1.4055	46	45.5220
3	3.5	3.5	7.0	1.3148	43	42.5532
4	2.3	2.3	4.6	1.0658	33	32.6571
5	1.6	1.6	3.2	0.8890	27	26.7194

By Linear Regression of Y on X

Slope, m = 35.9395 Intercept, b = -5.2153

Correlation Coefficient* = 0.9995

Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : _____

Calibrated by : Felix Li

Date : 22-Aug-14

Checked by : Pauline Wong

Date : 22-Aug-14



Lam Geotechnics Limited

Calibration Data for High Volume Sampler (TSP Sampler)

Location : MA1w

Equipment no. : EL080

Calibration Date : 21-Jun-14

Calibration Due Date : 21-Aug-14

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	301	Kelvin	Pressure, P _a
			1003 mmHg

Orifice Transfer Standard Information					
Equipment No.	EL086	Slope, m _c	2.01968	Intercept, b _c	-0.02746
Last Calibration Date	15-Jul-13	$\left(H \times P_a / 1013.3 \times 298 / T_a \right)^{1/2}$ $= m_c \times Q_{std} + b_c$			
Next Calibration Date	15-Jul-14				

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC (W(P _a /1013.3x298/T _a) ^{1/2} /35.31) Y-axis
	(up)	(down)	(difference)			
1	6.3	6.3	12.6	1.7534	53	52.4665
2	5.1	5.1	10.2	1.5790	48	47.5168
3	4.2	4.2	8.4	1.4342	40	39.5974
4	2.6	2.6	5.2	1.1313	30	29.6980
5	1.8	1.8	3.6	0.9436	24	23.7584

By Linear Regression of Y on X

Slope, m = 36.2029 Intercept, b = -10.9288

Correlation Coefficient* = 0.9965

Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : _____

Calibrated by : Felix Li

Date : 21-Jun-14

Checked by : Pauline Wong

Date : 21-Jun-14



Lam Geotechnics Limited

Calibration Data for High Volume Sampler (TSP Sampler)

Location : MA1w

Equipment no. : EL080

Calibration Date : 22-Aug-14

Calibration Due Date : 22-Oct-14

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	303	Kelvin	Pressure, P _a
			1009 mmHg

Orifice Transfer Standard Information					
Equipment No.	EL086	Slope, m _c	1.99175	Intercept, b _c	-0.00041
Last Calibration Date	14-Jul-14	$(H \times P_a / 1013.3 \times 298 / T_a)^{1/2}$ $= m_c \times Q_{std} + b_c$			
Next Calibration Date	14-Jul-15				

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC (W(P _a /1013.3x298/T _a) ^{1/2} /35.31) Y-axis
	(up)	(down)	(difference)			
1	6.5	6.5	13.0	1.7916	54	53.4389
2	5.3	5.3	10.6	1.6178	47	46.5116
3	4.4	4.4	8.8	1.4741	42	41.5636
4	2.6	2.6	5.2	1.1332	32	31.6675
5	2.1	2.1	4.2	1.0185	29	28.6986

By Linear Regression of Y on X

Slope, m = 31.5000 Intercept, b = -3.9461

Correlation Coefficient* = 0.9972

Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : _____

Calibrated by : Felix Li

Date : 22-Aug-14

Checked by : Pauline Wong

Date : 22-Aug-14



Appendix 5.1

Monitoring Schedules for Reporting Month and Coming Reporting Month

**Wan Chai Development Phase II and Central-Wan Chai Bypass
Sampling, Field Measurement and Testing Works (Stage 2)**

**Environmental Monitoring Schedule
August 2014**

27-Jul	28-Jul	29-Jul	30-Jul	31-Jul	1-Aug	2-Aug
	24hr TSP Noise (Daytime) (M1a, M2b, M3a, M4b, M5b M6, M8)	1hr TSP Noise (Daytime) (M7e, M7w)				24hr TSP
3-Aug	4-Aug	5-Aug	6-Aug	7-Aug	8-Aug	9-Aug
	1hr TSP Noise (Daytime) (M1a, M7e, M7w, M8)	Noise (Daytime) (M2b, M3a, M4b, M5b, M6)		24hr TSP		1hr TSP
10-Aug	11-Aug	12-Aug	13-Aug	14-Aug	15-Aug	16-Aug
	Noise (Daytime) (M3a, M4b, M5b, M6, M7e, M7w, M8)	Noise (Daytime) (M1a, M2b)		24hr TSP	24hr TSP (CMA1b and CMA5a) 1hr TSP	
17-Aug	18-Aug	19-Aug	20-Aug	21-Aug	22-Aug	23-Aug
	Noise (Daytime) (M1a, M2b, M3a, M4b, M5b, M6 M7e, M7w)	Noise (Daytime) (M8)	24hr TSP	24hr TSP (CMA1b and CMA5a) 1hr TSP		
24-Aug	25-Aug	26-Aug	27-Aug			
	Noise (Daytime) (M1a, M2b, M3a, M4b, M5b, M6 M7e, M7w)	24hr TSP Noise (Daytime) (M8)	1hr TSP 24hr TSP (MA1e)			

**Wan Chai Development Phase II and Central-Wan Chai Bypass
Sampling, Field Measurement and Testing Works (Stage 2)**

**Tentative Environmental Monitoring Schedule
September 2014**

				28-Aug	29-Aug	30-Aug
31-Aug	1-Sep	2-Sep	3-Sep	4-Sep	5-Sep	6-Sep
24hr TSP Noise (Daytime)		1hr TSP Noise (Daytime)			24hr TSP	
7-Sep	8-Sep	9-Sep	10-Sep	11-Sep	12-Sep	13-Sep
1hr TSP			Noise (Daytime)	Noise (Daytime)	24hr TSP	1hr TSP
14-Sep	15-Sep	16-Sep	17-Sep	18-Sep	19-Sep	20-Sep
Noise (Daytime)		Noise (Daytime)		24hr TSP	1hr TSP	
21-Sep	22-Sep	23-Sep	24-Sep	25-Sep	26-Sep	27-Sep
Noise (Daytime)	Noise (Daytime)		24hr TSP	1hr TSP		



Appendix 5.2

Noise Monitoring Results and Graphical Presentations



Noise Monitoring Result

Day Time (0700 - 1900hrs on normal weekdays)

Location: M1a - Harbour Road Sports Centre

Date	Time	Weather	Measurement Noise Level			Baseline Level	Construction Noise Level	Limit Level
			Leq	L10	L90	Leq	Leq	Leq
			Unit: dB(A), (30-min)					
28/07/14	9:25	Fine	74.6	77.0	70.0	72	71	75
04/08/14	16:42	Fine	74.6	76.5	71.5	72	71	75
12/08/14	9:45	Fine	74.3	76.5	70.0	72	70	75
18/08/14	9:10	Fine	74.2	76.5	70.5	72	70	75
25/08/14	9:29	Fine	76.7	80.0	72.0	72	75	75

Location: M2b - Noon-day gun area

Date	Time	Weather	Measurement Noise Level			Baseline Level	Construction Noise Level	Limit Level
			Leq	L10	L90	Leq	Leq	Leq
			Unit: dB(A), (30-min)					
28/07/14	10:10	Fine	72.8	75.0	69.0	68	71	75
05/08/14	9:28	Fine	78.1	80.0	74.0	68	78	75
12/08/14	10:35	Fine	73.0	74.5	69.0	68	72	75
18/08/14	10:32	Fine	72.1	74.0	69.5	68	70	75
25/08/14	10:36	Fine	72.7	73.5	68.5	68	71	75

Location: M3a - Tung Lo Wan Fire Station

Date	Time	Weather	Measurement Noise Level			Baseline Level	Construction Noise Level	Limit Level
			Leq	L10	L90	Leq	Leq	Leq
			Unit: dB(A), (30-min)					
28/07/14	10:54	Fine	66.4	67.5	64.5	69	66	75
05/08/14	10:56	Cloudy	67.2	68.5	65.5	69	67	75
11/08/14	15:47	Fine	66.5	68.0	64.5	69	67	75
18/08/14	11:18	Fine	67.0	68.0	65.5	69	67	75
25/08/14	14:41	Fine	64.9	66.0	63.0	69	65	75

Location: M4b - Victoria Centre

Date	Time	Weather	Measurement Noise Level			Baseline Noise Level	Construction Noise Level	Limit Level
			Leq	L10	L90	Leq	Leq	Leq
			Unit: dB(A), (30min)					
28/07/14	13:00	Fine	67.5	68.5	66.0	67	54	75
05/08/14	13:00	Fine	69.0	70.0	66.5	67	64	75
11/08/14	15:05	Fine	70.1	72.0	67.0	67	67	75
18/08/14	13:00	Fine	68.8	70.0	67.0	67	63	75
25/08/14	11:23	Fine	67.8	69.0	66.0	67	58	75

Location: M5b - City Garden

Date	Time	Weather	Measurement Noise Level			Baseline Level	Construction Noise Level	Limit Level
			Leq	L10	L90	Leq	Leq	Leq
			Unit: dB(A), (30min)					
28/07/14	13:55	Fine	69.7	70.5	68.0	68	65	75
05/08/14	13:52	Fine	73.5	75.0	69.5	68	72	75
11/08/14	14:21	Fine	71.9	74.0	68.5	68	70	75
18/08/14	13:58	Fine	70.8	71.5	69.5	68	68	75
25/08/14	13:04	Fine	71.7	73.5	68.0	68	69	75

Location: M6 - HK Baptist Church Henrietta Secondary School

Date	Time	Weather	Measurement Noise Level			Baseline Level	Construction Noise Level	Limit Level
			Leq	L10	L90	Leq	Leq	Leq
			Unit: dB(A), (30-min)					
28/07/14	15:11	Fine	73.7	75.0	72.0	71	71	70
05/08/14	14:32	Fine	73.2	74.0	71.5	71	70	70
11/08/14	13:38	Fine	73.3	74.5	71.5	71	70	70
18/08/14	14:45	Fine	71.2	73.0	68.0	71	62	70
25/08/14	13:45	Fine	73.4	74.5	71.5	71	70	70



Noise Monitoring Result

Day Time (0700 - 1900hrs on normal weekdays)

Location: M7e - International Finance Centre (Eastern End of Podium) (Reference Station)

Date	Time	Weather	Measurement Noise Level			Baseline Level	Construction Noise Level	Limit Level
			Leq	L10	L90	Leq	Leq	Leq
			Unit: dB(A), (30-min)					
29/07/14	14:54	Fine	68.5	71.0	64.5	67	64	N/A
04/08/14	14:35	Fine	68.0	69.5	65.0	67	62	N/A
11/08/14	10:15	Fine	66.6	68.0	64.0	67	67	N/A
18/08/14	15:44	Fine	67.9	69.5	65.0	67	61	N/A
25/08/14	15:46	Fine	66.9	68.5	63.5	67	50	N/A

Location: M7w - International Finance Centre (Western End of Podium)


Date	Time	Weather	Measurement Noise Level			Baseline Level	Construction Noise Level	Limit Level
			Leq	L10	L90	Leq	Leq	Leq
			Unit: dB(A), (30-min)					
29/07/14	15:32	Fine	67.7	71.5	62.0	69	68	75
04/08/14	15:42	Fine	67.8	69.5	64.5	69	68	75
11/08/14	10:50	Fine	66.1	68.0	63.0	69	66	75
18/08/14	16:20	Fine	66.6	68.0	63.5	69	67	75
25/08/14	14:23	Fine	65.9	67.5	63.0	69	66	75

Location: M8 - City Hall

Date	Time	Weather	Measurement Noise Level			Baseline Level	Construction Noise Level	Limit Level
			Leq	L10	L90	Leq	Leq	Leq
			Unit: dB(A), (30-min)					
28/07/14	16:42	Fine	59.6	61.5	56.0	64	60	70
04/08/14	13:40	Fine	59.5	61.5	57.0	64	60	70
11/08/14	11:25	Fine	61.5	62.0	55.5	64	62	70
19/08/14	10:20	Fine	63.8	65.0	56.5	64	64	70
26/08/14	10:25	Fine	60.6	62.0	57.5	64	61	70


Graphic Presentation of Noise Monitoring Result

Day Time (0700 - 1900hrs on normal weekdays)

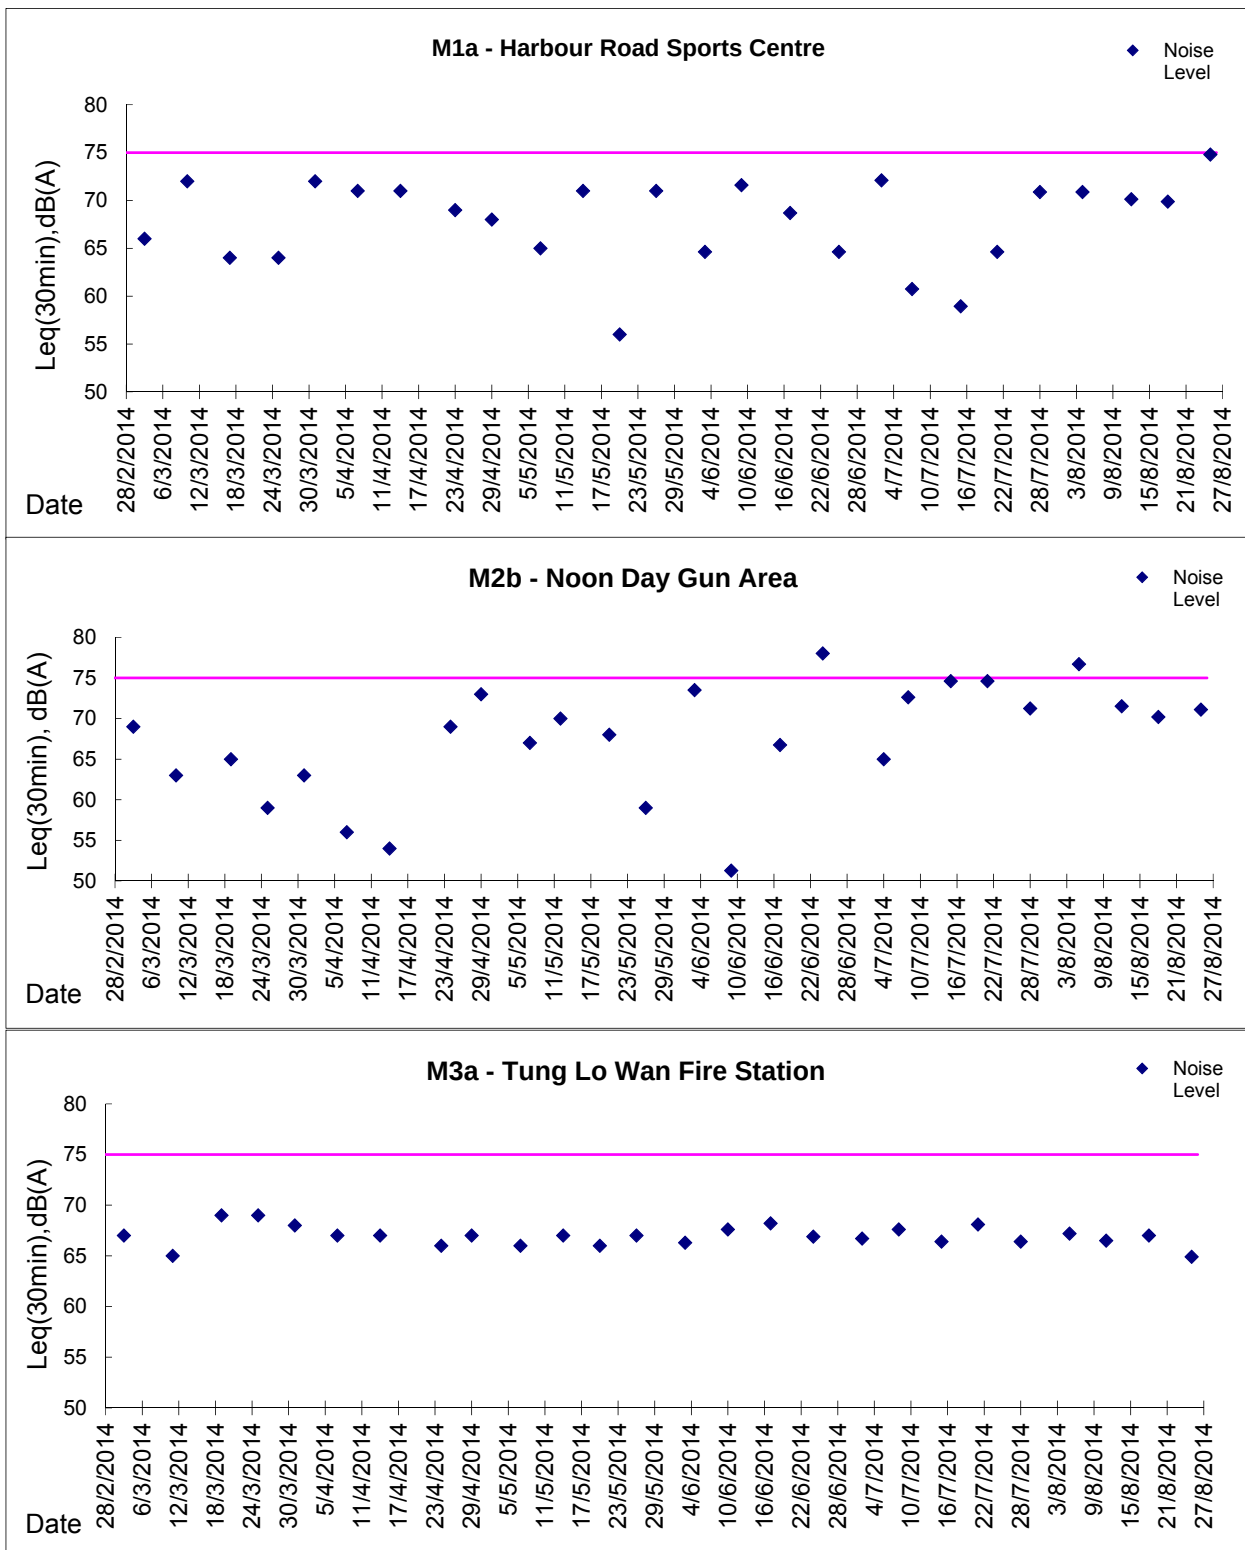




Graphic Presentation of Noise Monitoring Result

Day Time (0700 - 1900hrs on normal weekdays)

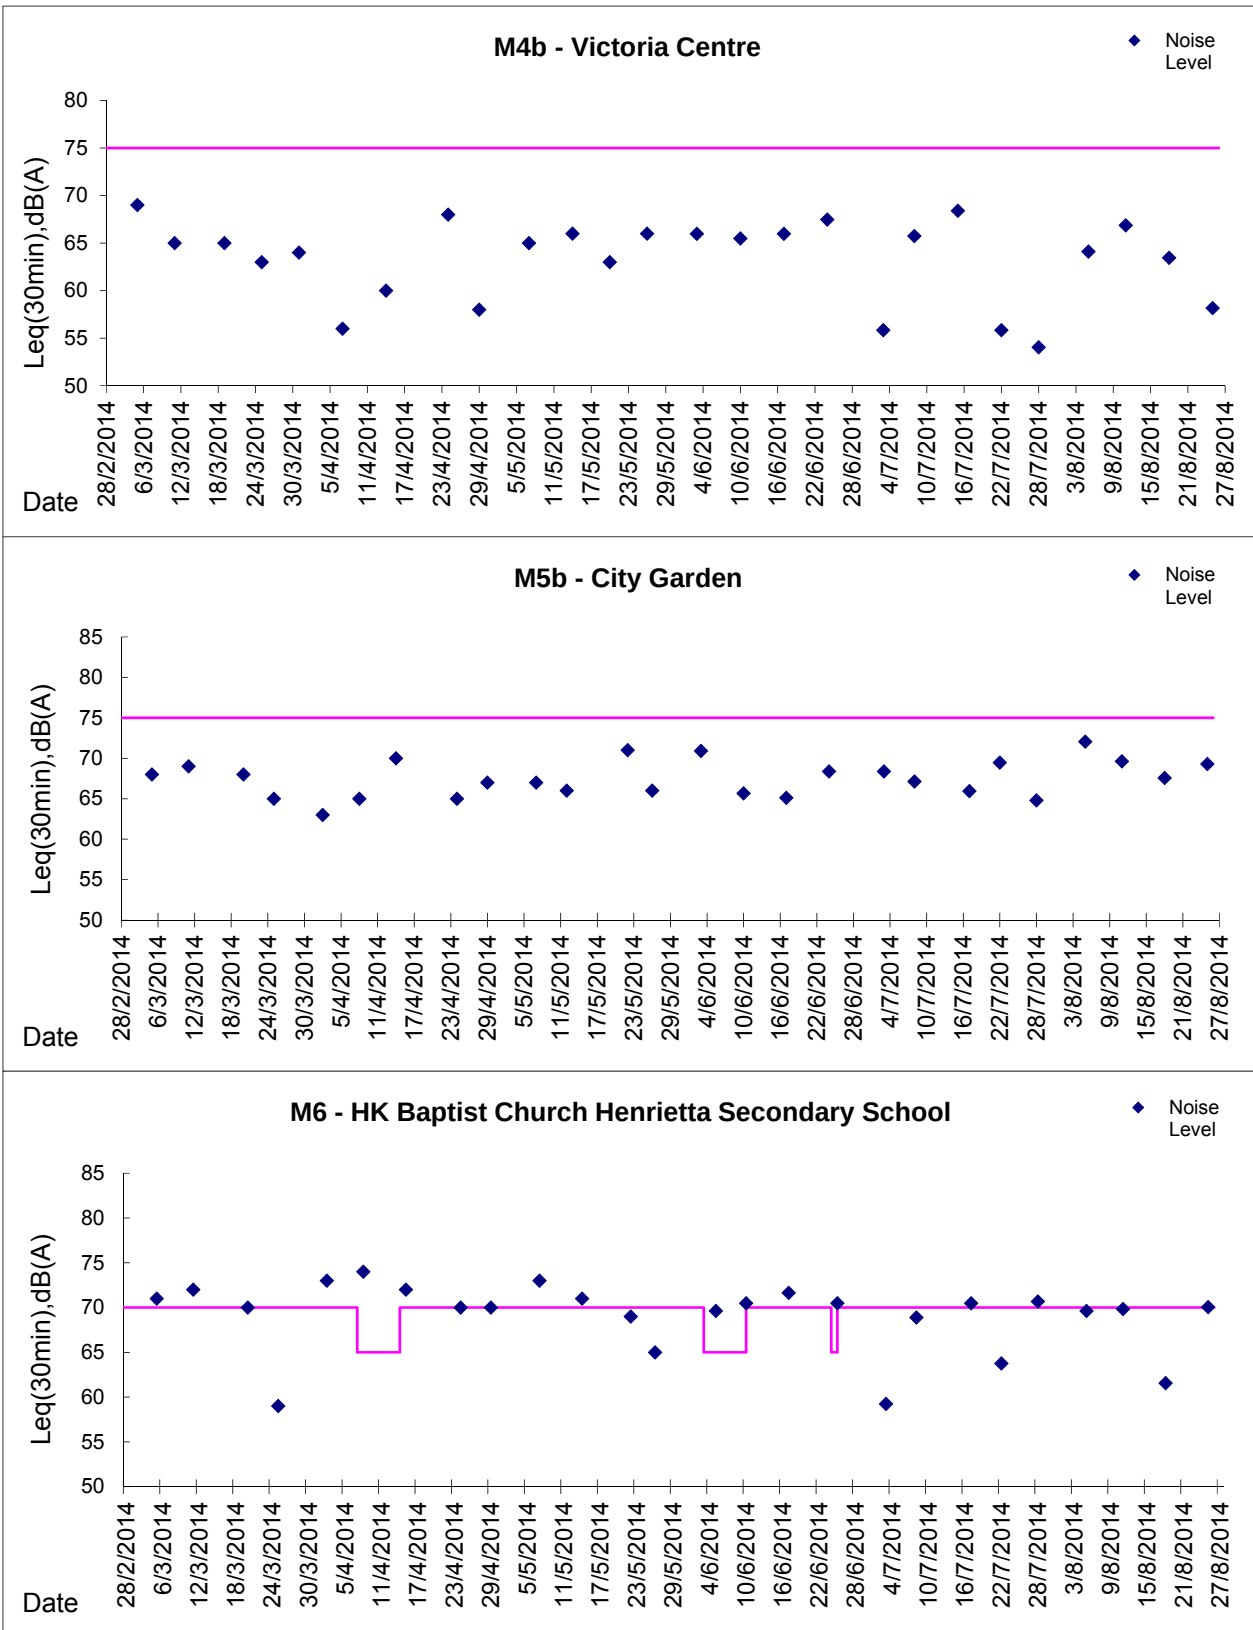

Graphic Presentation of Noise Monitoring Result

Day Time (0700 - 1900hrs on normal weekdays)

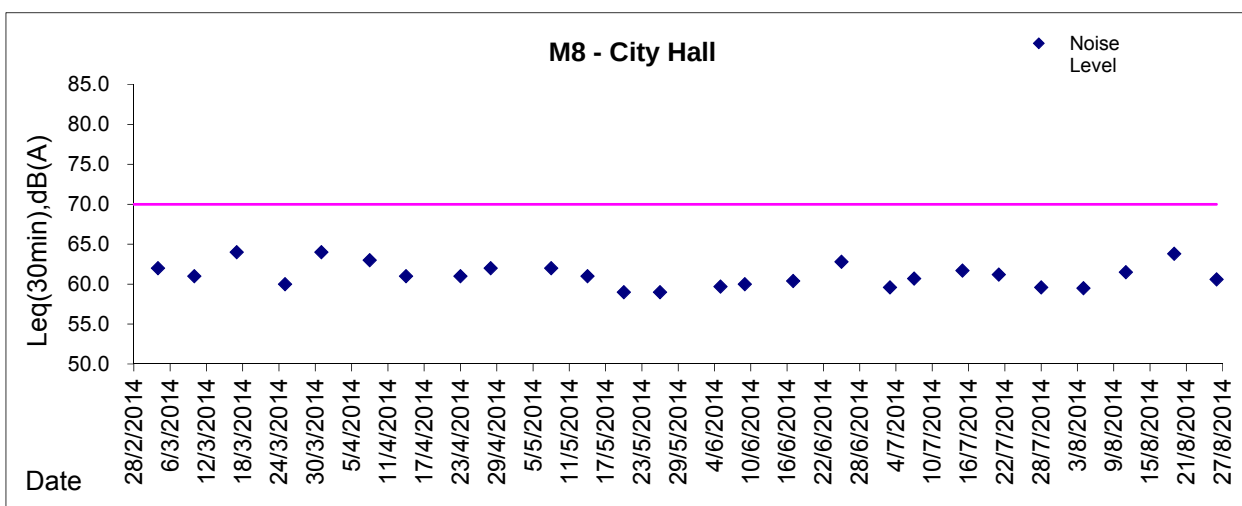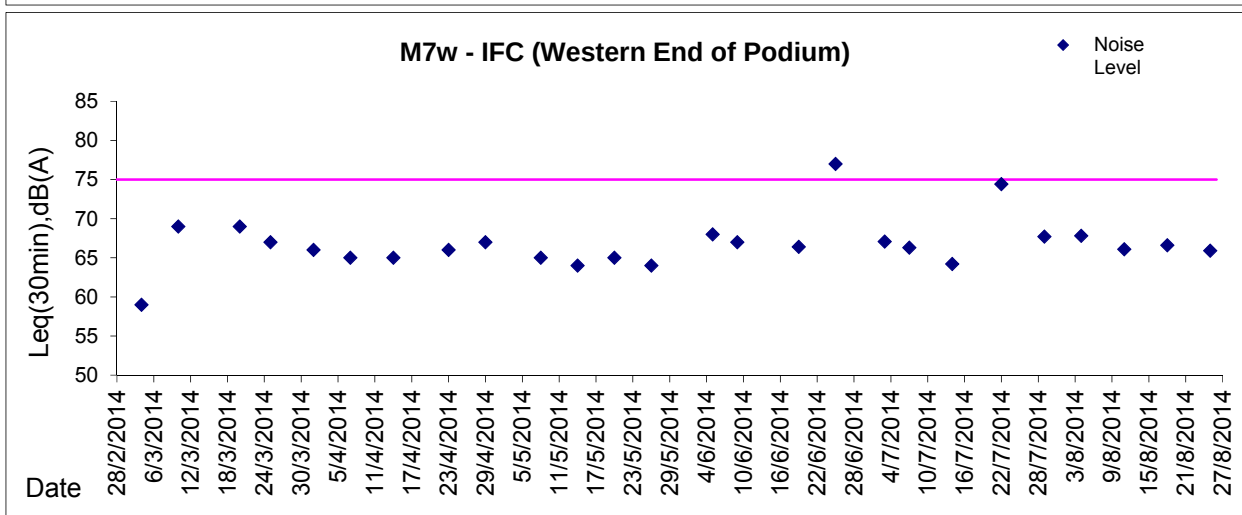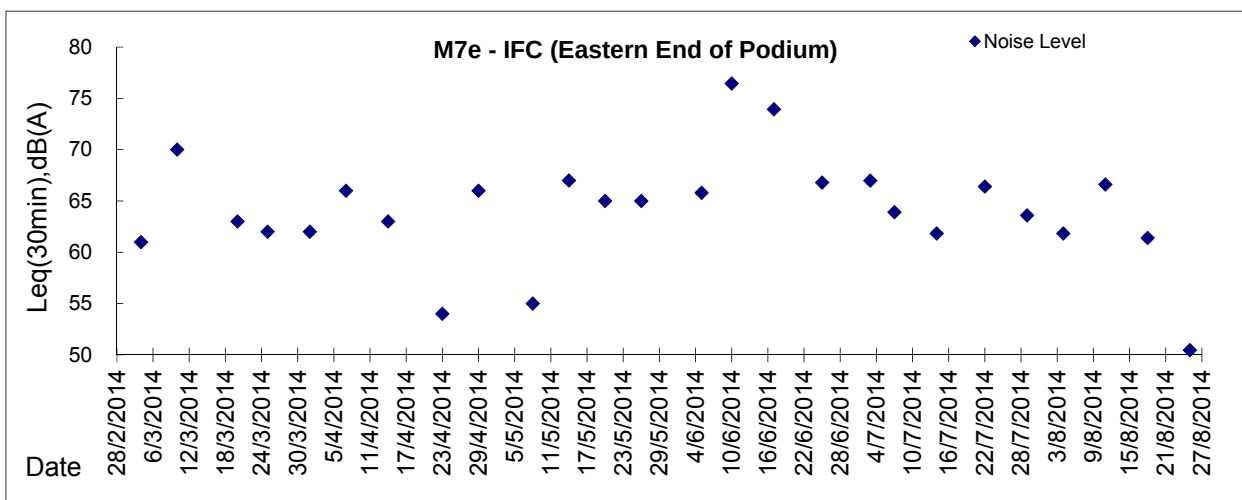

* Remark: M7e - IFC (Eastern End of Podium) is a reference monitoring station



Appendix 5.3

Air Quality Monitoring Results and Graphical Presentations



Location: CMA1b - Oil Street Site Office

Report on 24-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 176.7

Limit Level ($\mu\text{g}/\text{m}^3$) - 260

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
28-Jul-14	8:00	Fine	009368	2.8478	2.9624	4920.88	4944.88	24.00	1.35	1.35	1.35	1942	59
2-Aug-14	8:00	Rainy	009371	2.8690	3.0371	4947.88	4971.88	24.00	1.41	1.41	1.41	2025	83
8-Aug-14	8:00	Fine	009330	2.8666	2.9724	4974.88	4998.88	24.00	1.41	1.41	1.41	2025	52
15-Aug-14	13:00	Fine	009712	2.8483	2.9610	5004.88	5028.88	24.00	1.41	1.41	1.41	2031	56
21-Aug-14	13:00	Rainy	009452	2.8628	2.9734	15031.89	15055.89	24.00	1.41	1.41	1.41	2033	54
26-Aug-14	8:00	Fine	009701	2.8460	3.0276	15055.89	15079.89	24.00	1.37	1.37	1.37	1974	92

Remarks: Due to interruption of electricity, the 24hr TSP was rescheduled from 14 August 2014 and 20 August 2014 to 15 August 2014 and 21 August 2014 respectively.

Report on 1-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 320.1

Limit Level ($\mu\text{g}/\text{m}^3$) - 500

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
29-Jul-14	8:24	Fine	009426	2.8773	2.8876	4944.88	4945.88	1.00	1.41	1.41	1.41	84	122
29-Jul-14	9:32	Fine	009427	2.8633	2.8700	4945.88	4946.88	1.00	1.41	1.41	1.41	84	79
29-Jul-14	10:40	Fine	009428	2.8608	2.8678	4946.88	4947.88	1.00	1.41	1.41	1.41	84	83
4-Aug-14	9:45	Rainy	009359	2.8532	2.8622	4971.88	4972.88	1.00	1.41	1.41	1.41	84	107
4-Aug-14	10:52	Rainy	009326	2.8660	2.8736	4972.88	4973.88	1.00	1.41	1.41	1.41	84	90
4-Aug-14	13:00	Rainy	009329	2.8683	2.8746	4973.88	4974.88	1.00	1.41	1.41	1.41	84	75
9-Aug-14	8:09	Fine	009704	2.8400	2.8467	4998.88	4999.88	1.00	1.41	1.41	1.41	84	79
9-Aug-14	9:18	Fine	009706	2.8416	2.8463	4999.88	5000.88	1.00	1.41	1.41	1.41	84	56
9-Aug-14	10:27	Fine	009708	2.8445	2.8525	5000.88	5001.88	1.00	1.41	1.41	1.41	84	95
15-Aug-14	8:30	Fine	009527	2.8236	2.8291	5001.88	5002.88	1.00	1.37	1.39	1.38	83	66
15-Aug-14	9:35	Fine	009529	2.8120	2.8189	5002.88	5003.88	1.00	1.41	1.41	1.41	85	82
15-Aug-14	10:40	Fine	009531	2.8293	2.8361	5003.88	5004.88	1.00	1.41	1.41	1.41	85	80
21-Aug-14	8:40	Rainy	009448	2.8565	2.8640	15028.89	15029.89	1.00	1.41	1.41	1.41	85	88
21-Aug-14	9:45	Rainy	009450	2.8595	2.8676	15029.89	15030.89	1.00	1.41	1.41	1.41	85	96
21-Aug-14	10:50	Rainy	009455	2.8760	2.8832	15030.89	15031.89	1.00	1.41	1.41	1.41	85	85
27-Aug-14	8:18	Cloudy	009702	2.8538	2.8697	15079.89	15080.89	1.00	1.35	1.35	1.35	81	196
27-Aug-14	9:25	Cloudy	009683	2.8543	2.8707	15080.89	15081.89	1.00	1.35	1.35	1.35	81	202
27-Aug-14	10:45	Cloudy	009685	2.8526	2.8710	15081.89	15082.89	1.00	1.35	1.35	1.35	81	227

Location: CMA2a - Causeway Bay Community Centre

Report on 24-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 169.5

Limit Level ($\mu\text{g}/\text{m}^3$) - 260

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
28-Jul-14	8:00	Fine	009369	2.8503	2.9700	14631.38	14655.38	24.00	1.03	1.03	1.03	1477	81
2-Aug-14	8:00	Rainy	009372	2.8679	2.9890	14658.38	14682.38	24.00	1.14	1.14	1.14	1642	74
8-Aug-14	8:00	Fine	009331	2.8690	2.9600	14685.38	14709.38	24.00	1.14	1.00	1.07	1538	59
14-Aug-14	8:00	Rainy	009711	2.8440	2.9267	14712.38	14736.38	24.00	1.15	1.06	1.10	1587	52
20-Aug-14	8:00	Rainy	009532	2.8201	2.8963	14739.38	14763.38	24.00	1.07	1.03	1.05	1512	50
26-Aug-14	8:00	Fine	009453	2.8585	2.9323	14766.38	14790.38	24.00	1.06	1.06	1.06	1524	48

Report on 1-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 323.4

Limit Level ($\mu\text{g}/\text{m}^3$) - 500

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
29-Jul-14	8:07	Fine	009429	2.8661	2.8730	14655.38	14656.38	1.00	1.00	1.00	1.00	60	115
29-Jul-14	9:16	Fine	009430	2.8592	2.8662	14656.38	14657.38	1.00	1.00	1.00	1.00	60	117
29-Jul-14	10:30	Fine	009431	2.8580	2.8615	14657.38	14658.38	1.00	1.00	1.00	1.00	60	59
4-Aug-14	10:00	Rainy	009360	2.8499	2.8615	14682.38	14683.38	1.00	1.14	1.14	1.14	68	170
4-Aug-14	11:08	Rainy	009327	2.8764	2.8833	14683.38	14684.38	1.00	1.05	1.00	1.02	61	112
4-Aug-14	13:00	Rainy	009328	2.8589	2.8662	14684.38	14685.38	1.00	1.14	1.14	1.14	68	107
9-Aug-14	8:07	Fine	009705	2.8305	2.8350	14709.38	14710.38	1.00	1.00	1.00	1.00	60	75
9-Aug-14	9:16	Fine	009707	2.8582	2.8644	14710.38	14711.38	1.00	1.00	1.00	1.00	60	104
9-Aug-14	10:25	Fine	009709	2.8372	2.8445	14711.38	14712.38	1.00	1.00	1.00	1.00	60	122
15-Aug-14	8:10	Fine	009526	2.8125	2.8188	14736.38	14737.38	1.00	1.00	1.00	1.00	60	105
15-Aug-14	9:20	Fine	009528	2.8167	2.8226	14737.38	14738.38	1.00	1.00	1.00	1.00	60	98
15-Aug-14	10:25	Fine	009530	2.8269	2.8320	14738.38	14739.38	1.00	1.06	1.06	1.06	64	80
21-Aug-14	8:20	Rainy	009796	2.8345	2.8380	14763.38	14764.38	1.00	1.01	1.01	1.01	60	58
21-Aug-14	9:30	Rainy	009449	2.8538	2.8622	14764.38	14765.38	1.00	1.01	1.01	1.01	60	139
21-Aug-14	10:35	Rainy	009451	2.8765	2.8826	14765.38	14766.38	1.00	1.01	1.01	1.01	60	101
27-Aug-14	8:06	Cloudy	009681	2.8500	2.8542	14790.38	14791.38	1.00	1.00	1.00	1.00	60	70
27-Aug-14	9:09	Cloudy	009682	2.8567	2.8659	14791.38	14792.38	1.00	1.15	1.15	1.15	69	134
27-Aug-14	10:15	Cloudy	009684	2.8483	2.8568	14792.38	14793.38	1.00	1.03	1.03	1.03	62	138



Location: CMA3a - CWB PRE Site Office Area

Report on 24-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 171

Limit Level ($\mu\text{g}/\text{m}^3$) - 260

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
28-Jul-14	8:00	Fine	009251	2.8568	3.0268	2050.38	2074.38	24.00	1.41	1.41	1.41	2027	84
2-Aug-14	8:00	Rainy	009389	2.8592	3.0655	2077.38	2101.38	24.00	1.41	1.41	1.41	2025	102
8-Aug-14	8:00	Fine	009560	2.8208	2.9248	2104.38	2128.38	24.00	1.41	1.41	1.41	2026	51
14-Aug-14	8:00	Rainy	009799	2.8262	2.9232	2131.38	2155.38	24.00	1.41	1.41	1.41	2030	48
20-Aug-14	8:00	Rainy	009254	2.8619	2.9474	2158.38	2182.38	24.00	1.41	1.41	1.41	2036	42
26-Aug-14	8:00	Fine	009761	2.8039	2.9185	2185.38	2209.38	24.00	1.37	1.37	1.37	1979	58

Report on 1-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 311.3

Limit Level ($\mu\text{g}/\text{m}^3$) - 500

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
29-Jul-14	8:48	Fine	009382	2.8551	2.8678	2074.38	2075.38	1.00	1.31	1.31	1.31	79	161
29-Jul-14	9:53	Fine	009384	2.8646	2.8733	2075.38	2076.38	1.00	1.27	1.30	1.28	77	113
29-Jul-14	13:00	Fine	009387	2.8558	2.8674	2076.38	2077.38	1.00	1.31	1.31	1.31	79	147
4-Aug-14	9:03	Rainy	009390	2.8432	2.8529	2101.38	2102.38	1.00	1.28	1.28	1.28	77	126
4-Aug-14	10:15	Rainy	009416	2.8617	2.8766	2102.38	2103.38	1.00	1.31	1.31	1.31	79	189
4-Aug-14	13:00	Rainy	009419	2.8583	2.8683	2103.38	2104.38	1.00	1.31	1.31	1.31	79	127
9-Aug-14	8:10	Fine	009805	2.8188	2.8259	2128.38	2129.38	1.00	1.31	1.31	1.31	79	90
9-Aug-14	9:15	Fine	009803	2.8318	2.8434	2129.38	2130.38	1.00	1.31	1.31	1.31	79	147
9-Aug-14	10:25	Fine	009801	2.8266	2.8365	2130.38	2131.38	1.00	1.31	1.31	1.31	79	126
15-Aug-14	8:35	Fine	009408	2.8424	2.8507	2155.38	2156.38	1.00	1.32	1.32	1.32	79	105
15-Aug-14	9:40	Fine	009410	2.8364	2.8437	2156.38	2157.38	1.00	1.32	1.32	1.32	79	92
15-Aug-14	10:47	Fine	009412	2.8614	2.8661	2157.38	2158.38	1.00	1.29	1.27	1.28	77	61
21-Aug-14	8:40	Rainy	009755	2.8176	2.8209	2182.38	2183.38	1.00	1.32	1.32	1.32	79	42
21-Aug-14	9:47	Rainy	009757	2.8084	2.8114	2183.38	2184.38	1.00	1.32	1.32	1.32	79	38
21-Aug-14	10:58	Rainy	009759	2.8040	2.8094	2184.38	2185.38	1.00	1.32	1.32	1.32	79	68
27-Aug-14	8:15	Cloudy	009788	2.8238	2.8323	2209.38	2210.38	1.00	1.23	1.23	1.23	74	115
27-Aug-14	9:20	Cloudy	009763	2.8031	2.8102	2210.38	2211.38	1.00	1.23	1.23	1.23	74	96
27-Aug-14	10:35	Cloudy	009765	2.8427	2.8521	2211.38	2212.38	1.00	1.23	1.23	1.23	74	127



Location: CMA4a - SPCA

Report on 24-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 171.2

Limit Level ($\mu\text{g}/\text{m}^3$) - 260

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
28-Jul-14	8:00	Fine	009248	2.8574	2.9366	18857.98	18881.98	24.00	1.32	1.32	1.32	1899	42
2-Aug-14	8:00	Rainy	009388	2.8591	2.9672	18884.98	18908.98	24.00	1.32	1.32	1.32	1898	57
8-Aug-14	8:00	Fine	009561	2.8145	2.8911	18911.98	18935.98	24.00	1.32	1.32	1.32	1898	40
14-Aug-14	8:00	Rainy	009798	2.8222	2.8609	18938.98	18962.98	24.00	1.32	1.32	1.32	1903	20
20-Aug-14	8:00	Rainy	009413	2.8568	2.9104	18966.00	18990.00	24.00	1.34	1.34	1.34	1933	28
26-Aug-14	8:00	Fine	009760	2.8112	2.8825	18993.00	19017.00	24.00	1.32	1.32	1.32	1902	37

Report on 1-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 312.5

Limit Level ($\mu\text{g}/\text{m}^3$) - 500

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
29-Jul-14	9:04	Fine	009383	2.8484	2.8539	18881.98	18882.98	1.00	1.32	1.32	1.32	79	70
29-Jul-14	10:16	Fine	009385	2.8560	2.8623	18882.98	18883.98	1.00	1.32	1.32	1.32	79	80
29-Jul-14	13:00	Fine	009386	2.8436	2.8496	18883.98	18884.98	1.00	1.32	1.32	1.32	79	76
4-Aug-14	9:15	Rainy	009415	2.8646	2.8714	18908.98	18909.98	1.00	1.34	1.32	1.33	80	85
4-Aug-14	10:24	Rainy	009417	2.8639	2.8730	18909.98	18910.98	1.00	1.32	1.32	1.32	79	115
4-Aug-14	13:00	Rainy	009418	2.8470	2.8538	18910.98	18911.98	1.00	1.32	1.32	1.32	79	86
9-Aug-14	8:15	Fine	009804	2.8185	2.8233	18935.98	18936.98	1.00	1.32	1.32	1.32	79	61
9-Aug-14	9:25	Fine	009802	2.8278	2.8332	18936.98	18937.98	1.00	1.32	1.32	1.32	79	68
9-Aug-14	10:35	Fine	009800	2.8315	2.8362	18937.98	18938.98	1.00	1.32	1.32	1.32	79	59
15-Aug-14	8:20	Fine	009407	2.8507	2.8577	18962.98	18963.98	1.00	1.32	1.32	1.32	79	88
15-Aug-14	9:25	Fine	009409	2.8485	2.8546	18963.98	18964.98	1.00	1.32	1.32	1.32	79	77
15-Aug-14	10:30	Fine	009411	2.8365	2.8415	18964.98	18965.98	1.00	1.32	1.32	1.32	79	63
21-Aug-14	8:05	Rainy	009754	2.8224	2.8232	18990.00	18991.00	1.00	1.32	1.32	1.32	79	10
21-Aug-14	9:20	Rainy	009756	2.8159	2.8184	18991.00	18992.00	1.00	1.32	1.32	1.32	79	31
21-Aug-14	10:32	Rainy	009758	2.8154	2.8185	18992.00	18993.00	1.00	1.32	1.32	1.32	79	39
27-Aug-14	8:30	Cloudy	009762	2.8044	2.8078	19017.00	19018.00	1.00	1.32	1.32	1.32	79	43
27-Aug-14	9:44	Cloudy	009764	2.8629	2.8680	19018.00	19019.00	1.00	1.32	1.32	1.32	79	64
27-Aug-14	10:45	Cloudy	009766	2.8444	2.8509	19019.00	19020.00	1.00	1.32	1.32	1.32	79	82

Location: CMA5a - Children Garden opposite to Pedestrian Plaza

Report on 24-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 181

Limit Level ($\mu\text{g}/\text{m}^3$) - 260

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
28-Jul-14	8:00	Fine	009381	2.8516	2.9631	19847.88	19871.88	24.00	1.31	1.31	1.31	1889	59
2-Aug-14	8:00	Rainy	009356	2.8701	3.0326	19874.88	19898.88	24.00	1.31	1.31	1.31	1888	86
8-Aug-14	8:00	Fine	009345	2.8547	2.9565	19901.88	19925.88	24.00	1.31	1.31	1.31	1888	54
15-Aug-14	16:06	Fine	009536	2.8207	2.9275	19937.08	19961.08	24.00	1.31	1.31	1.31	1893	56
21-Aug-14	13:00	Rainy	009700	2.8443	2.9297	19964.09	19988.09	24.00	1.32	1.32	1.32	1895	45
26-Aug-14	8:00	Fine	009703	2.8536	3.0141	19988.09	20012.09	24.00	1.30	1.30	1.30	1877	86

Remarks: Due to interruption of electricity, the 24hr TSP was rescheduled from 14 August 2014 and 20 August 2014 to 15 August 2014 and 21 August 2014 respectively.

Report on 1-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 332

Limit Level ($\mu\text{g}/\text{m}^3$) - 500

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
29-Jul-14	13:00	Fine	009348	2.8683	2.8832	19871.88	19872.88	1.00	1.31	1.31	1.31	79	189
29-Jul-14	14:05	Fine	009351	2.8817	2.8958	19872.88	19873.88	1.00	1.31	1.31	1.31	79	179
29-Jul-14	15:12	Fine	009354	2.8670	2.8805	19873.88	19874.88	1.00	1.31	1.31	1.31	79	172
4-Aug-14	13:00	Rainy	009420	2.8659	2.8736	19898.88	19899.88	1.00	1.31	1.31	1.31	79	98
4-Aug-14	14:42	Rainy	009444	2.8555	2.8645	19899.88	19900.88	1.00	1.31	1.31	1.31	79	114
4-Aug-14	15:45	Rainy	009342	2.8575	2.8676	19900.88	19901.88	1.00	1.31	1.31	1.31	79	128
9-Aug-14	8:54	Fine	009553	2.8245	2.8357	19925.88	19926.88	1.00	1.31	1.31	1.31	79	142
9-Aug-14	10:04	Fine	009556	2.8093	2.8207	19926.88	19927.88	1.00	1.31	1.31	1.31	79	145
9-Aug-14	13:00	Fine	009559	2.8252	2.8314	19927.88	19928.88	1.00	1.31	1.31	1.31	79	79
15-Aug-14	9:46	Fine	009547	2.8155	2.8222	19934.08	19935.08	1.00	1.31	1.31	1.31	79	85
15-Aug-14	13:00	Fine	009550	2.8094	2.8150	19935.08	19936.08	1.00	1.31	1.31	1.31	79	71
15-Aug-14	14:30	Fine	009533	2.8211	2.8272	19936.08	19937.08	1.00	1.31	1.31	1.31	79	77
21-Aug-14	8:04	Rainy	009690	2.8495	2.8525	19961.09	19962.09	1.00	1.23	1.23	1.23	74	41
21-Aug-14	9:15	Rainy	009694	2.8628	2.8661	19962.09	19963.09	1.00	1.23	1.23	1.23	74	45
21-Aug-14	10:22	Rainy	009697	2.8552	2.8567	19963.09	19964.09	1.00	1.23	1.23	1.23	74	20
27-Aug-14	9:41	Cloudy	009762	2.8044	2.8078	20012.09	20013.09	1.00	1.27	1.27	1.27	76	45
27-Aug-14	13:00	Cloudy	009503	2.8523	2.8639	20013.09	20014.09	1.00	1.27	1.27	1.27	76	153
27-Aug-14	15:13	Cloudy	009506	2.8382	2.8541	20014.09	20015.09	1.00	1.27	1.27	1.27	76	209

Location: MA1e - International Finance Centre (Eastern Wing)

Report on 24-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 173.4

Limit Level ($\mu\text{g}/\text{m}^3$) - 260

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
28-Jul-14	8:00	Fine	009432	2.8539	2.9205	15540.96	15564.96	24.00	1.23	1.11	1.17	1689	39
2-Aug-14	8:00	Rainy	009159	2.8364	2.9521	15567.96	15591.96	24.00	1.11	1.11	1.11	1600	72
8-Aug-14	8:00	Fine	009261	2.8510	2.9098	15594.96	15618.96	24.00	1.11	1.11	1.11	1600	37
14-Aug-14	8:00	Rainy	009841	2.7853	2.8472	15621.96	15645.96	24.00	1.12	1.12	1.12	1608	39
20-Aug-14	8:00	Rainy	009837	2.7659	2.8301	15648.96	15672.96	24.00	1.22	1.12	1.17	1682	38
27-Aug-14	16:00	Cloudy	009394	2.8456	2.8506	15697.49	15721.49	24.00	1.15	1.15	1.15	1660	3

Remarks: Due to interruption of electricity, the 24hr TSP was rescheduled from 26 August 2014 to 27 August 2014.

Report on 1-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 325.1

Limit Level ($\mu\text{g}/\text{m}^3$) - 500

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
29-Jul-14	8:18	Fine	009258	2.8494	2.8540	15564.96	15565.96	1.00	1.11	1.11	1.11	67	69
29-Jul-14	9:26	Fine	009424	2.8521	2.8575	15565.96	15566.96	1.00	1.11	1.11	1.11	67	81
29-Jul-14	10:34	Fine	009425	2.8514	2.8560	15566.96	15567.96	1.00	1.11	1.11	1.11	67	69
4-Aug-14	8:52	Rainy	009395	2.8445	2.8510	15591.96	15592.96	1.00	1.11	1.11	1.11	67	98
4-Aug-14	9:57	Rainy	009396	2.8464	2.8517	15592.96	15593.96	1.00	1.11	1.11	1.11	67	80
4-Aug-14	13:00	Rainy	009397	2.8544	2.8592	15593.96	15594.96	1.00	1.11	1.11	1.11	67	72
9-Aug-14	8:28	Fine	009847	2.7808	2.7846	15618.96	15619.96	1.00	1.11	1.11	1.11	67	57
9-Aug-14	9:33	Fine	009848	2.7732	2.7764	15619.96	15620.96	1.00	1.11	1.11	1.11	67	48
9-Aug-14	10:38	Fine	009849	2.7762	2.7800	15620.96	15621.96	1.00	1.11	1.11	1.11	67	57
15-Aug-14	8:31	Fine	009840	2.8022	2.8079	15645.96	15646.96	1.00	1.12	1.12	1.12	67	85
15-Aug-14	9:35	Fine	009480	2.8577	2.8625	15646.96	15647.96	1.00	1.12	1.12	1.12	67	72
15-Aug-14	10:39	Fine	009481	2.8549	2.8601	15647.96	15648.96	1.00	1.15	1.12	1.13	68	77
21-Aug-14	8:30	Rainy	008544	2.8564	2.8592	15672.96	15673.96	1.00	1.12	1.12	1.12	67	42
21-Aug-14	9:35	Rainy	008545	2.8412	2.8450	15673.96	15674.96	1.00	1.18	1.12	1.15	69	55
21-Aug-14	10:40	Rainy	008546	2.8485	2.8517	15674.96	15675.96	1.00	1.24	1.12	1.18	71	45
27-Aug-14	10:06	Cloudy	009821	2.7786	2.7853	15694.49	15695.49	1.00	1.15	1.15	1.15	69	97
27-Aug-14	13:00	Cloudy	009818	2.7985	2.8058	15695.49	15696.49	1.00	1.15	1.15	1.15	69	106
27-Aug-14	14:06	Cloudy	009819	2.7958	2.7977	15696.49	15697.49	1.00	1.15	1.15	1.15	69	27

Location: MA1w - International Finance Centre (Western Wing)

Report on 24-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 173.4

Limit Level ($\mu\text{g}/\text{m}^3$) - 260

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
28-Jul-14	8:00	Fine	009433	2.8607	2.9607	15615.62	15639.62	24.00	1.35	1.35	1.35	1945	51
2-Aug-14	8:00	Rainy	009160	2.8452	2.9705	15642.62	15666.62	24.00	1.35	1.35	1.35	1944	64
8-Aug-14	8:00	Fine	008793	2.8622	2.9355	15669.62	15693.62	24.00	1.35	1.35	1.35	1944	38
14-Aug-14	8:00	Rainy	009842	2.7686	2.8445	15696.62	15720.62	24.00	1.36	1.35	1.36	1951	39
20-Aug-14	8:00	Rainy	009838	2.7866	2.8530	15723.62	15747.62	24.00	1.36	1.36	1.36	1958	34
26-Aug-14	8:00	Fine	008542	2.8593	2.9221	15750.62	15774.62	24.00	1.33	1.31	1.32	1900	33




Report on 1-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 325.1




Limit Level ($\mu\text{g}/\text{m}^3$) - 500

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
29-Jul-14	8:24	Fine	009255	2.8730	2.8779	15639.62	15640.62	1.00	1.35	1.35	1.35	81	60
29-Jul-14	9:32	Fine	009256	2.8520	2.8579	15640.62	15641.62	1.00	1.35	1.35	1.35	81	73
29-Jul-14	10:40	Fine	009257	2.8494	2.8550	15641.62	15642.62	1.00	1.35	1.35	1.35	81	69
4-Aug-14	8:56	Rainy	009398	2.8500	2.8564	15666.62	15667.62	1.00	1.35	1.35	1.35	81	79
4-Aug-14	10:01	Rainy	009399	2.8601	2.8681	15667.62	15668.62	1.00	1.35	1.35	1.35	81	99
4-Aug-14	13:00	Rainy	009400	2.8550	2.8628	15668.62	15669.62	1.00	1.35	1.35	1.35	81	96
9-Aug-14	8:32	Fine	009850	2.7851	2.7886	15693.62	15694.62	1.00	1.35	1.35	1.35	81	43
9-Aug-14	9:37	Fine	009851	2.7728	2.7762	15694.62	15695.62	1.00	1.35	1.35	1.35	81	42
9-Aug-14	10:42	Fine	009852	2.7843	2.7884	15695.62	15696.62	1.00	1.35	1.35	1.35	81	51
15-Aug-14	8:36	Fine	009482	2.8589	2.8655	15720.62	15721.62	1.00	1.35	1.35	1.35	81	81
15-Aug-14	9:40	Fine	009483	2.8541	2.8588	15721.62	15722.62	1.00	1.35	1.35	1.35	81	58
15-Aug-14	10:44	Fine	009484	2.8482	2.8522	15722.62	15723.62	1.00	1.35	1.35	1.35	81	49
21-Aug-14	8:34	Rainy	008547	2.8511	2.8547	15747.62	15748.62	1.00	1.36	1.36	1.36	82	44
21-Aug-14	9:39	Rainy	008548	2.8458	2.8500	15748.62	15749.62	1.00	1.36	1.36	1.36	82	52
21-Aug-14	10:44	Rainy	008549	2.8269	2.8311	15749.62	15750.62	1.00	1.36	1.36	1.36	82	52
27-Aug-14	8:54	Cloudy	009824	2.7985	2.8044	15774.62	15775.62	1.00	1.31	1.31	1.31	78	75
27-Aug-14	10:35	Cloudy	009823	2.7834	2.7894	15775.62	15776.62	1.00	1.31	1.31	1.31	78	77
27-Aug-14	13:00	Cloudy	009822	2.7813	2.7873	15776.62	15777.62	1.00	1.31	1.31	1.31	78	77


Graphic Presentation of 24 hour TSP Result

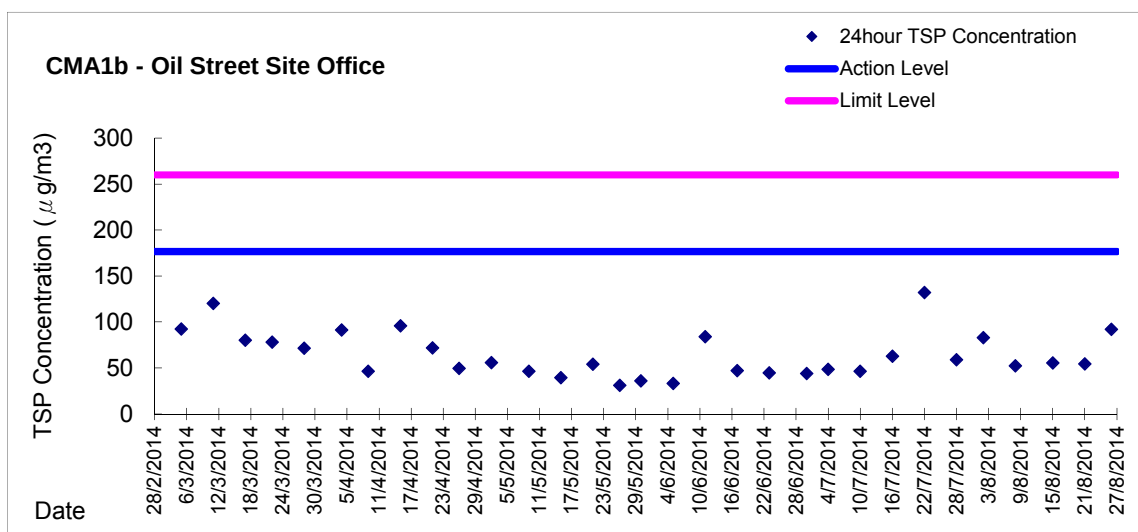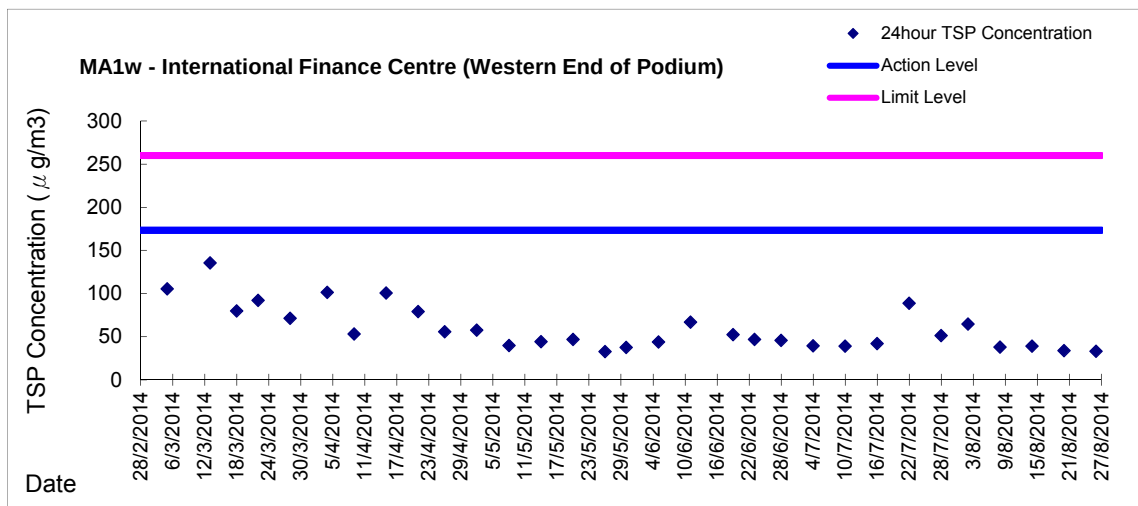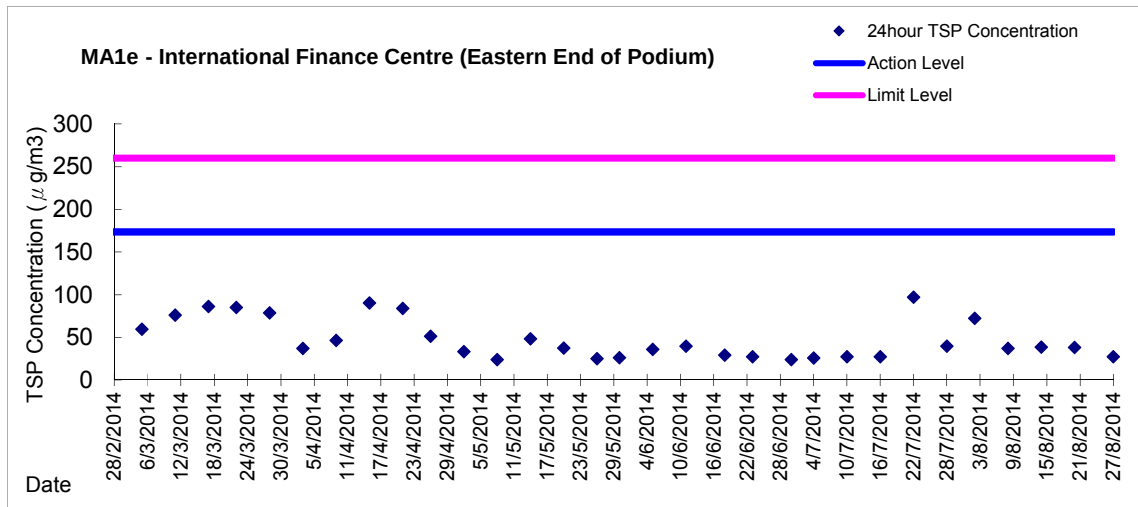




Graphic Presentation of 24 hour TSP Result

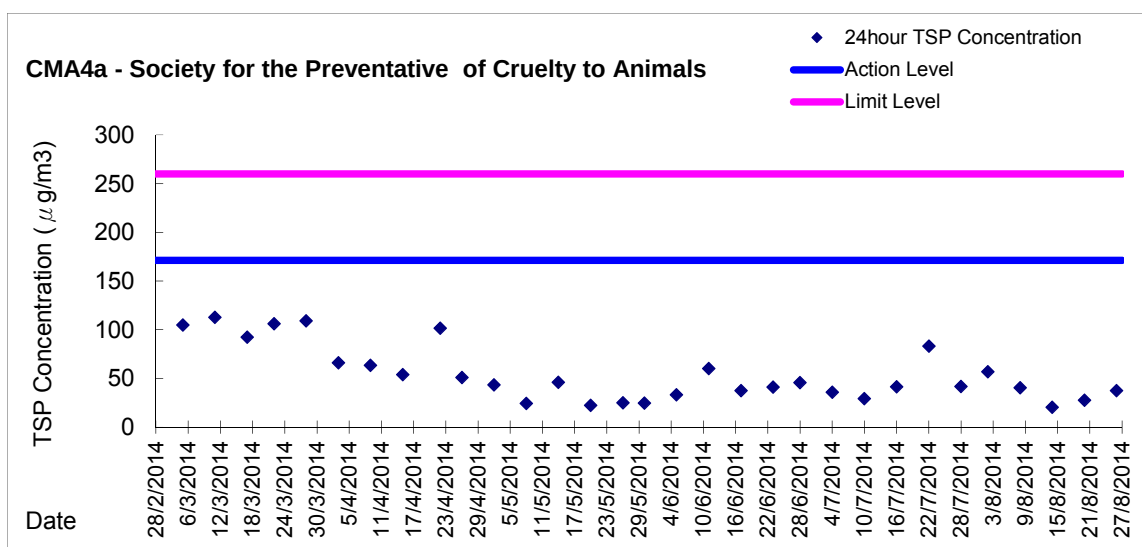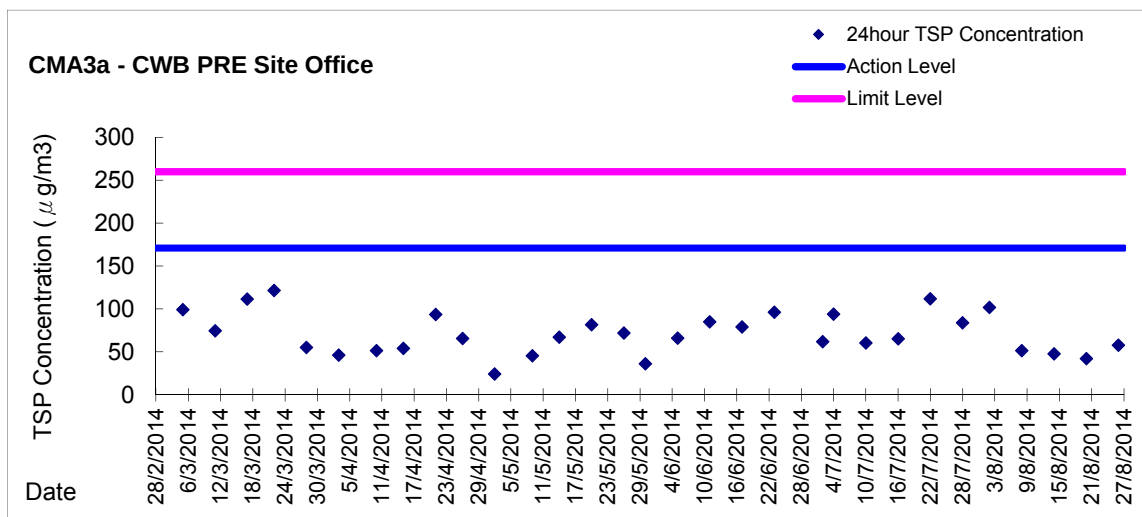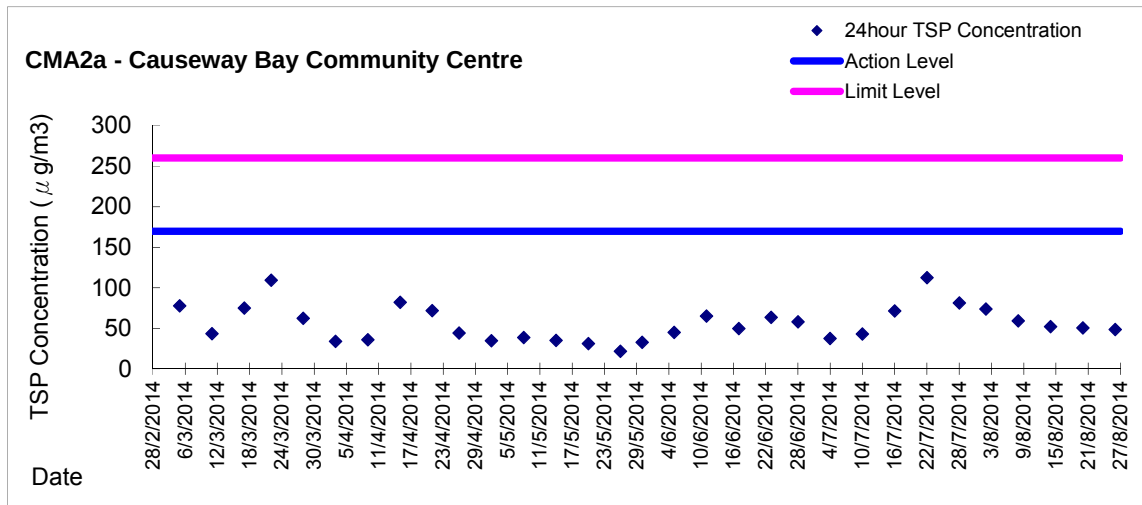




Graphic Presentation of 24 hour TSP Result

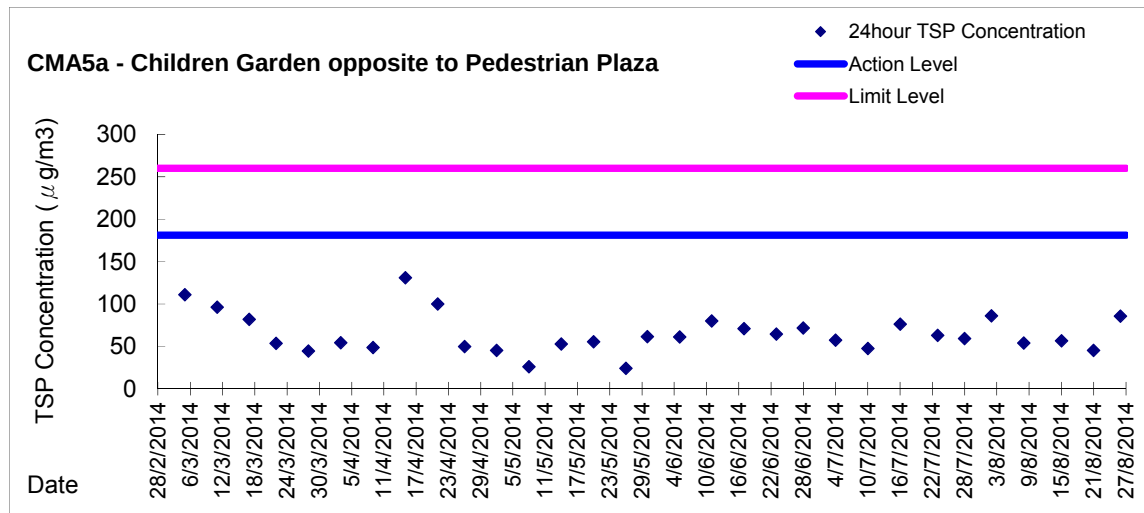


Graphic Presentation of 1 hour TSP Result

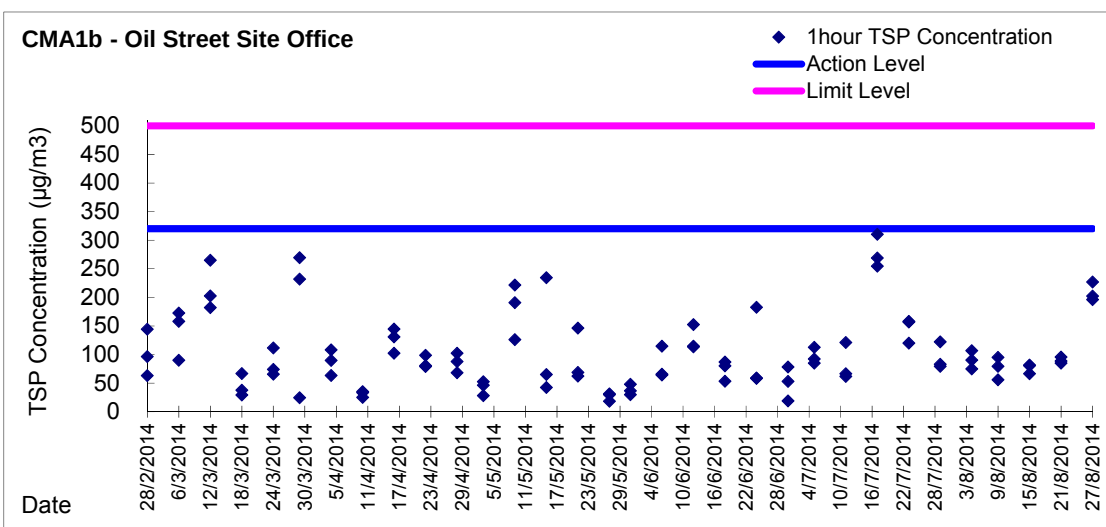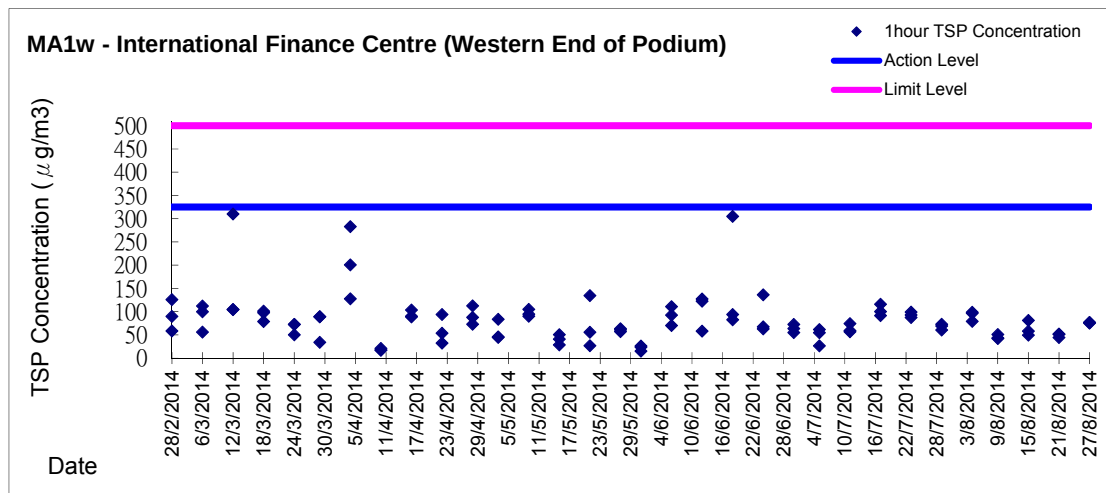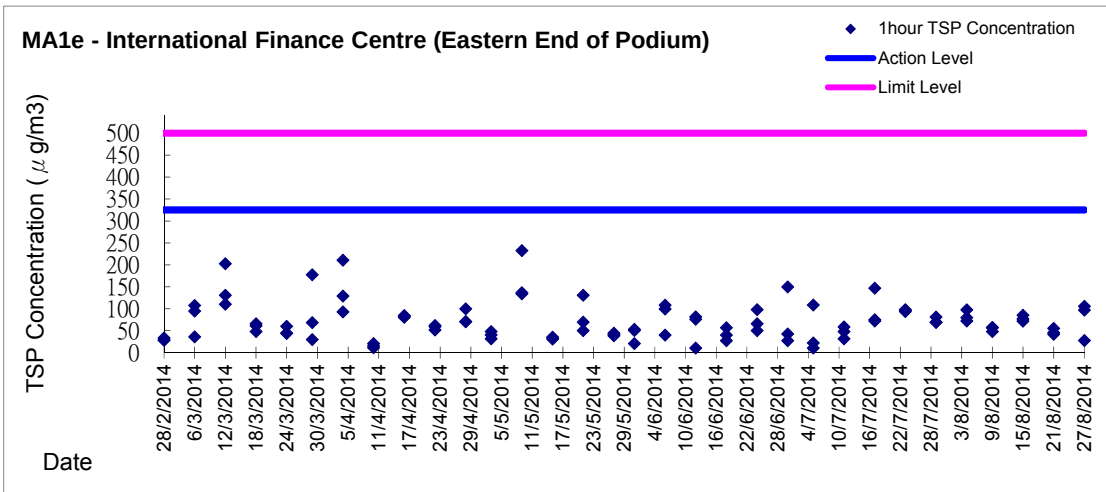

Graphic Presentation of 1 hour TSP Result

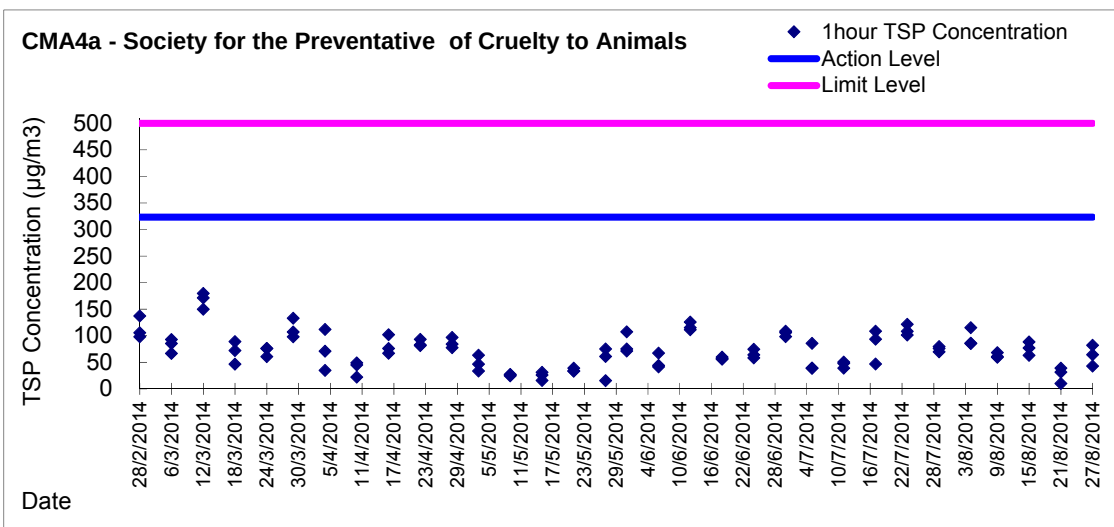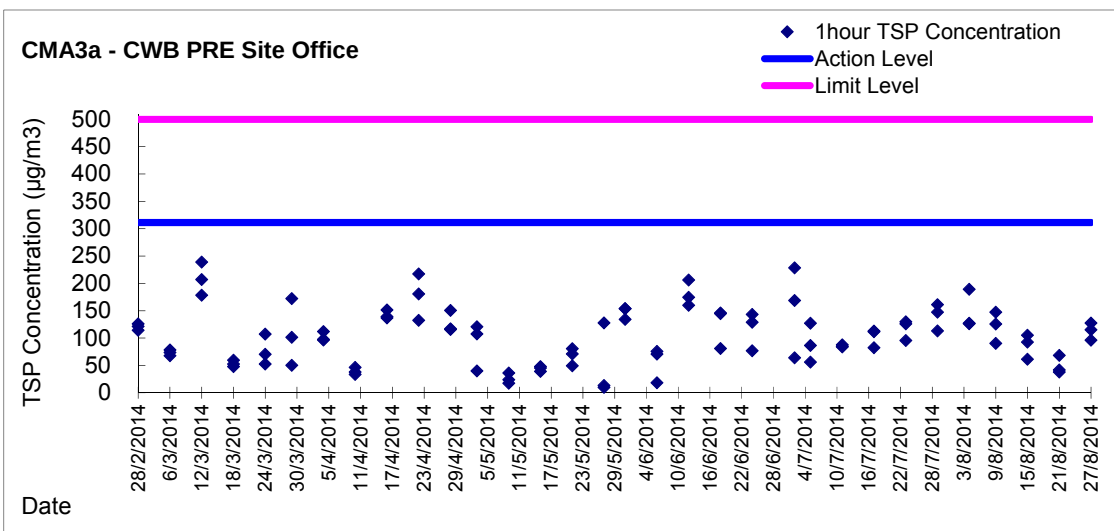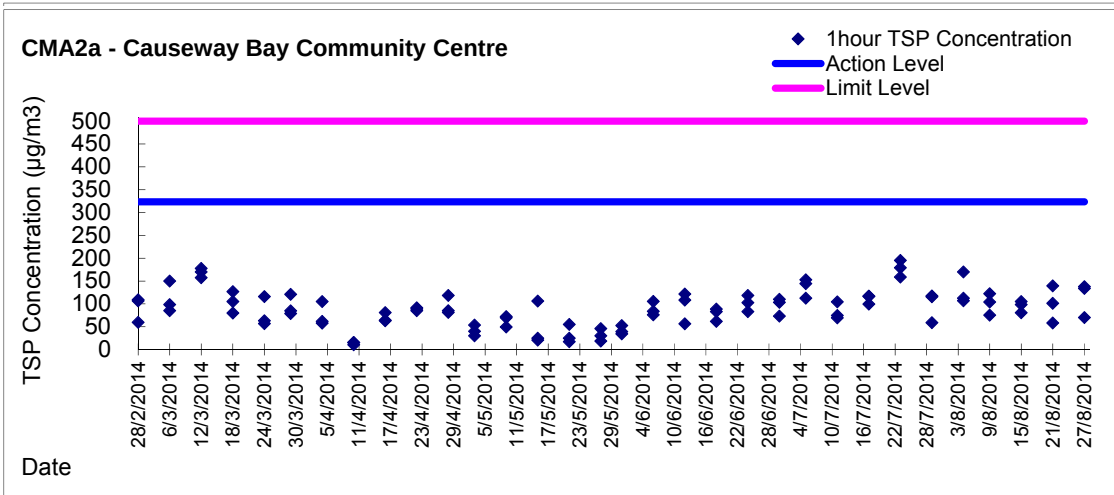

Graphic Presentation of 1 hour TSP Result

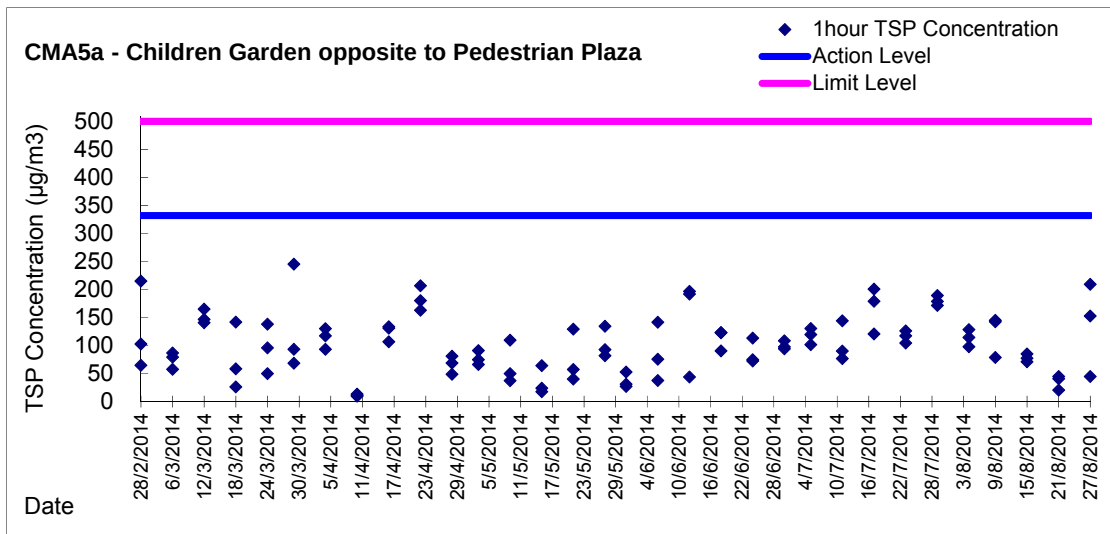



Appendix 5.4

Real Time Noise Monitoring Results and Graphical Presentations

Real-time Noise Data	RTN1 (Food and Environmental Hygiene Department Depot)											
Normal Day 07:00-19:00	1/8/2014 12:01	67.0	6/8/2014 18:31	67.3	12/8/2014 13:01	67.4	18/8/2014 7:31	66.9	22/8/2014 14:01	66.9		
	1/8/2014 12:31	66.6	7/8/2014 7:01	67.4	12/8/2014 13:31	67.8	18/8/2014 8:01	67.0	22/8/2014 14:31	66.9		
	1/8/2014 13:01	67.3	7/8/2014 7:31	67.8	12/8/2014 14:01	67.8	18/8/2014 8:31	66.8	22/8/2014 15:01	66.9		
28/7/2014 7:01	66.2	1/8/2014 13:31	67.2	7/8/2014 8:01	66.9	12/8/2014 14:31	67.5	18/8/2014 9:01	67.2	22/8/2014 15:31	66.5	
28/7/2014 7:31	67.5	1/8/2014 14:01	67.2	7/8/2014 8:31	67.2	12/8/2014 15:01	67.9	18/8/2014 9:31	67.3	22/8/2014 16:01	66.7	
28/7/2014 8:01	67.1	1/8/2014 14:31	67.1	7/8/2014 9:01	67.4	12/8/2014 15:31	68.0	18/8/2014 10:01	67.9	22/8/2014 16:31	66.8	
28/7/2014 8:31	66.3	1/8/2014 15:01	66.7	7/8/2014 9:31	68.1	12/8/2014 16:01	69.2	18/8/2014 10:31	68.1	22/8/2014 17:01	67.0	
28/7/2014 9:01	66.4	1/8/2014 15:31	66.7	7/8/2014 10:01	67.9	12/8/2014 16:31	67.9	18/8/2014 11:01	68.2	22/8/2014 17:31	66.5	
28/7/2014 9:31	66.8	1/8/2014 16:01	67.0	7/8/2014 10:31	67.8	12/8/2014 17:01	67.4	18/8/2014 11:31	67.7	22/8/2014 18:01	66.7	
28/7/2014 10:01	67.4	1/8/2014 16:31	66.8	7/8/2014 11:01	68.1	12/8/2014 17:31	67.1	18/8/2014 12:01	67.0	22/8/2014 18:31	65.2	
28/7/2014 10:31	67.3	1/8/2014 17:01	66.5	7/8/2014 11:31	67.6	12/8/2014 18:01	67.2	18/8/2014 12:31	67.0	23/8/2014 7:01	65.3	
28/7/2014 11:01	67.7	1/8/2014 17:31	66.4	7/8/2014 12:01	67.1	12/8/2014 18:31	70.8	18/8/2014 13:01	67.2	23/8/2014 7:31	66.1	
28/7/2014 11:31	67.1	1/8/2014 18:01	66.6	7/8/2014 12:31	67.5	13/8/2014 7:01	67.4	18/8/2014 13:31	67.8	23/8/2014 8:01	67.0	
28/7/2014 12:01	66.6	1/8/2014 18:31	65.4	7/8/2014 13:01	67.8	13/8/2014 7:31	68.7	18/8/2014 14:01	67.9	23/8/2014 8:31	66.7	
28/7/2014 12:31	66.7	2/8/2014 7:01	65.3	7/8/2014 13:31	68.0	13/8/2014 8:01	66.7	18/8/2014 14:31	66.1	23/8/2014 9:01	66.9	
28/7/2014 13:01	67.4	2/8/2014 7:31	66.3	7/8/2014 14:01	67.6	13/8/2014 8:31	66.9	18/8/2014 15:01	66.8	23/8/2014 9:31	67.1	
28/7/2014 13:31	67.4	2/8/2014 8:01	67.0	7/8/2014 14:31	67.8	13/8/2014 9:01	66.8	18/8/2014 15:31	67.4	23/8/2014 10:01	67.2	
28/7/2014 14:01	67.1	2/8/2014 8:31	67.3	7/8/2014 15:01	67.6	13/8/2014 9:31	67.9	18/8/2014 16:01	67.8	23/8/2014 10:31	67.1	
28/7/2014 14:31	66.8	2/8/2014 9:01	67.3	7/8/2014 15:31	67.3	13/8/2014 10:01	68.1	18/8/2014 16:31	67.2	23/8/2014 11:01	67.1	
28/7/2014 15:01	66.7	2/8/2014 9:31	67.9	7/8/2014 16:01	67.7	13/8/2014 10:31	67.4	18/8/2014 17:01	66.8	23/8/2014 11:31	66.7	
28/7/2014 15:31	67.0	2/8/2014 10:01	68.0	7/8/2014 16:31	67.9	13/8/2014 11:01	68.4	18/8/2014 17:31	66.6	23/8/2014 12:01	65.6	
28/7/2014 16:01	66.8	2/8/2014 10:31	68.2	7/8/2014 17:01	67.4	13/8/2014 11:31	70.8	18/8/2014 18:01	66.7	23/8/2014 12:31	66.0	
28/7/2014 16:31	67.0	2/8/2014 11:01	68.0	7/8/2014 17:31	67.5	13/8/2014 12:01	71.8	18/8/2014 18:31	65.8	23/8/2014 13:01	66.4	
28/7/2014 17:01	67.4	2/8/2014 11:31	67.0	7/8/2014 18:01	67.9	13/8/2014 12:31	69.1	19/8/2014 7:01	67.0	23/8/2014 13:31	66.3	
28/7/2014 17:31	66.7	2/8/2014 12:01	66.7	7/8/2014 18:31	67.5	13/8/2014 13:01	69.0	19/8/2014 7:31	67.7	23/8/2014 14:01	66.4	
28/7/2014 18:01	66.9	2/8/2014 12:31	66.9	8/8/2014 7:01	66.5	13/8/2014 13:31	68.6	19/8/2014 8:01	67.4	23/8/2014 14:31	67.2	
28/7/2014 18:31	66.4	2/8/2014 13:01	67.5	8/8/2014 7:31	67.3	13/8/2014 14:01	69.1	19/8/2014 8:31	66.9	23/8/2014 15:01	68.6	
29/7/2014 7:01	65.9	2/8/2014 13:31	67.4	8/8/2014 8:01	67.5	13/8/2014 14:31	69.1	19/8/2014 9:01	66.8	23/8/2014 15:31	68.1	
29/7/2014 7:31	67.1	2/8/2014 14:01	67.6	8/8/2014 8:31	67.4	13/8/2014 15:01	70.4	19/8/2014 9:31	67.8	23/8/2014 16:01	68.2	
29/7/2014 8:01	66.8	2/8/2014 14:31	67.1	8/8/2014 9:01	67.5	13/8/2014 15:31	69.1	19/8/2014 10:01	68.5	23/8/2014 16:31	67.8	
29/7/2014 8:31	66.7	2/8/2014 15:01	66.9	8/8/2014 9:31	68.0	13/8/2014 16:01	69.2	19/8/2014 10:31	68.6	23/8/2014 17:01	67.8	
29/7/2014 9:01	66.9	2/8/2014 15:31	67.0	8/8/2014 10:01	68.0	13/8/2014 16:31	68.6	19/8/2014 11:01	68.2	23/8/2014 17:31	67.6	
29/7/2014 9:31	67.4	2/8/2014 16:01	66.9	8/8/2014 10:31	67.0	13/8/2014 17:01	68.6	19/8/2014 11:31	67.4	23/8/2014 18:01	66.9	
29/7/2014 10:01	67.1	2/8/2014 16:31	67.4	8/8/2014 11:01	66.8	13/8/2014 17:31	68.5	19/8/2014 12:01	67.1	23/8/2014 18:31	65.8	
29/7/2014 10:31	66.9	2/8/2014 17:01	66.9	8/8/2014 11:31	66.1	13/8/2014 18:01	68.3	19/8/2014 12:31	67.5	25/8/2014 7:01	65.6	
29/7/2014 11:01	66.9	2/8/2014 17:31	67.6	8/8/2014 12:01	66.3	13/8/2014 18:31	67.0	19/8/2014 13:01	67.3	25/8/2014 7:31	66.2	
29/7/2014 11:31	67.1	2/8/2014 18:01	66.4	8/8/2014 12:31	66.7	14/8/2014 7:01	66.4	19/8/2014 13:31	67.5	25/8/2014 8:01	66.6	
29/7/2014 12:01	66.6	2/8/2014 18:31	65.6	8/8/2014 13:01	66.8	14/8/2014 7:31	67.4	19/8/2014 14:01	67.5	25/8/2014 8:31	66.9	
29/7/2014 12:31	66.4	4/8/2014 7:01	65.8	8/8/2014 13:31	67.2	14/8/2014 8:01	67.0	19/8/2014 14:31	67.8	25/8/2014 9:01	67.4	
29/7/2014 13:01	67.1	4/8/2014 7:31	67.0	8/8/2014 14:01	67.2	14/8/2014 8:31	66.6	19/8/2014 15:01	70.4	25/8/2014 9:31	67.4	
29/7/2014 13:31	67.2	4/8/2014 8:01	67.0	8/8/2014 14:31	67.2	14/8/2014 9:01	67.0	19/8/2014 15:31	67.9	25/8/2014 10:01	67.3	
29/7/2014 14:01	67.2	4/8/2014 8:31	66.4	8/8/2014 15:01	67.2	14/8/2014 9:31	67.0	19/8/2014 16:01	68.3	25/8/2014 10:31	67.4	
29/7/2014 14:31	66.9	4/8/2014 9:01	66.8	8/8/2014 15:31	67.5	14/8/2014 10:01	66.9	19/8/2014 16:31	68.0	25/8/2014 11:01	67.5	
29/7/2014 15:01	67.1	4/8/2014 9:31	67.6	8/8/2014 16:01	67.6	14/8/2014 10:31	66.9	19/8/2014 17:01	67.9	25/8/2014 11:31	67.1	
29/7/2014 15:31	66.8	4/8/2014 10:01	67.9	8/8/2014 16:31	67.9	14/8/2014 11:01	66.4	19/8/2014 17:31	68.5	25/8/2014 12:01	66.5	
29/7/2014 16:01	66.6	4/8/2014 10:31	67.5	8/8/2014 17:01	68.0	14/8/2014 11:31	66.3	19/8/2014 18:01	68.0	25/8/2014 12:31	67.0	
29/7/2014 16:31	66.5	4/8/2014 11:01	67.6	8/8/2014 17:31	67.2	14/8/2014 12:01	66.0	19/8/2014 18:31	67.5	25/8/2014 13:01	66.9	
29/7/2014 17:01	66.7	4/8/2014 11:31	67.2	8/8/2014 18:01	66.9	14/8/2014 12:31	66.5	20/8/2014 7:01	67.7	25/8/2014 13:31	66.8	
29/7/2014 17:31	66.9	4/8/2014 12:01	66.7	8/8/2014 18:31	66.8	14/8/2014 13:01	67.6	20/8/2014 7:31	67.9	25/8/2014 14:01	66.8	
29/7/2014 18:01	66.7	4/8/2014 12:31	67.0	9/8/2014 7:01	65.3	14/8/2014 13:31	68.4	20/8/2014 8:01	67.0	25/8/2014 14:31	66.7	
29/7/2014 18:31	66.2	4/8/2014 13:01	67.6	9/8/2014 7:31	66.3	14/8/2014 14:01	68.0	20/8/2014 8:31	66.9	25/8/2014 15:01	66.8	
30/7/2014 7:01	65.9	4/8/2014 13:31	67.9	9/8/2014 8:01	67.0	14/8/2014 14:31	68.5	20/8/2014 9:01	67.0	25/8/2014 15:31	66.7	
30/7/2014 7:31	66.9	4/8/2014 14:01	67.7	9/8/2014 8:31	67.2	14/8/2014 15:01	68.3	20/8/2014 9:31	67.0	25/8/2014 16:01	66.7	
30/7/2014 8:01	66.9	4/8/2014 14:31	67.4	9/8/2014 9:01	67.6	14/8/2014 15:31	68.1	20/8/2014 10:01	67.0	25/8/2014 16:31	66.6	
30/7/2014 8:31	66.1	4/8/2014 15:01	67.4	9/8/2014 9:31	67.8	14/8/2014 16:01	68.2	20/8/2014 10:31	67.9	25/8/2014 17:01	66.0	
30/7/2014 9:01	66.2	4/8/2014 15:31	67.1	9/8/2014 10:01	67.4	14/8/2014 16:31	68.0	20/8/2014 11:01	68.3	25/8/2014 17:31	65.8	
30/7/2014 9:31	66.4	4/8/2014 16:01	68.2	9/8/2014 10:31	67.2	14/8/2014 17:01	68.5	20/8/2014 11:31	68.0	25/8/2014 18:01	65.4	
30/7/2014 10:01	66.7	4/8/2014 16:31	67.9	9/8/2014 11:01	67.3	14/8/2014 17:31	68.2	20/8/2014 12:01	67.5	25/8/2014 18:31	65.2	
30/7/2014 10:31	67.0	4/8/2014 17:01	67.4	9/8/2014 11:31	67.0	14/8/2014 18:01	67.0	20/8/2014 12:31	67.6	26/8/2014 7:01	65.4	
30/7/2014 11:01	66.9	4/8/2014 17:31	67.1	9/8/2014 12:01	66.9	14/8/2014 18:31	65.5	20/8/2014 13:01	67.8	26/8/2014 7:31	66.0	
30/7/2014 11:31	66.7	4/8/2014 18:01	67.3	9/8/2014 12:31	66.6	15/8/2014 7:01	66.5	20/8/2014 13:31	68.8	26/8/2014 8:01	66.5	
30/7/2014 12:01	66.6	4/8/2014 18:31	67.1	9/8/2014 13:01	67.1	15/8/2014 7:31	67.3	20/8/2014 14:01	68.9	26/8/2014 8:31	66.8	
30/7/2014 12:31	66.7	5/8/2014 7:01	65.9	9/8/2014 13:31	67.2	15/8/2014 8:01	67.3	20/8/2014 14:31	68.6	26/8/2014 9:01	67.2	
30/7/2014 13:01	67.0	5/8/2014 7:31	67.1	9/8/2014 14:01	67.6	15/8/2014 8:31	67.1	20/8/2014 15:01	68.1	26/8/2014 9:31	67.3	
30/7/2014 13:31	66.9	5/8/2014 8:01	66.9	9/8/2014 14:31	66.7	15/8/2014 9:01	67.8	20/8/2014 15:31	67.3	26/8/2014 10:01	67.4	
30/7/2014 14:01	67.0	5/8/2014 8:31	66.8	9/8/2014 15:01	67.1	15/8/2014 9:31	67.8	20/8/2014 16:01	68.6	26/8/2014 10:31	67.3	
30/7/2014 14:31	66.8	5/8/2014 9:01	66.8	9/8/2014 15:31	66.8	15/8/2014 10:01	67.8	20/8/2014 16:31	69.5	26/8/2014 11:01	67.4	
30/7/2014 15:01	67.5	5/8/2014 9:31	67.5	9/8/2014 16:01	66.9	15/8/2014 10:31	68.2	20/8/2014 17:01	69.1	26/8/2014 11:31	67.1	

Real-time Noise Data		RTN1 (Food and Environmental Hygiene Department Depot)					
<u>Normal Day 19:00-23:00</u>		30/7/2014 19:41	65.8	1/8/2014 20:46	65.9	3/8/2014 9:51	66.1
<u>Sunday & Holiday</u>		30/7/2014 19:46	66.2	1/8/2014 20:51	66.5	3/8/2014 9:56	66.4
<u>07:00-23:00</u>		30/7/2014 19:51	65.4	1/8/2014 20:56	67.0	3/8/2014 10:01	66.0
		30/7/2014 19:56	65.3	1/8/2014 21:01	66.9	3/8/2014 10:06	66.1
		30/7/2014 20:01	65.5	1/8/2014 21:06	66.7	3/8/2014 10:11	66.4
28/7/2014 19:01	65.3	30/7/2014 20:06	66.0	1/8/2014 21:11	66.1	3/8/2014 10:16	66.1
28/7/2014 19:06	65.4	30/7/2014 20:11	66.0	1/8/2014 21:16	65.8	3/8/2014 10:21	66.4
28/7/2014 19:11	64.7	30/7/2014 20:16	65.5	1/8/2014 21:21	65.7	3/8/2014 10:26	66.3
28/7/2014 19:16	64.4	30/7/2014 20:21	65.4	1/8/2014 21:26	65.5	3/8/2014 10:31	66.6
28/7/2014 19:21	65.7	30/7/2014 20:26	65.6	1/8/2014 21:31	65.0	3/8/2014 10:36	66.7
28/7/2014 19:26	66.2	30/7/2014 20:31	65.6	1/8/2014 21:36	65.3	3/8/2014 10:41	66.4
28/7/2014 19:31	66.0	30/7/2014 20:36	65.4	1/8/2014 21:41	65.7	3/8/2014 10:46	65.7
28/7/2014 19:36	66.5	30/7/2014 20:41	65.3	1/8/2014 21:46	65.2	3/8/2014 10:51	65.9
28/7/2014 19:41	66.1	30/7/2014 20:46	65.4	1/8/2014 21:51	65.2	3/8/2014 10:56	66.3
28/7/2014 19:46	66.2	30/7/2014 20:51	65.6	1/8/2014 21:56	65.6	3/8/2014 11:01	65.9
28/7/2014 19:51	66.2	30/7/2014 20:56	65.5	1/8/2014 22:01	65.2	3/8/2014 11:06	66.1
28/7/2014 19:56	66.5	30/7/2014 21:01	65.1	1/8/2014 22:06	65.5	3/8/2014 11:11	66.5
28/7/2014 20:01	66.1	30/7/2014 21:06	65.3	1/8/2014 22:11	65.1	3/8/2014 11:16	66.4
28/7/2014 20:06	65.7	30/7/2014 21:11	65.5	1/8/2014 22:16	65.3	3/8/2014 11:21	65.9
28/7/2014 20:11	65.9	30/7/2014 21:16	65.1	1/8/2014 22:21	64.7	3/8/2014 11:26	66.1
28/7/2014 20:16	66.1	30/7/2014 21:21	65.7	1/8/2014 22:26	64.5	3/8/2014 11:31	66.0
28/7/2014 20:21	65.8	30/7/2014 21:26	65.1	1/8/2014 22:31	65.4	3/8/2014 11:36	65.9
28/7/2014 20:26	65.7	30/7/2014 21:31	66.5	1/8/2014 22:36	65.7	3/8/2014 11:41	66.6
28/7/2014 20:31	65.6	30/7/2014 21:36	65.1	1/8/2014 22:41	65.8	3/8/2014 11:46	66.2
28/7/2014 20:36	65.9	30/7/2014 21:41	65.3	1/8/2014 22:46	66.2	3/8/2014 11:51	66.3
28/7/2014 20:41	66.2	30/7/2014 21:46	65.3	1/8/2014 22:51	66.5	3/8/2014 11:56	65.8
28/7/2014 20:46	65.9	30/7/2014 21:51	65.4	1/8/2014 22:56	66.4	3/8/2014 12:01	66.0
28/7/2014 20:51	65.9	30/7/2014 21:56	65.1	2/8/2014 19:01	65.8	3/8/2014 12:06	65.9
28/7/2014 20:56	65.2	30/7/2014 22:01	65.7	2/8/2014 19:06	65.7	3/8/2014 12:11	65.9
28/7/2014 21:01	65.5	30/7/2014 22:06	65.0	2/8/2014 19:11	66.1	3/8/2014 12:16	66.6
28/7/2014 21:06	65.6	30/7/2014 22:11	65.6	2/8/2014 19:16	65.9	3/8/2014 12:21	66.2
28/7/2014 21:11	66.2	30/7/2014 22:16	65.1	2/8/2014 19:21	65.7	3/8/2014 12:26	66.6
28/7/2014 21:16	65.9	30/7/2014 22:21	65.8	2/8/2014 19:26	65.4	3/8/2014 12:31	66.1
28/7/2014 21:21	65.5	30/7/2014 22:26	65.2	2/8/2014 19:31	65.8	3/8/2014 12:36	65.7
28/7/2014 21:26	65.3	30/7/2014 22:31	65.3	2/8/2014 19:36	65.6	3/8/2014 12:41	65.9
28/7/2014 21:31	66.2	30/7/2014 22:36	64.9	2/8/2014 19:41	65.6	3/8/2014 12:46	66.1
28/7/2014 21:36	65.8	30/7/2014 22:41	65.5	2/8/2014 19:46	65.7	3/8/2014 12:51	66.6
28/7/2014 21:41	65.9	30/7/2014 22:46	64.8	2/8/2014 19:51	65.9	3/8/2014 12:56	66.3
28/7/2014 21:46	65.6	30/7/2014 22:51	64.9	2/8/2014 19:56	66.0	3/8/2014 13:01	66.0
28/7/2014 21:51	65.7	30/7/2014 22:56	64.8	2/8/2014 20:01	65.2	3/8/2014 13:06	66.7
28/7/2014 21:56	66.1	31/7/2014 19:01	66.6	2/8/2014 20:06	65.9	3/8/2014 13:11	66.0
28/7/2014 22:01	65.5	31/7/2014 19:06	66.5	2/8/2014 20:11	65.2	3/8/2014 13:16	65.9
28/7/2014 22:06	65.0	31/7/2014 19:11	66.2	2/8/2014 20:16	65.4	3/8/2014 13:21	65.9
28/7/2014 22:11	65.5	31/7/2014 19:16	66.0	2/8/2014 20:21	65.2	3/8/2014 13:26	66.6
28/7/2014 22:16	65.5	31/7/2014 19:21	66.1	2/8/2014 20:26	65.4	3/8/2014 13:31	66.2
28/7/2014 22:21	65.3	31/7/2014 19:26	66.1	2/8/2014 20:31	65.4	3/8/2014 13:36	66.9
28/7/2014 22:26	65.6	31/7/2014 19:31	65.5	2/8/2014 20:36	64.9	3/8/2014 13:41	66.6
28/7/2014 22:31	65.6	31/7/2014 19:36	65.2	2/8/2014 20:41	65.1	3/8/2014 13:46	66.0
28/7/2014 22:36	65.1	31/7/2014 19:41	65.0	2/8/2014 20:46	65.0	3/8/2014 13:51	66.3
28/7/2014 22:41	65.2	31/7/2014 19:46	65.4	2/8/2014 20:51	65.2	3/8/2014 13:56	66.2
28/7/2014 22:46	65.3	31/7/2014 19:51	66.0	2/8/2014 20:56	65.3	3/8/2014 14:01	66.1
28/7/2014 22:51	65.4	31/7/2014 19:56	65.2	2/8/2014 21:01	65.2	3/8/2014 14:06	65.8
28/7/2014 22:56	65.4	31/7/2014 20:01	65.8	2/8/2014 21:06	65.3	3/8/2014 14:11	66.2
29/7/2014 19:01	65.7	31/7/2014 20:06	66.0	2/8/2014 21:11	65.8	3/8/2014 14:16	66.7
29/7/2014 19:06	66.0	31/7/2014 20:11	66.3	2/8/2014 21:16	64.8	3/8/2014 14:21	66.7
29/7/2014 19:11	65.8	31/7/2014 20:16	65.7	2/8/2014 21:21	65.2	3/8/2014 14:26	66.2
29/7/2014 19:16	65.7	31/7/2014 20:21	65.6	2/8/2014 21:26	65.3	3/8/2014 14:31	66.4
29/7/2014 19:21	65.3	31/7/2014 20:26	65.7	2/8/2014 21:31	65.9	3/8/2014 14:36	66.0
29/7/2014 19:26	66.2	31/7/2014 20:31	65.6	2/8/2014 21:36	65.6	3/8/2014 14:41	66.2
29/7/2014 19:31	66.4	31/7/2014 20:36	65.7	2/8/2014 21:41	65.5	3/8/2014 14:46	66.2
29/7/2014 19:36	66.1	31/7/2014 20:41	65.7	2/8/2014 21:46	65.7	3/8/2014 14:51	66.7
29/7/2014 19:41	65.8	31/7/2014 20:46	65.5	2/8/2014 21:51	65.9	3/8/2014 14:56	66.1
29/7/2014 19:46	65.9	31/7/2014 20:51	65.8	2/8/2014 21:56	65.5	3/8/2014 15:01	65.9
29/7/2014 19:51	65.9	31/7/2014 20:56	65.5	2/8/2014 22:01	65.5	3/8/2014 15:06	66.1
29/7/2014 19:56	65.8	31/7/2014 21:01	65.1	2/8/2014 22:06	65.4	3/8/2014 15:11	66.2
29/7/2014 20:01	65.3	31/7/2014 21:06	65.6	2/8/2014 22:11	65.9	3/8/2014 15:16	66.5
29/7/2014 20:06	66.2	31/7/2014 21:11	65.4	2/8/2014 22:16	65.5	3/8/2014 15:21	66.8
29/7/2014 20:11	65.8	31/7/2014 21:16	65.1	2/8/2014 22:21	65.7	3/8/2014 15:26	66.6
29/7/2014 20:16	65.8	31/7/2014 21:21	65.3	2/8/2014 22:26	66.4	3/8/2014 15:31	66.2
29/7/2014 20:21	65.7	31/7/2014 21:26	65.3	2/8/2014 22:31	65.8	3/8/2014 15:36	65.9
29/7/2014 20:26	65.7	31/7/2014 21:31	65.4	2/8/2014 22:36	65.7	3/8/2014 15:41	66.6
29/7/2014 20:31	65.5	31/7/2014 21:36	65.7	2/8/2014 22:41	65.7	3/8/2014 15:46	66.4
29/7/2014 20:36	65.5	31/7/2014 21:41	65.4	2/8/2014 22:46	65.7	3/8/2014 15:51	66.5
29/7/2014 20:41	65.8	31/7/2014 21:46	65.1	2/8/2014 22:51	65.8	3/8/2014 15:56	66.4
29/7/2014 20:46	65.7	31/7/2014 21:51	65.6	2/8/2014 22:56	65.8	3/8/2014 16:01	66.3
29/7/2014 20:51	66.0	31/7/2014 21:56	65.3	3/8/2014 7:01	64.2	3/8/2014 16:06	66.6
29/7/2014 20:56	65.5	31/7/2014 22:01	65.0	3/8/2014 7:06	64.1	3/8/2014 16:11	66.7
29/7/2014 21:01	65.5	31/7/2014 22:06	65.4	3/8/2014 7:11	64.2	3/8/2014 16:16	66.4
29/7/2014 21:06	65.8	31/7/2014 22:11	65.4	3/8/2014 7:16	64.3	3/8/2014 16:21	66.6
29/7/2014 21:11	65.4	31/7/2014 22:16	65.4	3/8/2014 7:21	68.6	3/8/2014 16:26	66.2
29/7/2014 21:16	65.6	31/7/2014 22:21	65.8	3/8/2014 7:26	64.5	3/8/2014 16:31	66.5
29/7/2014 21:21	66.1	31/7/2014 22:26	65.5	3/8/2014 7:31	64.5	3/8/2014 16:36	66.6
29/7/2014 21:26	65.7	31/7/2014 22:31	65.4	3/8/2014 7:36	65.7	3/8/2014 16:41	66.7
29/7/2014 21:31	65.9	31/7/2014 22:36	65.6	3/8/2014 7:41	64.9	3/8/2014 16:46	66.2
29/7/2014 21:36	66.3	31/7/2014 22:41	65.5	3/8/2014 7:46	64.9	3/8/2014 16:51	66.4
29/7/2014 21:41	65.2	31/7/2014 22:46	65.5	3/8/2014 7:51	65.5	3/8/2014 16:56	66.4
29/7/2014 21:46	65.2	31/7/2014 22:51	65.6	3/8/2014 7:56	65.0	3/8/2014 17:01	66.3
29/7/2014 21:51	65.4	31/7/2014 22:56	65.1	3/8/2014 8:01	64.8	3/8/2014 17:06	66.6
29/7/2014 21:56	65.9	1/8/2014 19:01	64.4	3/8/2014 8:06	65.9	3/8/2014 17:11	65.8
29/7/2014 22:01	65.1	1/8/2014 19:06	64.7	3/8/2014 8:11	65.1	3/8/2014 17:16	65.9
29/7/2014 22:06	65.2	1/8/2014 19:11	64.9	3/8/2014 8:16	65.7	3/8/2014 17:21	65.8
29/7/2014 22:11	65.8	1/8/2014 19:16	66.6	3/8/2014 8:21	65.6	3/8/2014 17:26	66.2
29/7/2014 22:16	65.8	1/8/2014 19:21	65.0	3/8/2014 8:26	65.5	3/8/2014 17:31	66.1
29/7/2014 22:21	66.4	1/8/2014 19:26	64.9	3/8/2014 8:31	65.4	3/8/2014 17:36	65.6
29/7/2014 22:26	65.5	1/8/2014 19:31	64.4	3/8/2014 8:36	65.5	3/8/2014 17:41	65.7
29/7/2014 22:31	65.4	1/8/2014 19:36	64.5	3/8/2014 8:41	65.5	3/8/2014 17:46	66.3
29/7/2014 22:36	65.2	1/8/2014 19:41	63.8	3/8/2014 8:46	65.9	3/8/2014 17:51	65.9
29/7/2014 22:41	65.3	1/8/2014 19:46	64.3	3/8/2014 8:51	65.7	3/8/2014 17:56	65.8
29/7/2014 22:46	65.3	1/8/2014 19:51	65.3	3/8/2014 8:56	66.0	3/8/2014 18:01	65.6
29/7/2014 22:51	65.4	1/8/2014 19:56	65.7	3/8/2014 9:01	66.1	3/8/2014 18:06	65.7
29/7/2014 22:56	65.4	1/8/2014 20:01	65.9	3/8/2014 9:06	65.9	3/8/2014 18:11	65.8
30/7/2014 19:01	65.5	1/8/2014 20:06	65.8	3/8/2014 9:11	66.3	3/8/2014 18:16	65.8
30/7/2014 19:06	66.0	1/8/2014 20:11	65.6	3/8/2014 9:16	66.3	3/8/2	

Real-time Noise Data		RTN1 (Food and Environmental Hygiene Department Depot)					
7/8/2014 21:06	65.8	9/8/2014 22:11	65.3	10/8/2014 15:16	66.1	11/8/2014 20:21	66.6
7/8/2014 21:11	66.2	9/8/2014 22:16	65.5	10/8/2014 15:21	65.7	11/8/2014 20:26	66.0
7/8/2014 21:16	66.0	9/8/2014 22:21	64.9	10/8/2014 15:26	65.9	11/8/2014 20:31	66.0
7/8/2014 21:21	66.0	9/8/2014 22:26	65.6	10/8/2014 15:31	66.0	11/8/2014 20:36	65.3
7/8/2014 21:26	66.1	9/8/2014 22:31	67.3	10/8/2014 15:36	65.9	11/8/2014 20:41	65.5
7/8/2014 21:31	65.9	9/8/2014 22:36	65.5	10/8/2014 15:41	65.9	11/8/2014 20:46	65.7
7/8/2014 21:36	65.8	9/8/2014 22:41	65.2	10/8/2014 15:46	66.1	11/8/2014 20:51	65.9
7/8/2014 21:41	65.9	9/8/2014 22:46	65.3	10/8/2014 15:51	66.5	11/8/2014 20:56	66.4
7/8/2014 21:46	65.4	9/8/2014 22:51	65.4	10/8/2014 15:56	66.5	11/8/2014 21:01	65.7
7/8/2014 21:51	65.7	9/8/2014 22:56	65.4	10/8/2014 16:01	65.9	11/8/2014 21:06	65.7
7/8/2014 21:56	66.0	10/8/2014 7:01	64.4	10/8/2014 16:06	66.1	11/8/2014 21:11	65.6
7/8/2014 22:01	65.9	10/8/2014 7:06	64.8	10/8/2014 16:11	65.9	11/8/2014 21:16	65.4
7/8/2014 22:06	65.8	10/8/2014 7:11	65.1	10/8/2014 16:16	66.0	11/8/2014 21:21	66.3
7/8/2014 22:11	65.8	10/8/2014 7:16	64.4	10/8/2014 16:21	66.4	11/8/2014 21:26	65.3
7/8/2014 22:16	65.8	10/8/2014 7:21	64.3	10/8/2014 16:26	66.4	11/8/2014 21:31	65.7
7/8/2014 22:21	65.7	10/8/2014 7:26	68.2	10/8/2014 16:31	66.2	11/8/2014 21:36	65.6
7/8/2014 22:26	65.5	10/8/2014 7:31	64.6	10/8/2014 16:36	66.1	11/8/2014 21:41	65.8
7/8/2014 22:31	65.4	10/8/2014 7:36	65.1	10/8/2014 16:41	66.0	11/8/2014 21:46	65.5
7/8/2014 22:36	65.6	10/8/2014 7:41	64.5	10/8/2014 16:46	66.1	11/8/2014 21:51	65.9
7/8/2014 22:41	65.6	10/8/2014 7:46	65.2	10/8/2014 16:51	66.6	11/8/2014 21:56	65.7
7/8/2014 22:46	65.2	10/8/2014 7:51	66.8	10/8/2014 16:56	65.8	11/8/2014 22:01	65.3
7/8/2014 22:51	64.6	10/8/2014 7:56	65.1	10/8/2014 17:01	66.3	11/8/2014 22:06	65.3
7/8/2014 22:56	64.8	10/8/2014 8:01	65.0	10/8/2014 17:06	65.5	11/8/2014 22:11	65.4
8/8/2014 19:01	65.3	10/8/2014 8:06	65.6	10/8/2014 17:11	65.7	11/8/2014 22:16	65.7
8/8/2014 19:06	65.2	10/8/2014 8:11	65.2	10/8/2014 17:16	65.9	11/8/2014 22:21	66.3
8/8/2014 19:11	65.9	10/8/2014 8:16	65.7	10/8/2014 17:21	66.7	11/8/2014 22:26	65.9
8/8/2014 19:16	65.7	10/8/2014 8:21	66.2	10/8/2014 17:26	66.0	11/8/2014 22:31	65.6
8/8/2014 19:21	66.4	10/8/2014 8:26	65.6	10/8/2014 17:31	66.2	11/8/2014 22:36	65.3
8/8/2014 19:26	65.6	10/8/2014 8:31	65.6	10/8/2014 17:36	65.6	11/8/2014 22:41	64.8
8/8/2014 19:31	64.8	10/8/2014 8:36	66.1	10/8/2014 17:41	66.3	11/8/2014 22:46	65.5
8/8/2014 19:36	66.4	10/8/2014 8:41	65.9	10/8/2014 17:46	66.0	11/8/2014 22:51	65.6
8/8/2014 19:41	66.7	10/8/2014 8:46	66.0	10/8/2014 17:51	66.1	11/8/2014 22:56	65.3
8/8/2014 19:46	66.6	10/8/2014 8:51	65.6	10/8/2014 17:56	65.7	12/8/2014 19:01	64.8
8/8/2014 19:51	66.6	10/8/2014 8:56	66.6	10/8/2014 18:01	66.3	12/8/2014 19:06	63.9
8/8/2014 19:56	66.3	10/8/2014 9:01	66.1	10/8/2014 18:06	66.1	12/8/2014 19:11	63.4
8/8/2014 20:01	66.2	10/8/2014 9:06	65.6	10/8/2014 18:11	65.8	12/8/2014 19:16	63.5
8/8/2014 20:06	66.2	10/8/2014 9:11	65.8	10/8/2014 18:16	66.1	12/8/2014 19:21	64.6
8/8/2014 20:11	66.4	10/8/2014 9:16	66.4	10/8/2014 18:21	65.7	12/8/2014 19:26	69.3
8/8/2014 20:16	66.5	10/8/2014 9:21	66.2	10/8/2014 18:26	65.9	12/8/2014 19:31	68.3
8/8/2014 20:21	66.5	10/8/2014 9:26	67.0	10/8/2014 18:31	66.3	12/8/2014 19:36	68.1
8/8/2014 20:26	66.4	10/8/2014 9:31	67.0	10/8/2014 18:36	66.0	12/8/2014 19:41	68.6
8/8/2014 20:31	66.1	10/8/2014 9:36	66.2	10/8/2014 18:41	66.4	12/8/2014 19:46	64.7
8/8/2014 20:36	66.2	10/8/2014 9:41	67.3	10/8/2014 18:46	65.9	12/8/2014 19:51	68.7
8/8/2014 20:41	65.8	10/8/2014 9:46	66.4	10/8/2014 18:51	66.0	12/8/2014 19:56	68.3
8/8/2014 20:46	66.4	10/8/2014 9:51	66.3	10/8/2014 18:56	65.8	12/8/2014 20:01	67.2
8/8/2014 20:51	66.2	10/8/2014 9:56	66.7	10/8/2014 19:01	65.9	12/8/2014 20:06	67.3
8/8/2014 20:56	66.0	10/8/2014 10:01	66.6	10/8/2014 19:06	65.8	12/8/2014 20:11	67.5
8/8/2014 21:01	65.6	10/8/2014 10:06	66.1	10/8/2014 19:11	65.8	12/8/2014 20:16	67.6
8/8/2014 21:06	65.6	10/8/2014 10:11	67.1	10/8/2014 19:16	65.6	12/8/2014 20:21	67.9
8/8/2014 21:11	65.8	10/8/2014 10:16	66.4	10/8/2014 19:21	66.0	12/8/2014 20:26	67.1
8/8/2014 21:16	66.2	10/8/2014 10:21	66.2	10/8/2014 19:26	65.7	12/8/2014 20:31	66.5
8/8/2014 21:21	67.1	10/8/2014 10:26	66.0	10/8/2014 19:31	66.0	12/8/2014 20:36	67.1
8/8/2014 21:26	66.4	10/8/2014 10:31	66.4	10/8/2014 19:36	65.6	12/8/2014 20:41	67.3
8/8/2014 21:31	66.1	10/8/2014 10:36	66.1	10/8/2014 19:41	65.6	12/8/2014 20:46	67.5
8/8/2014 21:36	65.7	10/8/2014 10:41	66.2	10/8/2014 19:46	66.0	12/8/2014 20:51	67.0
8/8/2014 21:41	66.1	10/8/2014 10:46	66.6	10/8/2014 19:51	65.7	12/8/2014 20:56	66.7
8/8/2014 21:46	65.6	10/8/2014 10:51	66.7	10/8/2014 19:56	65.7	12/8/2014 21:01	65.7
8/8/2014 21:51	65.7	10/8/2014 10:56	66.7	10/8/2014 20:01	65.7	12/8/2014 21:06	67.1
8/8/2014 21:56	66.0	10/8/2014 11:01	66.5	10/8/2014 20:06	65.9	12/8/2014 21:11	67.1
8/8/2014 22:01	65.8	10/8/2014 11:06	66.2	10/8/2014 20:11	65.4	12/8/2014 21:16	67.1
8/8/2014 22:06	65.4	10/8/2014 11:11	67.1	10/8/2014 20:16	65.2	12/8/2014 21:21	67.0
8/8/2014 22:11	65.5	10/8/2014 11:16	65.9	10/8/2014 20:21	66.2	12/8/2014 21:26	67.0
8/8/2014 22:16	65.6	10/8/2014 11:21	65.9	10/8/2014 20:26	65.4	12/8/2014 21:31	66.9
8/8/2014 22:21	65.6	10/8/2014 11:26	66.6	10/8/2014 20:31	64.9	12/8/2014 21:36	66.9
8/8/2014 22:26	65.7	10/8/2014 11:31	67.5	10/8/2014 20:36	65.9	12/8/2014 21:41	67.3
8/8/2014 22:31	65.7	10/8/2014 11:36	65.9	10/8/2014 20:41	65.7	12/8/2014 21:46	66.7
8/8/2014 22:36	66.0	10/8/2014 11:41	66.8	10/8/2014 20:46	65.2	12/8/2014 21:51	66.5
8/8/2014 22:41	65.7	10/8/2014 11:46	65.9	10/8/2014 20:51	65.3	12/8/2014 21:56	66.5
8/8/2014 22:46	65.6	10/8/2014 11:51	65.2	10/8/2014 20:56	66.1	12/8/2014 22:01	66.6
8/8/2014 22:51	65.8	10/8/2014 11:56	64.8	10/8/2014 21:01	65.7	12/8/2014 22:06	66.6
8/8/2014 22:56	66.3	10/8/2014 12:01	65.7	10/8/2014 21:06	65.6	12/8/2014 22:11	66.4
9/8/2014 19:01	65.9	10/8/2014 12:06	65.4	10/8/2014 21:11	65.8	12/8/2014 22:16	66.5
9/8/2014 19:06	65.6	10/8/2014 12:11	66.0	10/8/2014 21:16	65.9	12/8/2014 22:21	66.1
9/8/2014 19:11	65.6	10/8/2014 12:16	65.6	10/8/2014 21:21	66.4	12/8/2014 22:26	66.1
9/8/2014 19:16	65.8	10/8/2014 12:21	65.0	10/8/2014 21:26	65.8	12/8/2014 22:31	66.1
9/8/2014 19:21	65.9	10/8/2014 12:26	65.2	10/8/2014 21:31	65.7	12/8/2014 22:36	66.0
9/8/2014 19:26	65.1	10/8/2014 12:31	66.5	10/8/2014 21:36	66.7	12/8/2014 22:41	66.2
9/8/2014 19:31	65.4	10/8/2014 12:36	66.1	10/8/2014 21:41	65.9	12/8/2014 22:46	66.4
9/8/2014 19:36	65.7	10/8/2014 12:41	65.8	10/8/2014 21:46	66.1	12/8/2014 22:51	66.1
9/8/2014 19:41	65.7	10/8/2014 12:46	66.4	10/8/2014 21:51	65.4	12/8/2014 22:56	66.0
9/8/2014 19:46	66.1	10/8/2014 12:51	66.2	10/8/2014 21:56	65.3	13/8/2014 19:01	67.1
9/8/2014 19:51	65.8	10/8/2014 12:56	66.5	10/8/2014 22:01	65.5	13/8/2014 19:06	66.8
9/8/2014 19:56	65.2	10/8/2014 13:01	66.7	10/8/2014 22:06	65.3	13/8/2014 19:11	67.0
9/8/2014 20:01	65.9	10/8/2014 13:06	66.3	10/8/2014 22:11	65.1	13/8/2014 19:16	67.1
9/8/2014 20:06	66.5	10/8/2014 13:11	65.9	10/8/2014 22:16	65.4	13/8/2014 19:21	67.1
9/8/2014 20:11	66.0	10/8/2014 13:16	66.0	10/8/2014 22:21	65.3	13/8/2014 19:26	69.0
9/8/2014 20:16	65.7	10/8/2014 13:21	66.1	10/8/2014 22:26	65.1	13/8/2014 19:31	69.2
9/8/2014 20:21	65.8	10/8/2014 13:26	66.0	10/8/2014 22:31	65.3	13/8/2014 19:36	67.6
9/8/2014 20:26	65.5	10/8/2014 13:31	65.7	10/8/2014 22:36	65.1	13/8/2014 19:41	67.3
9/8/2014 20:31	65.5	10/8/2014 13:36	65.6	10/8/2014 22:41	65.0	13/8/2014 19:46	66.9
9/8/2014 20:36	65.4	10/8/2014 13:41	66.0	10/8/2014 22:46	65.5	13/8/2014 19:51	67.5
9/8/2014 20:41	65.7	10/8/2014 13:46	66.5	10/8/2014 22:51	65.1	13/8/2014 19:56	66.5
9/8/2014 20:46	65.2	10/8/2014 13:51	66.4	10/8/2014 22:56	65.1	13/8/2014 20:01	66.7
9/8/2014 20:51	65.2	10/8/2014 13:56	66.8	11/8/2014 19:01	66.2	13/8/2014 20:06	66.5
9/8/2014 20:56	65.1	10/8/2014 14:01	66.1	11/8/2014 19:06	66.1	13/8/2014 20:11	66.7
9/8/2014 21:01	65.2	10/8/2014 14:06	66.1	11/8/2014 19:11	66.0	13/8/2014 20:16	66.6
9/8/2014 21:06	65.4	10/8/2014 14:11	66.0	11/8/2014 19:16	66.2	13/8/2014 20:21	67.5
9/8/2014 21:11	65.3	10/8/2014 14:16	65.7	11/8/2014 19:21	66.6	13/8/2014 20:26	67.8
9/8/2014 21:16	65.4	10/8/2014 14:21	65.7	11/8/2014 19:26	66.6	13/8/2014 20:31	67.3
9/8/2014 21:21	65.4	10/8/2014 14:26	65.4	11/8/2014 19:31	66.1	13/8/2014 20:36	67.0
9/8/2014 21:26	65.1	10/8/2014 14:31	65.9	11/8/2014 19:36	65.9	13/8/2014 20:41	66.9
9/8/2014 21:31	65.2	10/8/2014 14:36	66.3	11/8/2014 19:41	65.5	13/8/2014 20:46	67.2
9/8/2014 21:36	65.4	10/8/2014 14:41	66.4	11/8/2014 19:46			

Real-time Noise Data		RTN1 (Food and Environmental Hygiene Department Depot)					
17/8/2014 11:36	65.8	17/8/2014 20:41	65.2	19/8/2014 21:46	67.1	21/8/2014 22:51	65.6
17/8/2014 11:41	65.9	17/8/2014 20:46	65.0	19/8/2014 21:51	67.2	21/8/2014 22:56	65.4
17/8/2014 11:46	67.0	17/8/2014 20:51	65.1	19/8/2014 21:56	67.0	22/8/2014 19:01	64.7
17/8/2014 11:51	65.3	17/8/2014 20:56	65.2	19/8/2014 22:01	67.3	22/8/2014 19:06	64.9
17/8/2014 11:56	66.7	17/8/2014 21:01	65.4	19/8/2014 22:06	67.1	22/8/2014 19:11	64.4
17/8/2014 12:01	65.5	17/8/2014 21:06	65.2	19/8/2014 22:11	67.0	22/8/2014 19:16	64.4
17/8/2014 12:06	65.6	17/8/2014 21:11	65.2	19/8/2014 22:16	67.2	22/8/2014 19:21	64.1
17/8/2014 12:11	65.2	17/8/2014 21:16	65.4	19/8/2014 22:21	67.4	22/8/2014 19:26	64.3
17/8/2014 12:16	65.4	17/8/2014 21:21	65.3	19/8/2014 22:26	67.1	22/8/2014 19:31	64.1
17/8/2014 12:21	65.2	17/8/2014 21:26	64.8	19/8/2014 22:31	67.0	22/8/2014 19:36	64.4
17/8/2014 12:26	65.8	17/8/2014 21:31	65.1	19/8/2014 22:36	66.6	22/8/2014 19:41	64.5
17/8/2014 12:31	65.9	17/8/2014 21:36	65.3	19/8/2014 22:41	66.8	22/8/2014 19:46	65.1
17/8/2014 12:36	65.8	17/8/2014 21:41	65.1	19/8/2014 22:46	66.8	22/8/2014 19:51	65.3
17/8/2014 12:41	65.7	17/8/2014 21:46	64.8	19/8/2014 22:51	66.9	22/8/2014 19:56	65.7
17/8/2014 12:46	65.9	17/8/2014 21:51	65.2	19/8/2014 22:56	66.6	22/8/2014 20:01	65.8
17/8/2014 12:51	65.2	17/8/2014 21:56	64.7	20/8/2014 19:01	66.6	22/8/2014 20:06	66.3
17/8/2014 12:56	65.8	17/8/2014 22:01	65.0	20/8/2014 19:06	66.1	22/8/2014 20:11	65.7
17/8/2014 13:01	65.3	17/8/2014 22:06	65.2	20/8/2014 19:11	66.3	22/8/2014 20:16	66.0
17/8/2014 13:06	65.3	17/8/2014 22:11	65.3	20/8/2014 19:16	66.7	22/8/2014 20:21	65.6
17/8/2014 13:11	65.9	17/8/2014 22:16	65.2	20/8/2014 19:21	67.3	22/8/2014 20:26	65.5
17/8/2014 13:16	65.8	17/8/2014 22:21	64.9	20/8/2014 19:26	68.3	22/8/2014 20:31	65.6
17/8/2014 13:21	65.4	17/8/2014 22:26	64.8	20/8/2014 19:31	68.4	22/8/2014 20:36	65.8
17/8/2014 13:26	65.7	17/8/2014 22:31	65.3	20/8/2014 19:36	68.2	22/8/2014 20:41	65.8
17/8/2014 13:31	65.8	17/8/2014 22:36	65.0	20/8/2014 19:41	68.0	22/8/2014 20:46	65.7
17/8/2014 13:36	65.4	17/8/2014 22:41	65.1	20/8/2014 19:46	68.1	22/8/2014 20:51	65.9
17/8/2014 13:41	65.8	17/8/2014 22:46	64.8	20/8/2014 19:51	67.7	22/8/2014 20:56	66.1
17/8/2014 13:46	64.9	17/8/2014 22:51	64.8	20/8/2014 19:56	67.8	22/8/2014 21:01	65.8
17/8/2014 13:51	65.9	17/8/2014 22:56	65.3	20/8/2014 20:01	68.1	22/8/2014 21:06	65.5
17/8/2014 13:56	65.7	18/8/2014 19:01	64.7	20/8/2014 20:06	67.6	22/8/2014 21:11	65.6
17/8/2014 14:01	65.3	18/8/2014 19:06	65.4	20/8/2014 20:11	67.8	22/8/2014 21:16	65.6
17/8/2014 14:06	66.1	18/8/2014 19:11	65.7	20/8/2014 20:16	67.6	22/8/2014 21:21	65.9
17/8/2014 14:11	65.5	18/8/2014 19:16	66.0	20/8/2014 20:21	67.7	22/8/2014 21:26	65.6
17/8/2014 14:16	65.3	18/8/2014 19:21	66.3	20/8/2014 20:26	67.7	22/8/2014 21:31	65.6
17/8/2014 14:21	66.0	18/8/2014 19:26	66.2	20/8/2014 20:31	67.3	22/8/2014 21:36	65.5
17/8/2014 14:26	65.4	18/8/2014 19:31	66.1	20/8/2014 20:36	66.8	22/8/2014 21:41	65.5
17/8/2014 14:31	65.5	18/8/2014 19:36	66.1	20/8/2014 20:41	67.2	22/8/2014 21:46	65.3
17/8/2014 14:36	65.9	18/8/2014 19:41	66.0	20/8/2014 20:46	67.3	22/8/2014 21:51	65.5
17/8/2014 14:41	66.4	18/8/2014 19:46	65.5	20/8/2014 20:51	67.3	22/8/2014 21:56	65.3
17/8/2014 14:46	65.9	18/8/2014 19:51	65.7	20/8/2014 20:56	67.0	22/8/2014 22:01	65.3
17/8/2014 14:51	65.7	18/8/2014 19:56	65.8	20/8/2014 21:01	67.0	22/8/2014 22:06	65.9
17/8/2014 14:56	66.4	18/8/2014 20:01	66.1	20/8/2014 21:06	66.9	22/8/2014 22:11	65.6
17/8/2014 15:01	65.9	18/8/2014 20:06	65.9	20/8/2014 21:11	66.6	22/8/2014 22:16	65.9
17/8/2014 15:06	66.5	18/8/2014 20:11	65.4	20/8/2014 21:16	66.9	22/8/2014 22:21	66.1
17/8/2014 15:11	65.6	18/8/2014 20:16	65.5	20/8/2014 21:21	67.2	22/8/2014 22:26	65.3
17/8/2014 15:16	66.2	18/8/2014 20:21	65.5	20/8/2014 21:26	67.2	22/8/2014 22:31	65.7
17/8/2014 15:21	65.4	18/8/2014 20:26	65.5	20/8/2014 21:31	66.9	22/8/2014 22:36	65.4
17/8/2014 15:26	65.9	18/8/2014 20:31	66.2	20/8/2014 21:36	66.5	22/8/2014 22:41	65.1
17/8/2014 15:31	66.1	18/8/2014 20:36	65.2	20/8/2014 21:41	67.1	22/8/2014 22:46	65.7
17/8/2014 15:36	65.7	18/8/2014 20:41	65.5	20/8/2014 21:46	66.9	22/8/2014 22:51	65.6
17/8/2014 15:41	66.3	18/8/2014 20:46	65.6	20/8/2014 21:51	66.9	22/8/2014 22:56	65.5
17/8/2014 15:46	65.7	18/8/2014 20:51	65.3	20/8/2014 21:56	67.3	23/8/2014 19:01	65.7
17/8/2014 15:51	65.8	18/8/2014 20:56	65.1	20/8/2014 22:01	66.7	23/8/2014 19:06	65.5
17/8/2014 15:56	66.2	18/8/2014 21:01	65.0	20/8/2014 22:06	66.7	23/8/2014 19:11	65.5
17/8/2014 16:01	66.6	18/8/2014 21:06	65.2	20/8/2014 22:11	66.7	23/8/2014 19:16	65.8
17/8/2014 16:06	66.4	18/8/2014 21:11	64.9	20/8/2014 22:16	66.7	23/8/2014 19:21	65.7
17/8/2014 16:11	66.2	18/8/2014 21:16	65.3	20/8/2014 22:21	66.4	23/8/2014 19:26	66.6
17/8/2014 16:16	65.6	18/8/2014 21:21	65.7	20/8/2014 22:26	67.2	23/8/2014 19:31	66.2
17/8/2014 16:21	65.7	18/8/2014 21:26	65.4	20/8/2014 22:31	67.0	23/8/2014 19:36	65.8
17/8/2014 16:26	66.1	18/8/2014 21:31	65.3	20/8/2014 22:36	66.7	23/8/2014 19:41	65.9
17/8/2014 16:31	66.0	18/8/2014 21:36	64.9	20/8/2014 22:41	66.8	23/8/2014 19:46	65.7
17/8/2014 16:36	66.4	18/8/2014 21:41	65.2	20/8/2014 22:46	66.6	23/8/2014 19:51	66.6
17/8/2014 16:41	66.5	18/8/2014 21:46	65.9	20/8/2014 22:51	66.8	23/8/2014 19:56	66.2
17/8/2014 16:46	66.2	18/8/2014 21:51	65.6	20/8/2014 22:56	66.6	23/8/2014 20:01	66.3
17/8/2014 16:51	66.5	18/8/2014 21:56	65.2	21/8/2014 19:01	64.8	23/8/2014 20:06	66.4
17/8/2014 16:56	66.8	18/8/2014 22:01	64.7	21/8/2014 19:06	65.0	23/8/2014 20:11	66.1
17/8/2014 17:01	66.8	18/8/2014 22:06	64.6	21/8/2014 19:11	64.6	23/8/2014 20:16	66.1
17/8/2014 17:06	65.7	18/8/2014 22:11	65.0	21/8/2014 19:16	64.6	23/8/2014 20:21	66.4
17/8/2014 17:11	66.0	18/8/2014 22:16	65.0	21/8/2014 19:21	65.1	23/8/2014 20:26	66.5
17/8/2014 17:16	65.5	18/8/2014 22:21	65.2	21/8/2014 19:26	65.4	23/8/2014 20:31	66.3
17/8/2014 17:21	64.9	18/8/2014 22:26	64.8	21/8/2014 19:31	64.8	23/8/2014 20:36	66.2
17/8/2014 17:26	65.3	18/8/2014 22:31	65.1	21/8/2014 19:36	65.1	23/8/2014 20:41	66.3
17/8/2014 17:31	65.1	18/8/2014 22:36	64.9	21/8/2014 19:41	65.8	23/8/2014 20:46	66.4
17/8/2014 17:36	64.4	18/8/2014 22:41	64.8	21/8/2014 19:46	65.5	23/8/2014 20:51	66.1
17/8/2014 17:41	65.2	18/8/2014 22:46	64.7	21/8/2014 19:51	65.5	23/8/2014 20:56	66.3
17/8/2014 17:46	65.1	18/8/2014 22:51	64.9	21/8/2014 19:56	66.6	23/8/2014 21:01	66.5
17/8/2014 17:51	65.2	18/8/2014 22:56	65.5	21/8/2014 20:01	66.2	23/8/2014 21:06	66.3
17/8/2014 17:56	65.1	19/8/2014 19:01	67.5	21/8/2014 20:06	66.3	23/8/2014 21:11	66.5
17/8/2014 18:01	65.0	19/8/2014 19:06	67.8	21/8/2014 20:11	65.5	23/8/2014 21:16	66.4
17/8/2014 18:06	65.0	19/8/2014 19:11	67.9	21/8/2014 20:16	66.1	23/8/2014 21:21	66.6
17/8/2014 18:11	64.8	19/8/2014 19:16	67.3	21/8/2014 20:21	66.0	23/8/2014 21:26	66.3
17/8/2014 18:16	65.3	19/8/2014 19:21	67.6	21/8/2014 20:26	65.8	23/8/2014 21:31	66.3
17/8/2014 18:21	64.9	19/8/2014 19:26	67.6	21/8/2014 20:31	66.1	23/8/2014 21:36	66.1
17/8/2014 18:26	65.2	19/8/2014 19:31	67.1	21/8/2014 20:36	66.4	23/8/2014 21:41	66.4
17/8/2014 18:31	65.0	19/8/2014 19:36	67.2	21/8/2014 20:41	65.9	23/8/2014 21:46	66.3
17/8/2014 18:36	64.9	19/8/2014 19:41	67.4	21/8/2014 20:46	65.7	23/8/2014 21:51	66.2
17/8/2014 18:41	65.3	19/8/2014 19:46	67.7	21/8/2014 20:51	66.2	23/8/2014 21:56	66.5
17/8/2014 18:46	64.8	19/8/2014 19:51	67.8	21/8/2014 20:56	66.2	23/8/2014 22:01	66.4
17/8/2014 18:51	65.8	19/8/2014 19:56	67.4	21/8/2014 21:01	65.6	23/8/2014 22:06	66.5
17/8/2014 18:56	65.3	19/8/2014 20:01	67.4	21/8/2014 21:06	66.8	23/8/2014 22:11	67.0
17/8/2014 19:01	65.1	19/8/2014 20:06	67.3	21/8/2014 21:11	66.0	23/8/2014 22:16	66.5
17/8/2014 19:06	65.4	19/8/2014 20:11	67.5	21/8/2014 21:16	66.6	23/8/2014 22:21	66.3
17/8/2014 19:11	65.6	19/8/2014 20:16	67.5	21/8/2014 21:21	65.6	23/8/2014 22:26	66.3
17/8/2014 19:16	65.5	19/8/2014 20:21	67.4	21/8/2014 21:26	66.6	23/8/2014 22:31	66.3
17/8/2014 19:21	65.5	19/8/2014 20:26	67.1	21/8/2014 21:31	66.3	23/8/2014 22:36	66.3
17/8/2014 19:26	64.9	19/8/2014 20:31	66.8	21/8/2014 21:36	66.4	23/8/2014 22:41	66.2
17/8/2014 19:31	65.0	19/8/2014 20:36	66.9	21/8/2014 21:41	65.7	23/8/2014 22:46	66.3
17/8/2014 19:36	65.2	19/8/2014 20:41	67.1	21/8/2014 21:46	66.3	23/8/2014 22:51	66.3
17/8/2014 19:41	65.3	19/8/2014 20:46	67.2	21/8/2014 21:51	65.7	23/8/2014 22:56	66.3
17/8/2014 19:46	65.2	19/8/2014 20:51	67.3	21/8/2014 21:56	65.9	24/8/2014 7:01	65.9
17/8/2014 19:51	64.9	19/8/2014 20:56	67.2	21/8/2014 22:01	65.7	24/8/2014 7:06	65.9
17/8/2014 19:56	65.1	19/8/2014 21:01	67.0	21/8/2014 22:06	66.1	24/8/2014 7:11	66.0
17/8/2014 20:01	65.1	19/8/2014 21:06	67				

Real-time Noise Data		RTN1 (Food and Environmental Hygiene Department Depot)	
25/8/2014 22:06	65.7		29/7/2014 0:51 58.5
25/8/2014 22:11	65.8	Night time: 23:00-07:00	29/7/2014 0:56 59.1
25/8/2014 22:16	65.7		29/7/2014 1:01 58.5
25/8/2014 22:21	65.3	28/7/2014 0:01 61.1	29/7/2014 1:06 57.3
25/8/2014 22:26	65.1	28/7/2014 0:06 61.0	29/7/2014 1:11 56.7
25/8/2014 22:31	65.3	28/7/2014 0:11 61.2	29/7/2014 1:16 55.1
25/8/2014 22:36	65.1	28/7/2014 0:16 61.7	29/7/2014 1:21 57.1
25/8/2014 22:41	65.2	28/7/2014 0:21 59.7	29/7/2014 1:26 57.3
25/8/2014 22:46	65.2	28/7/2014 0:26 59.6	29/7/2014 1:31 56.1
25/8/2014 22:51	65.0	28/7/2014 0:31 60.3	29/7/2014 1:36 56.4
25/8/2014 22:56	65.3	28/7/2014 0:36 57.7	29/7/2014 1:41 57.5
26/8/2014 19:01	66.2	28/7/2014 0:41 58.9	29/7/2014 1:46 57.0
26/8/2014 19:06	65.9	28/7/2014 0:46 56.3	29/7/2014 1:51 58.0
26/8/2014 19:11	65.9	28/7/2014 0:51 57.9	29/7/2014 1:56 52.1
26/8/2014 19:16	66.1	28/7/2014 0:56 59.5	29/7/2014 2:01 50.6
26/8/2014 19:21	66.3	28/7/2014 1:01 56.4	29/7/2014 2:06 51.0
26/8/2014 19:26	66.6	28/7/2014 1:06 58.1	29/7/2014 2:11 49.3
26/8/2014 19:31	66.1	28/7/2014 1:11 54.1	29/7/2014 2:16 52.5
26/8/2014 19:36	66.6	28/7/2014 1:16 55.8	29/7/2014 2:21 49.3
26/8/2014 19:41	65.7	28/7/2014 1:21 52.6	29/7/2014 2:26 48.4
26/8/2014 19:46	66.5	28/7/2014 1:26 58.2	29/7/2014 2:31 61.7
26/8/2014 19:51	65.9	28/7/2014 1:31 53.6	29/7/2014 2:36 53.5
26/8/2014 19:56	65.8	28/7/2014 1:36 56.9	29/7/2014 2:41 61.7
26/8/2014 20:01	65.9	28/7/2014 1:41 47.4	29/7/2014 2:46 46.0
26/8/2014 20:06	65.8	28/7/2014 1:46 57.2	29/7/2014 2:51 61.7
26/8/2014 20:11	65.8	28/7/2014 1:51 53.8	29/7/2014 2:56 43.3
26/8/2014 20:16	65.7	28/7/2014 1:56 52.4	29/7/2014 3:01 61.7
26/8/2014 20:21	65.9	28/7/2014 2:01 54.4	29/7/2014 3:06 41.6
26/8/2014 20:26	65.3	28/7/2014 2:06 45.6	29/7/2014 3:11 61.7
26/8/2014 20:31	65.4	28/7/2014 2:11 52.5	29/7/2014 3:16 61.4
26/8/2014 20:36	65.4	28/7/2014 2:16 61.4	29/7/2014 3:21 61.2
26/8/2014 20:41	65.8	28/7/2014 2:21 51.9	29/7/2014 3:26 61.5
26/8/2014 20:46	65.1	28/7/2014 2:26 43.3	29/7/2014 3:31 61.9
26/8/2014 20:51	66.0	28/7/2014 2:31 61.3	29/7/2014 3:36 43.3
26/8/2014 20:56	65.1	28/7/2014 2:36 61.5	29/7/2014 3:41 61.2
26/8/2014 21:01	65.4	28/7/2014 2:41 61.8	29/7/2014 3:46 48.2
26/8/2014 21:06	65.3	28/7/2014 2:46 40.3	29/7/2014 3:51 61.7
26/8/2014 21:11	65.3	28/7/2014 2:51 57.6	29/7/2014 3:56 61.4
26/8/2014 21:16	65.6	28/7/2014 2:56 61.3	29/7/2014 4:01 61.6
26/8/2014 21:21	65.1	28/7/2014 3:01 61.7	29/7/2014 4:06 61.8
26/8/2014 21:26	65.7	28/7/2014 3:06 61.8	29/7/2014 4:11 61.8
26/8/2014 21:31	65.1	28/7/2014 3:11 61.7	29/7/2014 4:16 61.7
26/8/2014 21:36	65.0	28/7/2014 3:16 61.7	29/7/2014 4:21 61.5
26/8/2014 21:41	65.3	28/7/2014 3:21 61.8	29/7/2014 4:26 61.0
26/8/2014 21:46	65.7	28/7/2014 3:26 61.0	29/7/2014 4:31 61.3
26/8/2014 21:51	65.4	28/7/2014 3:31 60.8	29/7/2014 4:36 61.5
26/8/2014 21:56	65.5	28/7/2014 3:36 61.4	29/7/2014 4:41 61.9
26/8/2014 22:01	65.1	28/7/2014 3:41 61.6	29/7/2014 4:46 61.2
26/8/2014 22:06	65.0	28/7/2014 3:46 61.0	29/7/2014 4:51 45.1
26/8/2014 22:11	65.6	28/7/2014 3:51 50.9	29/7/2014 4:56 61.9
26/8/2014 22:16	65.2	28/7/2014 3:56 61.3	29/7/2014 5:01 61.4
26/8/2014 22:21	65.7	28/7/2014 4:01 61.5	29/7/2014 5:06 61.7
26/8/2014 22:26	65.4	28/7/2014 4:06 61.3	29/7/2014 5:11 61.7
26/8/2014 22:31	65.4	28/7/2014 4:11 61.1	29/7/2014 5:16 52.6
26/8/2014 22:36	65.4	28/7/2014 4:16 61.0	29/7/2014 5:21 61.9
26/8/2014 22:41	65.0	28/7/2014 4:21 61.4	29/7/2014 5:26 52.1
26/8/2014 22:46	65.8	28/7/2014 4:26 61.6	29/7/2014 5:31 52.7
26/8/2014 22:51	65.1	28/7/2014 4:31 61.7	29/7/2014 5:36 53.4
26/8/2014 22:56	65.1	28/7/2014 4:36 50.0	29/7/2014 5:41 52.0
27/8/2014 19:01	65.6	28/7/2014 4:41 60.9	29/7/2014 5:46 55.1
27/8/2014 19:06	65.9	28/7/2014 4:46 61.6	29/7/2014 5:51 54.1
27/8/2014 19:11	65.9	28/7/2014 4:51 61.4	29/7/2014 5:56 57.2
27/8/2014 19:16	66.1	28/7/2014 4:56 61.2	29/7/2014 6:01 56.2
27/8/2014 19:21	65.8	28/7/2014 5:01 53.7	29/7/2014 6:06 54.5
27/8/2014 19:26	66.0	28/7/2014 5:06 61.8	29/7/2014 6:11 58.0
27/8/2014 19:31	65.7	28/7/2014 5:11 61.6	29/7/2014 6:16 59.7
27/8/2014 19:36	65.3	28/7/2014 5:16 46.4	29/7/2014 6:21 59.2
27/8/2014 19:41	65.7	28/7/2014 5:21 46.7	29/7/2014 6:26 60.2
27/8/2014 19:46	65.2	28/7/2014 5:26 54.1	29/7/2014 6:31 60.4
27/8/2014 19:51	65.4	28/7/2014 5:31 61.8	29/7/2014 6:36 60.5
27/8/2014 19:56	65.9	28/7/2014 5:36 49.3	29/7/2014 6:41 62.0
27/8/2014 20:01	65.9	28/7/2014 5:41 52.8	29/7/2014 6:46 62.3
27/8/2014 20:06	66.0	28/7/2014 5:46 55.5	29/7/2014 6:51 62.7
27/8/2014 20:11	65.5	28/7/2014 5:51 57.6	29/7/2014 6:56 62.8
27/8/2014 20:16	66.0	28/7/2014 5:56 57.8	29/7/2014 23:01 63.4
27/8/2014 20:21	65.9	28/7/2014 6:01 55.4	29/7/2014 23:06 63.5
27/8/2014 20:26	66.1	28/7/2014 6:06 56.3	29/7/2014 23:11 61.9
27/8/2014 20:31	65.5	28/7/2014 6:11 59.2	29/7/2014 23:16 62.1
27/8/2014 20:36	65.1	28/7/2014 6:16 59.4	29/7/2014 23:21 62.2
27/8/2014 20:41	65.3	28/7/2014 6:21 58.4	29/7/2014 23:26 62.8
27/8/2014 20:46	65.5	28/7/2014 6:26 59.8	29/7/2014 23:31 62.3
27/8/2014 20:51	65.6	28/7/2014 6:31 61.1	29/7/2014 23:36 62.1
27/8/2014 20:56	65.4	28/7/2014 6:36 62.5	29/7/2014 23:41 62.0
27/8/2014 21:01	65.2	28/7/2014 6:41 62.2	29/7/2014 23:46 61.7
27/8/2014 21:06	65.1	28/7/2014 6:46 62.8	29/7/2014 23:51 61.2
27/8/2014 21:11	65.2	28/7/2014 6:51 63.1	29/7/2014 23:56 61.8
27/8/2014 21:16	64.6	28/7/2014 6:56 63.2	30/7/2014 0:01 61.3
27/8/2014 21:21	64.8	28/7/2014 23:01 62.3	30/7/2014 0:06 61.9
27/8/2014 21:26	64.9	28/7/2014 23:06 63.1	30/7/2014 0:11 60.6
27/8/2014 21:31	65.1	28/7/2014 23:11 62.7	30/7/2014 0:16 60.5
27/8/2014 21:36	64.8	28/7/2014 23:16 62.2	30/7/2014 0:21 61.4
27/8/2014 21:41	65.1	28/7/2014 23:21 61.7	30/7/2014 0:26 60.7
27/8/2014 21:46	65.0	28/7/2014 23:26 62.2	30/7/2014 0:31 60.3
27/8/2014 21:51	65.1	28/7/2014 23:31 62.4	30/7/2014 0:36 61.0
27/8/2014 21:56	65.3	28/7/2014 23:36 60.2	30/7/2014 0:41 59.0
27/8/2014 22:01	65.1	28/7/2014 23:41 61.3	30/7/2014 0:46 58.2
27/8/2014 22:06	67.2	28/7/2014 23:46 61.1	30/7/2014 0:51 58.7
27/8/2014 22:11	67.2	28/7/2014 23:51 61.1	30/7/2014 0:56 59.4
27/8/2014 22:16	66.9	28/7/2014 23:56 61.4	30/7/2014 1:01 57.6
27/8/2014 22:21	66.7	29/7/2014 0:01 61.5	30/7/2014 1:06 59.0
27/8/2014 22:26	66.5	29/7/2014 0:06 61.7	30/7/2014 1:11 57.3
27/8/2014 22:31	66.5	29/7/2014 0:11 62.3	30/7/2014 1:16 59.4
27/8/2014 22:36	66.5	29/7/2014 0:16 60.8	30/7/2014 1:21 56.4
27/8/2014 22:41	66.6	29/7/2014 0:21 60.7	30/7/2014 1:26 55.3
27/8/2014 22:46	66.0	29/7/2014 0:26 59.7	30/7/2014 1:31 57.8
27/8/2014 22:51	65.8	29/7/2014 0:31 60.6	30/7/2014 1:36 58.0
27/8/2014 22:56	65.9	29/7/2014 0:36 60.3	30/7/2014 1:41 57.2
		29/7/2014 0:41 59.6	30/7/2014 1:46 55.5
		29/7/2014 0:46 57.7	30/7/2014 1:51 56.0
			30/7/2014 1:56 56.6
			30/7/2014 2:01 54.2
			30/7/2014 2:06 54.7
			30/7/2014 2:11 49.1
			30/7/2014 2:16 54.7
			30/7/2014 2:21 49.8
			30/7/2014 2:26 48.8
			30/7/2014 2:31 52.5
			30/7/2014 2:36 61.8
			30/7/2014 2:41 53.4
			30/7/2014 2:46 61.6
			30/7/2014 2:51 52.9
			30/7/2014 2:56 42.5
			30/7/2014 3:01 61.3
			30/7/2014 3:06 54.2
			30/7/2014 3:11 61.6
			30/7/2014 3:16 61.7
			30/7/2014 3:21 61.5
			30/7/2014 3:26 61.5
			30/7/2014 3:31 61.6
			30/7/2014 3:36 50.1
			30/7/2014 3:41 61.6
			30/7/2014 3:46 61.4
			30/7/2014 3:51 51.9
			30/7/2014 3:56 61.6
			30/7/2014 4:01 61.5
			30/7/2014 4:06 61.6
			30/7/2014 4:11 61.6
			30/7/2014 4:16 61.8
			30/7/2014 4:21 48.2
			30/7/2014 4:26 61.0
			30/7/2014 4:31 61.1
			30/7/2014 4:36 61.8
			30/7/2014 4:41 61.8
			30/7/2014 4:46 61.5
			30/7/2014 4:51 61.7
			30/7/2014 4:56 61.4
			30/7/2014 5:01 49.3
			30/7/2014 5:06 61.8
			30/7/2014 5:11 59.0
			30/7/2014 5:16 40.3
			30/7/2014 5:21 59.2
			30/7/2014 5:26 60.3
			30/7/2014 5:31 59.5
			30/7/2014 5:36 61.5
			30/7/2014 5:41 61.4
			30/7/2014 5:46 62.0
			30/7/2014 5:51 62.7
			30/7/2014 5:56 62.6
			30/7/2014 6:01 62.9
			30/7/2014 6:06 62.7
			30/7/2014 6:11 62.2
			30/7/2014 6:16 62.0
			30/7/2014 6:21 62.6
			30/7/2014 6:26 62.1
			30/7/2014 6:31 63.3
			30/7/2014 6:36 62.3
			30/7/2014 6:41 61.7
			30/7/2014 6:46 62.3
			30/7/2014 6:51 62.3
			30/7/2014 6:56 62.3
			30/7/2014 23:01 62.2
			30/7/2014 23:06 61.6
			30/7/2014 23:11 61.6
			30/7/2014 23:16 62.7
			30/7/2014 23:21 60.3
			30/7/2014 23:26 61.3
			30/7/2014 23:31 61.8
			30/7/2014 23:36 62.4
			30/7/2014 23:41 61.4
			30/7/2014 23:46 61.2
			30/7/2014 23:51 60.7
			30/7/2014 23:56 61.5
			31/7/2014 0:01 60.7
			31/7/2014 0:06 60.6
			31/7/2014 0:11 61.3
			31/7/2014 0:16 60.4
			31/7/2014 0:21 60.4

Real-time Noise Data		RTN1 (Food and Environmental Hygiene Department Depot)									
2/8/2014 5:11	53.9	3/8/2014 6:16	59.5	4/8/2014 23:21	62.2	6/8/2014 0:26	61.1	7/8/2014 1:31	57.7	8/8/2014 2:36	56.3
2/8/2014 5:16	58.5	3/8/2014 6:21	60.6	4/8/2014 23:26	61.9	6/8/2014 0:31	58.7	7/8/2014 1:36	57.9	8/8/2014 2:41	56.4
2/8/2014 5:21	57.1	3/8/2014 6:26	61.1	4/8/2014 23:31	61.8	6/8/2014 0:36	58.6	7/8/2014 1:41	59.4	8/8/2014 2:46	55.3
2/8/2014 5:26	56.2	3/8/2014 6:31	60.6	4/8/2014 23:36	62.4	6/8/2014 0:41	58.2	7/8/2014 1:46	59.3	8/8/2014 2:51	54.6
2/8/2014 5:31	52.4	3/8/2014 6:36	60.1	4/8/2014 23:41	61.6	6/8/2014 0:46	56.9	7/8/2014 1:51	58.9	8/8/2014 2:56	44.0
2/8/2014 5:36	56.5	3/8/2014 6:41	60.3	4/8/2014 23:46	61.7	6/8/2014 0:51	58.4	7/8/2014 1:56	57.1	8/8/2014 3:01	58.1
2/8/2014 5:41	56.5	3/8/2014 6:46	60.7	4/8/2014 23:51	62.7	6/8/2014 0:56	57.5	7/8/2014 2:01	56.2	8/8/2014 3:06	53.7
2/8/2014 5:46	58.2	3/8/2014 6:51	62.1	4/8/2014 23:56	61.5	6/8/2014 1:01	60.8	7/8/2014 2:06	55.2	8/8/2014 3:11	61.8
2/8/2014 5:51	59.9	3/8/2014 6:56	60.6	5/8/2014 0:01	61.7	6/8/2014 1:06	75.4	7/8/2014 2:11	57.8	8/8/2014 3:16	49.3
2/8/2014 5:56	59.1	3/8/2014 23:01	61.7	5/8/2014 0:06	61.5	6/8/2014 1:11	67.6	7/8/2014 2:16	56.7	8/8/2014 3:21	61.7
2/8/2014 6:01	60.0	3/8/2014 23:06	61.3	5/8/2014 0:11	62.1	6/8/2014 1:16	68.8	7/8/2014 2:21	56.5	8/8/2014 3:26	52.1
2/8/2014 6:06	59.9	3/8/2014 23:11	61.7	5/8/2014 0:16	60.9	6/8/2014 1:21	64.7	7/8/2014 2:26	54.5	8/8/2014 3:31	50.3
2/8/2014 6:11	60.7	3/8/2014 23:16	61.7	5/8/2014 0:21	61.2	6/8/2014 1:26	61.1	7/8/2014 2:31	54.6	8/8/2014 3:36	52.4
2/8/2014 6:16	60.1	3/8/2014 23:21	61.9	5/8/2014 0:26	61.0	6/8/2014 1:31	60.5	7/8/2014 2:36	57.1	8/8/2014 3:41	45.6
2/8/2014 6:21	59.7	3/8/2014 23:26	60.7	5/8/2014 0:31	60.1	6/8/2014 1:36	59.7	7/8/2014 2:41	55.2	8/8/2014 3:46	52.3
2/8/2014 6:26	60.8	3/8/2014 23:31	60.5	5/8/2014 0:36	59.4	6/8/2014 1:41	58.7	7/8/2014 2:46	56.5	8/8/2014 3:51	53.4
2/8/2014 6:31	61.4	3/8/2014 23:36	60.9	5/8/2014 0:41	60.0	6/8/2014 1:46	60.6	7/8/2014 2:51	53.5	8/8/2014 3:56	52.4
2/8/2014 6:36	61.0	3/8/2014 23:41	61.4	5/8/2014 0:46	59.1	6/8/2014 1:51	59.3	7/8/2014 2:56	42.5	8/8/2014 4:01	54.8
2/8/2014 6:41	62.0	3/8/2014 23:46	62.2	5/8/2014 0:51	58.3	6/8/2014 1:56	56.5	7/8/2014 3:01	54.8	8/8/2014 4:06	53.6
2/8/2014 6:46	62.4	3/8/2014 23:51	58.9	5/8/2014 0:56	59.3	6/8/2014 2:01	57.7	7/8/2014 3:06	45.1	8/8/2014 4:11	52.9
2/8/2014 6:51	61.9	3/8/2014 23:56	61.1	5/8/2014 1:01	58.2	6/8/2014 2:06	54.7	7/8/2014 3:11	53.4	8/8/2014 4:16	49.4
2/8/2014 6:56	60.9	4/8/2014 0:01	60.6	5/8/2014 1:06	58.3	6/8/2014 2:11	55.1	7/8/2014 3:16	53.7	8/8/2014 4:21	51.9
2/8/2014 23:01	62.1	4/8/2014 0:06	59.0	5/8/2014 1:11	57.6	6/8/2014 2:16	55.9	7/8/2014 3:21	61.9	8/8/2014 4:26	61.6
2/8/2014 23:06	62.9	4/8/2014 0:11	60.4	5/8/2014 1:16	64.3	6/8/2014 2:21	57.0	7/8/2014 3:26	58.0	8/8/2014 4:31	45.6
2/8/2014 23:11	62.4	4/8/2014 0:16	59.5	5/8/2014 1:21	56.5	6/8/2014 2:26	55.0	7/8/2014 3:31	53.4	8/8/2014 4:36	44.6
2/8/2014 23:16	61.9	4/8/2014 0:21	62.9	5/8/2014 1:26	58.1	6/8/2014 2:31	55.8	7/8/2014 3:36	53.2	8/8/2014 4:41	50.6
2/8/2014 23:21	62.2	4/8/2014 0:26	60.2	5/8/2014 1:31	55.4	6/8/2014 2:36	51.9	7/8/2014 3:41	50.6	8/8/2014 4:46	61.8
2/8/2014 23:26	61.1	4/8/2014 0:31	60.9	5/8/2014 1:36	55.7	6/8/2014 2:41	54.0	7/8/2014 3:46	50.3	8/8/2014 4:51	48.4
2/8/2014 23:31	61.6	4/8/2014 0:36	58.4	5/8/2014 1:41	54.5	6/8/2014 2:46	57.9	7/8/2014 3:51	61.8	8/8/2014 4:56	47.9
2/8/2014 23:36	62.2	4/8/2014 0:41	60.5	5/8/2014 1:46	54.3	6/8/2014 2:51	56.3	7/8/2014 3:56	52.5	8/8/2014 5:01	55.3
2/8/2014 23:41	70.2	4/8/2014 0:46	56.3	5/8/2014 1:51	53.6	6/8/2014 2:56	35.5	7/8/2014 4:01	51.0	8/8/2014 5:06	51.7
2/8/2014 23:46	70.2	4/8/2014 0:51	58.3	5/8/2014 1:56	53.9	6/8/2014 3:01	46.7	7/8/2014 4:06	48.6	8/8/2014 5:11	45.6
2/8/2014 23:51	69.2	4/8/2014 0:56	55.7	5/8/2014 2:01	51.3	6/8/2014 3:06	52.6	7/8/2014 4:11	47.4	8/8/2014 5:16	55.0
2/8/2014 23:56	67.9	4/8/2014 1:01	57.3	5/8/2014 2:06	54.3	6/8/2014 3:11	52.3	7/8/2014 4:16	43.3	8/8/2014 5:21	55.8
3/8/2014 0:01	65.6	4/8/2014 1:06	54.4	5/8/2014 2:11	47.6	6/8/2014 3:16	53.7	7/8/2014 4:21	42.5	8/8/2014 5:26	57.2
3/8/2014 0:06	65.7	4/8/2014 1:11	58.0	5/8/2014 2:16	55.7	6/8/2014 3:21	51.4	7/8/2014 4:26	61.9	8/8/2014 5:31	54.3
3/8/2014 0:11	68.8	4/8/2014 1:16	53.7	5/8/2014 2:21	47.6	6/8/2014 3:26	57.5	7/8/2014 4:31	61.8	8/8/2014 5:36	53.6
3/8/2014 0:16	70.3	4/8/2014 1:21	54.5	5/8/2014 2:26	53.4	6/8/2014 3:31	53.1	7/8/2014 4:36	53.0	8/8/2014 5:41	54.3
3/8/2014 0:21	70.6	4/8/2014 1:26	54.3	5/8/2014 2:31	58.3	6/8/2014 3:36	52.8	7/8/2014 4:41	61.7	8/8/2014 5:46	57.6
3/8/2014 0:26	69.5	4/8/2014 1:31	53.6	5/8/2014 2:36	53.3	6/8/2014 3:41	48.8	7/8/2014 4:46	61.2	8/8/2014 5:51	59.9
3/8/2014 0:31	68.8	4/8/2014 1:36	52.7	5/8/2014 2:41	61.7	6/8/2014 3:46	54.7	7/8/2014 4:51	51.7	8/8/2014 5:56	56.3
3/8/2014 0:36	66.7	4/8/2014 1:41	60.2	5/8/2014 2:46	50.4	6/8/2014 3:51	48.8	7/8/2014 4:56	51.5	8/8/2014 6:01	58.6
3/8/2014 0:41	65.0	4/8/2014 1:46	51.1	5/8/2014 2:51	42.5	6/8/2014 3:56	61.9	7/8/2014 5:01	53.1	8/8/2014 6:06	58.8
3/8/2014 0:46	63.3	4/8/2014 1:51	51.4	5/8/2014 2:56	61.6	6/8/2014 4:01	50.9	7/8/2014 5:06	48.2	8/8/2014 6:11	60.1
3/8/2014 0:51	63.9	4/8/2014 1:56	49.8	5/8/2014 3:01	52.6	6/8/2014 4:06	50.4	7/8/2014 5:11	57.5	8/8/2014 6:16	61.5
3/8/2014 0:56	62.4	4/8/2014 2:01	48.8	5/8/2014 3:06	61.7	6/8/2014 4:11	51.4	7/8/2014 5:16	53.8	8/8/2014 6:21	60.7
3/8/2014 1:01	62.0	4/8/2014 2:06	49.3	5/8/2014 3:11	43.3	6/8/2014 4:16	48.6	7/8/2014 5:21	59.6	8/8/2014 6:26	61.8
3/8/2014 1:06	62.5	4/8/2014 2:11	48.4	5/8/2014 3:16	54.1	6/8/2014 4:21	61.9	7/8/2014 5:26	63.0	8/8/2014 6:31	61.3
3/8/2014 1:11	62.6	4/8/2014 2:16	61.8	5/8/2014 3:21	40.3	6/8/2014 4:26	61.7	7/8/2014 5:31	60.6	8/8/2014 6:36	62.1
3/8/2014 1:16	61.9	4/8/2014 2:21	61.9	5/8/2014 3:26	52.3	6/8/2014 4:31	49.6	7/8/2014 5:36	54.2	8/8/2014 6:41	63.0
3/8/2014 1:21	62.0	4/8/2014 2:26	61.8	5/8/2014 3:31	48.2	6/8/2014 4:36	50.6	7/8/2014 5:41	62.3	8/8/2014 6:46	63.3
3/8/2014 1:26	61.4	4/8/2014 2:31	61.6	5/8/2014 3:36	47.4	6/8/2014 4:41	46.7	7/8/2014 5:46	61.2	8/8/2014 6:51	63.5
3/8/2014 1:31	61.2	4/8/2014 2:36	61.3	5/8/2014 3:41	61.7	6/8/2014 4:46	51.7	7/8/2014 5:51	60.6	8/8/2014 6:56	63.6
3/8/2014 1:36	60.4	4/8/2014 2:41	61.6	5/8/2014 3:46	61.5	6/8/2014 4:51	54.3	7/8/2014 5:56	59.6	8/8/2014 23:01	64.1
3/8/2014 1:41	60.8	4/8/2014 2:46	61.1	5/8/2014 3:51	61.8	6/8/2014 4:56	41.6	7/8/2014 6:01	57.8	8/8/2014 23:06	63.9
3/8/2014 1:46	60.7	4/8/2014 2:51	61.6	5/8/2014 3:56	52.5	6/8/2014 5:01	51.6	7/8/2014 6:06	59.3	8/8/2014 23:11	65.6
3/8/2014 1:51	59.1	4/8/2014 2:56	61.8	5/8/2014 4:01	35.5	6/8/2014 5:06	61.9	7/8/2014 6:11	60.8	8/8/2014 23:16	63.1
3/8/2014 1:56	60.3	4/8/2014 3:01	61.5	5/8/2014 4:06	61.8	6/8/2014 5:11	50.9	7/8/2014 6:16	61.8	8/8/2014 23:21	64.2
3/8/2014 2:01	59.7	4/8/2014 3:06	61.5	5/8/2014 4:11	61.7	6/8/2014 5:16	56.8	7/8/2014 6:21	59.3	8/8/2014 23:26	62.8
3/8/2014 2:06	58.6	4/8/2014 3:11	61.6	5/8/2014 4:16	61.8	6/8/2014 5:21	48.8	7/8/2014 6:26	63.7	8/8/2014 23:31	61.9
3/8/2014 2:11	60.0	4/8/2014 3:16	61.5	5/8/2014 4:21	61.8	6/8/2014 5:26	51.9	7/8/2014 6:31	67.3	8/8/2014 23:36	63.2
3/8/2014 2:16	59.2	4/8/2014 3:21	61.4	5/8/2014 4:26	61.8	6/8/2014 5:31	52.6	7/8/2014 6:36	67.0	8/8/2014 23:41	63.4
3/8/2014 2:21	59.3	4/8/2014 3:26	61.7	5/8/2014 4:31	44.6	6/8/2014 5:36	54.7	7/8/2014 6:41	66.2	8/8/2014 23:46	63.0
3/8/2014 2:26	60.3	4/8/2014 3:31	61.5	5/8/2014 4:36	61.8	6/8/2014 5:41	54.5	7/8/2014 6:46	67.3	8/8/2014 23:51	63.1
3/8/2014 2:31	59.4	4/8/2014 3:36	61.7	5/8/2014 4:41	61.3	6/8/2014 5:46	56.8	7/8/2014 6:51	66.4	8/8/2014 23:56	62.0
3/8/2014 2:36	58.9	4/8/2014 3:41	61.5	5/8/2014 4:46	43.3	6/8/2014 5:51	55.6	7/8/2014 6:56	65.6	9/8/2014 0:01	63.3
3/8/2014 2:41	57.7	4/8/2014 3:46	61.4	5/8/2014 4:51	47.4	6/8/2014 5:56	57.8	7/8/2014 23:01	66.6	9/8/2014 0:06	61.8
3/8/2014 2:46	62.4	4/8/2014 3:51	61.8	5/8/2014 4:56	61.6	6/8/2014 6:01	57.9	7/8/2014 23:06	66.4	9/8/2014 0:11	62.0
3/8/2014 2:51	58.3	4/8/2014 3:56	61.8	5/8/2014 5:01	61.3	6/8/2014 6:06	57.4	7/8/2014 23:11	67.4	9/8/2014 0:16	61.9
3/8/2014 2:56	59.4	4/8/2014 4:01	61.3	5/8/2014 5:06	46.0	6/8/2014 6:11	59.1	7/8/2014 23:16	65.9	9/8/2014 0:21	64.9
3/8/2014 3:01	57.4	4/8/2014 4:06	61.1	5/8/2014 5:11	42.5	6/8/2014 6:16	61.8	7/8/2014 23:21	64.8	9/8/2014 0:26	61.7
3/8/2014 3:06	58.2	4/8/2014 4:11	61.3	5/8/2014 5:16	55.9	6/8/2014 6:21	60.5	7/8/2014 23:26	64.1	9/8/2014 0:31	60.8
3/8/2014 3:11	61.6	4/8/2014 4:16	61.3	5/8/2014 5:21	42.5	6/8/2014 6:26	60.5	7/8/2014 23:31	63.9	9/8/2014 0:36	61.1
3/8/2014 3:16	57.5										

Real-time Noise Data		RTN1 (Food and Environmental Hygiene Department Depot)													
9/8/2014 3:41	56.2	10/8/2014 4:46	50.4	11/8/2014 5:51	57.4	12/8/2014 6:56	63.4	14/8/2014 0:01	63.3	15/8/2014 1:06	60.8				
9/8/2014 3:46	55.2	10/8/2014 4:51	49.3	11/8/2014 5:56	57.0	12/8/2014 23:01	63.4	14/8/2014 0:06	63.4	15/8/2014 1:11	59.0				
9/8/2014 3:51	58.9	10/8/2014 4:56	48.4	11/8/2014 6:01	56.7	12/8/2014 23:06	63.6	14/8/2014 0:11	63.0	15/8/2014 1:16	59.6				
9/8/2014 3:56	55.1	10/8/2014 5:01	51.6	11/8/2014 6:06	59.5	12/8/2014 23:11	63.4	14/8/2014 0:16	63.4	15/8/2014 1:21	59.2				
9/8/2014 4:01	49.1	10/8/2014 5:06	54.5	11/8/2014 6:11	57.8	12/8/2014 23:16	63.3	14/8/2014 0:21	62.9	15/8/2014 1:26	59.1				
9/8/2014 4:06	56.3	10/8/2014 5:11	52.1	11/8/2014 6:16	59.9	12/8/2014 23:21	63.8	14/8/2014 0:26	62.1	15/8/2014 1:31	57.3				
9/8/2014 4:11	55.0	10/8/2014 5:16	52.9	11/8/2014 6:21	60.2	12/8/2014 23:26	63.0	14/8/2014 0:31	62.7	15/8/2014 1:36	57.1				
9/8/2014 4:16	54.7	10/8/2014 5:21	56.5	11/8/2014 6:26	60.4	12/8/2014 23:31	63.2	14/8/2014 0:36	62.8	15/8/2014 1:41	57.4				
9/8/2014 4:21	56.2	10/8/2014 5:26	55.9	11/8/2014 6:31	61.4	12/8/2014 23:36	63.2	14/8/2014 0:41	62.6	15/8/2014 1:46	59.2				
9/8/2014 4:26	54.6	10/8/2014 5:31	54.6	11/8/2014 6:36	62.4	12/8/2014 23:41	62.6	14/8/2014 0:46	61.7	15/8/2014 1:51	58.4				
9/8/2014 4:31	54.8	10/8/2014 5:36	52.9	11/8/2014 6:41	62.2	12/8/2014 23:46	62.8	14/8/2014 0:51	61.0	15/8/2014 1:56	57.3				
9/8/2014 4:36	61.5	10/8/2014 5:41	56.5	11/8/2014 6:46	62.3	12/8/2014 23:51	63.3	14/8/2014 0:56	62.0	15/8/2014 2:01	54.7				
9/8/2014 4:41	56.5	10/8/2014 5:46	54.0	11/8/2014 6:51	63.1	12/8/2014 23:56	62.2	14/8/2014 1:01	60.5	15/8/2014 2:06	60.5				
9/8/2014 4:46	55.6	10/8/2014 5:51	57.1	11/8/2014 6:56	63.5	13/8/2014 0:01	62.6	14/8/2014 1:06	59.2	15/8/2014 2:11	55.0				
9/8/2014 4:51	60.3	10/8/2014 5:56	56.6	11/8/2014 23:01	62.7	13/8/2014 0:06	62.7	14/8/2014 1:11	60.6	15/8/2014 2:16	55.7				
9/8/2014 4:56	60.5	10/8/2014 6:01	56.3	11/8/2014 23:06	62.8	13/8/2014 0:11	62.0	14/8/2014 1:16	59.4	15/8/2014 2:21	61.1				
9/8/2014 5:01	55.3	10/8/2014 6:06	58.1	11/8/2014 23:11	61.7	13/8/2014 0:16	61.6	14/8/2014 1:21	60.9	15/8/2014 2:26	51.5				
9/8/2014 5:06	55.7	10/8/2014 6:11	57.7	11/8/2014 23:16	62.4	13/8/2014 0:21	61.7	14/8/2014 1:26	59.7	15/8/2014 2:31	56.0				
9/8/2014 5:11	53.8	10/8/2014 6:16	59.2	11/8/2014 23:21	62.8	13/8/2014 0:26	60.3	14/8/2014 1:31	59.3	15/8/2014 2:36	55.4				
9/8/2014 5:16	56.7	10/8/2014 6:21	59.6	11/8/2014 23:26	62.1	13/8/2014 0:31	61.3	14/8/2014 1:36	58.8	15/8/2014 2:41	53.1				
9/8/2014 5:21	56.3	10/8/2014 6:26	60.0	11/8/2014 23:31	61.4	13/8/2014 0:36	60.7	14/8/2014 1:41	60.2	15/8/2014 2:46	55.7				
9/8/2014 5:26	54.4	10/8/2014 6:31	60.1	11/8/2014 23:36	62.3	13/8/2014 0:41	60.0	14/8/2014 1:46	58.3	15/8/2014 2:51	54.3				
9/8/2014 5:31	57.1	10/8/2014 6:36	61.6	11/8/2014 23:41	61.3	13/8/2014 0:46	61.0	14/8/2014 1:51	58.4	15/8/2014 2:56	35.5				
9/8/2014 5:36	57.6	10/8/2014 6:41	60.7	11/8/2014 23:46	61.1	13/8/2014 0:51	60.0	14/8/2014 1:56	57.2	15/8/2014 3:01	38.5				
9/8/2014 5:41	56.7	10/8/2014 6:46	61.8	11/8/2014 23:51	61.3	13/8/2014 0:56	59.7	14/8/2014 2:01	59.5	15/8/2014 3:06	55.5				
9/8/2014 5:46	56.1	10/8/2014 6:51	64.2	11/8/2014 23:56	61.9	13/8/2014 1:01	58.3	14/8/2014 2:06	59.5	15/8/2014 3:11	52.0				
9/8/2014 5:51	58.4	10/8/2014 6:56	61.7	12/8/2014 0:01	60.7	13/8/2014 1:06	58.3	14/8/2014 2:11	56.4	15/8/2014 3:16	53.6				
9/8/2014 5:56	57.2	10/8/2014 23:01	61.6	12/8/2014 0:06	61.0	13/8/2014 1:11	58.6	14/8/2014 2:16	57.0	15/8/2014 3:21	54.2				
9/8/2014 6:01	58.2	10/8/2014 23:06	61.4	12/8/2014 0:11	60.2	13/8/2014 1:16	58.2	14/8/2014 2:21	56.6	15/8/2014 3:26	49.6				
9/8/2014 6:06	57.6	10/8/2014 23:11	61.5	12/8/2014 0:16	61.0	13/8/2014 1:21	58.6	14/8/2014 2:26	54.9	15/8/2014 3:31	53.4				
9/8/2014 6:11	58.3	10/8/2014 23:16	60.1	12/8/2014 0:21	60.6	13/8/2014 1:26	59.4	14/8/2014 2:31	54.9	15/8/2014 3:36	53.3				
9/8/2014 6:16	60.3	10/8/2014 23:21	62.8	12/8/2014 0:26	59.5	13/8/2014 1:31	59.0	14/8/2014 2:36	55.7	15/8/2014 3:41	53.8				
9/8/2014 6:21	58.2	10/8/2014 23:26	61.1	12/8/2014 0:31	60.1	13/8/2014 1:36	58.4	14/8/2014 2:41	56.3	15/8/2014 3:46	40.3				
9/8/2014 6:26	60.9	10/8/2014 23:31	60.8	12/8/2014 0:36	60.7	13/8/2014 1:41	57.1	14/8/2014 2:46	55.0	15/8/2014 3:51	50.3				
9/8/2014 6:31	60.5	10/8/2014 23:36	60.6	12/8/2014 0:41	58.9	13/8/2014 1:46	57.2	14/8/2014 2:51	56.2	15/8/2014 3:56	52.0				
9/8/2014 6:36	60.5	10/8/2014 23:41	60.1	12/8/2014 0:46	58.6	13/8/2014 1:51	58.2	14/8/2014 2:56	52.7	15/8/2014 4:01	48.4				
9/8/2014 6:41	61.1	10/8/2014 23:46	60.7	12/8/2014 0:51	57.2	13/8/2014 1:56	55.6	14/8/2014 3:01	52.9	15/8/2014 4:06	46.0				
9/8/2014 6:46	61.3	10/8/2014 23:51	60.1	12/8/2014 0:56	59.2	13/8/2014 2:01	56.6	14/8/2014 3:06	47.1	15/8/2014 4:11	46.7				
9/8/2014 6:51	61.5	10/8/2014 23:56	59.9	12/8/2014 1:01	56.9	13/8/2014 2:06	57.7	14/8/2014 3:11	49.3	15/8/2014 4:16	61.7				
9/8/2014 6:56	62.1	11/8/2014 0:01	61.0	12/8/2014 1:06	61.4	13/8/2014 2:11	57.8	14/8/2014 3:16	54.1	15/8/2014 4:21	61.9				
9/8/2014 23:01	61.9	11/8/2014 0:06	60.4	12/8/2014 1:11	57.0	13/8/2014 2:16	56.0	14/8/2014 3:21	55.8	15/8/2014 4:26	61.8				
9/8/2014 23:06	61.7	11/8/2014 0:11	59.5	12/8/2014 1:16	58.9	13/8/2014 2:21	56.6	14/8/2014 3:26	61.7	15/8/2014 4:31	61.7				
9/8/2014 23:11	62.2	11/8/2014 0:16	58.4	12/8/2014 1:21	57.1	13/8/2014 2:26	55.2	14/8/2014 3:31	53.1	15/8/2014 4:36	61.6				
9/8/2014 23:16	61.8	11/8/2014 0:21	60.5	12/8/2014 1:26	55.9	13/8/2014 2:31	55.3	14/8/2014 3:36	51.3	15/8/2014 4:41	50.0				
9/8/2014 23:21	62.1	11/8/2014 0:26	60.4	12/8/2014 1:31	53.9	13/8/2014 2:36	53.7	14/8/2014 3:41	61.9	15/8/2014 4:46	61.7				
9/8/2014 23:26	61.8	11/8/2014 0:31	59.2	12/8/2014 1:36	57.1	13/8/2014 2:41	55.0	14/8/2014 3:46	61.4	15/8/2014 4:51	61.8				
9/8/2014 23:31	62.6	11/8/2014 0:36	58.0	12/8/2014 1:41	56.7	13/8/2014 2:46	54.5	14/8/2014 3:51	52.9	15/8/2014 4:56	44.6				
9/8/2014 23:36	61.8	11/8/2014 0:41	59.4	12/8/2014 1:46	56.1	13/8/2014 2:51	54.3	14/8/2014 3:56	49.1	15/8/2014 5:01	52.1				
9/8/2014 23:41	62.8	11/8/2014 0:46	59.0	12/8/2014 1:51	55.2	13/8/2014 2:56	54.1	14/8/2014 4:01	61.9	15/8/2014 5:06	50.0				
9/8/2014 23:46	61.9	11/8/2014 0:51	57.9	12/8/2014 1:56	57.0	13/8/2014 3:01	52.4	14/8/2014 4:06	50.9	15/8/2014 5:11	46.4				
9/8/2014 23:51	63.1	11/8/2014 0:56	57.4	12/8/2014 2:01	52.6	13/8/2014 3:06	53.0	14/8/2014 4:11	53.3	15/8/2014 5:16	52.2				
9/8/2014 23:56	62.1	11/8/2014 1:01	54.2	12/8/2014 2:06	51.4	13/8/2014 3:11	46.4	14/8/2014 4:16	61.2	15/8/2014 5:21	51.1				
10/8/2014 0:01	62.4	11/8/2014 1:06	55.8	12/8/2014 2:11	52.0	13/8/2014 3:16	52.3	14/8/2014 4:21	48.7	15/8/2014 5:26	53.2				
10/8/2014 0:06	61.3	11/8/2014 1:11	55.2	12/8/2014 2:16	49.4	13/8/2014 3:21	49.6	14/8/2014 4:26	61.6	15/8/2014 5:31	56.2				
10/8/2014 0:11	62.8	11/8/2014 1:16	58.8	12/8/2014 2:21	61.7	13/8/2014 3:26	49.8	14/8/2014 4:31	53.1	15/8/2014 5:36	56.0				
10/8/2014 0:16	60.7	11/8/2014 1:21	55.5	12/8/2014 2:26	51.1	13/8/2014 3:31	61.7	14/8/2014 4:36	47.1	15/8/2014 5:41	57.4				
10/8/2014 0:21	63.3	11/8/2014 1:26	56.0	12/8/2014 2:31	47.9	13/8/2014 3:36	61.9	14/8/2014 4:41	54.0	15/8/2014 5:46	58.6				
10/8/2014 0:26	62.0	11/8/2014 1:31	55.6	12/8/2014 2:36	48.6	13/8/2014 3:41	53.4	14/8/2014 4:46	61.7	15/8/2014 5:51	57.4				
10/8/2014 0:31	61.5	11/8/2014 1:36	54.9	12/8/2014 2:41	45.6	13/8/2014 3:46	47.9	14/8/2014 4:51	61.8	15/8/2014 5:56	58.4				
10/8/2014 0:36	60.9	11/8/2014 1:41	55.6	12/8/2014 2:46	61.9	13/8/2014 3:51	52.0	14/8/2014 4:56	49.1	15/8/2014 6:01	58.5				
10/8/2014 0:41	60.6	11/8/2014 1:46	55.7	12/8/2014 2:51	46.7	13/8/2014 3:56	52.0	14/8/2014 5:01	53.8	15/8/2014 6:06	59.4				
10/8/2014 0:46	63.7	11/8/2014 1:51	53.2	12/8/2014 2:56	61.9	13/8/2014 4:01	50.4	14/8/2014 5:06	53.1	15/8/2014 6:11	59.9				
10/8/2014 0:51	59.0	11/8/2014 1:56	41.6	12/8/2014 3:01	61.4	13/8/2014 4:06	53.8	14/8/2014 5:11	53.4	15/8/2014 6:16	60.6				
10/8/2014 0:56	59.7	11/8/2014 2:01	54.7	12/8/2014 3:06	61.6	13/8/2014 4:11	51.1	14/8/2014 5:16	52.8	15/8/2014 6:21	61.2				
10/8/2014 1:01	59.6	11/8/2014 2:06	42.5	12/8/2014 3:11	49.1	13/8/2014 4:16	53.6	14/8/2014 5:21	49.4	15/8/2014 6:26	59.9				
10/8/2014 1:06	59.0	11/8/2014 2:11	53.4	12/8/2014 3:16	38.5	1									

Real-time Noise Data		RTN1 (Food and Environmental Hygiene Department Depot)					
16/8/2014 2:11	58.5	17/8/2014 3:16	57.6	18/8/2014 4:21	43.3	19/8/2014 5:26	52.2
16/8/2014 2:16	59.4	17/8/2014 3:21	57.5	18/8/2014 4:26	61.3	19/8/2014 5:31	46.4
16/8/2014 2:21	59.6	17/8/2014 3:26	58.4	18/8/2014 4:31	61.5	19/8/2014 5:36	61.8
16/8/2014 2:26	59.8	17/8/2014 3:31	55.9	18/8/2014 4:36	61.7	19/8/2014 5:41	53.8
16/8/2014 2:31	58.5	17/8/2014 3:36	58.5	18/8/2014 4:41	41.6	19/8/2014 5:46	58.3
16/8/2014 2:36	59.6	17/8/2014 3:41	56.2	18/8/2014 4:46	61.4	19/8/2014 5:51	61.6
16/8/2014 2:41	57.9	17/8/2014 3:46	55.6	18/8/2014 4:51	61.4	19/8/2014 5:56	57.4
16/8/2014 2:46	58.0	17/8/2014 3:51	56.5	18/8/2014 4:56	61.5	19/8/2014 6:01	59.4
16/8/2014 2:51	57.4	17/8/2014 3:56	56.6	18/8/2014 5:01	61.7	19/8/2014 6:06	59.4
16/8/2014 2:56	57.4	17/8/2014 4:01	54.1	18/8/2014 5:06	61.4	19/8/2014 6:11	61.4
16/8/2014 3:01	54.6	17/8/2014 4:06	54.8	18/8/2014 5:11	47.1	19/8/2014 6:16	64.1
16/8/2014 3:06	58.1	17/8/2014 4:11	54.5	18/8/2014 5:16	51.4	19/8/2014 6:21	63.0
16/8/2014 3:11	55.4	17/8/2014 4:16	56.2	18/8/2014 5:21	53.7	19/8/2014 6:26	63.3
16/8/2014 3:16	51.4	17/8/2014 4:21	54.3	18/8/2014 5:26	54.3	19/8/2014 6:31	64.2
16/8/2014 3:21	57.6	17/8/2014 4:26	56.7	18/8/2014 5:31	51.7	19/8/2014 6:36	64.1
16/8/2014 3:26	55.8	17/8/2014 4:31	54.8	18/8/2014 5:36	53.8	19/8/2014 6:41	64.3
16/8/2014 3:31	57.1	17/8/2014 4:36	54.1	18/8/2014 5:41	53.8	19/8/2014 6:46	64.6
16/8/2014 3:36	57.9	17/8/2014 4:41	55.3	18/8/2014 5:46	55.4	19/8/2014 6:51	64.8
16/8/2014 3:41	58.1	17/8/2014 4:46	56.8	18/8/2014 5:51	56.5	19/8/2014 6:56	64.5
16/8/2014 3:46	57.7	17/8/2014 4:51	54.7	18/8/2014 5:56	57.9	19/8/2014 23:01	64.9
16/8/2014 3:51	56.2	17/8/2014 4:56	53.8	18/8/2014 6:01	56.2	19/8/2014 23:06	64.6
16/8/2014 3:56	57.0	17/8/2014 5:01	56.3	18/8/2014 6:06	58.4	19/8/2014 23:11	64.8
16/8/2014 4:01	55.0	17/8/2014 5:06	54.6	18/8/2014 6:11	58.5	19/8/2014 23:16	64.0
16/8/2014 4:06	57.5	17/8/2014 5:11	58.2	18/8/2014 6:16	59.9	19/8/2014 23:21	64.5
16/8/2014 4:11	55.1	17/8/2014 5:16	56.8	18/8/2014 6:21	60.7	19/8/2014 23:26	64.8
16/8/2014 4:16	54.1	17/8/2014 5:21	55.2	18/8/2014 6:26	60.5	19/8/2014 23:31	65.2
16/8/2014 4:21	53.2	17/8/2014 5:26	56.0	18/8/2014 6:31	61.9	19/8/2014 23:36	63.5
16/8/2014 4:26	52.3	17/8/2014 5:31	53.9	18/8/2014 6:36	62.0	19/8/2014 23:41	64.4
16/8/2014 4:31	56.0	17/8/2014 5:36	55.2	18/8/2014 6:41	61.9	19/8/2014 23:46	63.9
16/8/2014 4:36	52.0	17/8/2014 5:41	57.4	18/8/2014 6:46	62.3	19/8/2014 23:51	64.1
16/8/2014 4:41	54.5	17/8/2014 5:46	56.1	18/8/2014 6:51	62.9	19/8/2014 23:56	63.3
16/8/2014 4:46	55.6	17/8/2014 5:51	58.3	18/8/2014 6:56	63.4	20/8/2014 0:01	63.2
16/8/2014 4:51	54.7	17/8/2014 5:56	57.9	18/8/2014 23:01	61.1	20/8/2014 0:06	62.4
16/8/2014 4:56	51.0	17/8/2014 6:01	57.8	18/8/2014 23:06	60.9	20/8/2014 0:11	62.9
16/8/2014 5:01	51.9	17/8/2014 6:06	58.4	18/8/2014 23:11	61.7	20/8/2014 0:16	63.3
16/8/2014 5:06	56.0	17/8/2014 6:11	58.6	18/8/2014 23:16	61.0	20/8/2014 0:21	62.6
16/8/2014 5:11	55.5	17/8/2014 6:16	60.1	18/8/2014 23:21	60.7	20/8/2014 0:26	63.0
16/8/2014 5:16	56.7	17/8/2014 6:21	59.8	18/8/2014 23:26	61.4	20/8/2014 0:31	63.1
16/8/2014 5:21	53.3	17/8/2014 6:26	60.6	18/8/2014 23:31	60.7	20/8/2014 0:36	62.5
16/8/2014 5:26	56.0	17/8/2014 6:31	59.5	18/8/2014 23:36	60.8	20/8/2014 0:41	61.8
16/8/2014 5:31	53.3	17/8/2014 6:36	60.2	18/8/2014 23:41	60.7	20/8/2014 0:46	62.6
16/8/2014 5:36	57.6	17/8/2014 6:41	60.1	18/8/2014 23:46	61.2	20/8/2014 0:51	61.9
16/8/2014 5:41	56.8	17/8/2014 6:46	60.8	18/8/2014 23:51	61.2	20/8/2014 0:56	61.4
16/8/2014 5:46	58.3	17/8/2014 6:51	60.9	18/8/2014 23:56	60.6	20/8/2014 1:01	59.8
16/8/2014 5:51	57.1	17/8/2014 6:56	60.9	19/8/2014 0:01	59.4	20/8/2014 1:06	60.3
16/8/2014 5:56	57.9	17/8/2014 23:01	61.9	19/8/2014 0:06	61.4	20/8/2014 1:11	60.7
16/8/2014 6:01	58.7	17/8/2014 23:06	60.8	19/8/2014 0:11	59.6	20/8/2014 1:16	60.5
16/8/2014 6:06	58.9	17/8/2014 23:11	61.6	19/8/2014 0:16	59.8	20/8/2014 1:21	60.8
16/8/2014 6:11	58.6	17/8/2014 23:16	61.0	19/8/2014 0:21	59.7	20/8/2014 1:26	58.9
16/8/2014 6:16	58.5	17/8/2014 23:21	61.7	19/8/2014 0:26	59.3	20/8/2014 1:31	60.1
16/8/2014 6:21	59.4	17/8/2014 23:26	59.9	19/8/2014 0:31	59.6	20/8/2014 1:36	59.5
16/8/2014 6:26	60.3	17/8/2014 23:31	61.2	19/8/2014 0:36	59.2	20/8/2014 1:41	59.9
16/8/2014 6:31	59.3	17/8/2014 23:36	60.7	19/8/2014 0:41	58.3	20/8/2014 1:46	59.0
16/8/2014 6:36	61.1	17/8/2014 23:41	60.9	19/8/2014 0:46	57.5	20/8/2014 1:51	60.6
16/8/2014 6:41	62.0	17/8/2014 23:46	62.0	19/8/2014 0:51	58.1	20/8/2014 1:56	58.1
16/8/2014 6:46	61.3	17/8/2014 23:51	61.4	19/8/2014 0:56	57.2	20/8/2014 2:01	57.4
16/8/2014 6:51	61.8	17/8/2014 23:56	61.4	19/8/2014 1:01	55.9	20/8/2014 2:06	61.9
16/8/2014 6:56	62.8	18/8/2014 0:01	59.7	19/8/2014 1:06	58.6	20/8/2014 2:11	64.7
16/8/2014 23:01	62.0	18/8/2014 0:06	60.4	19/8/2014 1:11	56.8	20/8/2014 2:16	64.7
16/8/2014 23:06	62.5	18/8/2014 0:11	59.5	19/8/2014 1:16	57.1	20/8/2014 2:21	59.8
16/8/2014 23:11	63.1	18/8/2014 0:16	56.8	19/8/2014 1:21	56.9	20/8/2014 2:26	58.5
16/8/2014 23:16	62.2	18/8/2014 0:21	59.6	19/8/2014 1:26	56.6	20/8/2014 2:31	58.4
16/8/2014 23:21	63.3	18/8/2014 0:26	57.4	19/8/2014 1:31	57.1	20/8/2014 2:36	57.3
16/8/2014 23:26	61.9	18/8/2014 0:31	59.2	19/8/2014 1:36	55.4	20/8/2014 2:41	57.7
16/8/2014 23:31	61.6	18/8/2014 0:36	58.1	19/8/2014 1:41	55.8	20/8/2014 2:46	55.5
16/8/2014 23:36	62.5	18/8/2014 0:41	58.1	19/8/2014 1:46	53.4	20/8/2014 2:51	55.2
16/8/2014 23:41	62.2	18/8/2014 0:46	57.1	19/8/2014 1:51	53.5	20/8/2014 2:56	56.0
16/8/2014 23:46	61.9	18/8/2014 0:51	57.2	19/8/2014 1:56	53.9	20/8/2014 3:01	52.8
16/8/2014 23:51	62.6	18/8/2014 0:56	56.6	19/8/2014 2:01	43.3	20/8/2014 3:06	56.5
16/8/2014 23:56	61.6	18/8/2014 1:01	54.3	19/8/2014 2:06	48.2	20/8/2014 3:11	56.6
17/8/2014 0:01	62.0	18/8/2014 1:06	54.5	19/8/2014 2:11	61.7	20/8/2014 3:16	55.4
17/8/2014 0:06	62.1	18/8/2014 1:11	50.9	19/8/2014 2:16	52.3	20/8/2014 3:21	56.1
17/8/2014 0:11	61.4	18/8/2014 1:16	53.0	19/8/2014 2:21	47.4	20/8/2014 3:26	52.5
17/8/2014 0:16	61.3	18/8/2014 1:21	54.8	19/8/2014 2:26	40.3	20/8/2014 3:31	55.9
17/8/2014 0:21	62.1	18/8/2014 1:26	56.2	19/8/2014 2:31	61.5	20/8/2014 3:36	56.6
17/8/2014 0:26	60.2	18/8/2014 1:31	52.3	19/8/2014 2:36	61.8	20/8/2014 3:41	52.8
17/8/2014 0:31	61.1	18/8/2014 1:36	57.0	19/8/2014 2:41	61.7	20/8/2014 3:46	51.4
17/8/2014 0:36	61.6	18/8/2014 1:41	54.8	19/8/2014 2:46	35.5	20/8/2014 3:51	55.8
17/8/2014 0:41	61.4	18/8/2014 1:46	50.0	19/8/2014 2:51	61.7	20/8/2014 3:56	55.1
17/8/2014 0:46	60.5	18/8/2014 1:51	52.3	19/8/2014 2:56	61.7	20/8/2014 4:01	51.4
17/8/2014 0:51	59.4	18/8/2014 1:56	52.8	19/8/2014 3:01	61.3	20/8/2014 4:06	55.3
17/8/2014 0:56	60.9	18/8/2014 2:01	61.9	19/8/2014 3:06	61.5	20/8/2014 4:11	53.8
17/8/2014 1:01	59.9	18/8/2014 2:06	49.1	19/8/2014 3:11	61.5	20/8/2014 4:16	54.0
17/8/2014 1:06	60.2	18/8/2014 2:11	46.0	19/8/2014 3:16	61.9	20/8/2014 4:21	47.4
17/8/2014 1:11	60.6	18/8/2014 2:16	50.3	19/8/2014 3:21	61.5	20/8/2014 4:26	42.5
17/8/2014 1:16	61.2	18/8/2014 2:21	61.8	19/8/2014 3:26	60.8	20/8/2014 4:31	53.5
17/8/2014 1:21	59.5	18/8/2014 2:26	61.8	19/8/2014 3:31	57.6	20/8/2014 4:36	53.2
17/8/2014 1:26	61.8	18/8/2014 2:31	61.6	19/8/2014 3:36	44.6	20/8/2014 4:41	53.1
17/8/2014 1:31	59.8	18/8/2014 2:36	61.7	19/8/2014 3:41	61.8	20/8/2014 4:46	52.2
17/8/2014 1:36	59.5	18/8/2014 2:41	61.9	19/8/2014 3:46	61.2	20/8/2014 4:51	52.1
17/8/2014 1:41	57.8	18/8/2014 2:46	61.6	19/8/2014 3:51	52.5	20/8/2014 4:56	53.7
17/8/2014 1:46	58.9	18/8/2014 2:51	52.4	19/8/2014 3:56	61.1	20/8/2014 5:01	56.1
17/8/2014 1:51	59.9	18/8/2014 2:56	61.6	19/8/2014 4:01	61.3	20/8/2014 5:06	55.7
17/8/2014 1:56	56.0	18/8/2014 3:01	61.1	19/8/2014 4:06	61.8	20/8/2014 5:11	55.6
17/8/2014 2:01	59.3	18/8/2014 3:06	61.3	19/8/2014 4:11	61.1	20/8/2014 5:16	57.0
17/8/2014 2:06	56.7	18/8/2014 3:11	61.4	19/8/2014 4:16	61.4	20/8/2014 5:21	57.4
17/8/2014 2:11	60.0	18/8/2014 3:16	61.1	19/8/2014 4:21	61.9	20/8/2014 5:26	58.5
17/8/2014 2:16	57.9	18/8/2014 3:21	61.2	19/8/2014 4:26	61.3	20/8/2014 5:31	65.3
17/8/2014 2:21	57.9	18/8/2014 3:26	61.1	19/8/2014 4:31	61.5	20/8/2014 5:36	67.6
17/8/2014 2:26	57.6	18/8/2014 3:31	53.3	19/8/2014 4:36	61.2	20/8/2014 5:41	66.7
17/8/2014 2:31	59.1	18/8/2014 3:36	49.1	19/8/2014 4:41	61.5	20/8/2014 5:46	69.0
17/8/2014 2:36	59.7	18/8/2014 3:41	61.1	19/8/2014 4:46	61.3	20/8/2014 5:51	68.3
17/8/2014 2:41	59.0	18/8/2014 3:46	61.4	19/8/2014 4:51	61.7	20/8/2014 5:56	69.4
17/8/2014 2:46	57.3	18/8/2014 3:51	61.9	19/8/2014 4:56	61.8	20/8/2014 6:01	66.9
17/8/2014 2:51	58.0	18/8/2014 3:56	61.8				

Real-time Noise Data		RTN1 (Food and Environmental Hygiene Department Depot)									
23/8/2014 0:41	60.8	24/8/2014 1:46	59.1	25/8/2014 2:51	56.8	26/8/2014 3:56	54.6	27/8/2014 5:01	61.8		
23/8/2014 0:46	61.0	24/8/2014 1:51	58.7	25/8/2014 2:56	53.8	26/8/2014 4:01	50.2	27/8/2014 5:06	61.6		
23/8/2014 0:51	59.0	24/8/2014 1:56	58.0	25/8/2014 3:01	54.0	26/8/2014 4:06	54.4	27/8/2014 5:11	61.6		
23/8/2014 0:56	60.7	24/8/2014 2:01	58.7	25/8/2014 3:06	56.6	26/8/2014 4:11	52.6	27/8/2014 5:16	61.6		
23/8/2014 1:01	60.4	24/8/2014 2:06	59.9	25/8/2014 3:11	54.9	26/8/2014 4:16	50.4	27/8/2014 5:21	61.6		
23/8/2014 1:06	60.7	24/8/2014 2:11	56.8	25/8/2014 3:16	54.8	26/8/2014 4:21	52.1	27/8/2014 5:26	48.2		
23/8/2014 1:11	59.8	24/8/2014 2:16	57.5	25/8/2014 3:21	56.6	26/8/2014 4:26	51.0	27/8/2014 5:31	52.0		
23/8/2014 1:16	59.4	24/8/2014 2:21	59.4	25/8/2014 3:26	55.7	26/8/2014 4:31	52.3	27/8/2014 5:36	61.8		
23/8/2014 1:21	59.4	24/8/2014 2:26	56.4	25/8/2014 3:31	55.7	26/8/2014 4:36	50.6	27/8/2014 5:41	61.7		
23/8/2014 1:26	60.4	24/8/2014 2:31	56.7	25/8/2014 3:36	57.0	26/8/2014 4:41	53.1	27/8/2014 5:46	51.3		
23/8/2014 1:31	59.6	24/8/2014 2:36	57.2	25/8/2014 3:41	56.3	26/8/2014 4:46	52.9	27/8/2014 5:51	55.5		
23/8/2014 1:36	61.0	24/8/2014 2:41	56.1	25/8/2014 3:46	54.8	26/8/2014 4:51	50.9	27/8/2014 5:56	49.3		
23/8/2014 1:41	60.0	24/8/2014 2:46	56.4	25/8/2014 3:51	55.0	26/8/2014 4:56	48.3	27/8/2014 6:01	55.5		
23/8/2014 1:46	59.4	24/8/2014 2:51	56.1	25/8/2014 3:56	55.6	26/8/2014 5:01	51.8	27/8/2014 6:06	55.0		
23/8/2014 1:51	59.4	24/8/2014 2:56	53.6	25/8/2014 4:01	53.2	26/8/2014 5:06	51.9	27/8/2014 6:11	58.0		
23/8/2014 1:56	56.7	24/8/2014 3:01	52.0	25/8/2014 4:06	54.6	26/8/2014 5:11	55.3	27/8/2014 6:16	58.4		
23/8/2014 2:01	58.3	24/8/2014 3:06	55.2	25/8/2014 4:11	53.3	26/8/2014 5:16	55.5	27/8/2014 6:21	59.2		
23/8/2014 2:06	59.4	24/8/2014 3:11	52.8	25/8/2014 4:16	52.8	26/8/2014 5:21	54.1	27/8/2014 6:26	58.5		
23/8/2014 2:11	57.8	24/8/2014 3:16	53.2	25/8/2014 4:21	51.8	26/8/2014 5:26	55.5	27/8/2014 6:31	60.6		
23/8/2014 2:16	57.4	24/8/2014 3:21	56.0	25/8/2014 4:26	52.9	26/8/2014 5:31	53.1	27/8/2014 6:36	60.4		
23/8/2014 2:21	57.6	24/8/2014 3:26	51.0	25/8/2014 4:31	53.0	26/8/2014 5:36	55.8	27/8/2014 6:41	61.4		
23/8/2014 2:26	56.6	24/8/2014 3:31	54.9	25/8/2014 4:36	49.6	26/8/2014 5:41	56.2	27/8/2014 6:46	61.8		
23/8/2014 2:31	57.6	24/8/2014 3:36	54.9	25/8/2014 4:41	53.8	26/8/2014 5:46	56.7	27/8/2014 6:51	62.3		
23/8/2014 2:36	58.9	24/8/2014 3:41	54.4	25/8/2014 4:46	53.9	26/8/2014 5:51	57.4	27/8/2014 6:56	62.6		
23/8/2014 2:41	55.4	24/8/2014 3:46	50.7	25/8/2014 4:51	52.6	26/8/2014 5:56	57.9	27/8/2014 23:01	63.9		
23/8/2014 2:46	56.9	24/8/2014 3:51	53.7	25/8/2014 4:56	51.1	26/8/2014 6:01	57.7	27/8/2014 23:06	63.3		
23/8/2014 2:51	55.2	24/8/2014 3:56	53.8	25/8/2014 5:01	53.8	26/8/2014 6:06	58.5	27/8/2014 23:11	63.7		
23/8/2014 2:56	55.5	24/8/2014 4:01	50.8	25/8/2014 5:06	54.1	26/8/2014 6:11	58.6	27/8/2014 23:16	63.6		
23/8/2014 3:01	55.0	24/8/2014 4:06	53.6	25/8/2014 5:11	55.3	26/8/2014 6:16	59.6	27/8/2014 23:21	64.2		
23/8/2014 3:06	57.8	24/8/2014 4:11	52.8	25/8/2014 5:16	55.6	26/8/2014 6:21	60.0	27/8/2014 23:26	63.7		
23/8/2014 3:11	57.1	24/8/2014 4:16	44.4	25/8/2014 5:21	53.5	26/8/2014 6:26	60.5	27/8/2014 23:31	64.4		
23/8/2014 3:16	56.1	24/8/2014 4:21	49.3	25/8/2014 5:26	55.2	26/8/2014 6:31	60.3	27/8/2014 23:36	63.8		
23/8/2014 3:21	57.1	24/8/2014 4:26	40.8	25/8/2014 5:31	54.6	26/8/2014 6:36	61.1	27/8/2014 23:41	63.3		
23/8/2014 3:26	55.2	24/8/2014 4:31	52.3	25/8/2014 5:36	56.4	26/8/2014 6:41	61.4	27/8/2014 23:46	64.2		
23/8/2014 3:31	56.4	24/8/2014 4:36	44.2	25/8/2014 5:41	57.2	26/8/2014 6:46	61.5	27/8/2014 23:51	62.7		
23/8/2014 3:36	57.8	24/8/2014 4:41	53.2	25/8/2014 5:46	57.8	26/8/2014 6:51	61.9	27/8/2014 23:56	63.0		
23/8/2014 3:41	55.9	24/8/2014 4:46	48.3	25/8/2014 5:51	57.7	26/8/2014 6:56	62.4				
23/8/2014 3:46	54.6	24/8/2014 4:51	48.6	25/8/2014 5:56	58.1	26/8/2014 23:01	61.8				
23/8/2014 3:51	56.7	24/8/2014 4:56	48.9	25/8/2014 6:01	58.3	26/8/2014 23:06	62.3				
23/8/2014 3:56	54.7	24/8/2014 5:01	52.7	25/8/2014 6:06	58.9	26/8/2014 23:11	61.9				
23/8/2014 4:01	54.9	24/8/2014 5:06	53.6	25/8/2014 6:11	59.1	26/8/2014 23:16	61.8				
23/8/2014 4:06	53.1	24/8/2014 5:11	53.0	25/8/2014 6:16	59.8	26/8/2014 23:21	62.4				
23/8/2014 4:11	52.0	24/8/2014 5:16	54.3	25/8/2014 6:21	60.2	26/8/2014 23:26	61.6				
23/8/2014 4:16	53.9	24/8/2014 5:21	51.6	25/8/2014 6:26	60.3	26/8/2014 23:31	62.4				
23/8/2014 4:21	54.8	24/8/2014 5:26	54.4	25/8/2014 6:31	60.2	26/8/2014 23:36	61.4				
23/8/2014 4:26	53.1	24/8/2014 5:31	53.8	25/8/2014 6:36	61.2	26/8/2014 23:41	61.6				
23/8/2014 4:31	54.4	24/8/2014 5:36	55.3	25/8/2014 6:41	61.7	26/8/2014 23:46	62.1				
23/8/2014 4:36	50.9	24/8/2014 5:41	56.2	25/8/2014 6:46	61.9	26/8/2014 23:51	61.5				
23/8/2014 4:41	52.3	24/8/2014 5:46	58.0	25/8/2014 6:51	62.2	26/8/2014 23:56	60.8				
23/8/2014 4:46	38.5	24/8/2014 5:51	56.4	25/8/2014 6:56	62.5	27/8/2014 0:01	61.2				
23/8/2014 4:51	61.9	24/8/2014 5:56	57.5	25/8/2014 23:01	62.6	27/8/2014 0:06	60.7				
23/8/2014 4:56	51.1	24/8/2014 6:01	58.4	25/8/2014 23:06	62.4	27/8/2014 0:11	61.2				
23/8/2014 5:01	61.9	24/8/2014 6:06	58.7	25/8/2014 23:11	62.9	27/8/2014 0:16	60.1				
23/8/2014 5:06	53.4	24/8/2014 6:11	59.1	25/8/2014 23:16	62.3	27/8/2014 0:21	59.9				
23/8/2014 5:11	53.7	24/8/2014 6:16	59.8	25/8/2014 23:21	62.9	27/8/2014 0:26	58.8				
23/8/2014 5:16	53.9	24/8/2014 6:21	60.0	25/8/2014 23:26	62.3	27/8/2014 0:31	59.7				
23/8/2014 5:21	54.8	24/8/2014 6:26	60.3	25/8/2014 23:31	62.1	27/8/2014 0:36	59.6				
23/8/2014 5:26	55.8	24/8/2014 6:31	60.9	25/8/2014 23:36	62.4	27/8/2014 0:41	58.9				
23/8/2014 5:31	54.7	24/8/2014 6:36	62.0	25/8/2014 23:41	62.1	27/8/2014 0:46	62.0				
23/8/2014 5:36	56.8	24/8/2014 6:41	62.5	25/8/2014 23:46	62.0	27/8/2014 0:51	58.2				
23/8/2014 5:41	56.3	24/8/2014 6:46	62.6	25/8/2014 23:51	62.4	27/8/2014 0:56	60.4				
23/8/2014 5:46	56.4	24/8/2014 6:51	63.1	25/8/2014 23:56	62.1	27/8/2014 1:01	62.9				
23/8/2014 5:51	58.0	24/8/2014 6:56	63.2	26/8/2014 0:01	61.5	27/8/2014 1:06	57.0				
23/8/2014 5:56	56.1	24/8/2014 23:01	63.2	26/8/2014 0:06	61.8	27/8/2014 1:11	52.9				
23/8/2014 6:01	56.1	24/8/2014 23:06	63.1	26/8/2014 0:11	61.1	27/8/2014 1:16	57.7				
23/8/2014 6:06	58.9	24/8/2014 23:11	63.3	26/8/2014 0:16	60.6	27/8/2014 1:21	57.9				
23/8/2014 6:11	58.0	24/8/2014 23:16	63.3	26/8/2014 0:21	61.1	27/8/2014 1:26	53.1				
23/8/2014 6:16	58.2	24/8/2014 23:21	63.4	26/8/2014 0:26	60.3	27/8/2014 1:31	53.6				
23/8/2014 6:21	58.1	24/8/2014 23:26	63.3	26/8/2014 0:31	60.7	27/8/2014 1:36	53.0				
23/8/2014 6:26	59.7	24/8/2014 23:31	62.9	26/8/2014 0:36	60.6	27/8/2014 1:41	54.1				
23/8/2014 6:31	60.4	24/8/2014 23:36	62.9	26/8/2014 0:41	60.3	27/8/2014 1:46	54.4				
23/8/2014 6:36	60.2	24/8/2014 23:41	63.0	26/8/2014 0:46	60.0	27/8/2014 1:51	54.0				
23/8/2014 6:41	60.2	24/8/2014 23:46	62.5	26/8/2014 0:51	59.3	27/8/2014 1:56	61.8				
23/8/2014 6:46	62.6	24/8/2014 23:51	62.9	26/8/2014 0:56	59.5	27/8/2014 2:01	52.5				
23/8/2014 6:51	61.2	24/8/2014 23:56	62.8	26/8/2014 1:01	59.6	27/8/2014 2:06	43.3				
23/8/2014 6:56	63.2	25/8/2014 0:01	62.4	26/8/2014 1:06	58.9	27/8/2014 2:11	47.4				
23/8/2014 23:01	64.1	25/8/2014 0:06	62.2	26/8/2014 1:11	59.1	27/8/2014 2:16	52.2				
23/8/2014 23:06	63.9	25/8/2014 0:11	61.8	26/8/2014 1:16	59.0	27/8/2014 2:21	52.9				
23/8/2014 23:11	63.9	25/8/2014 0:16	62.1	26/8/2014 1:21	58.8	27/8/2014 2:26	49.8				
23/8/2014 23:16	63.9	25/8/2014 0:21	61.4	26/8/2014 1:26	60.0	27/8/2014 2:31	35.5				
23/8/2014 23:21	63.6	25/8/2014 0:26	61.4	26/8/2014 1:31	58.1	27/8/2014 2:36	43.3				
23/8/2014 23:26	63.9	25/8/2014 0:31	61.5	26/8/2014 1:36	58.8	27/8/2014 2:41	61.6				
23/8/2014 23:31	63.7	25/8/2014 0:36	61.6	26/8/2014 1:41	58.4	27/8/2014 2:46	61.7				
23/8/2014 23:36	63.5	25/8/2014 0:41	60.7	26/8/2014 1:46	57.5	27/8/2014 2:51	48.8				
23/8/2014 23:41	63.7	25/8/2014 0:46	61.0	26/8/2014 1:51	58.0	27/8/2014 2:56	61.2				
23/8/2014 23:46	63.0	25/8/2014 0:51	60.1	26/8/2014 1:56	56.7	27/8/2014 3:01	61.8				
23/8											

Real-time Noise Data	RTN2a (Hong Kong Electric Centre)									
Normal Day 07:00-19:00	1/8/2014 12:01	61.4	6/8/2014 18:31	66.3	12/8/2014 13:01	70.8	18/8/2014 7:31	65.2	22/8/2014 14:01	69.9
	1/8/2014 12:31	56.2	7/8/2014 7:01	65.7	12/8/2014 13:31	73.4	18/8/2014 8:01	66.2	22/8/2014 14:31	70.9
	1/8/2014 13:01	64.3	7/8/2014 7:31	66.9	12/8/2014 14:01	74.6	18/8/2014 8:31	71.4	22/8/2014 15:01	70.3
28/7/2014 7:01	1/8/2014 13:31	69.9	7/8/2014 8:01	64.6	12/8/2014 14:31	74.6	18/8/2014 9:01	70.4	22/8/2014 15:31	72.0
28/7/2014 7:31	1/8/2014 14:01	67.7	7/8/2014 8:31	71.2	12/8/2014 15:01	73.5	18/8/2014 9:31	70.7	22/8/2014 16:01	73.2
28/7/2014 8:01	1/8/2014 14:31	66.3	7/8/2014 9:01	70.9	12/8/2014 15:31	71.1	18/8/2014 10:01	70.9	22/8/2014 16:31	74.2
28/7/2014 8:31	1/8/2014 15:01	71.6	7/8/2014 9:31	70.1	12/8/2014 16:01	71.0	18/8/2014 10:31	72.5	22/8/2014 17:01	70.1
28/7/2014 9:01	1/8/2014 15:31	71.2	7/8/2014 10:01	70.7	12/8/2014 16:31	67.9	18/8/2014 11:01	0.0	22/8/2014 17:31	63.4
28/7/2014 9:31	1/8/2014 16:01	67.9	7/8/2014 10:31	70.0	12/8/2014 17:01	67.4	18/8/2014 11:31	0.0	22/8/2014 18:01	67.0
28/7/2014 10:01	1/8/2014 16:31	69.6	7/8/2014 11:01	71.4	12/8/2014 17:31	67.5	18/8/2014 12:01	0.0	22/8/2014 18:31	64.7
28/7/2014 10:31	1/8/2014 17:01	69.8	7/8/2014 11:31	69.2	12/8/2014 18:01	64.0	18/8/2014 12:31	0.0	23/8/2014 7:01	63.9
28/7/2014 11:01	1/8/2014 17:31	59.3	7/8/2014 12:01	64.4	12/8/2014 18:31	65.4	18/8/2014 13:01	70.2	23/8/2014 7:31	65.0
28/7/2014 11:31	1/8/2014 18:01	66.2	7/8/2014 12:31	64.3	13/8/2014 7:01	66.0	18/8/2014 13:31	68.9	23/8/2014 8:01	65.8
28/7/2014 12:01	1/8/2014 18:31	65.2	7/8/2014 13:01	68.9	13/8/2014 7:31	67.1	18/8/2014 14:01	68.8	23/8/2014 8:31	70.7
28/7/2014 12:31	2/8/2014 7:01	64.2	7/8/2014 13:31	70.9	13/8/2014 8:01	63.7	18/8/2014 14:31	70.3	23/8/2014 9:01	70.3
28/7/2014 13:01	2/8/2014 7:31	65.6	7/8/2014 14:01	71.6	13/8/2014 8:31	70.1	18/8/2014 15:01	70.8	23/8/2014 9:31	71.2
28/7/2014 13:31	2/8/2014 8:01	61.1	7/8/2014 14:31	70.7	13/8/2014 9:01	69.9	18/8/2014 15:31	70.7	23/8/2014 10:01	71.1
28/7/2014 14:01	2/8/2014 8:31	67.7	7/8/2014 15:01	70.4	13/8/2014 9:31	70.0	18/8/2014 16:01	70.8	23/8/2014 10:31	72.4
28/7/2014 14:31	2/8/2014 9:01	66.7	7/8/2014 15:31	71.2	13/8/2014 10:01	71.1	18/8/2014 16:31	71.0	23/8/2014 11:01	72.8
28/7/2014 15:01	2/8/2014 9:31	69.1	7/8/2014 16:01	70.2	13/8/2014 10:31	69.6	18/8/2014 17:01	68.7	23/8/2014 11:31	71.0
28/7/2014 15:31	2/8/2014 10:01	69.6	7/8/2014 16:31	70.7	13/8/2014 11:01	70.3	18/8/2014 17:31	66.4	23/8/2014 12:01	67.0
28/7/2014 16:01	2/8/2014 10:31	68.8	7/8/2014 17:01	72.3	13/8/2014 11:31	69.6	18/8/2014 18:01	66.8	23/8/2014 12:31	66.7
28/7/2014 16:31	2/8/2014 11:01	71.6	7/8/2014 17:31	70.2	13/8/2014 12:01	68.9	18/8/2014 18:31	65.7	23/8/2014 13:01	72.0
28/7/2014 17:01	2/8/2014 11:31	67.3	7/8/2014 18:01	68.3	13/8/2014 12:31	63.5	19/8/2014 7:01	65.3	23/8/2014 13:31	72.7
28/7/2014 17:31	2/8/2014 12:01	60.0	7/8/2014 18:31	66.3	13/8/2014 13:01	69.2	19/8/2014 7:31	65.7	23/8/2014 14:01	73.2
28/7/2014 18:01	2/8/2014 12:31	61.9	8/8/2014 7:01	65.3	13/8/2014 13:31	70.6	19/8/2014 8:01	69.1	23/8/2014 14:31	73.3
28/7/2014 18:31	2/8/2014 13:01	68.5	8/8/2014 7:31	66.2	13/8/2014 14:01	70.9	19/8/2014 8:31	71.5	23/8/2014 15:01	76.4
29/7/2014 7:01	2/8/2014 13:31	71.0	8/8/2014 8:01	65.6	13/8/2014 14:31	70.8	19/8/2014 9:01	67.2	23/8/2014 15:31	73.7
29/7/2014 7:31	2/8/2014 14:01	70.0	8/8/2014 8:31	70.3	13/8/2014 15:01	74.7	19/8/2014 9:31	68.7	23/8/2014 16:01	73.2
29/7/2014 8:01	2/8/2014 14:31	68.9	8/8/2014 9:01	70.3	13/8/2014 15:31	75.6	19/8/2014 10:01	70.8	23/8/2014 16:31	73.9
29/7/2014 8:31	2/8/2014 15:01	68.8	8/8/2014 9:31	70.5	13/8/2014 16:01	74.4	19/8/2014 10:31	69.8	23/8/2014 17:01	70.6
29/7/2014 9:01	2/8/2014 15:31	72.5	8/8/2014 10:01	71.4	13/8/2014 16:31	74.2	19/8/2014 11:01	70.7	23/8/2014 17:31	64.3
29/7/2014 9:31	2/8/2014 16:01	68.7	8/8/2014 10:31	73.0	13/8/2014 17:01	72.5	19/8/2014 11:31	62.9	23/8/2014 18:01	51.0
29/7/2014 10:01	2/8/2014 16:31	69.3	8/8/2014 11:01	71.1	13/8/2014 17:31	71.3	19/8/2014 12:01	67.2	23/8/2014 18:31	65.8
29/7/2014 10:31	2/8/2014 17:01	66.1	8/8/2014 11:31	69.0	13/8/2014 18:01	61.6	19/8/2014 12:31	57.0	25/8/2014 7:01	64.6
29/7/2014 11:01	2/8/2014 17:31	61.3	8/8/2014 12:01	58.3	13/8/2014 18:31	65.9	19/8/2014 13:01	69.5	25/8/2014 7:31	64.9
29/7/2014 11:31	2/8/2014 18:01	66.4	8/8/2014 12:31	53.2	14/8/2014 7:01	65.8	19/8/2014 13:31	71.6	25/8/2014 8:01	63.2
29/7/2014 12:01	2/8/2014 18:31	65.5	8/8/2014 13:01	70.2	14/8/2014 7:31	66.7	19/8/2014 14:01	71.4	25/8/2014 8:31	69.0
29/7/2014 12:31	4/8/2014 7:01	64.4	8/8/2014 13:31	73.0	14/8/2014 8:01	66.0	19/8/2014 14:31	73.7	25/8/2014 9:01	70.1
29/7/2014 13:01	4/8/2014 7:31	65.8	8/8/2014 14:01	69.1	14/8/2014 8:31	70.9	19/8/2014 15:01	73.8	25/8/2014 9:31	71.5
29/7/2014 13:31	4/8/2014 8:01	62.7	8/8/2014 14:31	68.2	14/8/2014 9:01	69.7	19/8/2014 15:31	71.4	25/8/2014 10:01	71.6
29/7/2014 14:01	4/8/2014 8:31	68.6	8/8/2014 15:01	66.8	14/8/2014 9:31	70.1	19/8/2014 16:01	71.9	25/8/2014 10:31	72.1
29/7/2014 14:31	4/8/2014 9:01	69.5	8/8/2014 15:31	67.0	14/8/2014 10:01	69.6	19/8/2014 16:31	70.3	25/8/2014 11:01	72.4
29/7/2014 15:01	4/8/2014 9:31	72.1	8/8/2014 16:01	66.9	14/8/2014 10:31	69.6	19/8/2014 17:01	70.0	25/8/2014 11:31	70.4
29/7/2014 15:31	4/8/2014 10:01	71.2	8/8/2014 16:31	74.0	14/8/2014 11:01	69.0	19/8/2014 17:31	67.8	25/8/2014 12:01	66.6
29/7/2014 16:01	4/8/2014 10:31	72.0	8/8/2014 17:01	68.8	14/8/2014 11:31	64.6	19/8/2014 18:01	67.2	25/8/2014 12:31	66.7
29/7/2014 16:31	4/8/2014 11:01	71.1	8/8/2014 17:31	67.5	14/8/2014 12:01	60.1	19/8/2014 18:31	65.9	25/8/2014 13:01	70.7
29/7/2014 17:01	4/8/2014 11:31	67.2	8/8/2014 18:01	63.7	14/8/2014 12:31	62.5	20/8/2014 7:01	65.6	25/8/2014 13:31	72.2
29/7/2014 17:31	4/8/2014 12:01	66.5	8/8/2014 18:31	66.5	14/8/2014 13:01	69.6	20/8/2014 7:31	65.6	25/8/2014 14:01	72.4
29/7/2014 18:01	4/8/2014 12:31	66.7	9/8/2014 7:01	63.8	14/8/2014 13:31	72.8	20/8/2014 8:01	63.5	25/8/2014 14:31	71.2
29/7/2014 18:31	4/8/2014 13:01	66.9	9/8/2014 7:31	65.2	14/8/2014 14:01	69.8	20/8/2014 8:31	70.8	25/8/2014 15:01	70.9
30/7/2014 7:01	4/8/2014 13:31	69.6	9/8/2014 8:01	64.3	14/8/2014 14:31	69.4	20/8/2014 9:01	70.3	25/8/2014 15:31	71.4
30/7/2014 7:31	4/8/2014 14:01	69.2	9/8/2014 8:31	71.8	14/8/2014 15:01	65.9	20/8/2014 9:31	71.6	25/8/2014 16:01	69.1
30/7/2014 8:01	4/8/2014 14:31	68.6	9/8/2014 9:01	72.2	14/8/2014 15:31	67.5	20/8/2014 10:01	72.8	25/8/2014 16:31	69.6
30/7/2014 8:31	4/8/2014 15:01	68.7	9/8/2014 9:31	72.6	14/8/2014 16:01	73.6	20/8/2014 10:31	71.7	25/8/2014 17:01	69.3
30/7/2014 9:01	4/8/2014 15:31	67.8	9/8/2014 10:01	73.3	14/8/2014 16:31	71.6	20/8/2014 11:01	72.5	25/8/2014 17:31	67.2
30/7/2014 9:31	4/8/2014 16:01	69.3	9/8/2014 10:31	72.2	14/8/2014 17:01	71.1	20/8/2014 11:31	66.2	25/8/2014 18:01	58.7
30/7/2014 10:01	4/8/2014 16:31	71.7	9/8/2014 11:01	71.9	14/8/2014 17:31	67.6	20/8/2014 12:01	66.8	25/8/2014 18:31	65.2
30/7/2014 10:31	4/8/2014 17:01	72.2	9/8/2014 11:31	67.5	14/8/2014 18:01	53.4	20/8/2014 12:31	66.6	26/8/2014 7:01	64.7
30/7/2014 11:01	4/8/2014 17:31	67.9	9/8/2014 12:01	54.2	14/8/2014 18:31	64.7	20/8/2014 13:01	72.7	26/8/2014 7:31	65.1
30/7/2014 11:31	4/8/2014 18:01	64.7	9/8/2014 12:31	55.1	15/8/2014 7:01	65.0	20/8/2014 13:31	71.9	26/8/2014 8:01	67.4
30/7/2014 12:01	4/8/2014 18:31	66.8	9/8/2014 13:01	70.3	15/8/2014 7:31	66.0	20/8/2014 14:01	73.5	26/8/2014 8:31	69.6
30/7/2014 12:31	5/8/2014 7:01	64.5	9/8/2014 13:31	72.2	15/8/2014 8:01	67.6	20/8/2014 14:31	73.9	26/8/2014 9:01	70.7
30/7/2014 13:01	5/8/2014 7:31	66.0	9/8/2014 14:01	72.7	15/8/2014 8:31	71.8	20/8/2014 15:01	71.9	26/8/2014 9:31	71.7
30/7/2014 13:31	5/8/2014 8:01	57.7	9/8/2014 14:31	72.1	15/8/2014 9:01	71.8	20/8/2014 15:31	70.5	26/8/2014 10:01	70.0
30/7/2014 14:01	5/8/2014 8:31	72.9	9/8/2014 15:01	73.3	15/8/2014 9:31	71.7	20/8/2014 16:01	72.6	26/8/2014 10:31	70.9
30/7/2014 14:31	5/8/2014 9:01	71.6	9/8/2014 15:31	71.3	15/8/2014 10:01	71.4	20/8/2014 16:31	72.2	26/8/2014 11:01	71.0
30/7/2014 15:01	5/8/2014 9:31	71.6	9/8/2014 16:01	70.9	15/8/2014 10:31	70.5	20/8/2014 17:01	71.9	26/8/2014 11:31	68.3
30/7/2014 15:31	5/8/2014 10:01	70.3	9/8/2014 16:31	67.3	15/8/2014 11:01	71.7	20/8/2014 17:31	69.5	26/8/2014 12:01	66.3
30/7/2014 16:01	5/8/2014 10:31	70.4	9/8/2014 17:01	68.3	15/8/2014 11:31	65.2	20/8/2014 18:01	67.4	26/8/2014 12:31	65.7
30/7/2014 16:31	5/8/2014 11:01	69.9	9/8/2014 17:31	67.4	15/8/2014 12:01	67.0	20/8/2014 18:31	65.7	26/8/2014 13:01	69.5
30/7/2014 17:01	5/8/2014 11:31	68.5	9/8/2014 18:01	62.6	15/8/2014 12:31	66.8	21/8/2014 7:01	65.2	26/8/2014 13:31	70.1
30/7/2014 17:31	5/8/2014 12:01	64.5	9/8/2014 18:31	65.8	15/8/2014 13:01	68.8	21/8/2014 7:31	65.9	26/8/2014 14:01	69.1
30/7/2014 18:01	5/8/2014 12:31	61.4								

Real-time Noise Data		RTN2a (Hong Kong Electric Centre)											
Normal Day 19:00-23:00		30/7/2014 19:41	65.6	1/8/2014 20:46	60.9	3/8/2014 9:51	62.5	3/8/2014 18:56	62.3	5/8/2014 20:01	62.4		
Sunday & Holiday 07:00-23:00		30/7/2014 19:46	64.3	1/8/2014 20:51	63.3	3/8/2014 9:56	62.3	3/8/2014 19:01	62.1	5/8/2014 20:06	62.5		
		30/7/2014 19:51	63.9	1/8/2014 20:56	75.8	3/8/2014 10:01	62.7	3/8/2014 19:06	62.5	5/8/2014 20:11	63.4		
		30/7/2014 19:56	63.0	1/8/2014 21:01	76.2	3/8/2014 10:06	62.1	3/8/2014 19:11	62.4	5/8/2014 20:16	61.8		
		30/7/2014 20:01	63.1	1/8/2014 21:06	75.6	3/8/2014 10:11	62.6	3/8/2014 19:16	62.1	5/8/2014 20:21	61.8		
28/7/2014 19:01	63.0	30/7/2014 20:06	63.6	1/8/2014 21:11	70.5	3/8/2014 10:16	62.6	3/8/2014 19:21	61.3	5/8/2014 20:26	62.5		
28/7/2014 19:06	61.9	30/7/2014 20:11	64.2	1/8/2014 21:16	67.0	3/8/2014 10:21	62.4	3/8/2014 19:26	61.4	5/8/2014 20:31	62.3		
28/7/2014 19:11	60.7	30/7/2014 20:16	63.1	1/8/2014 21:21	62.8	3/8/2014 10:26	62.3	3/8/2014 19:31	61.2	5/8/2014 20:36	62.6		
28/7/2014 19:16	59.7	30/7/2014 20:21	62.7	1/8/2014 21:26	63.1	3/8/2014 10:31	63.0	3/8/2014 19:36	61.7	5/8/2014 20:41	62.2		
28/7/2014 19:21	62.1	30/7/2014 20:26	62.5	1/8/2014 21:31	60.5	3/8/2014 10:36	62.9	3/8/2014 19:41	61.5	5/8/2014 20:46	61.8		
28/7/2014 19:26	62.8	30/7/2014 20:31	62.6	1/8/2014 21:36	60.2	3/8/2014 10:41	62.7	3/8/2014 19:46	60.4	5/8/2014 20:51	61.3		
28/7/2014 19:31	63.7	30/7/2014 20:36	62.8	1/8/2014 21:41	61.0	3/8/2014 10:46	62.7	3/8/2014 19:51	61.9	5/8/2014 20:56	61.8		
28/7/2014 19:36	63.8	30/7/2014 20:41	62.5	1/8/2014 21:46	61.8	3/8/2014 10:51	63.1	3/8/2014 19:56	61.1	5/8/2014 21:01	62.4		
28/7/2014 19:41	64.4	30/7/2014 20:46	63.4	1/8/2014 21:51	61.3	3/8/2014 10:56	62.5	3/8/2014 20:01	61.3	5/8/2014 21:06	62.2		
28/7/2014 19:46	63.2	30/7/2014 20:51	63.5	1/8/2014 21:56	60.8	3/8/2014 11:01	62.8	3/8/2014 20:06	61.3	5/8/2014 21:11	61.4		
28/7/2014 19:51	63.1	30/7/2014 20:56	61.9	1/8/2014 22:01	61.4	3/8/2014 11:06	63.7	3/8/2014 20:11	60.7	5/8/2014 21:16	61.6		
28/7/2014 19:56	63.1	30/7/2014 21:01	62.1	1/8/2014 22:06	60.8	3/8/2014 11:11	63.0	3/8/2014 20:16	61.0	5/8/2014 21:21	62.1		
28/7/2014 20:01	63.7	30/7/2014 21:06	62.2	1/8/2014 22:11	60.5	3/8/2014 11:16	63.2	3/8/2014 20:21	60.8	5/8/2014 21:26	62.7		
28/7/2014 20:06	61.9	30/7/2014 21:11	61.8	1/8/2014 22:16	60.5	3/8/2014 11:21	62.2	3/8/2014 20:26	60.7	5/8/2014 21:31	61.4		
28/7/2014 20:11	62.7	30/7/2014 21:16	63.1	1/8/2014 22:21	60.0	3/8/2014 11:26	61.8	3/8/2014 20:31	60.8	5/8/2014 21:36	61.6		
28/7/2014 20:16	63.1	30/7/2014 21:21	62.6	1/8/2014 22:26	59.5	3/8/2014 11:31	61.6	3/8/2014 20:36	60.8	5/8/2014 21:41	62.4		
28/7/2014 20:21	63.0	30/7/2014 21:26	63.2	1/8/2014 22:31	59.6	3/8/2014 11:36	62.4	3/8/2014 20:41	61.2	5/8/2014 21:46	61.5		
28/7/2014 20:26	62.3	30/7/2014 21:31	63.5	1/8/2014 22:36	61.3	3/8/2014 11:41	62.3	3/8/2014 20:46	61.6	5/8/2014 21:51	61.3		
28/7/2014 20:31	62.1	30/7/2014 21:36	63.8	1/8/2014 22:41	61.6	3/8/2014 11:46	62.9	3/8/2014 20:51	61.8	5/8/2014 21:56	61.2		
28/7/2014 20:36	62.6	30/7/2014 21:41	62.7	1/8/2014 22:46	62.3	3/8/2014 11:51	61.6	3/8/2014 20:56	61.0	5/8/2014 22:01	62.3		
28/7/2014 20:41	62.9	30/7/2014 21:46	64.2	1/8/2014 22:51	62.4	3/8/2014 11:56	62.1	3/8/2014 21:01	61.2	5/8/2014 22:06	61.7		
28/7/2014 20:46	63.0	30/7/2014 21:51	62.7	1/8/2014 22:56	62.5	3/8/2014 12:01	61.5	3/8/2014 21:06	60.8	5/8/2014 22:11	62.1		
28/7/2014 20:51	60.8	30/7/2014 21:56	62.4	2/8/2014 19:01	63.1	3/8/2014 12:06	62.5	3/8/2014 21:11	61.8	5/8/2014 22:16	62.0		
28/7/2014 20:56	62.4	30/7/2014 22:01	62.0	2/8/2014 19:06	62.9	3/8/2014 12:11	62.2	3/8/2014 21:16	61.7	5/8/2014 22:21	62.0		
28/7/2014 21:01	61.6	30/7/2014 22:06	61.3	2/8/2014 19:11	62.6	3/8/2014 12:16	62.8	3/8/2014 21:21	61.6	5/8/2014 22:26	61.2		
28/7/2014 21:06	61.4	30/7/2014 22:11	61.5	2/8/2014 19:16	62.6	3/8/2014 12:21	63.1	3/8/2014 21:26	61.8	5/8/2014 22:31	61.3		
28/7/2014 21:11	63.2	30/7/2014 22:16	61.0	2/8/2014 19:21	65.7	3/8/2014 12:26	62.2	3/8/2014 21:31	61.7	5/8/2014 22:36	61.8		
28/7/2014 21:16	61.3	30/7/2014 22:21	62.3	2/8/2014 19:26	61.7	3/8/2014 12:31	62.5	3/8/2014 21:36	61.2	5/8/2014 22:41	61.1		
28/7/2014 21:21	61.8	30/7/2014 22:26	61.4	2/8/2014 19:31	61.7	3/8/2014 12:36	61.9	3/8/2014 21:41	61.6	5/8/2014 22:46	60.7		
28/7/2014 21:26	63.9	30/7/2014 22:31	61.5	2/8/2014 19:36	61.8	3/8/2014 12:41	62.1	3/8/2014 21:46	62.0	5/8/2014 22:51	60.4		
28/7/2014 21:31	62.0	30/7/2014 22:36	63.0	2/8/2014 19:41	62.2	3/8/2014 12:46	62.9	3/8/2014 21:51	61.7	5/8/2014 22:56	61.3		
28/7/2014 21:36	62.8	30/7/2014 22:41	59.8	2/8/2014 19:46	63.0	3/8/2014 12:51	64.1	3/8/2014 21:56	61.4	6/8/2014 19:01	62.7		
28/7/2014 21:41	61.8	30/7/2014 22:46	60.0	2/8/2014 19:51	61.6	3/8/2014 12:56	64.1	3/8/2014 22:01	61.6	6/8/2014 19:06	62.8		
28/7/2014 21:46	62.2	30/7/2014 22:51	58.8	2/8/2014 19:56	62.6	3/8/2014 13:01	63.1	3/8/2014 22:06	61.3	6/8/2014 19:11	62.3		
28/7/2014 21:51	62.1	30/7/2014 22:56	58.2	2/8/2014 20:01	61.7	3/8/2014 13:06	63.5	3/8/2014 22:11	60.9	6/8/2014 19:16	62.4		
28/7/2014 21:56	62.3	31/7/2014 19:01	63.1	2/8/2014 20:06	61.7	3/8/2014 13:11	63.4	3/8/2014 22:16	61.1	6/8/2014 19:21	63.1		
28/7/2014 22:01	61.7	31/7/2014 19:06	62.5	2/8/2014 20:11	61.4	3/8/2014 13:16	62.3	3/8/2014 22:21	60.6	6/8/2014 19:26	62.6		
28/7/2014 22:06	60.9	31/7/2014 19:11	62.5	2/8/2014 20:16	61.7	3/8/2014 13:21	62.1	3/8/2014 22:26	60.7	6/8/2014 19:31	63.0		
28/7/2014 22:11	61.3	31/7/2014 19:16	62.3	2/8/2014 20:21	61.0	3/8/2014 13:26	62.3	3/8/2014 22:31	61.8	6/8/2014 19:36	62.9		
28/7/2014 22:16	61.6	31/7/2014 19:21	62.6	2/8/2014 20:26	61.1	3/8/2014 13:31	63.3	3/8/2014 22:36	60.8	6/8/2014 19:41	63.6		
28/7/2014 22:21	61.6	31/7/2014 19:26	62.4	2/8/2014 20:31	61.7	3/8/2014 13:36	63.1	3/8/2014 22:41	61.5	6/8/2014 19:46	63.1		
28/7/2014 22:26	61.5	31/7/2014 19:31	62.4	2/8/2014 20:36	61.1	3/8/2014 13:41	62.7	3/8/2014 22:46	61.0	6/8/2014 19:51	63.2		
28/7/2014 22:31	62.4	31/7/2014 19:36	62.2	2/8/2014 20:41	61.6	3/8/2014 13:46	62.1	3/8/2014 22:51	60.8	6/8/2014 19:56	62.9		
28/7/2014 22:36	61.0	31/7/2014 19:41	62.3	2/8/2014 20:46	60.8	3/8/2014 13:51	62.7	3/8/2014 22:56	61.2	6/8/2014 20:01	61.8		
28/7/2014 22:41	60.1	31/7/2014 19:46	62.0	2/8/2014 20:51	61.7	3/8/2014 13:56	62.5	4/8/2014 19:01	63.7	6/8/2014 20:06	63.3		
28/7/2014 22:46	61.5	31/7/2014 19:51	63.3	2/8/2014 20:56	61.3	3/8/2014 14:01	62.0	4/8/2014 19:06	64.2	6/8/2014 20:11	63.0		
28/7/2014 22:51	61.8	31/7/2014 19:56	63.0	2/8/2014 21:01	61.4	3/8/2014 14:06	61.9	4/8/2014 19:11	63.6	6/8/2014 20:16	63.6		
28/7/2014 22:56	60.5	31/7/2014 20:01	61.8	2/8/2014 21:06	60.9	3/8/2014 14:11	62.1	4/8/2014 19:16	63.3	6/8/2014 20:21	62.8		
29/7/2014 19:01	63.4	31/7/2014 20:06	62.2	2/8/2014 21:11	62.2	3/8/2014 14:16	62.2	4/8/2014 19:21	63.7	6/8/2014 20:26	63.1		
29/7/2014 19:06	63.4	31/7/2014 20:11	62.2	2/8/2014 21:16	61.2	3/8/2014 14:21	62.9	4/8/2014 19:26	63.5	6/8/2014 20:31	62.9		
29/7/2014 19:11	63.0	31/7/2014 20:16	62.4	2/8/2014 21:21	66.8	3/8/2014 14:26	62.7	4/8/2014 19:31	64.3	6/8/2014 20:36	62.9		
29/7/2014 19:16	63.2	31/7/2014 20:21	61.8	2/8/2014 21:26	60.9	3/8/2014 14:31	62.6	4/8/2014 19:36	63.4	6/8/2014 20:41	63.3		
29/7/2014 19:21	63.8	31/7/2014 20:26	61.7	2/8/2014 21:31	61.2	3/8/2014 14:36	62.3	4/8/2014 19:41	63.3	6/8/2014 20:46	64.6		
29/7/2014 19:26	63.6	31/7/2014 20:31	61.9	2/8/2014 21:36	60.9	3/8/2014 14:41	61.9	4/8/2014 19:46	63.6	6/8/2014 20:51	62.4		
29/7/2014 19:31	63.5	31/7/2014 20:36	61.3	2/8/2014 21:41	61.3	3/8/2014 14:46	62.2	4/8/2014 19:51	63.4	6/8/2014 20:56	62.1		
29/7/2014 19:36	63.3	31/7/2014 20:41	61.4	2/8/2014 21:46	61.7	3/8/2014 14:51	62.8	4/8/2014 19:56	63.8	6/8/2014 21:01	63.6		
29/7/2014 19:41	62.7	31/7/2014 20:46	61.2	2/8/2014 21:51	61.5	3/8/2014 14:56	62.8	4/8/2014 20:01	64.4	6/8/2014 21:06	61.7		
29/7/2014 19:46	62.8	31/7/2014 20:51	60.9	2/8/2014 21:56	61.5	3/8/2014 15:01	62.4	4/8/2014 20:06	63.9	6/8/2014 21:11	62.1		
29/7/2014 19:51	63.3	31/7/2014 20:56	61.5	2/8/2014 22:01	61.6	3/8/2014 15:06	62.7	4/8/2014 20:11	63.2	6/8/2014 21:16	60.6		
29/7/2014 19:56	63.5	31/7/2014 21:01	60.6	2/8/2014 22:06	61.4	3/8/2014 15:11	62.5	4/8/2014 20:16	62.9	6/8/2014 21:21	62.8		
29/7/2014 20:01	62.9	31/7/2014 21:06	61.5	2/8/2014 22:11	60.8	3/8/2014 15:16	62.9	4/8/2014 20:21	63.8	6/8/2014 21:26	62.3		
29/7/2014 20:06	62.6	31/7/2014 21:11	60.9	2/8/2014 22:									

Real-time Noise Data		RTN2a (Hong Kong Electric Centre)													
7/8/2014 21:06	62.3	9/8/2014 22:11	62.2	10/8/2014 15:16	62.6	11/8/2014 20:21	63.5	13/8/2014 21:26	63.8	15/8/2014 22:31	61.5				
7/8/2014 21:11	62.5	9/8/2014 22:16	61.5	10/8/2014 15:21	62.4	11/8/2014 20:26	62.3	13/8/2014 21:31	64.0	15/8/2014 22:36	61.7				
7/8/2014 21:16	62.4	9/8/2014 22:21	61.6	10/8/2014 15:26	62.3	11/8/2014 20:31	62.5	13/8/2014 21:36	63.6	15/8/2014 22:41	61.7				
7/8/2014 21:21	61.9	9/8/2014 22:26	62.1	10/8/2014 15:31	63.3	11/8/2014 20:36	61.6	13/8/2014 21:41	64.1	15/8/2014 22:46	61.7				
7/8/2014 21:26	62.8	9/8/2014 22:31	62.6	10/8/2014 15:36	62.8	11/8/2014 20:41	62.7	13/8/2014 21:46	63.6	15/8/2014 22:51	62.2				
7/8/2014 21:31	61.9	9/8/2014 22:36	60.6	10/8/2014 15:41	62.8	11/8/2014 20:46	61.8	13/8/2014 21:51	64.1	15/8/2014 22:56	62.6				
7/8/2014 21:36	61.4	9/8/2014 22:41	61.7	10/8/2014 15:46	63.4	11/8/2014 20:51	61.8	13/8/2014 21:56	64.3	16/8/2014 19:01	62.0				
7/8/2014 21:41	62.1	9/8/2014 22:46	61.4	10/8/2014 15:51	63.0	11/8/2014 20:56	61.9	13/8/2014 22:01	64.8	16/8/2014 19:06	62.6				
7/8/2014 21:46	62.1	9/8/2014 22:51	60.9	10/8/2014 15:56	63.5	11/8/2014 21:01	60.9	13/8/2014 22:06	64.4	16/8/2014 19:11	63.1				
7/8/2014 21:51	61.5	9/8/2014 22:56	62.4	10/8/2014 16:01	62.6	11/8/2014 21:06	61.1	13/8/2014 22:11	65.2	16/8/2014 19:16	62.8				
7/8/2014 21:56	62.1	10/8/2014 7:01	57.9	10/8/2014 16:06	63.0	11/8/2014 21:11	61.3	13/8/2014 22:16	64.2	16/8/2014 19:21	63.7				
7/8/2014 22:01	62.3	10/8/2014 7:06	57.4	10/8/2014 16:11	62.3	11/8/2014 21:16	61.0	13/8/2014 22:21	64.3	16/8/2014 19:26	62.7				
7/8/2014 22:06	62.3	10/8/2014 7:11	57.1	10/8/2014 16:16	62.0	11/8/2014 21:21	64.5	13/8/2014 22:26	64.0	16/8/2014 19:31	61.9				
7/8/2014 22:11	61.7	10/8/2014 7:16	58.6	10/8/2014 16:21	62.9	11/8/2014 21:26	61.4	13/8/2014 22:31	64.1	16/8/2014 19:36	62.5				
7/8/2014 22:16	61.9	10/8/2014 7:21	57.8	10/8/2014 16:26	63.0	11/8/2014 21:31	61.6	13/8/2014 22:36	64.3	16/8/2014 19:41	62.1				
7/8/2014 22:21	61.9	10/8/2014 7:26	61.1	10/8/2014 16:31	62.8	11/8/2014 21:36	61.0	13/8/2014 22:41	64.0	16/8/2014 19:46	62.3				
7/8/2014 22:26	62.1	10/8/2014 7:31	59.2	10/8/2014 16:36	63.3	11/8/2014 21:41	61.6	13/8/2014 22:46	63.8	16/8/2014 19:51	62.3				
7/8/2014 22:31	63.8	10/8/2014 7:36	58.1	10/8/2014 16:41	62.9	11/8/2014 21:46	60.9	13/8/2014 22:51	63.9	16/8/2014 19:56	62.2				
7/8/2014 22:36	61.7	10/8/2014 7:41	58.9	10/8/2014 16:46	62.9	11/8/2014 21:51	62.2	13/8/2014 22:56	63.4	16/8/2014 20:01	62.6				
7/8/2014 22:41	61.4	10/8/2014 7:46	60.2	10/8/2014 16:51	63.4	11/8/2014 21:56	61.5	14/8/2014 19:01	60.9	16/8/2014 20:06	62.6				
7/8/2014 22:46	62.1	10/8/2014 7:51	60.0	10/8/2014 16:56	63.3	11/8/2014 22:01	61.0	14/8/2014 19:06	59.5	16/8/2014 20:11	62.0				
7/8/2014 22:51	61.0	10/8/2014 7:56	62.6	10/8/2014 17:01	62.9	11/8/2014 22:06	60.5	14/8/2014 19:11	59.7	16/8/2014 20:16	62.3				
7/8/2014 22:56	60.4	10/8/2014 8:01	58.9	10/8/2014 17:06	63.9	11/8/2014 22:11	61.3	14/8/2014 19:16	60.9	16/8/2014 20:21	61.9				
8/8/2014 19:01	60.7	10/8/2014 8:06	60.6	10/8/2014 17:11	62.5	11/8/2014 22:16	61.4	14/8/2014 19:21	60.9	16/8/2014 20:26	61.2				
8/8/2014 19:06	60.7	10/8/2014 8:11	59.7	10/8/2014 17:16	62.8	11/8/2014 22:21	62.1	14/8/2014 19:26	62.1	16/8/2014 20:31	61.8				
8/8/2014 19:11	60.9	10/8/2014 8:16	61.1	10/8/2014 17:21	63.5	11/8/2014 22:26	62.4	14/8/2014 19:31	60.9	16/8/2014 20:36	62.3				
8/8/2014 19:16	61.7	10/8/2014 8:21	61.7	10/8/2014 17:26	64.4	11/8/2014 22:31	61.7	14/8/2014 19:36	61.2	16/8/2014 20:41	60.8				
8/8/2014 19:21	62.6	10/8/2014 8:26	61.0	10/8/2014 17:31	63.5	11/8/2014 22:36	61.3	14/8/2014 19:41	61.9	16/8/2014 20:46	60.8				
8/8/2014 19:26	62.4	10/8/2014 8:31	60.4	10/8/2014 17:36	62.9	11/8/2014 22:41	60.0	14/8/2014 19:46	62.7	16/8/2014 20:51	61.0				
8/8/2014 19:31	62.3	10/8/2014 8:36	62.2	10/8/2014 17:41	63.4	11/8/2014 22:46	60.3	14/8/2014 19:51	63.1	16/8/2014 20:56	61.7				
8/8/2014 19:36	62.5	10/8/2014 8:41	62.4	10/8/2014 17:46	62.9	11/8/2014 22:51	61.4	14/8/2014 19:56	64.5	16/8/2014 21:01	60.9				
8/8/2014 19:41	63.1	10/8/2014 8:46	61.9	10/8/2014 17:51	62.6	11/8/2014 22:56	60.3	14/8/2014 20:01	63.8	16/8/2014 21:06	62.1				
8/8/2014 19:46	63.6	10/8/2014 8:51	62.2	10/8/2014 17:56	63.8	12/8/2014 19:01	68.3	14/8/2014 20:06	64.3	16/8/2014 21:11	61.9				
8/8/2014 19:51	62.5	10/8/2014 8:56	62.8	10/8/2014 18:01	63.2	12/8/2014 19:06	68.7	14/8/2014 20:11	64.1	16/8/2014 21:16	62.1				
8/8/2014 19:56	63.0	10/8/2014 9:01	62.6	10/8/2014 18:06	63.5	12/8/2014 19:11	68.1	14/8/2014 20:16	63.3	16/8/2014 21:21	60.3				
8/8/2014 20:01	62.3	10/8/2014 9:06	63.0	10/8/2014 18:11	62.6	12/8/2014 19:16	68.1	14/8/2014 20:21	63.9	16/8/2014 21:26	59.9				
8/8/2014 20:06	62.7	10/8/2014 9:11	62.7	10/8/2014 18:16	62.4	12/8/2014 19:21	67.9	14/8/2014 20:26	63.8	16/8/2014 21:31	59.5				
8/8/2014 20:11	62.1	10/8/2014 9:16	62.7	10/8/2014 18:21	62.4	12/8/2014 19:26	67.4	14/8/2014 20:31	63.8	16/8/2014 21:36	59.6				
8/8/2014 20:16	62.4	10/8/2014 9:21	63.0	10/8/2014 18:26	64.0	12/8/2014 19:31	66.2	14/8/2014 20:36	63.5	16/8/2014 21:41	58.1				
8/8/2014 20:21	63.6	10/8/2014 9:26	63.9	10/8/2014 18:31	63.0	12/8/2014 19:36	65.5	14/8/2014 20:41	63.4	16/8/2014 21:46	62.2				
8/8/2014 20:26	62.3	10/8/2014 9:31	65.0	10/8/2014 18:36	63.6	12/8/2014 19:41	64.6	14/8/2014 20:46	63.8	16/8/2014 21:51	61.3				
8/8/2014 20:31	62.6	10/8/2014 9:36	62.7	10/8/2014 18:41	63.2	12/8/2014 19:46	67.7	14/8/2014 20:51	63.7	16/8/2014 21:56	61.7				
8/8/2014 20:36	62.6	10/8/2014 9:41	60.7	10/8/2014 18:46	62.9	12/8/2014 19:51	67.4	14/8/2014 20:56	63.6	16/8/2014 22:01	62.0				
8/8/2014 20:41	62.3	10/8/2014 9:46	62.6	10/8/2014 18:51	62.2	12/8/2014 19:56	66.1	14/8/2014 21:01	63.4	16/8/2014 22:06	61.3				
8/8/2014 20:46	62.7	10/8/2014 9:51	63.1	10/8/2014 18:56	62.2	12/8/2014 20:01	65.5	14/8/2014 21:06	63.5	16/8/2014 22:11	61.5				
8/8/2014 20:51	62.6	10/8/2014 9:56	61.9	10/8/2014 19:01	62.3	12/8/2014 20:06	64.9	14/8/2014 21:11	64.0	16/8/2014 22:16	62.4				
8/8/2014 20:56	62.7	10/8/2014 10:01	62.7	10/8/2014 19:06	61.8	12/8/2014 20:11	64.4	14/8/2014 21:16	63.7	16/8/2014 22:21	62.0				
8/8/2014 21:01	61.4	10/8/2014 10:06	63.1	10/8/2014 19:11	62.7	12/8/2014 20:16	64.4	14/8/2014 21:21	65.5	16/8/2014 22:26	61.4				
8/8/2014 21:06	62.2	10/8/2014 10:11	63.5	10/8/2014 19:16	61.9	12/8/2014 20:21	65.5	14/8/2014 21:26	63.2	16/8/2014 22:31	61.5				
8/8/2014 21:11	61.7	10/8/2014 10:16	62.8	10/8/2014 19:21	61.8	12/8/2014 20:26	65.3	14/8/2014 21:31	62.9	16/8/2014 22:36	61.7				
8/8/2014 21:16	61.7	10/8/2014 10:21	63.2	10/8/2014 19:26	61.8	12/8/2014 20:31	64.5	14/8/2014 21:36	62.1	16/8/2014 22:41	61.6				
8/8/2014 21:21	62.4	10/8/2014 10:26	61.8	10/8/2014 19:31	62.0	12/8/2014 20:36	64.6	14/8/2014 21:41	62.9	16/8/2014 22:46	61.0				
8/8/2014 21:26	61.9	10/8/2014 10:31	62.2	10/8/2014 19:36	62.3	12/8/2014 20:41	65.4	14/8/2014 21:46	62.8	16/8/2014 22:51	60.9				
8/8/2014 21:31	62.5	10/8/2014 10:36	62.6	10/8/2014 19:41	61.6	12/8/2014 20:46	65.0	14/8/2014 21:51	63.3	16/8/2014 22:56	60.6				
8/8/2014 21:36	61.6	10/8/2014 10:41	60.6	10/8/2014 19:46	62.0	12/8/2014 20:51	64.7	14/8/2014 21:56	62.9	17/8/2014 7:01	57.5				
8/8/2014 21:41	62.0	10/8/2014 10:46	60.5	10/8/2014 19:51	61.1	12/8/2014 20:56	64.4	14/8/2014 22:01	62.8	17/8/2014 7:06	52.8				
8/8/2014 21:46	61.9	10/8/2014 10:51	62.8	10/8/2014 19:56	61.1	12/8/2014 21:01	63.2	14/8/2014 22:06	63.3	17/8/2014 7:11	55.8				
8/8/2014 21:51	62.1	10/8/2014 10:56	61.9	10/8/2014 20:01	61.6	12/8/2014 21:06	63.4	14/8/2014 22:11	63.7	17/8/2014 7:16	54.7				
8/8/2014 21:56	62.5	10/8/2014 11:01	61.9	10/8/2014 20:06	62.3	12/8/2014 21:11	63.8	14/8/2014 22:16	63.2	17/8/2014 7:21	55.8				
8/8/2014 22:01	62.0	10/8/2014 11:06	62.3	10/8/2014 20:11	61.5	12/8/2014 21:16	64.0	14/8/2014 22:21	64.7	17/8/2014 7:26	53.3				
8/8/2014 22:06	61.5	10/8/2014 11:11	61.6	10/8/2014 20:16	61.4	12/8/2014 21:21	63.9	14/8/2014 22:26	63.7	17/8/2014 7:31	56.6				
8/8/2014 22:11	61.1	10/8/2014 11:16	62.0	10/8/2014 20:21	62.8	12/8/2014 21:26	64.2	14/8/2014 22:31	62.8	17/8/2014 7:36	56.2				
8/8/2014 22:16	62.2	10/8/2014 11:21	62.9	10/8/2014 20:26	61.0	12/8/2014 21:31	63.4	14/8/2014 22:36	62.7	17/8/2014 7:41	58.5				
8/8/2014 22:21	61.9	10/8/2014 11:26	61.3	10/8/2014 20:31	60.8	12/8/2014 21:36	64.0	14/8/2014 22:41	62.9	17/8/2014 7:46	58.4				
8/8/201															

Real-time Noise Data		RTN2a (Hong Kong Electric Centre)											
17/8/2014 11:36	61.9	17/8/2014 20:41	60.8	19/8/2014 21:46	63.2	21/8/2014 22:51	62.4	24/8/2014 7:56	55.9	24/8/2014 17:01	62.2		
17/8/2014 11:41	62.7	17/8/2014 20:46	61.5	19/8/2014 21:51	62.8	21/8/2014 22:56	62.0	24/8/2014 8:01	55.2	24/8/2014 17:06	62.3		
17/8/2014 11:46	62.5	17/8/2014 20:51	61.6	19/8/2014 21:56	62.8	22/8/2014 19:01	60.0	24/8/2014 8:06	57.2	24/8/2014 17:11	62.8		
17/8/2014 11:51	61.2	17/8/2014 20:56	61.6	19/8/2014 22:01	62.8	22/8/2014 19:06	59.9	24/8/2014 8:11	61.0	24/8/2014 17:16	62.3		
17/8/2014 11:56	60.8	17/8/2014 21:01	61.2	19/8/2014 22:06	62.5	22/8/2014 19:11	59.5	24/8/2014 8:16	58.4	24/8/2014 17:21	62.2		
17/8/2014 12:01	61.9	17/8/2014 21:06	60.6	19/8/2014 22:11	63.0	22/8/2014 19:16	59.2	24/8/2014 8:21	59.9	24/8/2014 17:26	62.0		
17/8/2014 12:06	61.5	17/8/2014 21:11	61.7	19/8/2014 22:16	63.1	22/8/2014 19:21	59.9	24/8/2014 8:26	61.4	24/8/2014 17:31	63.6		
17/8/2014 12:11	60.4	17/8/2014 21:16	61.6	19/8/2014 22:21	63.2	22/8/2014 19:26	58.9	24/8/2014 8:31	59.9	24/8/2014 17:36	61.9		
17/8/2014 12:16	61.1	17/8/2014 21:21	60.9	19/8/2014 22:26	63.2	22/8/2014 19:31	59.1	24/8/2014 8:36	59.2	24/8/2014 17:41	61.9		
17/8/2014 12:21	60.7	17/8/2014 21:26	60.8	19/8/2014 22:31	62.2	22/8/2014 19:36	60.1	24/8/2014 8:41	60.3	24/8/2014 17:46	62.1		
17/8/2014 12:26	60.8	17/8/2014 21:31	61.9	19/8/2014 22:36	62.1	22/8/2014 19:41	60.5	24/8/2014 8:46	61.5	24/8/2014 17:51	62.4		
17/8/2014 12:31	61.4	17/8/2014 21:36	61.1	19/8/2014 22:41	62.3	22/8/2014 19:46	62.4	24/8/2014 8:51	60.3	24/8/2014 17:56	62.4		
17/8/2014 12:36	61.8	17/8/2014 21:41	61.3	19/8/2014 22:46	61.8	22/8/2014 19:51	63.1	24/8/2014 8:56	60.8	24/8/2014 18:01	62.1		
17/8/2014 12:41	61.4	17/8/2014 21:46	60.9	19/8/2014 22:51	62.3	22/8/2014 19:56	62.4	24/8/2014 9:01	61.2	24/8/2014 18:06	61.7		
17/8/2014 12:46	60.6	17/8/2014 21:51	61.4	19/8/2014 22:56	61.6	22/8/2014 20:01	62.5	24/8/2014 9:06	60.4	24/8/2014 18:11	62.4		
17/8/2014 12:51	60.0	17/8/2014 21:56	60.6	20/8/2014 19:01	62.1	22/8/2014 20:06	63.7	24/8/2014 9:11	61.4	24/8/2014 18:16	62.8		
17/8/2014 12:56	60.8	17/8/2014 22:01	61.4	20/8/2014 19:06	62.2	22/8/2014 20:11	62.5	24/8/2014 9:16	61.7	24/8/2014 18:21	62.0		
17/8/2014 13:01	60.2	17/8/2014 22:06	60.1	20/8/2014 19:11	63.2	22/8/2014 20:16	62.7	24/8/2014 9:21	61.5	24/8/2014 18:26	62.6		
17/8/2014 13:06	60.1	17/8/2014 22:11	60.5	20/8/2014 19:16	63.9	22/8/2014 20:21	63.0	24/8/2014 9:26	61.8	24/8/2014 18:31	63.9		
17/8/2014 13:11	59.7	17/8/2014 22:16	61.1	20/8/2014 19:21	64.4	22/8/2014 20:26	62.1	24/8/2014 9:31	62.9	24/8/2014 18:36	63.4		
17/8/2014 13:16	59.7	17/8/2014 22:21	61.1	20/8/2014 19:26	64.6	22/8/2014 20:31	62.1	24/8/2014 9:36	62.1	24/8/2014 18:41	62.2		
17/8/2014 13:21	60.0	17/8/2014 22:26	62.1	20/8/2014 19:31	64.7	22/8/2014 20:36	62.4	24/8/2014 9:41	62.2	24/8/2014 18:46	62.1		
17/8/2014 13:26	60.6	17/8/2014 22:31	61.5	20/8/2014 19:36	64.4	22/8/2014 20:41	62.5	24/8/2014 9:46	62.5	24/8/2014 18:51	60.8		
17/8/2014 13:31	60.4	17/8/2014 22:36	61.5	20/8/2014 19:41	64.3	22/8/2014 20:46	62.5	24/8/2014 9:51	62.4	24/8/2014 18:56	61.6		
17/8/2014 13:36	60.6	17/8/2014 22:41	61.3	20/8/2014 19:46	63.8	22/8/2014 20:51	63.0	24/8/2014 9:56	64.2	24/8/2014 19:01	61.9		
17/8/2014 13:41	60.6	17/8/2014 22:46	60.7	20/8/2014 19:51	63.8	22/8/2014 20:56	62.9	24/8/2014 10:01	62.9	24/8/2014 19:06	61.1		
17/8/2014 13:46	60.8	17/8/2014 22:51	60.1	20/8/2014 19:56	64.0	22/8/2014 21:01	62.3	24/8/2014 10:06	62.7	24/8/2014 19:11	61.3		
17/8/2014 13:51	59.3	17/8/2014 22:56	61.3	20/8/2014 20:01	64.3	22/8/2014 21:06	62.6	24/8/2014 10:11	61.6	24/8/2014 19:16	61.5		
17/8/2014 13:56	60.9	18/8/2014 19:01	61.2	20/8/2014 20:06	63.7	22/8/2014 21:11	62.0	24/8/2014 10:16	62.1	24/8/2014 19:21	61.2		
17/8/2014 14:01	60.6	18/8/2014 19:06	61.9	20/8/2014 20:11	63.4	22/8/2014 21:16	62.0	24/8/2014 10:21	63.0	24/8/2014 19:26	61.1		
17/8/2014 14:06	63.1	18/8/2014 19:11	62.3	20/8/2014 20:16	63.7	22/8/2014 21:21	63.0	24/8/2014 10:26	62.2	24/8/2014 19:31	61.3		
17/8/2014 14:11	60.2	18/8/2014 19:16	62.9	20/8/2014 20:21	64.4	22/8/2014 21:26	61.7	24/8/2014 10:31	61.5	24/8/2014 19:36	61.4		
17/8/2014 14:16	59.5	18/8/2014 19:21	62.7	20/8/2014 20:26	63.4	22/8/2014 21:31	61.8	24/8/2014 10:36	62.3	24/8/2014 19:41	61.3		
17/8/2014 14:21	60.5	18/8/2014 19:26	62.6	20/8/2014 20:31	63.1	22/8/2014 21:36	63.0	24/8/2014 10:41	61.1	24/8/2014 19:46	60.9		
17/8/2014 14:26	59.9	18/8/2014 19:31	62.8	20/8/2014 20:36	62.9	22/8/2014 21:41	61.8	24/8/2014 10:46	61.1	24/8/2014 19:51	61.8		
17/8/2014 14:31	60.3	18/8/2014 19:36	62.4	20/8/2014 20:41	63.3	22/8/2014 21:46	62.4	24/8/2014 10:51	62.0	24/8/2014 19:56	60.7		
17/8/2014 14:36	60.6	18/8/2014 19:41	62.3	20/8/2014 20:46	63.3	22/8/2014 21:51	62.7	24/8/2014 10:56	61.5	24/8/2014 20:01	61.6		
17/8/2014 14:41	63.5	18/8/2014 19:46	61.3	20/8/2014 20:51	63.4	22/8/2014 21:56	62.2	24/8/2014 11:01	61.5	24/8/2014 20:06	61.6		
17/8/2014 14:46	61.4	18/8/2014 19:51	61.6	20/8/2014 20:56	62.6	22/8/2014 22:01	61.7	24/8/2014 11:06	62.5	24/8/2014 20:11	61.8		
17/8/2014 14:51	62.5	18/8/2014 19:56	61.7	20/8/2014 21:01	62.8	22/8/2014 22:06	61.9	24/8/2014 11:11	61.8	24/8/2014 20:16	60.6		
17/8/2014 14:56	61.2	18/8/2014 20:01	62.4	20/8/2014 21:06	62.6	22/8/2014 22:11	62.7	24/8/2014 11:16	62.2	24/8/2014 20:21	60.3		
17/8/2014 15:01	59.4	18/8/2014 20:06	62.1	20/8/2014 21:11	63.0	22/8/2014 22:16	62.6	24/8/2014 11:21	61.7	24/8/2014 20:26	60.5		
17/8/2014 15:06	61.2	18/8/2014 20:11	61.8	20/8/2014 21:16	62.9	22/8/2014 22:21	62.9	24/8/2014 11:26	61.4	24/8/2014 20:31	61.1		
17/8/2014 15:11	61.4	18/8/2014 20:16	61.9	20/8/2014 21:21	63.1	22/8/2014 22:26	62.5	24/8/2014 11:31	61.0	24/8/2014 20:36	61.8		
17/8/2014 15:16	62.5	18/8/2014 20:21	61.3	20/8/2014 21:26	63.8	22/8/2014 22:31	62.4	24/8/2014 11:36	62.2	24/8/2014 20:41	63.1		
17/8/2014 15:21	61.6	18/8/2014 20:26	60.8	20/8/2014 21:31	62.9	22/8/2014 22:36	62.4	24/8/2014 11:41	61.1	24/8/2014 20:46	61.8		
17/8/2014 15:26	60.1	18/8/2014 20:31	60.9	20/8/2014 21:36	62.2	22/8/2014 22:41	61.4	24/8/2014 11:46	61.2	24/8/2014 20:51	60.6		
17/8/2014 15:31	60.9	18/8/2014 20:36	60.5	20/8/2014 21:41	63.4	22/8/2014 22:46	61.7	24/8/2014 11:51	61.0	24/8/2014 20:56	60.6		
17/8/2014 15:36	60.5	18/8/2014 20:41	60.4	20/8/2014 21:46	63.3	22/8/2014 22:51	62.1	24/8/2014 11:56	61.4	24/8/2014 21:01	60.8		
17/8/2014 15:41	62.3	18/8/2014 20:46	59.7	20/8/2014 21:51	63.4	22/8/2014 22:56	62.2	24/8/2014 12:01	62.5	24/8/2014 21:06	61.5		
17/8/2014 15:46	62.4	18/8/2014 20:51	59.0	20/8/2014 21:56	63.6	23/8/2014 19:01	63.4	24/8/2014 12:06	61.9	24/8/2014 21:11	61.8		
17/8/2014 15:51	61.5	18/8/2014 20:56	59.5	20/8/2014 22:01	63.0	23/8/2014 19:06	63.2	24/8/2014 12:11	61.8	24/8/2014 21:16	60.1		
17/8/2014 15:56	61.9	18/8/2014 21:01	58.8	20/8/2014 22:06	62.9	23/8/2014 19:11	62.0	24/8/2014 12:16	62.0	24/8/2014 21:21	61.2		
17/8/2014 16:01	62.7	18/8/2014 21:06	59.9	20/8/2014 22:11	63.2	23/8/2014 19:16	62.3	24/8/2014 12:21	61.8	24/8/2014 21:26	60.6		
17/8/2014 16:06	62.0	18/8/2014 21:11	59.9	20/8/2014 22:16	62.7	23/8/2014 19:21	62.8	24/8/2014 12:26	61.6	24/8/2014 21:31	60.8		
17/8/2014 16:11	61.7	18/8/2014 21:16	59.9	20/8/2014 22:21	62.4	23/8/2014 19:26	62.0	24/8/2014 12:31	62.9	24/8/2014 21:36	62.9		
17/8/2014 16:16	61.9	18/8/2014 21:21	59.8	20/8/2014 22:26	63.5	23/8/2014 19:31	62.0	24/8/2014 12:36	62.0	24/8/2014 21:41	61.7		
17/8/2014 16:21	61.3	18/8/2014 21:26	60.1	20/8/2014 22:31	62.6	23/8/2014 19:36	63.4	24/8/2014 12:41	61.7	24/8/2014 21:46	63.5		
17/8/2014 16:26	61.4	18/8/2014 21:31	60.1	20/8/2014 22:36	62.7	23/8/2014 19:41	61.6	24/8/2014 12:46	61.3	24/8/2014 21:51	61.2		
17/8/2014 16:31	61.7	18/8/2014 21:36	59.1	20/8/2014 22:41	63.6	23/8/2014 19:46	62.6	24/8/2014 12:51	61.3	24/8/2014 21:56	61.7		
17/8/2014 16:36	63.5	18/8/2014 21:41	59.4	20/8/2014 22:46	63.2	23/8/2014 19:51	62.0	24/8/2014 12:56	62.5	24/8/2014 22:01	60.3		
17/8/2014 16:41	63.1	18/8/2014 21:46	61.6	20/8/2014 22:51	63.0	23/8/2014 19:56	61.8	24/8/2014 13:01	62.0	24/8/2014 22:06	59.9		
17/8/2014 16:46	63.7	18/8/2014 21:51	60.4	20/8/2014 22:56	62.5	23/8/2014 20:01	62.6	24/8/2014 13:06	63.8	24/8/2014 22:11	61.0		
17/8/2014 16:51	62.8	18/8/2014 21:56	58.9	21/8/2014 19:01	61.2	23/8/2014 20:06	62.1	24/8/2014 13:11	61.6	24/8/2014 22:16	61.0		
17/8/2014 16:56	63.6	18/8/2014 22:01	58.4	21/8/2014 19:06	61.1	23/8/2014 20:11	62.1	24/8/2014 13:16	61.5	24/8/2014 22:21	60.7		
17/8/2014 17:01	64.7	18/8/2014 22:06	58.4	21/8/2014 19:11	60.7	23/8/2014 20:16	60.7						

Real-time Noise Data		RTN2a (Hong Kong Electric Centre)														
25/8/2014 22:06	61.0			29/7/2014 0:51	60.3			30/7/2014 1:56	60.1			31/7/2014 3:01	55.6		1/8/2014 4:06	53.5
25/8/2014 22:11	60.5			29/7/2014 0:56	59.2			30/7/2014 2:01	60.2			31/7/2014 3:06	53.3		1/8/2014 4:11	52.5
25/8/2014 22:16	61.9			29/7/2014 1:01	59.8			30/7/2014 2:06	59.4			31/7/2014 3:11	53.5		1/8/2014 4:16	54.3
25/8/2014 22:21	60.7		28/7/2014 0:01	61.4	29/7/2014 1:06	60.5		30/7/2014 2:11	59.5			31/7/2014 3:16	54.0		1/8/2014 4:21	54.8
25/8/2014 22:26	61.2		28/7/2014 0:06	61.9	29/7/2014 1:11	59.8		30/7/2014 2:16	59.4			31/7/2014 3:21	52.2		1/8/2014 4:26	53.6
25/8/2014 22:31	60.3		28/7/2014 0:11	62.7	29/7/2014 1:16	58.2		30/7/2014 2:21	59.2			31/7/2014 3:26	53.0		1/8/2014 4:31	53.1
25/8/2014 22:36	60.3		28/7/2014 0:16	62.0	29/7/2014 1:21	59.1		30/7/2014 2:26	59.2			31/7/2014 3:31	53.2		1/8/2014 4:36	50.4
25/8/2014 22:41	59.5		28/7/2014 0:21	60.1	29/7/2014 1:26	59.0		30/7/2014 2:31	59.1			31/7/2014 3:36	54.5		1/8/2014 4:41	55.3
25/8/2014 22:46	60.2		28/7/2014 0:26	60.9	29/7/2014 1:31	58.7		30/7/2014 2:36	59.5			31/7/2014 3:41	52.9		1/8/2014 4:46	53.5
25/8/2014 22:51	60.2		28/7/2014 0:31	61.1	29/7/2014 1:36	58.7		30/7/2014 2:41	59.0			31/7/2014 3:46	55.1		1/8/2014 4:51	51.6
25/8/2014 22:56	61.6		28/7/2014 0:36	59.9	29/7/2014 1:41	58.2		30/7/2014 2:46	59.4			31/7/2014 3:51	54.3		1/8/2014 4:56	54.2
26/8/2014 19:01	62.9		28/7/2014 0:41	60.1	29/7/2014 1:46	59.0		30/7/2014 2:51	58.8			31/7/2014 3:56	52.2		1/8/2014 5:01	55.9
26/8/2014 19:06	62.7		28/7/2014 0:46	58.3	29/7/2014 1:51	58.9		30/7/2014 2:56	58.3			31/7/2014 4:01	49.4		1/8/2014 5:06	54.5
26/8/2014 19:11	62.5		28/7/2014 0:51	60.6	29/7/2014 1:56	58.7		30/7/2014 3:01	58.2			31/7/2014 4:06	52.2		1/8/2014 5:11	54.8
26/8/2014 19:16	62.9		28/7/2014 0:56	60.2	29/7/2014 2:01	55.3		30/7/2014 3:06	59.5			31/7/2014 4:11	50.1		1/8/2014 5:16	55.8
26/8/2014 19:21	63.1		28/7/2014 1:01	58.6	29/7/2014 2:06	56.3		30/7/2014 3:11	57.8			31/7/2014 4:16	48.8		1/8/2014 5:21	59.4
26/8/2014 19:26	63.3		28/7/2014 1:06	59.6	29/7/2014 2:11	56.7		30/7/2014 3:16	58.1			31/7/2014 4:21	53.6		1/8/2014 5:26	56.6
26/8/2014 19:31	62.4		28/7/2014 1:11	59.0	29/7/2014 2:16	56.2		30/7/2014 3:21	57.6			31/7/2014 4:26	52.2		1/8/2014 5:31	52.9
26/8/2014 19:36	63.1		28/7/2014 1:16	58.2	29/7/2014 2:21	56.3		30/7/2014 3:26	57.6			31/7/2014 4:31	53.5		1/8/2014 5:36	55.5
26/8/2014 19:41	62.9		28/7/2014 1:21	57.6	29/7/2014 2:26	56.8		30/7/2014 3:31	57.4			31/7/2014 4:36	52.6		1/8/2014 5:41	55.9
26/8/2014 19:46	62.6		28/7/2014 1:26	59.3	29/7/2014 2:31	54.9		30/7/2014 3:36	58.4			31/7/2014 4:41	50.2		1/8/2014 5:46	56.5
26/8/2014 19:51	63.7		28/7/2014 1:31	57.6	29/7/2014 2:36	55.4		30/7/2014 3:41	58.4			31/7/2014 4:46	52.6		1/8/2014 5:51	58.0
26/8/2014 19:56	62.6		28/7/2014 1:36	58.7	29/7/2014 2:41	56.0		30/7/2014 3:46	57.5			31/7/2014 4:51	50.4		1/8/2014 5:56	59.2
26/8/2014 20:01	62.3		28/7/2014 1:41	57.4	29/7/2014 2:46	55.7		30/7/2014 3:51	59.1			31/7/2014 4:56	54.0		1/8/2014 6:01	57.4
26/8/2014 20:06	62.9		28/7/2014 1:46	58.2	29/7/2014 2:51	56.0		30/7/2014 3:56	57.0			31/7/2014 5:01	53.4		1/8/2014 6:06	58.6
26/8/2014 20:11	62.6		28/7/2014 1:51	57.3	29/7/2014 2:56	55.2		30/7/2014 4:01	57.7			31/7/2014 5:06	56.2		1/8/2014 6:11	58.5
26/8/2014 20:16	62.4		28/7/2014 1:56	58.5	29/7/2014 3:01	55.5		30/7/2014 4:06	56.8			31/7/2014 5:11	53.5		1/8/2014 6:16	59.3
26/8/2014 20:21	62.5		28/7/2014 2:01	54.4	29/7/2014 3:06	56.4		30/7/2014 4:11	58.3			31/7/2014 5:16	59.1		1/8/2014 6:21	59.6
26/8/2014 20:26	61.9		28/7/2014 2:06	55.4	29/7/2014 3:11	53.4		30/7/2014 4:16	57.2			31/7/2014 5:21	54.8		1/8/2014 6:26	59.6
26/8/2014 20:31	61.6		28/7/2014 2:11	57.1	29/7/2014 3:16	53.0		30/7/2014 4:21	59.0			31/7/2014 5:26	53.8		1/8/2014 6:31	59.4
26/8/2014 20:36	61.7		28/7/2014 2:16	53.1	29/7/2014 3:21	51.4		30/7/2014 4:26	56.9			31/7/2014 5:31	55.3		1/8/2014 6:36	60.3
26/8/2014 20:41	62.5		28/7/2014 2:21	56.5	29/7/2014 3:26	52.2		30/7/2014 4:31	56.3			31/7/2014 5:36	54.4		1/8/2014 6:41	60.5
26/8/2014 20:46	61.7		28/7/2014 2:26	55.7	29/7/2014 3:31	51.2		30/7/2014 4:36	57.5			31/7/2014 5:41	56.6		1/8/2014 6:46	61.6
26/8/2014 20:51	60.8		28/7/2014 2:31	53.1	29/7/2014 3:36	55.1		30/7/2014 4:41	57.8			31/7/2014 5:46	57.1		1/8/2014 6:51	62.2
26/8/2014 20:56	61.3		28/7/2014 2:36	51.6	29/7/2014 3:41	52.3		30/7/2014 4:46	58.2			31/7/2014 5:51	58.7		1/8/2014 6:56	61.6
26/8/2014 21:01	62.2		28/7/2014 2:41	50.8	29/7/2014 3:46	51.8		30/7/2014 4:51	57.6			31/7/2014 5:56	59.3		1/8/2014 7:01	64.3
26/8/2014 21:06	61.0		28/7/2014 2:46	53.4	29/7/2014 3:51	55.2		30/7/2014 4:56	57.9			31/7/2014 6:01	57.0		1/8/2014 7:06	64.5
26/8/2014 21:11	61.1		28/7/2014 2:51	60.1	29/7/2014 3:56	52.7		30/7/2014 5:01	58.7			31/7/2014 6:06	57.5		1/8/2014 7:11	63.9
26/8/2014 21:16	61.9		28/7/2014 2:56	54.6	29/7/2014 4:01	54.6		30/7/2014 5:06	58.5			31/7/2014 6:11	59.6		1/8/2014 7:16	64.3
26/8/2014 21:21	61.8		28/7/2014 3:01	54.0	29/7/2014 4:06	53.3		30/7/2014 5:11	57.0			31/7/2014 6:16	60.2		1/8/2014 7:21	64.9
26/8/2014 21:26	61.3		28/7/2014 3:06	55.6	29/7/2014 4:11	53.2		30/7/2014 5:16	60.8			31/7/2014 6:21	59.8		1/8/2014 7:26	64.2
26/8/2014 21:31	62.3		28/7/2014 3:11	50.6	29/7/2014 4:16	50.4		30/7/2014 5:21	58.8			31/7/2014 6:26	60.9		1/8/2014 7:31	64.2
26/8/2014 21:36	60.8		28/7/2014 3:16	53.0	29/7/2014 4:21	51.3		30/7/2014 5:26	59.0			31/7/2014 6:31	60.2		1/8/2014 7:36	64.6
26/8/2014 21:41	60.5		28/7/2014 3:21	54.5	29/7/2014 4:26	48.1		30/7/2014 5:31	57.6			31/7/2014 6:36	60.9		1/8/2014 7:41	64.1
26/8/2014 21:46	61.7		28/7/2014 3:26	48.3	29/7/2014 4:31	45.5		30/7/2014 5:36	60.0			31/7/2014 6:41	61.6		1/8/2014 7:46	64.1
26/8/2014 21:51	61.3		28/7/2014 3:31	57.8	29/7/2014 4:36	51.4		30/7/2014 5:41	58.9			31/7/2014 6:46	61.5		1/8/2014 7:51	64.1
26/8/2014 21:56	61.1		28/7/2014 3:36	47.7	29/7/2014 4:41	54.6		30/7/2014 5:46	59.4			31/7/2014 6:51	62.6		1/8/2014 7:56	63.6
26/8/2014 22:01	61.1		28/7/2014 3:41	53.4	29/7/2014 4:46	58.3		30/7/2014 5:51	59.6			31/7/2014 6:56	62.5		2/8/2014 0:01	63.6
26/8/2014 22:06	61.0		28/7/2014 3:46	58.1	29/7/2014 4:51	53.4		30/7/2014 5:56	59.9			31/7/2014 7:01	63.1		2/8/2014 0:06	64.2
26/8/2014 22:11	61.4		28/7/2014 3:51	57.0	29/7/2014 4:56	54.3		30/7/2014 6:01	59.9			31/7/2014 7:06	63.4		2/8/2014 0:11	64.2
26/8/2014 22:16	61.1		28/7/2014 3:56	49.7	29/7/2014 5:01	53.2		30/7/2014 6:06	60.1			31/7/2014 7:11	62.5		2/8/2014 0:16	63.9
26/8/2014 22:21	60.7		28/7/2014 4:01	48.0	29/7/2014 5:06	51.8		30/7/2014 6:11	60.3			31/7/2014 7:16	62.8		2/8/2014 0:21	63.6
26/8/2014 22:26	62.4		28/7/2014 4:06	52.2	29/7/2014 5:11	54.0		30/7/2014 6:16	62.1			31/7/2014 7:21	63.0		2/8/2014 0:26	63.9
26/8/2014 22:31	61.1		28/7/2014 4:11	49.9	29/7/2014 5:16	57.7		30/7/2014 6:21	61.7			31/7/2014 7:26	63.1		2/8/2014 0:31	63.5
26/8/2014 22:36	60.7		28/7/2014 4:16	58.2	29/7/2014 5:21	52.1		30/7/2014 6:26	61.5			31/7/2014 7:31	64.3		2/8/2014 0:36	63.2
26/8/2014 22:41	60.8		28/7/2014 4:21	49.9	29/7/2014 5:26	55.6		30/7/2014 6:31	61.1			31/7/2014 7:36	63.2		2/8/2014 0:41	63.5
26/8/2014 22:46	60.6		28/7/2014 4:26	55.3	29/7/2014 5:31	56.3		30/7/2014 6:36	62.7			31/7/2014 7:41	62.6		2/8/2014 0:46	62.8
26/8/2014 22:51	60.9		28/7/2014 4:31	53.5	29/7/2014 5:36	56.6		30/7/2014 6:41	62.2			31/7/2014 7:46	62.3		2/8/2014 0:51	63.6
26/8/2014 22:56	61.1		28/7/2014 4:36	54.4	29/7/2014 5:41	55.6		30/7/2014 6:46	63.0			31/7/2014 7:51	62.6		2/8/2014 0:56	63.5
27/8/2014 19:01	60.6		28/7/2014 4:41	49.7	29/7/2014 5:46	59.0		30/7/2014 6:51	63.2			31/7/2014 7:56	62.5		2/8/2014 1:01	63.2
27/8/2014 19:06	61.7		28/7/2014 4:46	51.2	29/7/2014 5:51	58.4		30/7/2014 6:56	63.1			1/8/2014 0:01	61.7		2/8/2014 1:06	62.4
27/8/2014 19:11	62.3		28/7/2014 4:51	54.3	29/7/2014 5:56	59.0		30/7/2014 7:01	63.4			1/8/2014 0:06	62.7		2/8/2014 1:11	63.3
27/8/2014 19:16	62.2		28/7/2014 4:56	49.6	29/7/2014 6:01	57.3		30/7/2014 7:06	62.9			1/8/2014 0:11	61.6		2/8/2014 1:16	62.3
27/8/2014 19:21	62.5		28/7/2014 5:01	57.0	29/7/2014 6:06	57.5		30/7/2014 7:11	63.5			1/8/2014 0:16	62.1		2/8/2014 1:21	63.0
27/8/2014 19:26	62.6		28/7/2014 5:06	55.4	29/7/2014 6:11											

Real-time Noise Data		RTN2a (Hong Kong Electric Centre)											
2/8/2014 5:11	58.0	3/8/2014 6:16	61.0	4/8/2014 23:21	62.4	6/8/2014 0:26	61.8	7/8/2014 1:31	60.4	8/8/2014 2:36	58.4		
2/8/2014 5:16	58.2	3/8/2014 6:21	61.3	4/8/2014 23:26	62.6	6/8/2014 0:31	61.0	7/8/2014 1:36	59.7	8/8/2014 2:41	58.9		
2/8/2014 5:21	59.9	3/8/2014 6:26	62.1	4/8/2014 23:31	62.0	6/8/2014 0:36	60.9	7/8/2014 1:41	60.8	8/8/2014 2:46	59.2		
2/8/2014 5:26	58.0	3/8/2014 6:31	62.5	4/8/2014 23:36	63.4	6/8/2014 0:41	60.6	7/8/2014 1:46	60.6	8/8/2014 2:51	58.8		
2/8/2014 5:31	58.2	3/8/2014 6:36	61.4	4/8/2014 23:41	62.3	6/8/2014 0:46	59.5	7/8/2014 1:51	60.7	8/8/2014 2:56	57.9		
2/8/2014 5:36	57.4	3/8/2014 6:41	61.5	4/8/2014 23:46	62.5	6/8/2014 0:51	59.7	7/8/2014 1:56	59.9	8/8/2014 3:01	59.4		
2/8/2014 5:41	58.2	3/8/2014 6:46	62.2	4/8/2014 23:51	62.3	6/8/2014 0:56	60.1	7/8/2014 2:01	59.3	8/8/2014 3:06	58.9		
2/8/2014 5:46	59.3	3/8/2014 6:51	62.7	4/8/2014 23:56	62.8	6/8/2014 1:01	62.5	7/8/2014 2:06	59.4	8/8/2014 3:11	57.0		
2/8/2014 5:51	59.8	3/8/2014 6:56	64.9	5/8/2014 0:01	62.0	6/8/2014 1:06	67.0	7/8/2014 2:11	60.0	8/8/2014 3:16	56.5		
2/8/2014 5:56	59.6	3/8/2014 23:01	62.4	5/8/2014 0:06	62.1	6/8/2014 1:11	77.4	7/8/2014 2:16	59.3	8/8/2014 3:21	56.0		
2/8/2014 6:01	58.9	3/8/2014 23:06	62.7	5/8/2014 0:11	62.1	6/8/2014 1:16	67.6	7/8/2014 2:21	59.4	8/8/2014 3:26	57.6		
2/8/2014 6:06	59.5	3/8/2014 23:11	62.8	5/8/2014 0:16	62.0	6/8/2014 1:21	65.2	7/8/2014 2:26	58.9	8/8/2014 3:31	56.5		
2/8/2014 6:11	60.4	3/8/2014 23:16	62.9	5/8/2014 0:21	61.5	6/8/2014 1:26	62.6	7/8/2014 2:31	58.4	8/8/2014 3:36	56.9		
2/8/2014 6:16	60.2	3/8/2014 23:21	63.2	5/8/2014 0:26	61.9	6/8/2014 1:31	60.8	7/8/2014 2:36	60.1	8/8/2014 3:41	57.3		
2/8/2014 6:21	60.4	3/8/2014 23:26	61.8	5/8/2014 0:31	61.2	6/8/2014 1:36	60.7	7/8/2014 2:41	59.4	8/8/2014 3:46	56.9		
2/8/2014 6:26	60.2	3/8/2014 23:31	61.9	5/8/2014 0:36	60.7	6/8/2014 1:41	60.3	7/8/2014 2:46	58.2	8/8/2014 3:51	57.3		
2/8/2014 6:31	61.8	3/8/2014 23:36	62.2	5/8/2014 0:41	61.0	6/8/2014 1:46	60.9	7/8/2014 2:51	57.0	8/8/2014 3:56	58.1		
2/8/2014 6:36	61.7	3/8/2014 23:41	62.5	5/8/2014 0:46	60.2	6/8/2014 1:51	60.0	7/8/2014 2:56	56.8	8/8/2014 4:01	55.0		
2/8/2014 6:41	62.4	3/8/2014 23:46	62.1	5/8/2014 0:51	59.9	6/8/2014 1:56	59.2	7/8/2014 3:01	57.7	8/8/2014 4:06	58.1		
2/8/2014 6:46	62.2	3/8/2014 23:51	61.3	5/8/2014 0:56	59.6	6/8/2014 2:01	59.4	7/8/2014 3:06	58.0	8/8/2014 4:11	55.8		
2/8/2014 6:51	62.4	3/8/2014 23:56	60.9	5/8/2014 1:01	60.2	6/8/2014 2:06	58.8	7/8/2014 3:11	56.5	8/8/2014 4:16	56.4		
2/8/2014 6:56	61.9	4/8/2014 0:01	61.6	5/8/2014 1:06	59.8	6/8/2014 2:11	59.2	7/8/2014 3:16	56.9	8/8/2014 4:21	56.4		
2/8/2014 23:01	63.5	4/8/2014 0:06	60.8	5/8/2014 1:11	59.3	6/8/2014 2:16	56.9	7/8/2014 3:21	58.3	8/8/2014 4:26	55.3		
2/8/2014 23:06	63.3	4/8/2014 0:11	60.9	5/8/2014 1:16	59.2	6/8/2014 2:21	58.8	7/8/2014 3:26	59.5	8/8/2014 4:31	53.3		
2/8/2014 23:11	63.4	4/8/2014 0:16	60.3	5/8/2014 1:21	59.4	6/8/2014 2:26	59.3	7/8/2014 3:31	57.3	8/8/2014 4:36	56.8		
2/8/2014 23:16	62.9	4/8/2014 0:21	61.0	5/8/2014 1:26	59.1	6/8/2014 2:31	57.9	7/8/2014 3:36	57.4	8/8/2014 4:41	56.8		
2/8/2014 23:21	63.5	4/8/2014 0:26	64.8	5/8/2014 1:31	59.6	6/8/2014 2:36	56.9	7/8/2014 3:41	57.1	8/8/2014 4:46	56.6		
2/8/2014 23:26	63.6	4/8/2014 0:31	61.4	5/8/2014 1:36	58.3	6/8/2014 2:41	58.3	7/8/2014 3:46	55.1	8/8/2014 4:51	54.1		
2/8/2014 23:31	62.7	4/8/2014 0:36	60.2	5/8/2014 1:41	58.4	6/8/2014 2:46	56.2	7/8/2014 3:51	55.5	8/8/2014 4:56	56.2		
2/8/2014 23:36	63.6	4/8/2014 0:41	60.3	5/8/2014 1:46	57.6	6/8/2014 2:51	59.8	7/8/2014 3:56	56.2	8/8/2014 5:01	56.4		
2/8/2014 23:41	68.9	4/8/2014 0:46	59.5	5/8/2014 1:51	58.1	6/8/2014 2:56	57.5	7/8/2014 4:01	55.8	8/8/2014 5:06	59.9		
2/8/2014 23:46	68.6	4/8/2014 0:51	58.5	5/8/2014 1:56	56.9	6/8/2014 3:01	55.9	7/8/2014 4:06	58.4	8/8/2014 5:11	56.9		
2/8/2014 23:51	68.7	4/8/2014 0:56	59.3	5/8/2014 2:01	56.7	6/8/2014 3:06	57.5	7/8/2014 4:11	54.4	8/8/2014 5:16	57.5		
2/8/2014 23:56	69.1	4/8/2014 1:01	59.6	5/8/2014 2:06	56.9	6/8/2014 3:11	56.9	7/8/2014 4:16	56.1	8/8/2014 5:21	59.1		
3/8/2014 0:01	68.7	4/8/2014 1:06	58.7	5/8/2014 2:11	57.3	6/8/2014 3:16	54.8	7/8/2014 4:21	54.8	8/8/2014 5:26	60.2		
3/8/2014 0:06	67.6	4/8/2014 1:11	58.8	5/8/2014 2:16	57.7	6/8/2014 3:21	57.0	7/8/2014 4:26	54.7	8/8/2014 5:31	59.0		
3/8/2014 0:11	67.5	4/8/2014 1:16	58.2	5/8/2014 2:21	56.5	6/8/2014 3:26	56.6	7/8/2014 4:31	53.7	8/8/2014 5:36	57.2		
3/8/2014 0:16	67.9	4/8/2014 1:21	58.2	5/8/2014 2:26	56.7	6/8/2014 3:31	58.4	7/8/2014 4:36	57.4	8/8/2014 5:41	59.2		
3/8/2014 0:21	68.8	4/8/2014 1:26	57.8	5/8/2014 2:31	58.2	6/8/2014 3:36	56.0	7/8/2014 4:41	54.6	8/8/2014 5:46	58.4		
3/8/2014 0:26	68.4	4/8/2014 1:31	58.0	5/8/2014 2:36	56.6	6/8/2014 3:41	55.4	7/8/2014 4:46	52.9	8/8/2014 5:51	60.0		
3/8/2014 0:31	67.8	4/8/2014 1:36	56.7	5/8/2014 2:41	52.3	6/8/2014 3:46	56.9	7/8/2014 4:51	55.8	8/8/2014 5:56	59.1		
3/8/2014 0:36	66.5	4/8/2014 1:41	58.2	5/8/2014 2:46	54.6	6/8/2014 3:51	56.2	7/8/2014 4:56	54.6	8/8/2014 6:01	59.3		
3/8/2014 0:41	65.5	4/8/2014 1:46	57.1	5/8/2014 2:51	52.8	6/8/2014 3:56	56.9	7/8/2014 5:01	56.8	8/8/2014 6:06	59.9		
3/8/2014 0:46	63.6	4/8/2014 1:51	57.1	5/8/2014 2:56	53.6	6/8/2014 4:01	54.5	7/8/2014 5:06	55.4	8/8/2014 6:11	60.9		
3/8/2014 0:51	63.7	4/8/2014 1:56	56.7	5/8/2014 3:01	56.1	6/8/2014 4:06	56.3	7/8/2014 5:11	57.8	8/8/2014 6:16	61.2		
3/8/2014 0:56	62.9	4/8/2014 2:01	57.3	5/8/2014 3:06	54.2	6/8/2014 4:11	55.7	7/8/2014 5:16	58.2	8/8/2014 6:21	61.8		
3/8/2014 1:01	63.0	4/8/2014 2:06	57.5	5/8/2014 3:11	54.1	6/8/2014 4:16	56.0	7/8/2014 5:21	58.8	8/8/2014 6:26	61.7		
3/8/2014 1:06	63.3	4/8/2014 2:11	55.5	5/8/2014 3:16	51.6	6/8/2014 4:21	55.9	7/8/2014 5:26	59.6	8/8/2014 6:31	60.4		
3/8/2014 1:11	62.7	4/8/2014 2:16	56.6	5/8/2014 3:21	56.0	6/8/2014 4:26	55.4	7/8/2014 5:31	62.6	8/8/2014 6:36	62.3		
3/8/2014 1:16	62.1	4/8/2014 2:21	56.3	5/8/2014 3:26	55.0	6/8/2014 4:31	54.9	7/8/2014 5:36	61.2	8/8/2014 6:41	62.1		
3/8/2014 1:21	62.8	4/8/2014 2:26	53.7	5/8/2014 3:31	53.0	6/8/2014 4:36	56.5	7/8/2014 5:41	59.7	8/8/2014 6:46	63.7		
3/8/2014 1:26	62.1	4/8/2014 2:31	53.7	5/8/2014 3:36	54.5	6/8/2014 4:41	55.4	7/8/2014 5:46	64.1	8/8/2014 6:51	63.8		
3/8/2014 1:31	62.2	4/8/2014 2:36	52.5	5/8/2014 3:41	54.2	6/8/2014 4:46	56.8	7/8/2014 5:51	62.6	8/8/2014 6:56	63.8		
3/8/2014 1:36	61.5	4/8/2014 2:41	53.8	5/8/2014 3:46	50.2	6/8/2014 4:51	57.4	7/8/2014 5:56	60.9	8/8/2014 23:01	64.1		
3/8/2014 1:41	61.4	4/8/2014 2:46	54.2	5/8/2014 3:51	49.4	6/8/2014 4:56	56.1	7/8/2014 6:01	58.2	8/8/2014 23:06	64.0		
3/8/2014 1:46	62.1	4/8/2014 2:51	52.5	5/8/2014 3:56	56.6	6/8/2014 5:01	56.5	7/8/2014 6:06	59.4	8/8/2014 23:11	64.7		
3/8/2014 1:51	61.3	4/8/2014 2:56	51.2	5/8/2014 4:01	53.0	6/8/2014 5:06	57.0	7/8/2014 6:11	60.6	8/8/2014 23:16	64.0		
3/8/2014 1:56	61.5	4/8/2014 3:01	51.5	5/8/2014 4:06	53.5	6/8/2014 5:11	56.0	7/8/2014 6:16	62.1	8/8/2014 23:21	63.8		
3/8/2014 2:01	61.8	4/8/2014 3:06	51.6	5/8/2014 4:11	50.7	6/8/2014 5:16	57.6	7/8/2014 6:21	60.2	8/8/2014 23:26	63.7		
3/8/2014 2:06	60.7	4/8/2014 3:11	50.7	5/8/2014 4:16	50.0	6/8/2014 5:21	60.2	7/8/2014 6:26	62.5	8/8/2014 23:31	63.3		
3/8/2014 2:11	60.5	4/8/2014 3:16	51.8	5/8/2014 4:21	51.8	6/8/2014 5:26	57.8	7/8/2014 6:31	64.9	8/8/2014 23:36	63.4		
3/8/2014 2:16	61.2	4/8/2014 3:21	44.3	5/8/2014 4:26	52.9	6/8/2014 5:31	56.9	7/8/2014 6:36	66.7	8/8/2014 23:41	63.7		
3/8/2014 2:21	61.2	4/8/2014 3:26	52.0	5/8/2014 4:31	53.0	6/8/2014 5:36	58.1	7/8/2014 6:41	64.5	8/8/2014 23:46	63.4		
3/8/2014 2:26	62.0	4/8/2014 3:31	51.0	5/8/2014 4:36	50.1	6/8/2014 5:41	58.0	7/8/2014 6:46	65.8	8/8/2014 23:51	63.6		
3/8/2014 2:31	60.9	4/8/2014 3:36	52.4	5/8/2014 4:41	51.3	6/8/2014 5:46	58.7	7/8/2014 6:51	65.4	8/8/2014 23:56	63.5		
3/8/2014 2:36	61.2	4/8/2014 3:41	50.1	5/8/2014 4:46	50.7	6/8/2014 5:51	58.8	7/8/2014 6:56	64.9	9/8/2014 0:01	63.6		
3/8/2014 2:41	60.3	4/8/2014 3:46	50.2	5/8/2014 4:51	52.4	6/8/2014 5:56	59.7	7/8/2014 23:01	63.5	9/8/2014 0:06	63.3		
3/8/2014 2:46	60.1	4/8/2014 3:51	31.9	5/8/2014 4:56	51.8	6/8/2014 6:01	60.1	7/8/2014 23:06	67.6	9/8/2014 0:11	62.9		
3/8/2014 2:51	62.3	4/8/2014 3:56	53.9	5/8/2014 5:01	47.9	6/8/2014 6:06	59.2	7/8/2014 23:11	66.9	9/8/2014 0:16	62.9		
3/8/2014 2:56	60.7	4/8/2014 4:01	52.4	5/8/2014 5:06	53.4	6/8/2014 6:11	60.2	7/8/2014 23:16	6				

Real-time Noise Data		RTN2a (Hong Kong Electric Centre)									
9/8/2014 3:41	59.2	10/8/2014 4:46	56.5	11/8/2014 5:51	57.3	12/8/2014 6:56	62.4	14/8/2014 0:01	64.1	15/8/2014 1:06	62.4
9/8/2014 3:46	58.3	10/8/2014 4:51	56.8	11/8/2014 5:56	57.8	12/8/2014 23:01	64.1	14/8/2014 0:06	63.5	15/8/2014 1:11	60.8
9/8/2014 3:51	61.4	10/8/2014 4:56	56.3	11/8/2014 6:01	57.5	12/8/2014 23:06	64.6	14/8/2014 0:11	64.2	15/8/2014 1:16	60.5
9/8/2014 3:56	57.6	10/8/2014 5:01	56.2	11/8/2014 6:06	59.0	12/8/2014 23:11	64.8	14/8/2014 0:16	63.3	15/8/2014 1:21	63.0
9/8/2014 4:01	57.1	10/8/2014 5:06	58.4	11/8/2014 6:11	58.4	12/8/2014 23:16	64.1	14/8/2014 0:21	62.8	15/8/2014 1:26	60.8
9/8/2014 4:06	58.0	10/8/2014 5:11	58.1	11/8/2014 6:16	59.2	12/8/2014 23:21	64.6	14/8/2014 0:26	63.5	15/8/2014 1:31	60.9
9/8/2014 4:11	58.5	10/8/2014 5:16	57.3	11/8/2014 6:21	59.9	12/8/2014 23:26	64.5	14/8/2014 0:31	63.3	15/8/2014 1:36	59.8
9/8/2014 4:16	58.0	10/8/2014 5:21	58.2	11/8/2014 6:26	60.3	12/8/2014 23:31	63.7	14/8/2014 0:36	63.0	15/8/2014 1:41	59.5
9/8/2014 4:21	58.0	10/8/2014 5:26	58.7	11/8/2014 6:31	60.5	12/8/2014 23:36	64.4	14/8/2014 0:41	63.6	15/8/2014 1:46	60.6
9/8/2014 4:26	58.7	10/8/2014 5:31	58.4	11/8/2014 6:36	61.6	12/8/2014 23:41	63.7	14/8/2014 0:46	62.6	15/8/2014 1:51	60.1
9/8/2014 4:31	57.9	10/8/2014 5:36	57.7	11/8/2014 6:41	62.1	12/8/2014 23:46	63.7	14/8/2014 0:51	62.4	15/8/2014 1:56	60.2
9/8/2014 4:36	58.0	10/8/2014 5:41	57.9	11/8/2014 6:46	62.0	12/8/2014 23:51	64.3	14/8/2014 0:56	62.5	15/8/2014 2:01	59.0
9/8/2014 4:41	60.9	10/8/2014 5:46	58.6	11/8/2014 6:51	62.8	12/8/2014 23:56	63.7	14/8/2014 1:01	61.9	15/8/2014 2:06	59.9
9/8/2014 4:46	58.1	10/8/2014 5:51	58.4	11/8/2014 6:56	63.2	13/8/2014 0:01	63.6	14/8/2014 1:06	61.1	15/8/2014 2:11	59.3
9/8/2014 4:51	60.0	10/8/2014 5:56	59.7	11/8/2014 23:01	63.4	13/8/2014 0:06	63.8	14/8/2014 1:11	61.4	15/8/2014 2:16	59.5
9/8/2014 4:56	57.2	10/8/2014 6:01	59.5	11/8/2014 23:06	62.8	13/8/2014 0:11	63.4	14/8/2014 1:16	61.7	15/8/2014 2:21	60.3
9/8/2014 5:01	59.5	10/8/2014 6:06	60.2	11/8/2014 23:11	62.6	13/8/2014 0:16	62.9	14/8/2014 1:21	61.3	15/8/2014 2:26	58.6
9/8/2014 5:06	57.7	10/8/2014 6:11	60.2	11/8/2014 23:16	63.0	13/8/2014 0:21	63.0	14/8/2014 1:26	61.9	15/8/2014 2:31	58.8
9/8/2014 5:11	57.0	10/8/2014 6:16	59.8	11/8/2014 23:21	62.9	13/8/2014 0:26	63.5	14/8/2014 1:31	61.3	15/8/2014 2:36	58.7
9/8/2014 5:16	56.4	10/8/2014 6:21	61.0	11/8/2014 23:26	63.2	13/8/2014 0:31	62.7	14/8/2014 1:36	61.0	15/8/2014 2:41	58.8
9/8/2014 5:21	58.7	10/8/2014 6:26	60.4	11/8/2014 23:31	62.4	13/8/2014 0:36	62.8	14/8/2014 1:41	60.9	15/8/2014 2:46	57.5
9/8/2014 5:26	58.2	10/8/2014 6:31	61.7	11/8/2014 23:36	62.9	13/8/2014 0:41	62.8	14/8/2014 1:46	60.6	15/8/2014 2:51	58.9
9/8/2014 5:31	58.4	10/8/2014 6:36	61.4	11/8/2014 23:41	62.7	13/8/2014 0:46	62.0	14/8/2014 1:51	59.8	15/8/2014 2:56	57.3
9/8/2014 5:36	58.4	10/8/2014 6:41	62.3	11/8/2014 23:46	61.7	13/8/2014 0:51	61.5	14/8/2014 1:56	59.8	15/8/2014 3:01	54.9
9/8/2014 5:41	57.5	10/8/2014 6:46	61.3	11/8/2014 23:51	61.2	13/8/2014 0:56	61.8	14/8/2014 2:01	59.9	15/8/2014 3:06	58.9
9/8/2014 5:46	59.0	10/8/2014 6:51	63.7	11/8/2014 23:56	62.1	13/8/2014 1:01	60.8	14/8/2014 2:06	62.5	15/8/2014 3:11	57.9
9/8/2014 5:51	59.0	10/8/2014 6:56	63.1	12/8/2014 0:01	62.2	13/8/2014 1:06	60.0	14/8/2014 2:11	59.7	15/8/2014 3:16	56.9
9/8/2014 5:56	59.2	10/8/2014 23:01	62.8	12/8/2014 0:06	62.5	13/8/2014 1:11	61.3	14/8/2014 2:16	59.6	15/8/2014 3:21	56.9
9/8/2014 6:01	58.7	10/8/2014 23:06	62.6	12/8/2014 0:11	61.4	13/8/2014 1:16	59.8	14/8/2014 2:21	60.0	15/8/2014 3:26	56.6
9/8/2014 6:06	59.9	10/8/2014 23:11	61.7	12/8/2014 0:16	61.8	13/8/2014 1:21	60.6	14/8/2014 2:26	59.6	15/8/2014 3:31	55.4
9/8/2014 6:11	59.6	10/8/2014 23:16	61.8	12/8/2014 0:21	61.4	13/8/2014 1:26	60.1	14/8/2014 2:31	59.6	15/8/2014 3:36	56.6
9/8/2014 6:16	60.5	10/8/2014 23:21	62.6	12/8/2014 0:26	61.3	13/8/2014 1:31	59.9	14/8/2014 2:36	58.4	15/8/2014 3:41	58.6
9/8/2014 6:21	60.3	10/8/2014 23:26	63.1	12/8/2014 0:31	60.9	13/8/2014 1:36	60.5	14/8/2014 2:41	59.3	15/8/2014 3:46	54.8
9/8/2014 6:26	60.6	10/8/2014 23:31	62.1	12/8/2014 0:36	60.5	13/8/2014 1:41	59.1	14/8/2014 2:46	59.4	15/8/2014 3:51	56.7
9/8/2014 6:31	61.0	10/8/2014 23:36	61.6	12/8/2014 0:41	60.6	13/8/2014 1:46	58.7	14/8/2014 2:51	59.5	15/8/2014 3:56	57.1
9/8/2014 6:36	60.7	10/8/2014 23:41	61.3	12/8/2014 0:46	60.5	13/8/2014 1:51	59.8	14/8/2014 2:56	58.8	15/8/2014 4:01	54.2
9/8/2014 6:41	61.5	10/8/2014 23:46	62.2	12/8/2014 0:51	58.9	13/8/2014 1:56	60.1	14/8/2014 3:01	58.0	15/8/2014 4:06	57.3
9/8/2014 6:46	61.9	10/8/2014 23:51	61.5	12/8/2014 0:56	60.7	13/8/2014 2:01	59.2	14/8/2014 3:06	57.6	15/8/2014 4:11	55.0
9/8/2014 6:51	61.7	10/8/2014 23:56	61.4	12/8/2014 1:01	59.1	13/8/2014 2:06	60.5	14/8/2014 3:11	56.9	15/8/2014 4:16	54.3
9/8/2014 6:56	62.4	11/8/2014 0:01	61.5	12/8/2014 1:06	60.6	13/8/2014 2:11	59.2	14/8/2014 3:16	57.0	15/8/2014 4:21	54.7
9/8/2014 23:01	62.9	11/8/2014 0:06	62.6	12/8/2014 1:11	59.9	13/8/2014 2:16	59.1	14/8/2014 3:21	57.0	15/8/2014 4:26	55.2
9/8/2014 23:06	62.8	11/8/2014 0:11	61.2	12/8/2014 1:16	60.4	13/8/2014 2:21	58.8	14/8/2014 3:26	56.2	15/8/2014 4:31	54.4
9/8/2014 23:11	63.2	11/8/2014 0:16	60.6	12/8/2014 1:21	59.8	13/8/2014 2:26	58.8	14/8/2014 3:31	57.9	15/8/2014 4:36	54.1
9/8/2014 23:16	62.8	11/8/2014 0:21	60.5	12/8/2014 1:26	59.7	13/8/2014 2:31	58.1	14/8/2014 3:36	57.0	15/8/2014 4:41	56.4
9/8/2014 23:21	62.8	11/8/2014 0:26	62.0	12/8/2014 1:31	58.9	13/8/2014 2:36	56.2	14/8/2014 3:41	56.9	15/8/2014 4:46	53.6
9/8/2014 23:26	62.9	11/8/2014 0:31	61.3	12/8/2014 1:36	58.8	13/8/2014 2:41	57.8	14/8/2014 3:46	54.6	15/8/2014 4:51	56.1
9/8/2014 23:31	62.7	11/8/2014 0:36	59.8	12/8/2014 1:41	59.7	13/8/2014 2:46	58.3	14/8/2014 3:51	57.0	15/8/2014 4:56	55.2
9/8/2014 23:36	63.1	11/8/2014 0:41	61.8	12/8/2014 1:46	57.6	13/8/2014 2:51	57.6	14/8/2014 3:56	57.4	15/8/2014 5:01	55.6
9/8/2014 23:41	62.8	11/8/2014 0:46	59.9	12/8/2014 1:51	57.8	13/8/2014 2:56	57.4	14/8/2014 4:01	56.8	15/8/2014 5:06	56.0
9/8/2014 23:46	62.5	11/8/2014 0:51	60.1	12/8/2014 1:56	59.0	13/8/2014 3:01	57.5	14/8/2014 4:06	57.2	15/8/2014 5:11	55.1
9/8/2014 23:51	62.3	11/8/2014 0:56	59.4	12/8/2014 2:01	57.5	13/8/2014 3:06	57.7	14/8/2014 4:11	58.3	15/8/2014 5:16	55.6
9/8/2014 23:56	63.3	11/8/2014 1:01	58.9	12/8/2014 2:06	57.7	13/8/2014 3:11	52.0	14/8/2014 4:16	55.2	15/8/2014 5:21	55.3
10/8/2014 0:01	62.4	11/8/2014 1:06	58.6	12/8/2014 2:11	56.5	13/8/2014 3:16	55.8	14/8/2014 4:21	55.1	15/8/2014 5:26	58.7
10/8/2014 0:06	62.7	11/8/2014 1:11	58.7	12/8/2014 2:16	57.5	13/8/2014 3:21	54.4	14/8/2014 4:26	54.9	15/8/2014 5:31	57.5
10/8/2014 0:11	62.6	11/8/2014 1:16	63.6	12/8/2014 2:21	55.6	13/8/2014 3:26	54.4	14/8/2014 4:31	57.9	15/8/2014 5:36	57.7
10/8/2014 0:16	61.9	11/8/2014 1:21	57.6	12/8/2014 2:26	57.0	13/8/2014 3:31	54.2	14/8/2014 4:36	57.6	15/8/2014 5:41	59.5
10/8/2014 0:21	64.0	11/8/2014 1:26	58.6	12/8/2014 2:31	56.8	13/8/2014 3:36	54.3	14/8/2014 4:41	58.2	15/8/2014 5:46	60.1
10/8/2014 0:26	62.5	11/8/2014 1:31	58.3	12/8/2014 2:36	56.4	13/8/2014 3:41	55.1	14/8/2014 4:46	55.6	15/8/2014 5:51	58.4
10/8/2014 0:31	61.8	11/8/2014 1:36	57.9	12/8/2014 2:41	56.3	13/8/2014 3:46	55.1	14/8/2014 4:51	55.6	15/8/2014 5:56	58.2
10/8/2014 0:36	61.7	11/8/2014 1:41	58.1	12/8/2014 2:46	55.2	13/8/2014 3:51	56.3	14/8/2014 4:56	57.0	15/8/2014 6:01	59.9
10/8/2014 0:41	62.1	11/8/2014 1:46	58.3	12/8/2014 2:51	56.0	13/8/2014 3:56	54.7	14/8/2014 5:01	57.2	15/8/2014 6:06	59.5
10/8/2014 0:46	62.4	11/8/2014 1:51	58.6	12/8/2014 2:56	56.1	13/8/2014 4:01	53.4	14/8/2014 5:06	57.3	15/8/2014 6:11	60.6
10/8/2014 0:51	60.8	11/8/2014 1:56	54.4	12/8/2014 3:01	52.9	13/8/2014 4:06	56.1	14/8/2014 5:11	57.0	15/8/2014 6:16	60.8
10/8/2014 0:56	61.2	11/8/2014 2:01	57.8	12/8/2014 3:06	54.0	13/8/2014 4:11	54.4	14/8/2014 5:16	57.9	15/8/2014 6:21	61.4
10/8/2014 1:01	61.5	11/8/2014 2:06	56.7	12/8/2014 3:11	55.3	13/8/2014 4:16	54.3	14/8/2014 5:21	58.9	15/8/2014 6:26	60.6
10/8/2014 1:06	60.5	11/8/2014 2:11	54.7	12/8/2014 3:16	54.1	13/8/2014 4:21	56.1	14/8/2014 5:26	58.7	15/8/2014 6:31	61.4
10/8/2014 1:11	60.1	11/8/2014 2:16	55.6	12/8/2014 3:21	54.4	13/8/2014 4:26	52.9	14/8/2014 5:31	57.3	15/8/2014 6:36	61.8
10/8/2014 1:16	60.2	11/8/2014 2:21	55.2	12/8/2014 3:26	60.3	13/8/2014 4:31	56.2	14/8/2014 5:36	60.4	15/8/2014 6:41	63.0
10/8/2014 1:21	60.7	11/8/2014 2:26	55.9	12/8/2014 3:31	54.2	13/8/2014 4:36	56.3	14/8/2014 5:41	58.1	15/8/2014 6:46	62.9
10/8/2014 1:26	61.0	11/8/2014 2:31	55.5	12/8/2014 3:36	53.2	13/8/2014 4:41	61.6	14/8/2014 5:46	59.9	15/8/2014 6:51	63.2
10/8/2014 1:31	61.2	11/8/2014 2:36	52.8	12/8/2014 3:41	54.1	13/8/2014					

Real-time Noise Data		RTN2a (Hong Kong Electric Centre)									
16/8/2014 2:11	59.7	17/8/2014 3:16	60.3	18/8/2014 4:21	47.1	19/8/2014 5:26	52.5	20/8/2014 6:31	62.6	21/8/2014 23:36	63.2
16/8/2014 2:16	60.8	17/8/2014 3:21	58.8	18/8/2014 4:26	57.9	19/8/2014 5:31	50.8	20/8/2014 6:36	63.7	21/8/2014 23:41	62.7
16/8/2014 2:21	60.3	17/8/2014 3:26	58.4	18/8/2014 4:31	51.2	19/8/2014 5:36	52.2	20/8/2014 6:41	63.4	21/8/2014 23:46	63.1
16/8/2014 2:26	59.4	17/8/2014 3:31	57.6	18/8/2014 4:36	50.6	19/8/2014 5:41	56.1	20/8/2014 6:46	64.0	21/8/2014 23:51	63.3
16/8/2014 2:31	60.0	17/8/2014 3:36	59.0	18/8/2014 4:41	52.0	19/8/2014 5:46	61.2	20/8/2014 6:51	64.2	21/8/2014 23:56	62.4
16/8/2014 2:36	60.8	17/8/2014 3:41	58.6	18/8/2014 4:46	53.8	19/8/2014 5:51	61.5	20/8/2014 6:56	63.9	22/8/2014 0:01	62.1
16/8/2014 2:41	59.5	17/8/2014 3:46	57.5	18/8/2014 4:51	43.1	19/8/2014 5:56	59.5	20/8/2014 23:01	63.6	22/8/2014 0:06	61.8
16/8/2014 2:46	60.3	17/8/2014 3:51	58.0	18/8/2014 4:56	46.0	19/8/2014 6:01	59.0	20/8/2014 23:06	64.2	22/8/2014 0:11	61.5
16/8/2014 2:51	58.7	17/8/2014 3:56	57.8	18/8/2014 5:01	47.8	19/8/2014 6:06	58.8	20/8/2014 23:11	63.6	22/8/2014 0:16	61.7
16/8/2014 2:56	59.7	17/8/2014 4:01	56.1	18/8/2014 5:06	47.5	19/8/2014 6:11	61.2	20/8/2014 23:16	63.8	22/8/2014 0:21	61.3
16/8/2014 3:01	58.4	17/8/2014 4:06	56.4	18/8/2014 5:11	50.7	19/8/2014 6:16	61.9	20/8/2014 23:21	63.9	22/8/2014 0:26	62.0
16/8/2014 3:06	59.0	17/8/2014 4:11	56.6	18/8/2014 5:16	55.3	19/8/2014 6:21	61.2	20/8/2014 23:26	63.9	22/8/2014 0:31	61.6
16/8/2014 3:11	58.6	17/8/2014 4:16	57.3	18/8/2014 5:21	54.0	19/8/2014 6:26	62.4	20/8/2014 23:31	63.6	22/8/2014 0:36	60.9
16/8/2014 3:16	58.3	17/8/2014 4:21	56.3	18/8/2014 5:26	58.3	19/8/2014 6:31	62.4	20/8/2014 23:36	63.1	22/8/2014 0:41	61.9
16/8/2014 3:21	57.3	17/8/2014 4:26	58.0	18/8/2014 5:31	56.9	19/8/2014 6:36	62.4	20/8/2014 23:41	63.5	22/8/2014 0:46	60.9
16/8/2014 3:26	58.5	17/8/2014 4:31	56.7	18/8/2014 5:36	55.2	19/8/2014 6:41	63.1	20/8/2014 23:46	65.1	22/8/2014 0:51	60.9
16/8/2014 3:31	59.0	17/8/2014 4:36	56.8	18/8/2014 5:41	57.3	19/8/2014 6:46	62.7	20/8/2014 23:51	63.3	22/8/2014 0:56	59.7
16/8/2014 3:36	58.8	17/8/2014 4:41	56.8	18/8/2014 5:46	56.6	19/8/2014 6:51	63.2	20/8/2014 23:56	62.7	22/8/2014 1:01	60.3
16/8/2014 3:41	59.1	17/8/2014 4:46	58.4	18/8/2014 5:51	58.0	19/8/2014 6:56	63.0	21/8/2014 0:01	63.4	22/8/2014 1:06	60.7
16/8/2014 3:46	59.0	17/8/2014 4:51	56.9	18/8/2014 5:56	58.1	19/8/2014 23:01	64.0	21/8/2014 0:06	63.0	22/8/2014 1:11	59.3
16/8/2014 3:51	59.1	17/8/2014 4:56	55.0	18/8/2014 6:01	58.2	19/8/2014 23:06	63.8	21/8/2014 0:11	63.2	22/8/2014 1:16	59.9
16/8/2014 3:56	58.5	17/8/2014 5:01	57.6	18/8/2014 6:06	58.4	19/8/2014 23:11	64.0	21/8/2014 0:16	62.3	22/8/2014 1:21	59.1
16/8/2014 4:01	58.0	17/8/2014 5:06	57.5	18/8/2014 6:11	59.3	19/8/2014 23:16	63.2	21/8/2014 0:21	62.8	22/8/2014 1:26	60.6
16/8/2014 4:06	58.2	17/8/2014 5:11	57.5	18/8/2014 6:16	59.4	19/8/2014 23:21	63.7	21/8/2014 0:26	62.5	22/8/2014 1:31	59.2
16/8/2014 4:11	58.7	17/8/2014 5:16	58.8	18/8/2014 6:21	60.3	19/8/2014 23:26	63.3	21/8/2014 0:31	61.9	22/8/2014 1:36	59.2
16/8/2014 4:16	58.3	17/8/2014 5:21	57.5	18/8/2014 6:26	60.5	19/8/2014 23:31	64.6	21/8/2014 0:36	61.8	22/8/2014 1:41	59.5
16/8/2014 4:21	56.7	17/8/2014 5:26	56.7	18/8/2014 6:31	60.9	19/8/2014 23:36	62.9	21/8/2014 0:41	61.5	22/8/2014 1:46	58.2
16/8/2014 4:26	57.1	17/8/2014 5:31	57.1	18/8/2014 6:36	61.4	19/8/2014 23:41	63.6	21/8/2014 0:46	61.6	22/8/2014 1:51	59.0
16/8/2014 4:31	57.7	17/8/2014 5:36	56.6	18/8/2014 6:41	61.4	19/8/2014 23:46	63.0	21/8/2014 0:51	61.6	22/8/2014 1:56	58.3
16/8/2014 4:36	56.5	17/8/2014 5:41	57.2	18/8/2014 6:46	61.5	19/8/2014 23:51	63.1	21/8/2014 0:56	61.6	22/8/2014 2:01	57.8
16/8/2014 4:41	58.6	17/8/2014 5:46	58.5	18/8/2014 6:51	62.1	19/8/2014 23:56	63.0	21/8/2014 1:01	61.3	22/8/2014 2:06	58.7
16/8/2014 4:46	57.3	17/8/2014 5:51	58.1	18/8/2014 6:56	62.9	20/8/2014 0:01	62.3	21/8/2014 1:06	60.9	22/8/2014 2:11	57.8
16/8/2014 4:51	57.9	17/8/2014 5:56	58.2	18/8/2014 23:01	61.4	20/8/2014 0:06	62.2	21/8/2014 1:11	60.6	22/8/2014 2:16	56.1
16/8/2014 4:56	57.7	17/8/2014 6:01	57.8	18/8/2014 23:06	60.8	20/8/2014 0:11	62.9	21/8/2014 1:16	60.9	22/8/2014 2:21	58.3
16/8/2014 5:01	55.3	17/8/2014 6:06	58.9	18/8/2014 23:11	61.7	20/8/2014 0:16	62.2	21/8/2014 1:21	60.9	22/8/2014 2:26	57.7
16/8/2014 5:06	57.6	17/8/2014 6:11	59.5	18/8/2014 23:16	61.1	20/8/2014 0:21	62.4	21/8/2014 1:26	60.2	22/8/2014 2:31	57.0
16/8/2014 5:11	57.5	17/8/2014 6:16	59.5	18/8/2014 23:21	60.4	20/8/2014 0:26	62.1	21/8/2014 1:31	59.8	22/8/2014 2:36	55.7
16/8/2014 5:16	57.5	17/8/2014 6:21	60.0	18/8/2014 23:26	61.6	20/8/2014 0:31	61.8	21/8/2014 1:36	61.3	22/8/2014 2:41	55.8
16/8/2014 5:21	56.3	17/8/2014 6:26	59.8	18/8/2014 23:31	61.4	20/8/2014 0:36	61.6	21/8/2014 1:41	59.8	22/8/2014 2:46	57.8
16/8/2014 5:26	57.5	17/8/2014 6:31	60.2	18/8/2014 23:36	60.9	20/8/2014 0:41	61.4	21/8/2014 1:46	59.3	22/8/2014 2:51	57.0
16/8/2014 5:31	57.2	17/8/2014 6:36	60.2	18/8/2014 23:41	60.9	20/8/2014 0:46	61.9	21/8/2014 1:51	59.0	22/8/2014 2:56	55.7
16/8/2014 5:36	57.0	17/8/2014 6:41	60.5	18/8/2014 23:46	61.2	20/8/2014 0:51	60.9	21/8/2014 1:56	59.0	22/8/2014 3:01	56.1
16/8/2014 5:41	59.1	17/8/2014 6:46	60.4	18/8/2014 23:51	60.8	20/8/2014 0:56	60.7	21/8/2014 2:01	58.4	22/8/2014 3:06	56.1
16/8/2014 5:46	58.8	17/8/2014 6:51	60.6	18/8/2014 23:56	60.7	20/8/2014 1:01	59.1	21/8/2014 2:06	59.3	22/8/2014 3:11	56.0
16/8/2014 5:51	58.4	17/8/2014 6:56	62.2	19/8/2014 0:01	60.2	20/8/2014 1:06	60.3	21/8/2014 2:11	57.4	22/8/2014 3:16	52.8
16/8/2014 5:56	58.9	17/8/2014 23:01	63.1	19/8/2014 0:06	60.7	20/8/2014 1:11	60.0	21/8/2014 2:16	57.7	22/8/2014 3:21	56.4
16/8/2014 6:01	58.6	17/8/2014 23:06	62.0	19/8/2014 0:11	60.1	20/8/2014 1:16	59.9	21/8/2014 2:21	58.8	22/8/2014 3:26	56.5
16/8/2014 6:06	62.3	17/8/2014 23:11	62.3	19/8/2014 0:16	60.1	20/8/2014 1:21	60.1	21/8/2014 2:26	58.9	22/8/2014 3:31	55.1
16/8/2014 6:11	59.3	17/8/2014 23:16	63.2	19/8/2014 0:21	59.7	20/8/2014 1:26	59.2	21/8/2014 2:31	57.3	22/8/2014 3:36	54.1
16/8/2014 6:16	59.7	17/8/2014 23:21	62.2	19/8/2014 0:26	59.7	20/8/2014 1:31	59.3	21/8/2014 2:36	57.7	22/8/2014 3:41	56.3
16/8/2014 6:21	59.7	17/8/2014 23:26	61.6	19/8/2014 0:31	59.5	20/8/2014 1:36	59.6	21/8/2014 2:41	57.5	22/8/2014 3:46	52.7
16/8/2014 6:26	60.3	17/8/2014 23:31	62.1	19/8/2014 0:36	58.9	20/8/2014 1:41	58.8	21/8/2014 2:46	57.2	22/8/2014 3:51	55.3
16/8/2014 6:31	60.2	17/8/2014 23:36	61.5	19/8/2014 0:41	58.6	20/8/2014 1:46	58.8	21/8/2014 2:51	54.1	22/8/2014 3:56	55.9
16/8/2014 6:36	60.9	17/8/2014 23:41	61.7	19/8/2014 0:46	58.0	20/8/2014 1:51	59.3	21/8/2014 2:56	54.4	22/8/2014 4:01	50.2
16/8/2014 6:41	61.1	17/8/2014 23:46	62.9	19/8/2014 0:51	58.5	20/8/2014 1:56	58.4	21/8/2014 3:01	56.1	22/8/2014 4:06	54.0
16/8/2014 6:46	61.6	17/8/2014 23:51	62.2	19/8/2014 0:56	58.6	20/8/2014 2:01	58.7	21/8/2014 3:06	56.6	22/8/2014 4:11	56.0
16/8/2014 6:51	60.9	17/8/2014 23:56	61.5	19/8/2014 1:01	58.5	20/8/2014 2:06	63.3	21/8/2014 3:11	57.4	22/8/2014 4:16	53.5
16/8/2014 6:56	61.9	18/8/2014 0:01	61.5	19/8/2014 1:06	57.7	20/8/2014 2:11	64.7	21/8/2014 3:16	57.0	22/8/2014 4:21	53.0
16/8/2014 23:01	64.0	18/8/2014 0:06	61.6	19/8/2014 1:11	57.5	20/8/2014 2:16	65.2	21/8/2014 3:21	57.4	22/8/2014 4:26	52.6
16/8/2014 23:06	63.5	18/8/2014 0:11	60.5	19/8/2014 1:16	58.5	20/8/2014 2:21	58.2	21/8/2014 3:26	56.2	22/8/2014 4:31	51.9
16/8/2014 23:11	63.3	18/8/2014 0:16	59.8	19/8/2014 1:21	57.4	20/8/2014 2:26	57.7	21/8/2014 3:31	55.8	22/8/2014 4:36	55.8
16/8/2014 23:16	63.3	18/8/2014 0:21	60.1	19/8/2014 1:26	57.8	20/8/2014 2:31	56.6	21/8/2014 3:36	56.9	22/8/2014 4:41	54.2
16/8/2014 23:21	63.7	18/8/2014 0:26	60.1	19/8/2014 1:31	57.4	20/8/2014 2:36	55.8	21/8/2014 3:41	53.6	22/8/2014 4:46	53.5
16/8/2014 23:26	64.3	18/8/2014 0:31	60.3	19/8/2014 1:36	57.3	20/8/2014 2:41	56.8	21/8/2014 3:46	55.0	22/8/2014 4:51	54.2
16/8/2014 23:31	62.6	18/8/2014 0:36	60.7	19/8/2014 1:41	55.7	20/8/2014 2:46	55.0	21/8/2014 3:51	55.2	22/8/2014 4:56	55.6
16/8/2014 23:36	63.2	18/8/2014 0:41	59.7	19/8/2014 1:46	57.2	20/8/2014 2:51	53.9	21/8/2014 3:56	55.8	22/8/2014 5:01	53.8
16/8/2014 23:41	62.8	18/8/2014 0:46	59.7	19/8/2014 1:51	56.6	20/8/2014 2:56	55.6	21/8/2014 4:01	54.1	22/8/2014 5:06	54.6
16/8/2014 23:46	63.0	18/8/2014 0:51	59.8	19/8/2014 1:56	55.6	20/8/2014 3:01	53.7	21/8/2014 4:06	54.1	22/8/2014 5:11	55.0
16/8/2014 23:51	62.3	18/8/2014 0:56	59.0	19/8/2014 2:01	53.9	20/8/2014 3:06	56.6	21/8/2014 4:11	55.3	22/8/2014 5:16	54.9
16/8/2014 23:56	62.6	18/8/2014 1:01	58.8	19/8/2014 2:06	55.3	20/8/2014 3:11	54.6	21/8/2014 4:16	54.2	22/8/2014 5:21	54.9
17/8/2014 0:01	66.0</										

Real-time Noise Data		RTN2a (Hong Kong Electric Centre)					
23/8/2014 0:41	62.4	24/8/2014 1:46	59.9	25/8/2014 2:51	49.8	26/8/2014 3:56	52.3
23/8/2014 0:46	62.3	24/8/2014 1:51	60.1	25/8/2014 2:56	50.1	26/8/2014 4:01	49.8
23/8/2014 0:51	61.7	24/8/2014 1:56	60.0	25/8/2014 3:01	52.8	26/8/2014 4:06	48.3
23/8/2014 0:56	61.1	24/8/2014 2:01	60.7	25/8/2014 3:06	53.2	26/8/2014 4:11	49.1
23/8/2014 1:01	62.0	24/8/2014 2:06	59.4	25/8/2014 3:11	48.8	26/8/2014 4:16	53.9
23/8/2014 1:06	61.9	24/8/2014 2:11	59.5	25/8/2014 3:16	42.0	26/8/2014 4:21	50.8
23/8/2014 1:11	61.6	24/8/2014 2:16	59.5	25/8/2014 3:21	51.6	26/8/2014 4:26	51.3
23/8/2014 1:16	61.4	24/8/2014 2:21	59.1	25/8/2014 3:26	58.2	26/8/2014 4:31	58.3
23/8/2014 1:21	61.2	24/8/2014 2:26	59.0	25/8/2014 3:31	49.2	26/8/2014 4:36	52.6
23/8/2014 1:26	61.9	24/8/2014 2:31	59.2	25/8/2014 3:36	47.9	26/8/2014 4:41	52.7
23/8/2014 1:31	61.6	24/8/2014 2:36	58.9	25/8/2014 3:41	58.3	26/8/2014 4:46	55.4
23/8/2014 1:36	61.6	24/8/2014 2:41	60.0	25/8/2014 3:46	58.1	26/8/2014 4:51	54.1
23/8/2014 1:41	60.9	24/8/2014 2:46	57.8	25/8/2014 3:51	51.1	26/8/2014 4:56	50.5
23/8/2014 1:46	61.1	24/8/2014 2:51	58.2	25/8/2014 3:56	47.8	26/8/2014 5:01	51.6
23/8/2014 1:51	60.6	24/8/2014 2:56	59.0	25/8/2014 4:01	41.0	26/8/2014 5:06	53.5
23/8/2014 1:56	60.2	24/8/2014 3:01	58.7	25/8/2014 4:06	54.4	26/8/2014 5:11	54.9
23/8/2014 2:01	59.9	24/8/2014 3:06	58.7	25/8/2014 4:11	47.8	26/8/2014 5:16	55.8
23/8/2014 2:06	61.3	24/8/2014 3:11	58.2	25/8/2014 4:16	50.9	26/8/2014 5:21	57.0
23/8/2014 2:11	60.9	24/8/2014 3:16	58.6	25/8/2014 4:21	52.3	26/8/2014 5:26	55.3
23/8/2014 2:16	59.3	24/8/2014 3:21	59.5	25/8/2014 4:26	58.0	26/8/2014 5:31	53.2
23/8/2014 2:21	60.1	24/8/2014 3:26	57.8	25/8/2014 4:31	58.0	26/8/2014 5:36	54.3
23/8/2014 2:26	59.5	24/8/2014 3:31	58.5	25/8/2014 4:36	49.8	26/8/2014 5:41	54.9
23/8/2014 2:31	60.2	24/8/2014 3:36	57.5	25/8/2014 4:41	58.2	26/8/2014 5:46	56.8
23/8/2014 2:36	60.8	24/8/2014 3:41	56.9	25/8/2014 4:46	38.9	26/8/2014 5:51	57.0
23/8/2014 2:41	59.6	24/8/2014 3:46	57.2	25/8/2014 4:51	53.1	26/8/2014 5:56	57.6
23/8/2014 2:46	59.9	24/8/2014 3:51	58.1	25/8/2014 4:56	34.9	26/8/2014 6:01	57.1
23/8/2014 2:51	59.8	24/8/2014 3:56	58.8	25/8/2014 5:01	50.7	26/8/2014 6:06	58.0
23/8/2014 2:56	59.1	24/8/2014 4:01	55.6	25/8/2014 5:06	53.2	26/8/2014 6:11	57.8
23/8/2014 3:01	59.4	24/8/2014 4:06	58.7	25/8/2014 5:11	53.0	26/8/2014 6:16	58.5
23/8/2014 3:06	59.7	24/8/2014 4:11	57.0	25/8/2014 5:16	49.6	26/8/2014 6:21	60.5
23/8/2014 3:11	59.4	24/8/2014 4:16	57.4	25/8/2014 5:21	53.4	26/8/2014 6:26	59.7
23/8/2014 3:16	58.9	24/8/2014 4:21	56.4	25/8/2014 5:26	55.9	26/8/2014 6:31	60.1
23/8/2014 3:21	60.0	24/8/2014 4:26	57.0	25/8/2014 5:31	54.4	26/8/2014 6:36	60.7
23/8/2014 3:26	57.8	24/8/2014 4:31	56.3	25/8/2014 5:36	55.5	26/8/2014 6:41	60.9
23/8/2014 3:31	59.1	24/8/2014 4:36	56.5	25/8/2014 5:41	55.3	26/8/2014 6:46	62.2
23/8/2014 3:36	59.0	24/8/2014 4:41	56.1	25/8/2014 5:46	58.2	26/8/2014 6:51	63.2
23/8/2014 3:41	58.7	24/8/2014 4:46	56.2	25/8/2014 5:51	56.2	26/8/2014 6:56	62.4
23/8/2014 3:46	58.0	24/8/2014 4:51	56.0	25/8/2014 5:56	58.9	26/8/2014 23:01	63.1
23/8/2014 3:51	58.1	24/8/2014 4:56	56.1	25/8/2014 6:01	57.8	26/8/2014 23:06	63.4
23/8/2014 3:56	59.0	24/8/2014 5:01	56.4	25/8/2014 6:06	57.4	26/8/2014 23:11	62.9
23/8/2014 4:01	57.2	24/8/2014 5:06	58.3	25/8/2014 6:11	58.2	26/8/2014 23:16	63.0
23/8/2014 4:06	57.4	24/8/2014 5:11	56.4	25/8/2014 6:16	58.8	26/8/2014 23:21	62.7
23/8/2014 4:11	57.0	24/8/2014 5:16	56.4	25/8/2014 6:21	59.9	26/8/2014 23:26	62.0
23/8/2014 4:16	58.4	24/8/2014 5:21	58.2	25/8/2014 6:26	60.4	26/8/2014 23:31	63.0
23/8/2014 4:21	58.0	24/8/2014 5:26	58.5	25/8/2014 6:31	61.0	26/8/2014 23:36	62.9
23/8/2014 4:26	57.5	24/8/2014 5:31	56.5	25/8/2014 6:36	61.7	26/8/2014 23:41	63.0
23/8/2014 4:31	57.5	24/8/2014 5:36	59.8	25/8/2014 6:41	61.2	26/8/2014 23:46	62.3
23/8/2014 4:36	57.3	24/8/2014 5:41	57.0	25/8/2014 6:46	62.7	26/8/2014 23:51	62.2
23/8/2014 4:41	57.2	24/8/2014 5:46	56.1	25/8/2014 6:51	62.5	26/8/2014 23:56	62.1
23/8/2014 4:46	56.7	24/8/2014 5:51	56.7	25/8/2014 6:56	62.3	27/8/2014 0:01	62.0
23/8/2014 4:51	56.3	24/8/2014 5:56	57.0	25/8/2014 23:01	62.9	27/8/2014 0:06	61.8
23/8/2014 4:56	57.8	24/8/2014 6:01	58.1	25/8/2014 23:06	62.4	27/8/2014 0:11	61.4
23/8/2014 5:01	57.3	24/8/2014 6:06	58.0	25/8/2014 23:11	62.3	27/8/2014 0:16	61.9
23/8/2014 5:06	57.2	24/8/2014 6:11	58.8	25/8/2014 23:16	62.6	27/8/2014 0:21	61.2
23/8/2014 5:11	57.6	24/8/2014 6:16	58.3	25/8/2014 23:21	62.5	27/8/2014 0:26	61.2
23/8/2014 5:16	57.0	24/8/2014 6:21	57.7	25/8/2014 23:26	62.3	27/8/2014 0:31	60.1
23/8/2014 5:21	58.0	24/8/2014 6:26	58.5	25/8/2014 23:31	63.2	27/8/2014 0:36	60.4
23/8/2014 5:26	59.0	24/8/2014 6:31	59.0	25/8/2014 23:36	62.2	27/8/2014 0:41	60.8
23/8/2014 5:31	57.1	24/8/2014 6:36	59.8	25/8/2014 23:41	62.8	27/8/2014 0:46	63.8
23/8/2014 5:36	58.2	24/8/2014 6:41	60.6	25/8/2014 23:46	62.4	27/8/2014 0:51	61.1
23/8/2014 5:41	58.5	24/8/2014 6:46	59.3	25/8/2014 23:51	61.8	27/8/2014 0:56	61.5
23/8/2014 5:46	59.0	24/8/2014 6:51	60.2	25/8/2014 23:56	61.8	27/8/2014 1:01	61.1
23/8/2014 5:51	59.5	24/8/2014 6:56	61.1	26/8/2014 0:01	61.5	27/8/2014 1:06	60.4
23/8/2014 5:56	58.8	24/8/2014 23:01	63.6	26/8/2014 0:06	62.3	27/8/2014 1:11	58.7
23/8/2014 6:01	59.0	24/8/2014 23:06	62.6	26/8/2014 0:11	61.6	27/8/2014 1:16	57.8
23/8/2014 6:06	59.7	24/8/2014 23:11	62.4	26/8/2014 0:16	62.2	27/8/2014 1:21	60.0
23/8/2014 6:11	59.7	24/8/2014 23:16	62.5	26/8/2014 0:21	61.2	27/8/2014 1:26	58.4
23/8/2014 6:16	59.7	24/8/2014 23:21	62.6	26/8/2014 0:26	61.9	27/8/2014 1:31	57.2
23/8/2014 6:21	59.0	24/8/2014 23:26	62.4	26/8/2014 0:31	62.0	27/8/2014 1:36	57.8
23/8/2014 6:26	59.9	24/8/2014 23:31	61.9	26/8/2014 0:36	59.6	27/8/2014 1:41	57.5
23/8/2014 6:31	59.8	24/8/2014 23:36	62.2	26/8/2014 0:41	60.4	27/8/2014 1:46	58.9
23/8/2014 6:36	61.1	24/8/2014 23:41	62.0	26/8/2014 0:46	60.8	27/8/2014 1:51	57.6
23/8/2014 6:41	60.9	24/8/2014 23:46	61.5	26/8/2014 0:51	60.4	27/8/2014 1:56	56.8
23/8/2014 6:46	62.3	24/8/2014 23:51	60.6	26/8/2014 0:56	60.2	27/8/2014 2:01	57.4
23/8/2014 6:51	61.5	24/8/2014 23:56	61.1	26/8/2014 1:01	60.4	27/8/2014 2:06	56.0
23/8/2014 6:56	62.4	25/8/2014 0:01	61.9	26/8/2014 1:06	59.7	27/8/2014 2:11	57.5
23/8/2014 23:01	65.1	25/8/2014 0:06	62.4	26/8/2014 1:11	58.9	27/8/2014 2:16	56.1
23/8/2014 23:06	63.0	25/8/2014 0:11	61.2	26/8/2014 1:16	59.3	27/8/2014 2:21	59.2
23/8/2014 23:11	63.6	25/8/2014 0:16	60.2	26/8/2014 1:21	58.6	27/8/2014 2:26	56.6
23/8/2014 23:16	63.1	25/8/2014 0:21	60.8	26/8/2014 1:26	59.1	27/8/2014 2:31	55.2
23/8/2014 23:21	62.8	25/8/2014 0:26	60.8	26/8/2014 1:31	58.9	27/8/2014 2:36	55.6
23/8/2014 23:26	62.5	25/8/2014 0:31	60.6	26/8/2014 1:36	55.9	27/8/2014 2:41	55.6
23/8/2014 23:31	62.9	25/8/2014 0:36	60.1	26/8/2014 1:41	58.0	27/8/2014 2:46	55.1
23/8/2014 23:36	62.7	25/8/2014 0:41	59.9	26/8/2014 1:46	57.5	27/8/2014 2:51	56.0
23/8/2014 23:41	63.1	25/8/2014 0:46	59.0	26/8/2014 1:51	57.8	27/8/2014 2:56	53.6
23/8/2014 23:46	62.6	25/8/2014 0:51	60.8	26/8/2014 1:56	57.4	27/8/2014 3:01	54.6
23/8/2014 23:51	62.2	25/8/2014 0:56	58.7	26/8/2014 2:01	56.9	27/8/2014 3:06	55.8
23/8/2014 23:56	62.6	25/8/2014 1:01	59.0	26/8/2014 2:06	55.7	27/8/2014 3:11	56.5
24/8/2014 0:01	62.2	25/8/2014 1:06	59.0	26/8/2014 2:11	56.2	27/8/2014 3:16	52.9
24/8/2014 0:06	63.2	25/8/2014 1:11	58.2	26/8/2014 2:16	56.9	27/8/2014 3:21	53.8
24/8/2014 0:11	63.9	25/8/2014 1:16	57.4	26/8/2014 2:21	54.4	27/8/2014 3:26	52.9
24/8/2014 0:16	61.6	25/8/2014 1:21	57.0	26/8/2014 2:26	56.0	27/8/2014 3:31	53.7
24/8/2014 0:21	62.0	25/8/2014 1:26	58.2	26/8/2014 2:31	53.9	27/8/2014 3:36	51.9
24/8/2014 0:26	61.4	25/8/2014 1:31	55.8	26/8/2014 2:36	54.0	27/8/2014 3:41	53.8
24/8/2014 0:31	61.4	25/8/2014 1:36	55.9	26/8/2014 2:41	56.0	27/8/2014 3:46	49.5
24/8/2014 0:36	61.9	25/8/2014 1:41	56.8	26/8/2014 2:46	53.9	27/8/2014 3:51	53.2
24/8/2014 0:41	62.1	25/8/2014 1:46	55.4	26/8/2014 2:51	54.8	27/8/2014 3:56	51.4
24/8/2014 0:46	60.7	25/8/2014 1:51	55.9	26/8/2014 2:56	51.4	27/8/2014 4:01	50.5
24/8/2014 0:51	62.4	25/8/2014 1:56	55.6	26/8/2014 3:01	54.8	27/8/2014 4:06	49.3
24/8/2014 0:56	61.9	25/8/2014 2:01	54.5	26/8/2014 3:06	55.1	27/8/2014 4:11	50.8
24/8/2014 1:01	61.3	25/8/2014 2:06	55.7	26/8/2014 3:11	50.5	27/8/2014 4:16	45.5
24/8/2014 1:06	59.4	25/8/2014 2:11	56.4	26/8/2014 3:16	50.4	27/8/2014 4:21	52.7
24/8/2014 1:11	60.0	25/8/2014 2:16	53.7	26/8/2014 3:21	52.3	27/8/2014 4:26	50.4
24/8/2014 1:16	60.1	25/8/2014 2:21	52.7	26/8/2014 3:26	54.4	27/8/2014 4:31	52.0
24/8/2014 1:21	60.6						

Real-time Noise Data		RTN3 (Po Leung Kuk Yu Lee Mo Fan Memorial School)									
Normal Day 07:00-19:00		1/8/2014 12:01	68.0	6/8/2014 18:31	69.2	12/8/2014 13:01	68.0	18/8/2014 7:31	68.5	22/8/2014 14:01	69.0
		1/8/2014 12:31	67.9	7/8/2014 7:01	69.3	12/8/2014 13:31	68.7	18/8/2014 8:01	67.5	22/8/2014 14:31	68.5
		1/8/2014 13:01	68.3	7/8/2014 7:31	69.8	12/8/2014 14:01	68.6	18/8/2014 8:31	65.8	22/8/2014 15:01	68.8
28/7/2014 7:01	68.6	1/8/2014 13:31	68.7	7/8/2014 8:01	67.3	12/8/2014 14:31	68.2	18/8/2014 9:01	66.7	22/8/2014 15:31	68.4
28/7/2014 7:31	69.4	1/8/2014 14:01	68.8	7/8/2014 8:31	66.4	12/8/2014 15:01	68.9	18/8/2014 9:31	66.4	22/8/2014 16:01	69.1
28/7/2014 8:01	69.2	1/8/2014 14:31	68.2	7/8/2014 9:01	66.7	12/8/2014 15:31	68.7	18/8/2014 10:01	66.5	22/8/2014 16:31	69.0
28/7/2014 8:31	65.8	1/8/2014 15:01	68.4	7/8/2014 9:31	66.7	12/8/2014 16:01	58.3	18/8/2014 10:31	67.0	22/8/2014 17:01	68.9
28/7/2014 9:01	65.9	1/8/2014 15:31	68.7	7/8/2014 10:01	69.4	12/8/2014 16:31	56.2	18/8/2014 11:01	68.8	22/8/2014 17:31	68.8
28/7/2014 9:31	66.4	1/8/2014 16:01	68.8	7/8/2014 10:31	69.5	12/8/2014 17:01	50.4	18/8/2014 11:31	68.6	22/8/2014 18:01	68.7
28/7/2014 10:01	68.8	1/8/2014 16:31	69.1	7/8/2014 11:01	59.4	12/8/2014 17:31	48.5	18/8/2014 12:01	68.5	22/8/2014 18:31	67.4
28/7/2014 10:31	69.2	1/8/2014 17:01	68.5	7/8/2014 11:31	57.0	12/8/2014 18:01	44.4	18/8/2014 12:31	68.4	23/8/2014 7:01	67.3
28/7/2014 11:01	69.3	1/8/2014 17:31	68.7	7/8/2014 12:01	57.3	12/8/2014 18:31	65.6	18/8/2014 13:01	68.3	23/8/2014 7:31	68.1
28/7/2014 11:31	69.0	1/8/2014 18:01	68.2	7/8/2014 12:31	69.3	13/8/2014 7:01	45.7	18/8/2014 13:31	68.6	23/8/2014 8:01	69.1
28/7/2014 12:01	68.6	1/8/2014 18:31	66.8	7/8/2014 13:01	69.2	13/8/2014 7:31	63.4	18/8/2014 14:01	69.1	23/8/2014 8:31	68.4
28/7/2014 12:31	68.5	2/8/2014 7:01	67.5	7/8/2014 13:31	69.5	13/8/2014 8:01	66.9	18/8/2014 14:31	66.3	23/8/2014 9:01	69.1
28/7/2014 13:01	68.9	2/8/2014 7:31	68.3	7/8/2014 14:01	69.6	13/8/2014 8:31	66.6	18/8/2014 15:01	65.8	23/8/2014 9:31	69.0
28/7/2014 13:31	68.9	2/8/2014 8:01	68.9	7/8/2014 14:31	69.0	13/8/2014 9:01	66.5	18/8/2014 15:31	68.8	23/8/2014 10:01	68.9
28/7/2014 14:01	69.3	2/8/2014 8:31	53.3	7/8/2014 15:01	69.4	13/8/2014 9:31	67.5	18/8/2014 16:01	69.3	23/8/2014 10:31	69.2
28/7/2014 14:31	69.2	2/8/2014 9:01	52.9	7/8/2014 15:31	49.3	13/8/2014 10:01	68.0	18/8/2014 16:31	69.2	23/8/2014 11:01	69.1
28/7/2014 15:01	68.9	2/8/2014 9:31	69.3	7/8/2014 16:01	62.9	13/8/2014 10:31	69.3	18/8/2014 17:01	68.9	23/8/2014 11:31	68.9
28/7/2014 15:31	68.9	2/8/2014 10:01	69.4	7/8/2014 16:31	69.7	13/8/2014 11:01	63.5	18/8/2014 17:31	68.7	23/8/2014 12:01	68.3
28/7/2014 16:01	69.2	2/8/2014 10:31	69.3	7/8/2014 17:01	69.6	13/8/2014 11:31	69.6	18/8/2014 18:01	68.7	23/8/2014 12:31	67.0
28/7/2014 16:31	69.3	2/8/2014 11:01	68.7	7/8/2014 17:31	68.8	13/8/2014 12:01	69.7	18/8/2014 18:31	68.4	23/8/2014 13:01	67.5
28/7/2014 17:01	59.4	2/8/2014 11:31	69.1	7/8/2014 18:01	69.5	13/8/2014 12:31	64.4	19/8/2014 7:01	53.3	23/8/2014 13:31	65.9
28/7/2014 17:31	69.4	2/8/2014 12:01	68.6	7/8/2014 18:31	68.8	13/8/2014 13:01	62.9	19/8/2014 7:31	62.8	23/8/2014 14:01	67.9
28/7/2014 18:01	69.2	2/8/2014 12:31	68.8	8/8/2014 7:01	69.5	13/8/2014 13:31	63.0	19/8/2014 8:01	68.4	23/8/2014 14:31	66.6
28/7/2014 18:31	68.9	2/8/2014 13:01	68.7	8/8/2014 7:31	53.6	13/8/2014 14:01	63.3	19/8/2014 8:31	66.1	23/8/2014 15:01	68.4
29/7/2014 7:01	67.9	2/8/2014 13:31	69.0	8/8/2014 8:01	69.3	13/8/2014 14:31	64.9	19/8/2014 9:01	67.0	23/8/2014 15:31	68.6
29/7/2014 7:31	68.9	2/8/2014 14:01	68.9	8/8/2014 8:31	68.4	13/8/2014 15:01	67.5	19/8/2014 9:31	67.9	23/8/2014 16:01	68.5
29/7/2014 8:01	68.2	2/8/2014 14:31	68.9	8/8/2014 9:01	55.6	13/8/2014 15:31	61.9	19/8/2014 10:01	69.0	23/8/2014 16:31	67.8
29/7/2014 8:31	66.7	2/8/2014 15:01	68.9	8/8/2014 9:31	50.8	13/8/2014 16:01	64.7	19/8/2014 10:31	59.9	23/8/2014 17:01	68.8
29/7/2014 9:01	66.6	2/8/2014 15:31	68.7	8/8/2014 10:01	48.4	13/8/2014 16:31	61.6	19/8/2014 11:01	58.1	23/8/2014 17:31	69.1
29/7/2014 9:31	68.3	2/8/2014 16:01	68.7	8/8/2014 10:31	67.7	13/8/2014 17:01	61.4	19/8/2014 11:31	69.7	23/8/2014 18:01	68.6
29/7/2014 10:01	68.1	2/8/2014 16:31	68.8	8/8/2014 11:01	66.8	13/8/2014 17:31	58.5	19/8/2014 12:01	57.3	23/8/2014 18:31	68.4
29/7/2014 10:31	68.4	2/8/2014 17:01	68.5	8/8/2014 11:31	64.8	13/8/2014 18:01	69.6	19/8/2014 12:31	69.6	25/8/2014 7:01	68.3
29/7/2014 11:01	68.5	2/8/2014 17:31	68.4	8/8/2014 12:01	64.5	13/8/2014 18:31	68.9	19/8/2014 13:01	69.5	25/8/2014 7:31	68.6
29/7/2014 11:31	68.4	2/8/2014 18:01	68.2	8/8/2014 12:31	68.2	14/8/2014 7:01	69.6	19/8/2014 13:31	69.5	25/8/2014 8:01	67.4
29/7/2014 12:01	68.2	2/8/2014 18:31	68.3	8/8/2014 13:01	68.4	14/8/2014 7:31	62.4	19/8/2014 14:01	70.0	25/8/2014 8:31	66.0
29/7/2014 12:31	68.0	4/8/2014 7:01	67.9	8/8/2014 13:31	69.0	14/8/2014 8:01	59.4	19/8/2014 14:31	54.0	25/8/2014 9:01	66.5
29/7/2014 13:01	68.1	4/8/2014 7:31	69.1	8/8/2014 14:01	69.0	14/8/2014 8:31	66.6	19/8/2014 15:01	64.0	25/8/2014 9:31	68.9
29/7/2014 13:31	68.4	4/8/2014 8:01	67.8	8/8/2014 14:31	69.0	14/8/2014 9:01	69.2	19/8/2014 15:31	62.2	25/8/2014 10:01	68.7
29/7/2014 14:01	68.5	4/8/2014 8:31	65.4	8/8/2014 15:01	68.7	14/8/2014 9:31	66.8	19/8/2014 16:01	65.3	25/8/2014 10:31	68.5
29/7/2014 14:31	68.7	4/8/2014 9:01	67.4	8/8/2014 15:31	68.7	14/8/2014 10:01	65.7	19/8/2014 16:31	64.9	25/8/2014 11:01	68.5
29/7/2014 15:01	68.6	4/8/2014 9:31	55.8	8/8/2014 16:01	69.1	14/8/2014 10:31	65.7	19/8/2014 17:01	64.2	25/8/2014 11:31	68.4
29/7/2014 15:31	68.8	4/8/2014 10:01	61.4	8/8/2014 16:31	69.3	14/8/2014 11:01	67.3	19/8/2014 17:31	63.1	25/8/2014 12:01	68.0
29/7/2014 16:01	68.8	4/8/2014 10:31	69.6	8/8/2014 17:01	69.0	14/8/2014 11:31	64.9	19/8/2014 18:01	64.6	25/8/2014 12:31	68.2
29/7/2014 16:31	68.9	4/8/2014 11:01	69.5	8/8/2014 17:31	68.9	14/8/2014 12:01	64.6	19/8/2014 18:31	56.5	25/8/2014 13:01	68.0
29/7/2014 17:01	68.8	4/8/2014 11:31	69.1	8/8/2014 18:01	69.1	14/8/2014 12:31	68.1	20/8/2014 7:01	61.8	25/8/2014 13:31	68.2
29/7/2014 17:31	68.7	4/8/2014 12:01	68.9	8/8/2014 18:31	67.7	14/8/2014 13:01	69.5	20/8/2014 7:31	60.5	25/8/2014 14:01	68.0
29/7/2014 18:01	68.6	4/8/2014 12:31	68.8	9/8/2014 7:01	67.1	14/8/2014 13:31	69.6	20/8/2014 8:01	67.2	25/8/2014 14:31	68.3
29/7/2014 18:31	68.8	4/8/2014 13:01	68.8	9/8/2014 7:31	67.7	14/8/2014 14:01	69.5	20/8/2014 8:31	66.3	25/8/2014 15:01	68.3
30/7/2014 7:01	67.9	4/8/2014 13:31	69.3	9/8/2014 8:01	68.4	14/8/2014 14:31	52.2	20/8/2014 9:01	66.5	25/8/2014 15:31	68.5
30/7/2014 7:31	68.5	4/8/2014 14:01	69.1	9/8/2014 8:31	68.9	14/8/2014 15:01	69.6	20/8/2014 9:31	68.7	25/8/2014 16:01	68.0
30/7/2014 8:01	68.3	4/8/2014 14:31	68.9	9/8/2014 9:01	69.0	14/8/2014 15:31	69.6	20/8/2014 10:01	69.0	25/8/2014 16:31	65.3
30/7/2014 8:31	67.4	4/8/2014 15:01	68.9	9/8/2014 9:31	68.0	14/8/2014 16:01	59.1	20/8/2014 10:31	69.6	25/8/2014 17:01	68.0
30/7/2014 9:01	67.5	4/8/2014 15:31	68.9	9/8/2014 10:01	68.0	14/8/2014 16:31	69.6	20/8/2014 11:01	69.1	25/8/2014 17:31	68.5
30/7/2014 9:31	68.5	4/8/2014 16:01	37.9	9/8/2014 10:31	68.6	14/8/2014 17:01	69.5	20/8/2014 11:31	69.7	25/8/2014 18:01	68.6
30/7/2014 10:01	68.3	4/8/2014 16:31	51.3	9/8/2014 11:01	69.1	14/8/2014 17:31	69.5	20/8/2014 12:01	62.3	25/8/2014 18:31	67.7
30/7/2014 10:31	69.4	4/8/2014 17:01	69.3	9/8/2014 11:31	68.7	14/8/2014 18:01	69.6	20/8/2014 12:31	62.5	26/8/2014 7:01	68.5
30/7/2014 11:01	69.1	4/8/2014 17:31	69.1	9/8/2014 12:01	68.9	14/8/2014 18:31	65.7	20/8/2014 13:01	61.5	26/8/2014 7:31	68.6
30/7/2014 11:31	68.7	4/8/2014 18:01	69.1	9/8/2014 12:31	68.5	15/8/2014 7:01	47.7	20/8/2014 13:31	64.0	26/8/2014 8:01	66.8
30/7/2014 12:01	68.4	4/8/2014 18:31	69.2	9/8/2014 13:01	68.7	15/8/2014 7:31	53.9	20/8/2014 14:01	59.7	26/8/2014 8:31	65.0
30/7/2014 12:31	68.3	5/8/2014 7:01	68.1	9/8/2014 13:31	68.9	15/8/2014 8:01	68.8	20/8/2014 14:31	56.8	26/8/2014 9:01	66.5
30/7/2014 13:01	68.7	5/8/2014 7:31	69.0	9/8/2014 14:01	68.8	15/8/2014 8:31	66.3	20/8/2014 15:01	60.9	26/8/2014 9:31	68.5
30/7/2014 13:31	69.3	5/8/2014 8:01	68.2	9/8/2014 14:31	68.8	15/8/2014 9:01	65.6	20/8/2014 15:31	57.5	26/8/2014 10:01	68.5
30/7/2014 14:01	69.3	5/8/2014 8:31	66.4	9/8/2014 15:01	68.5	15/8/2014 9:31	66.3	20/8/2014 16:01	62.6	26/8/2014 10:31	68.6
30/7/2014 14:31	68.8	5/8/2014 9:01	67.5	9/8/2014 15:31	68.6	15/8/2014 10:01	68.2	20/8/2014 16:31	64.2	26/8/2014 11:01	68.4
30/7/2014 15:01	69.1	5/8/2014 9:31	69.5	9/8/2014 16:01	68.9	15/8/2014 10:31	69.3	20/8/2014 17:01	65.8	26/8/2014 11:31	68.3
30/7/2014 15:31	69.2	5/8/2014 10:01	69.7	9/8/2014 16:31	69.1	15/8/2014 11:01	69.0	20/8/2014 17:31	65.0	26/8/2014 12:01	68.2
30/7/2014 16:01	69.6	5/8/2014 10:31	42.0	9/8/2014 17:01							

Real-time Noise Data		RTN3 (Po Leung Kuk Yu Lee Mo Fan Memorial School)									
<u>Normal Day 19:00-23:00</u>		30/7/2014 19:46	63.4	1/8/2014 20:51	62.3	3/8/2014 9:56	63.8	3/8/2014 19:01	63.2	5/8/2014 20:06	64.0
<u>Sunday & Holiday</u>		30/7/2014 19:51	62.5	1/8/2014 20:56	57.1	3/8/2014 10:01	63.4	3/8/2014 19:06	62.7	5/8/2014 20:11	63.1
<u>07:00-23:00</u>		30/7/2014 19:56	62.9	1/8/2014 21:01	63.9	3/8/2014 10:06	64.0	3/8/2014 19:11	63.4	5/8/2014 20:16	62.3
		30/7/2014 20:01	62.6	1/8/2014 21:06	64.3	3/8/2014 10:11	64.5	3/8/2014 19:16	62.3	5/8/2014 20:21	61.2
		30/7/2014 20:06	62.2	1/8/2014 21:11	56.3	3/8/2014 10:16	64.3	3/8/2014 19:21	59.7	5/8/2014 20:26	62.1
28/7/2014 19:06	65.1	30/7/2014 20:11	64.3	1/8/2014 21:16	55.6	3/8/2014 10:21	63.4	3/8/2014 19:26	62.4	5/8/2014 20:31	62.9
28/7/2014 19:11	64.6	30/7/2014 20:16	62.2	1/8/2014 21:21	57.2	3/8/2014 10:26	63.8	3/8/2014 19:31	59.6	5/8/2014 20:36	63.1
28/7/2014 19:16	64.1	30/7/2014 20:21	61.7	1/8/2014 21:26	60.0	3/8/2014 10:31	64.3	3/8/2014 19:36	61.8	5/8/2014 20:41	63.2
28/7/2014 19:21	63.0	30/7/2014 20:26	60.8	1/8/2014 21:31	66.2	3/8/2014 10:36	64.7	3/8/2014 19:41	59.8	5/8/2014 20:46	61.8
28/7/2014 19:26	64.7	30/7/2014 20:31	61.4	1/8/2014 21:36	52.5	3/8/2014 10:41	64.4	3/8/2014 19:46	60.4	5/8/2014 20:51	61.8
28/7/2014 19:31	64.6	30/7/2014 20:36	62.1	1/8/2014 21:41	61.4	3/8/2014 10:46	63.4	3/8/2014 19:51	61.6	5/8/2014 20:56	63.2
28/7/2014 19:36	64.8	30/7/2014 20:41	59.3	1/8/2014 21:46	55.0	3/8/2014 10:51	64.2	3/8/2014 19:56	58.7	5/8/2014 21:01	63.4
28/7/2014 19:41	66.8	30/7/2014 20:46	59.1	1/8/2014 21:51	58.2	3/8/2014 10:56	65.1	3/8/2014 20:01	61.3	5/8/2014 21:06	62.5
28/7/2014 19:46	64.3	30/7/2014 20:51	61.5	1/8/2014 21:56	58.7	3/8/2014 11:01	65.4	3/8/2014 20:06	58.1	5/8/2014 21:11	62.4
28/7/2014 19:51	64.4	30/7/2014 20:56	59.1	1/8/2014 22:01	53.2	3/8/2014 11:06	64.2	3/8/2014 20:11	60.3	5/8/2014 21:16	61.9
28/7/2014 19:56	64.9	30/7/2014 21:01	59.3	1/8/2014 22:06	58.3	3/8/2014 11:11	64.6	3/8/2014 20:16	61.0	5/8/2014 21:21	62.1
28/7/2014 20:01	64.9	30/7/2014 21:06	59.2	1/8/2014 22:11	57.3	3/8/2014 11:16	64.2	3/8/2014 20:21	58.4	5/8/2014 21:26	63.1
28/7/2014 20:06	64.4	30/7/2014 21:11	61.7	1/8/2014 22:16	59.5	3/8/2014 11:21	65.0	3/8/2014 20:26	58.7	5/8/2014 21:31	61.1
28/7/2014 20:11	63.0	30/7/2014 21:16	60.1	1/8/2014 22:21	57.0	3/8/2014 11:26	64.3	3/8/2014 20:31	60.2	5/8/2014 21:36	62.4
28/7/2014 20:16	63.6	30/7/2014 21:21	61.6	1/8/2014 22:26	49.7	3/8/2014 11:31	63.8	3/8/2014 20:36	61.2	5/8/2014 21:41	61.5
28/7/2014 20:21	63.8	30/7/2014 21:26	60.5	1/8/2014 22:31	59.5	3/8/2014 11:36	64.6	3/8/2014 20:41	62.0	5/8/2014 21:46	62.2
28/7/2014 20:26	64.3	30/7/2014 21:31	61.6	1/8/2014 22:36	60.2	3/8/2014 11:41	64.1	3/8/2014 20:46	61.4	5/8/2014 21:51	60.5
28/7/2014 20:31	63.3	30/7/2014 21:36	60.8	1/8/2014 22:41	59.9	3/8/2014 11:46	64.4	3/8/2014 20:51	62.1	5/8/2014 21:56	61.7
28/7/2014 20:36	61.8	30/7/2014 21:41	60.2	1/8/2014 22:46	62.3	3/8/2014 11:51	64.3	3/8/2014 20:56	62.6	5/8/2014 22:01	62.0
28/7/2014 20:41	62.3	30/7/2014 21:46	61.5	1/8/2014 22:51	63.7	3/8/2014 11:56	64.5	3/8/2014 21:01	62.0	5/8/2014 22:06	60.4
28/7/2014 20:46	64.7	30/7/2014 21:51	61.6	1/8/2014 22:56	63.2	3/8/2014 12:01	64.0	3/8/2014 21:06	62.8	5/8/2014 22:11	63.1
28/7/2014 20:51	63.1	30/7/2014 21:56	59.4	1/8/2014 23:01	62.7	3/8/2014 12:06	63.9	3/8/2014 21:11	62.4	5/8/2014 22:16	61.4
28/7/2014 20:56	62.8	30/7/2014 22:01	62.1	2/8/2014 19:06	63.1	3/8/2014 12:11	63.9	3/8/2014 21:16	60.8	5/8/2014 22:21	61.4
28/7/2014 21:01	61.8	30/7/2014 22:06	59.9	2/8/2014 19:11	63.8	3/8/2014 12:16	64.2	3/8/2014 21:21	63.1	5/8/2014 22:26	61.2
28/7/2014 21:06	62.2	30/7/2014 22:11	61.6	2/8/2014 19:16	63.7	3/8/2014 12:21	63.5	3/8/2014 21:26	62.4	5/8/2014 22:31	62.8
28/7/2014 21:11	61.1	30/7/2014 22:16	59.4	2/8/2014 19:21	67.4	3/8/2014 12:26	63.5	3/8/2014 21:31	61.5	5/8/2014 22:36	60.6
28/7/2014 21:16	63.1	30/7/2014 22:21	61.7	2/8/2014 19:26	61.4	3/8/2014 12:31	64.4	3/8/2014 21:36	59.0	5/8/2014 22:41	60.3
28/7/2014 21:21	63.4	30/7/2014 22:26	59.5	2/8/2014 19:31	62.4	3/8/2014 12:36	63.3	3/8/2014 21:41	62.2	5/8/2014 22:46	60.7
28/7/2014 21:26	61.7	30/7/2014 22:31	60.6	2/8/2014 19:36	62.4	3/8/2014 12:41	62.9	3/8/2014 21:46	61.0	5/8/2014 22:51	60.7
28/7/2014 21:31	59.3	30/7/2014 22:36	57.1	2/8/2014 19:41	62.8	3/8/2014 12:46	63.3	3/8/2014 21:51	61.0	5/8/2014 22:56	61.3
28/7/2014 21:36	61.5	30/7/2014 22:41	64.6	2/8/2014 19:46	63.4	3/8/2014 12:51	62.5	3/8/2014 21:56	59.6	5/8/2014 23:01	51.3
28/7/2014 21:41	61.7	30/7/2014 22:46	56.7	2/8/2014 19:51	62.7	3/8/2014 12:56	63.5	3/8/2014 22:01	60.3	6/8/2014 19:06	66.4
28/7/2014 21:46	60.7	30/7/2014 22:51	57.7	2/8/2014 19:56	63.3	3/8/2014 13:01	63.1	3/8/2014 22:06	60.8	6/8/2014 19:11	64.6
28/7/2014 21:51	62.3	30/7/2014 22:56	58.2	2/8/2014 20:01	60.0	3/8/2014 13:06	65.7	3/8/2014 22:11	61.3	6/8/2014 19:16	64.0
28/7/2014 21:56	61.2	30/7/2014 23:01	59.5	2/8/2014 20:06	62.0	3/8/2014 13:11	64.0	3/8/2014 22:16	57.3	6/8/2014 19:21	65.5
28/7/2014 22:01	63.1	31/7/2014 19:06	65.5	2/8/2014 20:11	60.6	3/8/2014 13:16	63.5	3/8/2014 22:21	61.4	6/8/2014 19:26	65.4
28/7/2014 22:06	62.7	31/7/2014 19:11	62.9	2/8/2014 20:16	61.1	3/8/2014 13:21	63.5	3/8/2014 22:26	59.4	6/8/2014 19:31	65.9
28/7/2014 22:11	59.3	31/7/2014 19:16	61.9	2/8/2014 20:21	62.3	3/8/2014 13:26	64.3	3/8/2014 22:31	62.0	6/8/2014 19:36	64.6
28/7/2014 22:16	62.8	31/7/2014 19:21	63.6	2/8/2014 20:26	61.8	3/8/2014 13:31	64.8	3/8/2014 22:36	61.0	6/8/2014 19:41	65.2
28/7/2014 22:21	62.9	31/7/2014 19:26	63.1	2/8/2014 20:31	60.0	3/8/2014 13:36	64.7	3/8/2014 22:41	61.6	6/8/2014 19:46	65.5
28/7/2014 22:26	60.7	31/7/2014 19:31	62.0	2/8/2014 20:36	60.8	3/8/2014 13:41	63.8	3/8/2014 22:46	59.1	6/8/2014 19:51	65.4
28/7/2014 22:31	62.6	31/7/2014 19:36	62.0	2/8/2014 20:41	61.8	3/8/2014 13:46	62.6	3/8/2014 22:51	60.1	6/8/2014 19:56	64.5
28/7/2014 22:36	63.3	31/7/2014 19:41	61.9	2/8/2014 20:46	57.0	3/8/2014 13:51	63.7	3/8/2014 22:56	59.7	6/8/2014 20:01	63.9
28/7/2014 22:41	58.8	31/7/2014 19:46	62.4	2/8/2014 20:51	60.8	3/8/2014 13:56	63.1	3/8/2014 23:01	55.3	6/8/2014 20:06	65.0
28/7/2014 22:46	59.8	31/7/2014 19:51	64.3	2/8/2014 20:56	62.0	3/8/2014 14:01	62.6	4/8/2014 19:06	66.6	6/8/2014 20:11	64.3
28/7/2014 22:51	59.9	31/7/2014 19:56	61.2	2/8/2014 21:01	63.1	3/8/2014 14:06	62.8	4/8/2014 19:11	64.6	6/8/2014 20:16	65.0
28/7/2014 22:56	62.7	31/7/2014 20:01	63.9	2/8/2014 21:06	63.1	3/8/2014 14:11	61.6	4/8/2014 19:16	64.8	6/8/2014 20:21	64.0
28/7/2014 23:01	61.0	31/7/2014 20:06	61.8	2/8/2014 21:11	62.6	3/8/2014 14:16	62.9	4/8/2014 19:21	64.6	6/8/2014 20:26	63.2
29/7/2014 19:06	64.7	31/7/2014 20:11	64.6	2/8/2014 21:16	61.0	3/8/2014 14:21	63.3	4/8/2014 19:26	66.6	6/8/2014 20:31	63.6
29/7/2014 19:11	64.9	31/7/2014 20:16	62.9	2/8/2014 21:21	57.9	3/8/2014 14:26	62.5	4/8/2014 19:31	65.2	6/8/2014 20:36	63.5
29/7/2014 19:16	64.1	31/7/2014 20:21	62.2	2/8/2014 21:26	60.0	3/8/2014 14:31	61.8	4/8/2014 19:36	65.2	6/8/2014 20:41	65.8
29/7/2014 19:21	64.0	31/7/2014 20:26	61.8	2/8/2014 21:31	59.9	3/8/2014 14:36	61.3	4/8/2014 19:41	64.5	6/8/2014 20:46	63.4
29/7/2014 19:26	64.4	31/7/2014 20:31	62.6	2/8/2014 21:36	58.5	3/8/2014 14:41	61.2	4/8/2014 19:46	65.4	6/8/2014 20:51	62.9
29/7/2014 19:31	64.4	31/7/2014 20:36	61.9	2/8/2014 21:41	59.7	3/8/2014 14:46	63.5	4/8/2014 19:51	65.9	6/8/2014 20:56	63.4
29/7/2014 19:36	64.6	31/7/2014 20:41	59.8	2/8/2014 21:46	61.3	3/8/2014 14:51	63.6	4/8/2014 19:56	65.5	6/8/2014 21:01	63.4
29/7/2014 19:41	63.4	31/7/2014 20:46	56.6	2/8/2014 21:51	60.3	3/8/2014 14:56	62.1	4/8/2014 20:01	66.2	6/8/2014 21:06	62.7
29/7/2014 19:46	64.0	31/7/2014 20:51	59.7	2/8/2014 21:56	58.7	3/8/2014 15:01	63.1	4/8/2014 20:06	65.5	6/8/2014 21:11	63.0
29/7/2014 19:51	63.1	31/7/2014 20:56	60.7	2/8/2014 22:01	58.7	3/8/2014 15:06	60.6	4/8/2014 20:11	64.0	6/8/2014 21:16	61.6
29/7/2014 19:56	63.8	31/7/2014 21:01	56.6	2/8/2014 22:06	59.5	3/8/2014 15:11	61.1	4/8/2014 20:16	64.8	6/8/2014 21:21	56.7
29/7/2014 20:01	64.1	31/7/2014 21:06	61.0	2/8/2014 22:11	60.0	3/8/2014 15:16	62.5	4/8/2014 20:21	64.4	6/8/2014 21:26	60.2
29/7/2014 20:06	63.9	31/7/2014 21:11	59.8	2/8/2014 22:16	59.6	3/8/2014 15:21	64.0	4/8/2014 20:26	64.1	6/8/2014 21:31	63.9
29/7/2014 20:11	63.6	31/7/2014 21:16	59.6	2/8/2014 22:21	60.6	3/8/2014 15:26	62.1	4/8/2014 20:31	64.2	6/8/2014 21:36	66.4
29/7/2014 20:16	65.1	31/7/2014 21:21	59.2	2/8/2014 22:26	62.2	3/8/2014 15:31	62.8	4/8/2014 20:36	64.3	6/8/2014 21:41	69.1
29/7/2014 20:21	62.9	31/7/2014 21:26	57.1	2/8/2014 22:31	60.0	3/8/2014 15:36	61.6	4/8/2014 20:41	63.9	6/8/2014 21:46	67.7
29/7/2014 20:26	61.9	31/7/2014 21:31	61.1	2/8/2014 22:36	61.0	3/8/2					

Real-time Noise Data		RTN3 (Po Leung Kuk Yu Lee Mo Fan Memorial School)					
7/8/2014 21:11	62.3	9/8/2014 22:16	62.5	10/8/2014 15:21	60.7	11/8/2014 20:26	60.7
7/8/2014 21:16	62.8	9/8/2014 22:21	59.3	10/8/2014 15:26	61.1	11/8/2014 20:31	62.6
7/8/2014 21:21	61.8	9/8/2014 22:26	60.9	10/8/2014 15:31	60.5	11/8/2014 20:36	57.4
7/8/2014 21:26	62.3	9/8/2014 22:31	66.5	10/8/2014 15:36	61.3	11/8/2014 20:41	60.8
7/8/2014 21:31	62.7	9/8/2014 22:36	62.3	10/8/2014 15:41	60.8	11/8/2014 20:46	60.9
7/8/2014 21:36	61.7	9/8/2014 22:41	61.6	10/8/2014 15:46	62.0	11/8/2014 20:51	57.2
7/8/2014 21:41	63.1	9/8/2014 22:46	59.3	10/8/2014 15:51	61.6	11/8/2014 20:56	62.0
7/8/2014 21:46	61.1	9/8/2014 22:51	59.4	10/8/2014 15:56	62.7	11/8/2014 21:01	60.8
7/8/2014 21:51	61.7	9/8/2014 22:56	61.5	10/8/2014 16:01	61.0	11/8/2014 21:06	60.6
7/8/2014 21:56	62.8	9/8/2014 23:01	57.1	10/8/2014 16:06	60.4	11/8/2014 21:11	59.6
7/8/2014 22:01	63.9	10/8/2014 7:06	60.7	10/8/2014 16:11	59.4	11/8/2014 21:16	57.5
7/8/2014 22:06	61.6	10/8/2014 7:11	50.6	10/8/2014 16:16	60.6	11/8/2014 21:21	65.4
7/8/2014 22:11	61.6	10/8/2014 7:16	65.7	10/8/2014 16:21	61.8	11/8/2014 21:26	58.9
7/8/2014 22:16	62.8	10/8/2014 7:21	65.7	10/8/2014 16:26	61.7	11/8/2014 21:31	57.7
7/8/2014 22:21	62.3	10/8/2014 7:26	66.5	10/8/2014 16:31	62.4	11/8/2014 21:36	59.8
7/8/2014 22:26	61.8	10/8/2014 7:31	65.7	10/8/2014 16:36	62.1	11/8/2014 21:41	61.1
7/8/2014 22:31	60.7	10/8/2014 7:36	65.9	10/8/2014 16:41	62.7	11/8/2014 21:46	59.3
7/8/2014 22:36	62.7	10/8/2014 7:41	51.7	10/8/2014 16:46	62.1	11/8/2014 21:51	61.5
7/8/2014 22:41	61.3	10/8/2014 7:46	51.0	10/8/2014 16:51	63.1	11/8/2014 21:56	59.1
7/8/2014 22:46	60.7	10/8/2014 7:51	60.9	10/8/2014 16:56	60.6	11/8/2014 22:01	58.3
7/8/2014 22:51	59.1	10/8/2014 7:56	48.6	10/8/2014 17:01	61.4	11/8/2014 22:06	56.2
7/8/2014 22:56	61.4	10/8/2014 8:01	66.2	10/8/2014 17:06	58.6	11/8/2014 22:11	58.0
7/8/2014 23:01	58.9	10/8/2014 8:06	66.4	10/8/2014 17:11	62.5	11/8/2014 22:16	61.3
8/8/2014 19:06	61.7	10/8/2014 8:11	51.0	10/8/2014 17:16	60.7	11/8/2014 22:21	61.5
8/8/2014 19:11	62.5	10/8/2014 8:16	60.2	10/8/2014 17:21	65.8	11/8/2014 22:26	60.5
8/8/2014 19:16	63.6	10/8/2014 8:21	63.1	10/8/2014 17:26	61.8	11/8/2014 22:31	59.8
8/8/2014 19:21	63.5	10/8/2014 8:26	58.3	10/8/2014 17:31	62.4	11/8/2014 22:36	58.7
8/8/2014 19:26	64.2	10/8/2014 8:31	55.2	10/8/2014 17:36	63.0	11/8/2014 22:41	53.2
8/8/2014 19:31	63.0	10/8/2014 8:36	57.6	10/8/2014 17:41	63.0	11/8/2014 22:46	55.9
8/8/2014 19:36	63.2	10/8/2014 8:41	61.8	10/8/2014 17:46	63.5	11/8/2014 22:51	57.6
8/8/2014 19:41	64.1	10/8/2014 8:46	60.5	10/8/2014 17:51	63.5	11/8/2014 22:56	58.5
8/8/2014 19:46	63.4	10/8/2014 8:51	61.2	10/8/2014 17:56	64.8	11/8/2014 23:01	57.5
8/8/2014 19:51	64.2	10/8/2014 8:56	64.0	10/8/2014 18:01	64.5	12/8/2014 19:06	71.0
8/8/2014 19:56	63.2	10/8/2014 9:01	62.9	10/8/2014 18:06	63.3	12/8/2014 19:11	70.1
8/8/2014 20:01	63.4	10/8/2014 9:06	58.9	10/8/2014 18:11	62.0	12/8/2014 19:16	70.3
8/8/2014 20:06	62.6	10/8/2014 9:11	61.9	10/8/2014 18:16	62.4	12/8/2014 19:21	70.0
8/8/2014 20:11	61.2	10/8/2014 9:16	62.4	10/8/2014 18:21	63.0	12/8/2014 19:26	69.4
8/8/2014 20:16	62.4	10/8/2014 9:21	62.7	10/8/2014 18:26	63.2	12/8/2014 19:31	67.5
8/8/2014 20:21	63.5	10/8/2014 9:26	62.9	10/8/2014 18:31	64.1	12/8/2014 19:36	64.9
8/8/2014 20:26	62.1	10/8/2014 9:31	63.7	10/8/2014 18:36	63.7	12/8/2014 19:41	65.9
8/8/2014 20:31	63.1	10/8/2014 9:36	63.0	10/8/2014 18:41	64.5	12/8/2014 19:46	69.2
8/8/2014 20:36	63.0	10/8/2014 9:41	62.8	10/8/2014 18:46	62.4	12/8/2014 19:51	68.6
8/8/2014 20:41	63.0	10/8/2014 9:46	62.8	10/8/2014 18:51	63.3	12/8/2014 19:56	67.9
8/8/2014 20:46	63.5	10/8/2014 9:51	64.3	10/8/2014 18:56	62.3	12/8/2014 20:01	67.5
8/8/2014 20:51	63.5	10/8/2014 9:56	64.2	10/8/2014 19:01	61.9	12/8/2014 20:06	64.6
8/8/2014 20:56	63.7	10/8/2014 10:01	63.1	10/8/2014 19:06	63.7	12/8/2014 20:11	63.6
8/8/2014 21:01	62.8	10/8/2014 10:06	63.1	10/8/2014 19:11	63.7	12/8/2014 20:16	66.7
8/8/2014 21:06	61.3	10/8/2014 10:11	62.7	10/8/2014 19:16	62.5	12/8/2014 20:21	67.9
8/8/2014 21:11	61.8	10/8/2014 10:16	63.6	10/8/2014 19:21	63.1	12/8/2014 20:26	67.7
8/8/2014 21:16	63.8	10/8/2014 10:21	63.3	10/8/2014 19:26	62.0	12/8/2014 20:31	66.3
8/8/2014 21:21	61.5	10/8/2014 10:26	63.0	10/8/2014 19:31	63.3	12/8/2014 20:36	66.9
8/8/2014 21:26	61.8	10/8/2014 10:31	63.4	10/8/2014 19:36	61.6	12/8/2014 20:41	67.2
8/8/2014 21:31	62.7	10/8/2014 10:36	62.9	10/8/2014 19:41	62.0	12/8/2014 20:46	66.9
8/8/2014 21:36	60.9	10/8/2014 10:41	64.4	10/8/2014 19:46	61.5	12/8/2014 20:51	66.3
8/8/2014 21:41	63.5	10/8/2014 10:46	64.8	10/8/2014 19:51	60.9	12/8/2014 20:56	66.0
8/8/2014 21:46	61.2	10/8/2014 10:51	63.8	10/8/2014 19:56	60.5	12/8/2014 21:01	64.8
8/8/2014 21:51	62.8	10/8/2014 10:56	63.9	10/8/2014 20:01	56.1	12/8/2014 21:06	64.5
8/8/2014 21:56	62.9	10/8/2014 11:01	64.6	10/8/2014 20:06	61.0	12/8/2014 21:11	65.3
8/8/2014 22:01	62.0	10/8/2014 11:06	64.8	10/8/2014 20:11	60.0	12/8/2014 21:16	65.9
8/8/2014 22:06	61.2	10/8/2014 11:11	64.6	10/8/2014 20:16	59.2	12/8/2014 21:21	65.5
8/8/2014 22:11	61.9	10/8/2014 11:16	62.9	10/8/2014 20:21	63.8	12/8/2014 21:26	66.0
8/8/2014 22:16	62.0	10/8/2014 11:21	64.4	10/8/2014 20:26	58.0	12/8/2014 21:31	64.9
8/8/2014 22:21	63.9	10/8/2014 11:26	62.9	10/8/2014 20:31	59.1	12/8/2014 21:36	65.0
8/8/2014 22:26	63.1	10/8/2014 11:31	64.5	10/8/2014 20:36	61.7	12/8/2014 21:41	66.5
8/8/2014 22:31	61.7	10/8/2014 11:36	63.4	10/8/2014 20:41	59.2	12/8/2014 21:46	65.7
8/8/2014 22:36	63.2	10/8/2014 11:41	65.5	10/8/2014 20:46	56.7	12/8/2014 21:51	65.0
8/8/2014 22:41	63.4	10/8/2014 11:46	65.0	10/8/2014 20:51	57.5	12/8/2014 21:56	66.2
8/8/2014 22:46	63.0	10/8/2014 11:51	63.1	10/8/2014 20:56	62.0	12/8/2014 22:01	66.6
8/8/2014 22:51	62.3	10/8/2014 11:56	63.2	10/8/2014 21:01	60.1	12/8/2014 22:06	65.5
8/8/2014 22:56	61.8	10/8/2014 12:01	63.8	10/8/2014 21:06	60.8	12/8/2014 22:11	65.4
8/8/2014 23:01	61.5	10/8/2014 12:06	63.4	10/8/2014 21:11	60.7	12/8/2014 22:16	65.8
9/8/2014 19:06	62.2	10/8/2014 12:11	64.1	10/8/2014 21:16	62.2	12/8/2014 22:21	65.2
9/8/2014 19:11	62.8	10/8/2014 12:16	63.6	10/8/2014 21:21	63.6	12/8/2014 22:26	65.9
9/8/2014 19:16	61.8	10/8/2014 12:21	61.7	10/8/2014 21:26	59.8	12/8/2014 22:31	65.3
9/8/2014 19:21	65.5	10/8/2014 12:26	62.3	10/8/2014 21:31	61.4	12/8/2014 22:36	64.3
9/8/2014 19:26	62.9	10/8/2014 12:31	65.6	10/8/2014 21:36	63.4	12/8/2014 22:41	65.8
9/8/2014 19:31	61.7	10/8/2014 12:36	63.7	10/8/2014 21:41	60.7	12/8/2014 22:46	65.2
9/8/2014 19:36	62.3	10/8/2014 12:41	63.3	10/8/2014 21:46	61.1	12/8/2014 22:51	65.8
9/8/2014 19:41	62.0	10/8/2014 12:46	62.1	10/8/2014 21:51	61.0	12/8/2014 22:56	64.1
9/8/2014 19:46	62.8	10/8/2014 12:51	61.8	10/8/2014 21:56	61.8	12/8/2014 23:01	64.3
9/8/2014 19:51	62.9	10/8/2014 12:56	61.5	10/8/2014 22:01	62.1	13/8/2014 19:06	66.9
9/8/2014 19:56	61.7	10/8/2014 13:01	61.8	10/8/2014 22:06	60.9	13/8/2014 19:11	66.9
9/8/2014 20:01	61.0	10/8/2014 13:06	62.4	10/8/2014 22:11	60.2	13/8/2014 19:16	66.6
9/8/2014 20:06	62.4	10/8/2014 13:11	62.2	10/8/2014 22:16	60.6	13/8/2014 19:21	66.5
9/8/2014 20:11	60.0	10/8/2014 13:16	63.7	10/8/2014 22:21	60.6	13/8/2014 19:26	67.9
9/8/2014 20:16	61.0	10/8/2014 13:21	63.1	10/8/2014 22:26	58.6	13/8/2014 19:31	70.4
9/8/2014 20:21	60.9	10/8/2014 13:26	62.4	10/8/2014 22:31	60.8	13/8/2014 19:36	68.8
9/8/2014 20:26	59.2	10/8/2014 13:31	63.0	10/8/2014 22:36	60.8	13/8/2014 19:41	68.3
9/8/2014 20:31	61.8	10/8/2014 13:36	63.1	10/8/2014 22:41	60.4	13/8/2014 19:46	67.8
9/8/2014 20:36	58.3	10/8/2014 13:41	62.9	10/8/2014 22:46	60.6	13/8/2014 19:51	67.6
9/8/2014 20:41	60.1	10/8/2014 13:46	62.4	10/8/2014 22:51	59.6	13/8/2014 19:56	66.5
9/8/2014 20:46	57.0	10/8/2014 13:51	63.3	10/8/2014 22:56	58.9	13/8/2014 20:01	67.0
9/8/2014 20:51	60.9	10/8/2014 13:56	63.5	10/8/2014 23:01	56.1	13/8/2014 20:06	66.7
9/8/2014 20:56	61.0	10/8/2014 14:01	61.2	11/8/2014 19:06	63.6	13/8/2014 20:11	67.0
9/8/2014 21:01	56.3	10/8/2014 14:06	62.2	11/8/2014 19:11	63.6	13/8/2014 20:16	66.5
9/8/2014 21:06	61.7	10/8/2014 14:11	64.4	11/8/2014 19:16	64.5	13/8/2014 20:21	67.3
9/8/2014 21:11	60.5	10/8/2014 14:16	63.6	11/8/2014 19:21	63.5	13/8/2014 20:26	67.4
9/8/2014 21:16	60.3	10/8/2014 14:21	63.3	11/8/2014 19:26	64.7	13/8/2014 20:31	66.5
9/8/2014 21:21	60.1	10/8/2014 14:26	63.8	11/8/2014 19:31	63.7	13/8/2014 20:36	66.7
9/8/2014 21:26	61.5	10/8/2014 14:31	63.7	11/8/2014 19:36	64.2	13/8/2014 20:41	65.7
9/8/2014 21:31	60.4	10/8/2014 14:36	62.6	11/8/2014 19:41	63.8	13/8/2014 20:46	66.7
9/8/2014 21:36	60.7	10/8/2014 14:41	65.9	11/8/2014 19:46	63.0	13/8/2014 20:51	66.5
9/8/2014 21:41	62.4	10/8/2014 14:46	62.6	11/8/2014 19:5			

Real-time Noise Data		RTN3 (Po Leung Kuk Yu Lee Mo Fan Memorial School)					
17/8/2014 11:41	62.8	17/8/2014 20:46	60.7	19/8/2014 21:51	66.3	21/8/2014 22:56	63.3
17/8/2014 11:46	59.3	17/8/2014 20:51	59.6	19/8/2014 21:56	65.8	21/8/2014 23:01	62.0
17/8/2014 11:51	59.4	17/8/2014 20:56	61.6	19/8/2014 22:01	66.5	22/8/2014 19:06	63.1
17/8/2014 11:56	59.9	17/8/2014 21:01	61.2	19/8/2014 22:06	65.8	22/8/2014 19:11	61.6
17/8/2014 12:01	57.5	17/8/2014 21:06	59.2	19/8/2014 22:11	65.7	22/8/2014 19:16	58.4
17/8/2014 12:06	59.4	17/8/2014 21:11	61.1	19/8/2014 22:16	66.5	22/8/2014 19:21	62.6
17/8/2014 12:11	59.6	17/8/2014 21:16	60.5	19/8/2014 22:21	66.2	22/8/2014 19:26	65.3
17/8/2014 12:16	60.4	17/8/2014 21:21	58.9	19/8/2014 22:26	66.5	22/8/2014 19:31	65.1
17/8/2014 12:21	58.0	17/8/2014 21:26	57.9	19/8/2014 22:31	66.0	22/8/2014 19:36	53.2
17/8/2014 12:26	58.7	17/8/2014 21:31	59.0	19/8/2014 22:36	65.3	22/8/2014 19:41	65.8
17/8/2014 12:31	59.7	17/8/2014 21:36	60.1	19/8/2014 22:41	66.0	22/8/2014 19:46	63.4
17/8/2014 12:36	61.7	17/8/2014 21:41	54.7	19/8/2014 22:46	64.8	22/8/2014 19:51	63.1
17/8/2014 12:41	61.4	17/8/2014 21:46	56.5	19/8/2014 22:51	65.3	22/8/2014 19:56	63.2
17/8/2014 12:46	57.5	17/8/2014 21:51	60.5	19/8/2014 22:56	64.4	22/8/2014 20:01	63.5
17/8/2014 12:51	59.4	17/8/2014 21:56	58.9	19/8/2014 23:01	64.6	22/8/2014 20:06	64.4
17/8/2014 12:56	58.0	17/8/2014 22:01	61.7	20/8/2014 19:06	60.7	22/8/2014 20:11	62.8
17/8/2014 13:01	59.4	17/8/2014 22:06	58.0	20/8/2014 19:11	67.3	22/8/2014 20:16	63.2
17/8/2014 13:06	59.2	17/8/2014 22:11	57.3	20/8/2014 19:16	68.0	22/8/2014 20:21	62.8
17/8/2014 13:11	59.7	17/8/2014 22:16	60.2	20/8/2014 19:21	67.4	22/8/2014 20:26	62.2
17/8/2014 13:16	59.3	17/8/2014 22:21	58.5	20/8/2014 19:26	67.4	22/8/2014 20:31	63.6
17/8/2014 13:21	58.5	17/8/2014 22:26	58.6	20/8/2014 19:31	68.5	22/8/2014 20:36	63.4
17/8/2014 13:26	58.7	17/8/2014 22:31	60.8	20/8/2014 19:36	68.1	22/8/2014 20:41	62.9
17/8/2014 13:31	59.8	17/8/2014 22:36	61.0	20/8/2014 19:41	67.8	22/8/2014 20:46	62.8
17/8/2014 13:36	57.3	17/8/2014 22:41	57.7	20/8/2014 19:46	68.1	22/8/2014 20:51	63.5
17/8/2014 13:41	60.6	17/8/2014 22:46	61.0	20/8/2014 19:51	68.1	22/8/2014 20:56	63.8
17/8/2014 13:46	59.1	17/8/2014 22:51	55.9	20/8/2014 19:56	67.1	22/8/2014 21:01	62.9
17/8/2014 13:51	58.1	17/8/2014 22:56	61.0	20/8/2014 20:01	67.9	22/8/2014 21:06	62.8
17/8/2014 13:56	62.1	17/8/2014 23:01	56.3	20/8/2014 20:06	67.2	22/8/2014 21:11	62.2
17/8/2014 14:01	57.2	18/8/2014 19:06	64.2	20/8/2014 20:11	67.8	22/8/2014 21:16	63.0
17/8/2014 14:06	62.9	18/8/2014 19:11	64.0	20/8/2014 20:16	67.3	22/8/2014 21:21	63.4
17/8/2014 14:11	59.8	18/8/2014 19:16	63.3	20/8/2014 20:21	67.8	22/8/2014 21:26	63.1
17/8/2014 14:16	49.7	18/8/2014 19:21	63.5	20/8/2014 20:26	67.6	22/8/2014 21:31	63.4
17/8/2014 14:21	60.3	18/8/2014 19:26	63.8	20/8/2014 20:31	67.1	22/8/2014 21:36	62.4
17/8/2014 14:26	53.7	18/8/2014 19:31	63.9	20/8/2014 20:36	66.7	22/8/2014 21:41	62.6
17/8/2014 14:31	59.3	18/8/2014 19:36	64.4	20/8/2014 20:41	67.0	22/8/2014 21:46	61.9
17/8/2014 14:36	56.5	18/8/2014 19:41	63.8	20/8/2014 20:46	67.2	22/8/2014 21:51	63.5
17/8/2014 14:41	55.7	18/8/2014 19:46	62.9	20/8/2014 20:51	67.6	22/8/2014 21:56	67.2
17/8/2014 14:46	59.1	18/8/2014 19:51	63.9	20/8/2014 20:56	66.7	22/8/2014 22:01	62.5
17/8/2014 14:51	59.7	18/8/2014 19:56	63.1	20/8/2014 21:01	67.2	22/8/2014 22:06	62.4
17/8/2014 14:56	59.8	18/8/2014 20:01	64.3	20/8/2014 21:06	66.6	22/8/2014 22:11	63.2
17/8/2014 15:01	57.0	18/8/2014 20:06	64.9	20/8/2014 21:11	66.6	22/8/2014 22:16	63.6
17/8/2014 15:06	61.1	18/8/2014 20:11	63.2	20/8/2014 21:16	66.4	22/8/2014 22:21	63.5
17/8/2014 15:11	60.5	18/8/2014 20:16	63.5	20/8/2014 21:21	67.2	22/8/2014 22:26	62.1
17/8/2014 15:16	62.0	18/8/2014 20:21	62.5	20/8/2014 21:26	67.1	22/8/2014 22:31	63.8
17/8/2014 15:21	54.7	18/8/2014 20:26	62.6	20/8/2014 21:31	67.4	22/8/2014 22:36	63.0
17/8/2014 15:26	54.2	18/8/2014 20:31	63.0	20/8/2014 21:36	66.3	22/8/2014 22:41	61.5
17/8/2014 15:31	58.4	18/8/2014 20:36	62.1	20/8/2014 21:41	67.6	22/8/2014 22:46	63.6
17/8/2014 15:36	53.9	18/8/2014 20:41	63.1	20/8/2014 21:46	67.4	22/8/2014 22:51	63.1
17/8/2014 15:41	62.8	18/8/2014 20:46	63.6	20/8/2014 21:51	67.5	22/8/2014 22:56	63.1
17/8/2014 15:46	58.0	18/8/2014 20:51	61.6	20/8/2014 21:56	68.1	22/8/2014 23:01	61.1
17/8/2014 15:51	62.0	18/8/2014 20:56	62.0	20/8/2014 22:01	66.9	23/8/2014 19:06	64.3
17/8/2014 15:56	60.3	18/8/2014 21:01	59.8	20/8/2014 22:06	67.6	23/8/2014 19:11	63.2
17/8/2014 16:01	59.1	18/8/2014 21:06	59.7	20/8/2014 22:11	66.5	23/8/2014 19:16	63.4
17/8/2014 16:06	62.3	18/8/2014 21:11	59.7	20/8/2014 22:16	66.8	23/8/2014 19:21	63.7
17/8/2014 16:11	60.5	18/8/2014 21:16	61.2	20/8/2014 22:21	65.8	23/8/2014 19:26	62.7
17/8/2014 16:16	58.2	18/8/2014 21:21	63.8	20/8/2014 22:26	67.0	23/8/2014 19:31	61.8
17/8/2014 16:21	60.2	18/8/2014 21:26	61.7	20/8/2014 22:31	67.4	23/8/2014 19:36	62.5
17/8/2014 16:26	62.1	18/8/2014 21:31	60.0	20/8/2014 22:36	66.6	23/8/2014 19:41	63.4
17/8/2014 16:31	59.3	18/8/2014 21:36	59.5	20/8/2014 22:41	66.6	23/8/2014 19:46	62.4
17/8/2014 16:36	61.0	18/8/2014 21:41	60.6	20/8/2014 22:46	66.2	23/8/2014 19:51	61.2
17/8/2014 16:41	60.3	18/8/2014 21:46	63.0	20/8/2014 22:51	65.9	23/8/2014 19:56	62.5
17/8/2014 16:46	59.3	18/8/2014 21:51	61.0	20/8/2014 22:56	64.4	23/8/2014 20:01	64.5
17/8/2014 16:51	60.9	18/8/2014 21:56	60.9	20/8/2014 23:01	64.1	23/8/2014 20:06	62.3
17/8/2014 16:56	67.3	18/8/2014 22:01	58.9	21/8/2014 19:06	64.7	23/8/2014 20:11	61.4
17/8/2014 17:01	61.8	18/8/2014 22:06	59.7	21/8/2014 19:11	64.7	23/8/2014 20:16	62.0
17/8/2014 17:06	57.3	18/8/2014 22:11	59.6	21/8/2014 19:16	65.0	23/8/2014 20:21	62.4
17/8/2014 17:11	62.6	18/8/2014 22:16	60.2	21/8/2014 19:21	65.3	23/8/2014 20:26	60.3
17/8/2014 17:16	62.7	18/8/2014 22:21	60.8	21/8/2014 19:26	66.3	23/8/2014 20:31	60.0
17/8/2014 17:21	61.3	18/8/2014 22:26	59.8	21/8/2014 19:31	64.4	23/8/2014 20:36	60.5
17/8/2014 17:26	63.9	18/8/2014 22:31	61.5	21/8/2014 19:36	64.1	23/8/2014 20:41	59.4
17/8/2014 17:31	61.4	18/8/2014 22:36	53.4	21/8/2014 19:41	65.6	23/8/2014 20:46	60.8
17/8/2014 17:36	62.2	18/8/2014 22:41	59.5	21/8/2014 19:46	63.8	23/8/2014 20:51	60.2
17/8/2014 17:41	63.1	18/8/2014 22:46	61.1	21/8/2014 19:51	65.0	23/8/2014 20:56	61.4
17/8/2014 17:46	62.8	18/8/2014 22:51	58.4	21/8/2014 19:56	65.9	23/8/2014 21:01	61.1
17/8/2014 17:51	62.1	18/8/2014 22:56	59.6	21/8/2014 20:01	65.0	23/8/2014 21:06	59.6
17/8/2014 17:56	63.1	18/8/2014 23:01	55.3	21/8/2014 20:06	64.8	23/8/2014 21:11	58.7
17/8/2014 18:01	64.2	19/8/2014 19:06	66.9	21/8/2014 20:11	64.4	23/8/2014 21:16	59.7
17/8/2014 18:06	63.3	19/8/2014 19:11	67.2	21/8/2014 20:16	64.2	23/8/2014 21:21	60.6
17/8/2014 18:11	61.2	19/8/2014 19:16	68.4	21/8/2014 20:21	63.6	23/8/2014 21:26	61.8
17/8/2014 18:16	64.3	19/8/2014 19:21	67.9	21/8/2014 20:26	63.8	23/8/2014 21:31	60.1
17/8/2014 18:21	63.8	19/8/2014 19:26	67.7	21/8/2014 20:31	63.9	23/8/2014 21:36	61.7
17/8/2014 18:26	64.6	19/8/2014 19:31	67.2	21/8/2014 20:36	64.1	23/8/2014 21:41	61.4
17/8/2014 18:31	64.6	19/8/2014 19:36	67.6	21/8/2014 20:41	64.8	23/8/2014 21:46	62.0
17/8/2014 18:36	63.6	19/8/2014 19:41	67.6	21/8/2014 20:46	63.1	23/8/2014 21:51	61.8
17/8/2014 18:41	64.3	19/8/2014 19:46	67.2	21/8/2014 20:51	64.8	23/8/2014 21:56	62.6
17/8/2014 18:46	63.1	19/8/2014 19:51	68.3	21/8/2014 20:56	64.4	23/8/2014 22:01	62.2
17/8/2014 18:51	65.0	19/8/2014 19:56	67.6	21/8/2014 21:01	61.8	23/8/2014 22:06	65.4
17/8/2014 18:56	61.9	19/8/2014 20:01	67.1	21/8/2014 21:06	65.3	23/8/2014 22:11	61.8
17/8/2014 19:01	62.8	19/8/2014 20:06	67.0	21/8/2014 21:11	62.8	23/8/2014 22:16	62.1
17/8/2014 19:06	62.3	19/8/2014 20:11	67.0	21/8/2014 21:16	65.3	23/8/2014 22:21	63.6
17/8/2014 19:11	63.5	19/8/2014 20:16	67.4	21/8/2014 21:21	62.6	23/8/2014 22:26	62.3
17/8/2014 19:16	62.3	19/8/2014 20:21	67.2	21/8/2014 21:26	64.9	23/8/2014 22:31	60.4
17/8/2014 19:21	63.8	19/8/2014 20:26	66.6	21/8/2014 21:31	64.7	23/8/2014 22:36	62.3
17/8/2014 19:26	59.6	19/8/2014 20:31	66.3	21/8/2014 21:36	64.5	23/8/2014 22:41	60.1
17/8/2014 19:31	61.2	19/8/2014 20:36	65.7	21/8/2014 21:41	63.5	23/8/2014 22:46	61.1
17/8/2014 19:36	60.2	19/8/2014 20:41	67.2	21/8/2014 21:46	64.6	23/8/2014 22:51	58.1
17/8/2014 19:41	58.8	19/8/2014 20:46	66.9	21/8/2014 21:51	64.1	23/8/2014 22:56	57.1
17/8/2014 19:46	62.4	19/8/2014 20:51	66.9	21/8/2014 21:56	64.5	23/8/2014 23:01	64.7
17/8/2014 19:51	60.6	19/8/2014 20:56	66.4	21/8/2014 22:01	62.6	24/8/2014 7:06	64.7
17/8/2014 19:56	60.6	19/8/2014 21:01	66.9	21/8/2014 22:06	64.5	24/8/2014 7:11	64.4
17/8/2014 20:01	61.1	19/8/2014 21:06	66.8	21/8/2014 22:11	64.0	24/8/2014 7:16	64.4
17/8/2014 20:06	62.3	19/8/2014 21:11					

Real-time Noise Data		RTN3 (Po Leung Kuk Yu Lee Mo Fan Memorial School)	
25/8/2014 22:11	59.3		29/7/2014 0:51 59.3
25/8/2014 22:16	61.8	Night time: 23:00-07:00	29/7/2014 0:56 61.1
25/8/2014 22:21	59.6		29/7/2014 1:01 61.1
25/8/2014 22:26	61.6	28/7/2014 0:01 63.8	29/7/2014 1:06 60.3
25/8/2014 22:31	59.3	28/7/2014 0:06 63.4	29/7/2014 1:11 61.1
25/8/2014 22:36	57.6	28/7/2014 0:11 64.4	29/7/2014 1:16 57.0
25/8/2014 22:41	60.0	28/7/2014 0:16 64.6	29/7/2014 1:21 55.3
25/8/2014 22:46	59.4	28/7/2014 0:21 61.8	29/7/2014 1:26 58.4
25/8/2014 22:51	61.7	28/7/2014 0:26 62.3	29/7/2014 1:31 58.8
25/8/2014 22:56	59.8	28/7/2014 0:31 63.2	29/7/2014 1:36 59.7
25/8/2014 23:01	58.9	28/7/2014 0:36 59.8	29/7/2014 1:41 54.4
26/8/2014 19:06	62.3	28/7/2014 0:41 60.9	29/7/2014 1:46 59.1
26/8/2014 19:11	63.1	28/7/2014 0:46 60.7	29/7/2014 1:51 58.0
26/8/2014 19:16	62.3	28/7/2014 0:51 60.9	29/7/2014 1:56 59.8
26/8/2014 19:21	63.5	28/7/2014 0:56 61.3	29/7/2014 2:01 57.5
26/8/2014 19:26	64.6	28/7/2014 1:01 58.0	29/7/2014 2:06 36.7
26/8/2014 19:31	63.8	28/7/2014 1:06 59.7	29/7/2014 2:11 62.9
26/8/2014 19:36	65.1	28/7/2014 1:11 58.0	29/7/2014 2:16 62.5
26/8/2014 19:41	62.6	28/7/2014 1:16 57.1	29/7/2014 2:21 62.9
26/8/2014 19:46	63.3	28/7/2014 1:21 52.1	29/7/2014 2:26 62.7
26/8/2014 19:51	63.7	28/7/2014 1:26 60.7	29/7/2014 2:31 63.0
26/8/2014 19:56	63.2	28/7/2014 1:31 62.9	29/7/2014 2:36 62.4
26/8/2014 20:01	61.8	28/7/2014 1:36 59.5	29/7/2014 2:41 62.5
26/8/2014 20:06	63.6	28/7/2014 1:41 63.0	29/7/2014 2:46 63.0
26/8/2014 20:11	62.8	28/7/2014 1:46 58.1	29/7/2014 2:51 62.6
26/8/2014 20:16	62.4	28/7/2014 1:51 44.5	29/7/2014 2:56 62.4
26/8/2014 20:21	63.5	28/7/2014 1:56 58.3	29/7/2014 3:01 62.1
26/8/2014 20:26	60.7	28/7/2014 2:01 45.8	29/7/2014 3:06 61.9
26/8/2014 20:31	61.9	28/7/2014 2:06 62.3	29/7/2014 3:11 62.6
26/8/2014 20:36	61.0	28/7/2014 2:11 62.8	29/7/2014 3:16 61.9
26/8/2014 20:41	63.1	28/7/2014 2:16 61.6	29/7/2014 3:21 62.0
26/8/2014 20:46	61.4	28/7/2014 2:21 63.0	29/7/2014 3:26 61.1
26/8/2014 20:51	63.0	28/7/2014 2:26 62.3	29/7/2014 3:31 61.0
26/8/2014 20:56	60.8	28/7/2014 2:31 61.1	29/7/2014 3:36 62.2
26/8/2014 21:01	61.4	28/7/2014 2:36 61.5	29/7/2014 3:41 62.0
26/8/2014 21:06	60.9	28/7/2014 2:41 60.9	29/7/2014 3:46 61.0
26/8/2014 21:11	61.1	28/7/2014 2:46 62.3	29/7/2014 3:51 62.0
26/8/2014 21:16	61.4	28/7/2014 2:51 56.0	29/7/2014 3:56 61.8
26/8/2014 21:21	60.7	28/7/2014 2:56 62.3	29/7/2014 4:01 62.0
26/8/2014 21:26	62.6	28/7/2014 3:01 63.0	29/7/2014 4:06 62.2
26/8/2014 21:31	61.6	28/7/2014 3:06 62.1	29/7/2014 4:11 62.7
26/8/2014 21:36	58.8	28/7/2014 3:11 61.5	29/7/2014 4:16 61.4
26/8/2014 21:41	60.4	28/7/2014 3:16 61.2	29/7/2014 4:21 61.2
26/8/2014 21:46	63.5	28/7/2014 3:21 61.5	29/7/2014 4:26 61.1
26/8/2014 21:51	61.2	28/7/2014 3:26 60.7	29/7/2014 4:31 60.5
26/8/2014 21:56	61.2	28/7/2014 3:31 60.4	29/7/2014 4:36 61.0
26/8/2014 22:01	58.3	28/7/2014 3:36 61.0	29/7/2014 4:41 61.4
26/8/2014 22:06	61.4	28/7/2014 3:41 61.3	29/7/2014 4:46 62.1
26/8/2014 22:11	63.0	28/7/2014 3:46 59.9	29/7/2014 4:51 61.4
26/8/2014 22:16	61.3	28/7/2014 3:51 61.9	29/7/2014 4:56 62.2
26/8/2014 22:21	62.1	28/7/2014 3:56 60.8	29/7/2014 5:01 62.2
26/8/2014 22:26	61.1	28/7/2014 4:01 61.0	29/7/2014 5:06 60.7
26/8/2014 22:31	60.0	28/7/2014 4:06 61.1	29/7/2014 5:11 62.1
26/8/2014 22:36	60.7	28/7/2014 4:11 60.5	29/7/2014 5:16 61.6
26/8/2014 22:41	60.4	28/7/2014 4:16 60.0	29/7/2014 5:21 62.8
26/8/2014 22:46	61.4	28/7/2014 4:21 61.3	29/7/2014 5:26 62.4
26/8/2014 22:51	59.7	28/7/2014 4:26 61.2	29/7/2014 5:31 62.9
26/8/2014 22:56	60.8	28/7/2014 4:31 61.6	29/7/2014 5:36 63.0
26/8/2014 23:01	58.4	28/7/2014 4:36 62.5	29/7/2014 5:41 63.0
27/8/2014 19:06	63.5	28/7/2014 4:41 61.2	29/7/2014 5:46 62.9
27/8/2014 19:11	64.1	28/7/2014 4:46 62.1	29/7/2014 5:51 58.4
27/8/2014 19:16	63.4	28/7/2014 4:51 61.4	29/7/2014 5:56 57.4
27/8/2014 19:21	62.6	28/7/2014 4:56 61.5	29/7/2014 6:01 59.0
27/8/2014 19:26	64.1	28/7/2014 5:01 45.8	29/7/2014 6:06 57.4
27/8/2014 19:31	62.6	28/7/2014 5:06 62.1	29/7/2014 6:11 55.6
27/8/2014 19:36	62.3	28/7/2014 5:11 61.5	29/7/2014 6:16 61.4
27/8/2014 19:41	63.2	28/7/2014 5:16 62.6	29/7/2014 6:21 62.0
27/8/2014 19:46	59.0	28/7/2014 5:21 62.7	29/7/2014 6:26 62.1
27/8/2014 19:51	62.2	28/7/2014 5:26 46.3	29/7/2014 6:31 61.7
27/8/2014 19:56	62.6	28/7/2014 5:31 62.6	29/7/2014 6:36 63.5
27/8/2014 20:01	62.8	28/7/2014 5:36 63.0	29/7/2014 6:41 63.2
27/8/2014 20:06	63.3	28/7/2014 5:41 53.3	29/7/2014 6:46 64.7
27/8/2014 20:11	62.4	28/7/2014 5:46 59.0	29/7/2014 6:51 65.4
27/8/2014 20:16	63.3	28/7/2014 5:51 58.1	29/7/2014 6:56 66.3
27/8/2014 20:21	63.3	28/7/2014 5:56 59.2	29/7/2014 7:01 66.2
27/8/2014 20:26	63.4	28/7/2014 6:01 56.6	29/7/2014 7:06 66.1
27/8/2014 20:31	60.0	28/7/2014 6:06 59.0	29/7/2014 7:11 64.9
27/8/2014 20:36	60.3	28/7/2014 6:11 60.2	29/7/2014 7:16 64.6
27/8/2014 20:41	60.4	28/7/2014 6:16 61.9	29/7/2014 7:21 65.4
27/8/2014 20:46	61.5	28/7/2014 6:21 62.9	29/7/2014 7:26 65.9
27/8/2014 20:51	62.9	28/7/2014 6:26 63.0	29/7/2014 7:31 64.9
27/8/2014 20:56	61.7	28/7/2014 6:31 64.0	29/7/2014 7:36 65.4
27/8/2014 21:01	61.2	28/7/2014 6:36 65.1	29/7/2014 7:41 64.7
27/8/2014 21:06	59.4	28/7/2014 6:41 65.1	29/7/2014 7:46 64.7
27/8/2014 21:11	61.8	28/7/2014 6:46 65.3	29/7/2014 7:51 64.2
27/8/2014 21:16	58.6	28/7/2014 6:51 66.4	29/7/2014 7:56 64.0
27/8/2014 21:21	54.6	28/7/2014 6:56 66.0	30/7/2014 0:01 63.8
27/8/2014 21:26	57.8	28/7/2014 7:01 65.7	30/7/2014 0:06 65.1
27/8/2014 21:31	59.0	28/7/2014 7:06 65.4	30/7/2014 0:11 63.5
27/8/2014 21:36	59.7	28/7/2014 7:11 65.4	30/7/2014 0:16 62.6
27/8/2014 21:41	60.9	28/7/2014 7:16 64.9	30/7/2014 0:21 64.3
27/8/2014 21:46	56.2	28/7/2014 7:21 64.7	30/7/2014 0:26 63.3
27/8/2014 21:51	59.3	28/7/2014 7:26 65.0	30/7/2014 0:31 63.8
27/8/2014 21:56	60.6	28/7/2014 7:31 64.7	30/7/2014 0:36 62.8
27/8/2014 22:01	59.7	28/7/2014 7:36 65.2	30/7/2014 0:41 61.8
27/8/2014 22:06	54.6	28/7/2014 7:41 63.3	30/7/2014 0:46 60.5
27/8/2014 22:11	62.9	28/7/2014 7:46 64.4	30/7/2014 0:51 60.5
27/8/2014 22:16	64.1	28/7/2014 7:51 64.2	30/7/2014 0:56 61.7
27/8/2014 22:21	62.8	28/7/2014 7:56 63.4	30/7/2014 1:01 60.4
27/8/2014 22:26	62.2	29/7/2014 0:01 63.8	30/7/2014 1:06 61.4
27/8/2014 22:31	63.3	29/7/2014 0:06 64.2	30/7/2014 1:11 59.3
27/8/2014 22:36	62.4	29/7/2014 0:11 63.0	30/7/2014 1:16 61.6
27/8/2014 22:41	62.4	29/7/2014 0:16 65.5	30/7/2014 1:21 58.6
27/8/2014 22:46	64.1	29/7/2014 0:21 63.1	30/7/2014 1:26 54.7
27/8/2014 22:51	62.3	29/7/2014 0:26 63.1	30/7/2014 1:31 58.8
27/8/2014 22:56	63.0	29/7/2014 0:31 64.0	30/7/2014 1:36 57.7
27/8/2014 23:01	61.3	29/7/2014 0:36 63.8	30/7/2014 1:41 58.9
		29/7/2014 0:41 61.4	30/7/2014 1:46 57.9
		29/7/2014 0:46 61.2	30/7/2014 1:51 56.9
			30/7/2014 1:56 56.6
			30/7/2014 2:01 49.4
			30/7/2014 2:06 54.7
			30/7/2014 2:11 63.0
			30/7/2014 2:16 51.5
			30/7/2014 2:21 62.5
			30/7/2014 2:26 62.9
			30/7/2014 2:31 63.1
			30/7/2014 2:36 62.4
			30/7/2014 2:41 62.7
			30/7/2014 2:46 62.1
			30/7/2014 2:51 62.7
			30/7/2014 2:56 62.3
			30/7/2014 3:01 61.2
			30/7/2014 3:06 56.0
			30/7/2014 3:11 61.9
			30/7/2014 3:16 61.4
			30/7/2014 3:21 61.1
			30/7/2014 3:26 61.7
			30/7/2014 3:31 61.4
			30/7/2014 3:36 62.1
			30/7/2014 3:41 61.7
			30/7/2014 3:46 61.2
			30/7/2014 3:51 62.2
			30/7/2014 3:56 61.1
			30/7/2014 4:01 61.2
			30/7/2014 4:06 61.5
			30/7/2014 4:11 61.6
			30/7/2014 4:16 61.4
			30/7/2014 4:21 62.4
			30/7/2014 4:26 60.5
			30/7/2014 4:31 60.9
			30/7/2014 4:36 62.4
			30/7/2014 4:41 61.8
			30/7/2014 4:46 60.7
			30/7/2014 4:51 62.1
			30/7/2014 4:56 55.5
			30/7/2014 5:01 54.9
			30/7/2014 5:06 61.7
			30/7/2014 5:11 54.9
			30/7/2014 5:16 62.2
			30/7/2014 5:21 62.7
			30/7/2014 5:26 62.5
			30/7/2014 5:31 62.1
			30/7/2014 5:36 54.4
			30/7/2014 5:41 62.9
			30/7/2014 5:46 55.0
			30/7/2014 5:51 57.3
			30/7/2014 5:56 55.5
			30/7/2014 6:01 54.9
			30/7/2014 6:06 50.3
			30/7/2014 6:11 62.3
			30/7/2014 6:16 62.4
			30/7/2014 6:21 60.9
			30/7/2014 6:26 61.5
			30/7/2014 6:31 61.0
			30/7/2014 6:36 63.4
			30/7/2014 6:41 62.7
			30/7/2014 6:46 65.4
			30/7/2014 6:51 64.8
			30/7/2014 6:56 64.1
			30/7/2014 7:01 65.2
			30/7/2014 7:06 64.7
			30/7/2014 7:11 64.8
			30/7/2014 7:16 65.5
			30/7/2014 7:21 63.7
			30/7/2014 7:26 64.7
			30/7/2014 7:31 64.7
			30/7/2014 7:36 64.9
			30/7/2014 7:41 64.5
			30/7/2014 7:46 63.4
			30/7/2014 7:51 63.9
			30/7/2014 7:56 63.9
			31/7/2014 0:01 62.7
			31/7/2014 0:06 63.5
			31/7/2014 0:11 63.4
			31/7/2014 0:16 61.8
			31/7/2014 0:21 62.0
			31/7/2014 0:26 62.9

Real-time Noise Data		RTN3 (Po Leung Kuk Yu Lee Mo Fan Memorial School)									
2/8/2014 5:11	52.8	3/8/2014 6:16	63.2	4/8/2014 23:21	64.5	6/8/2014 0:26	64.4	7/8/2014 1:31	61.2	8/8/2014 2:36	59.7
2/8/2014 5:16	61.1	3/8/2014 6:21	63.7	4/8/2014 23:26	64.2	6/8/2014 0:31	62.1	7/8/2014 1:36	60.4	8/8/2014 2:41	58.9
2/8/2014 5:21	59.0	3/8/2014 6:26	64.9	4/8/2014 23:31	63.8	6/8/2014 0:36	61.6	7/8/2014 1:41	61.7	8/8/2014 2:46	54.8
2/8/2014 5:26	52.9	3/8/2014 6:31	63.5	4/8/2014 23:36	65.2	6/8/2014 0:41	61.4	7/8/2014 1:46	62.8	8/8/2014 2:51	59.7
2/8/2014 5:31	55.0	3/8/2014 6:36	64.2	4/8/2014 23:41	64.5	6/8/2014 0:46	59.0	7/8/2014 1:51	60.7	8/8/2014 2:56	54.4
2/8/2014 5:36	58.0	3/8/2014 6:41	64.6	4/8/2014 23:46	64.4	6/8/2014 0:51	60.1	7/8/2014 1:56	60.0	8/8/2014 3:01	57.0
2/8/2014 5:41	58.6	3/8/2014 6:46	64.9	4/8/2014 23:51	63.6	6/8/2014 0:56	57.6	7/8/2014 2:01	59.5	8/8/2014 3:06	58.6
2/8/2014 5:46	60.5	3/8/2014 6:51	65.8	4/8/2014 23:56	64.6	6/8/2014 1:01	64.1	7/8/2014 2:06	56.0	8/8/2014 3:11	62.9
2/8/2014 5:51	62.3	3/8/2014 6:56	64.2	5/8/2014 0:01	63.9	6/8/2014 1:06	75.9	7/8/2014 2:11	60.7	8/8/2014 3:16	52.9
2/8/2014 5:56	61.4	3/8/2014 23:01	64.4	5/8/2014 0:06	64.1	6/8/2014 1:11	69.3	7/8/2014 2:16	62.4	8/8/2014 3:21	62.3
2/8/2014 6:01	61.0	3/8/2014 23:06	64.4	5/8/2014 0:11	64.2	6/8/2014 1:16	68.7	7/8/2014 2:21	58.0	8/8/2014 3:26	54.6
2/8/2014 6:06	61.6	3/8/2014 23:11	64.8	5/8/2014 0:16	63.9	6/8/2014 1:21	65.4	7/8/2014 2:26	56.6	8/8/2014 3:31	47.2
2/8/2014 6:11	61.9	3/8/2014 23:16	64.2	5/8/2014 0:21	63.4	6/8/2014 1:26	62.3	7/8/2014 2:31	53.5	8/8/2014 3:36	49.6
2/8/2014 6:16	63.1	3/8/2014 23:21	64.3	5/8/2014 0:26	63.7	6/8/2014 1:31	61.6	7/8/2014 2:36	60.3	8/8/2014 3:41	62.9
2/8/2014 6:21	62.9	3/8/2014 23:26	62.9	5/8/2014 0:31	62.3	6/8/2014 1:36	61.5	7/8/2014 2:41	56.5	8/8/2014 3:46	56.4
2/8/2014 6:26	62.6	3/8/2014 23:31	62.6	5/8/2014 0:36	62.8	6/8/2014 1:41	59.9	7/8/2014 2:46	57.0	8/8/2014 3:51	55.5
2/8/2014 6:31	64.4	3/8/2014 23:36	63.4	5/8/2014 0:41	63.4	6/8/2014 1:46	62.6	7/8/2014 2:51	50.6	8/8/2014 3:56	53.7
2/8/2014 6:36	64.0	3/8/2014 23:41	64.7	5/8/2014 0:46	60.4	6/8/2014 1:51	61.7	7/8/2014 2:56	63.0	8/8/2014 4:01	63.1
2/8/2014 6:41	64.9	3/8/2014 23:46	63.8	5/8/2014 0:51	59.6	6/8/2014 1:56	56.0	7/8/2014 3:01	54.5	8/8/2014 4:06	49.8
2/8/2014 6:46	65.5	3/8/2014 23:51	63.2	5/8/2014 0:56	61.5	6/8/2014 2:01	61.2	7/8/2014 3:06	63.0	8/8/2014 4:11	62.9
2/8/2014 6:51	64.5	3/8/2014 23:56	62.9	5/8/2014 1:01	59.7	6/8/2014 2:06	55.6	7/8/2014 3:11	53.9	8/8/2014 4:16	41.5
2/8/2014 6:56	64.6	4/8/2014 0:01	62.7	5/8/2014 1:06	59.7	6/8/2014 2:11	57.4	7/8/2014 3:16	55.7	8/8/2014 4:21	63.0
2/8/2014 23:01	65.0	4/8/2014 0:06	60.3	5/8/2014 1:11	58.7	6/8/2014 2:16	52.5	7/8/2014 3:21	51.0	8/8/2014 4:26	62.0
2/8/2014 23:06	64.9	4/8/2014 0:11	63.6	5/8/2014 1:16	61.2	6/8/2014 2:21	57.7	7/8/2014 3:26	58.0	8/8/2014 4:31	63.0
2/8/2014 23:11	64.9	4/8/2014 0:16	61.2	5/8/2014 1:21	57.4	6/8/2014 2:26	55.7	7/8/2014 3:31	51.9	8/8/2014 4:36	62.6
2/8/2014 23:16	65.1	4/8/2014 0:21	62.7	5/8/2014 1:26	60.4	6/8/2014 2:31	55.0	7/8/2014 3:36	54.0	8/8/2014 4:41	63.0
2/8/2014 23:21	65.6	4/8/2014 0:26	63.4	5/8/2014 1:31	57.0	6/8/2014 2:36	63.1	7/8/2014 3:41	63.0	8/8/2014 4:46	62.5
2/8/2014 23:26	64.5	4/8/2014 0:31	62.9	5/8/2014 1:36	56.5	6/8/2014 2:41	55.0	7/8/2014 3:46	63.0	8/8/2014 4:51	39.7
2/8/2014 23:31	64.3	4/8/2014 0:36	58.3	5/8/2014 1:41	55.1	6/8/2014 2:46	56.2	7/8/2014 3:51	62.7	8/8/2014 4:56	63.0
2/8/2014 23:36	64.5	4/8/2014 0:41	59.5	5/8/2014 1:46	50.0	6/8/2014 2:51	56.3	7/8/2014 3:56	49.1	8/8/2014 5:01	58.6
2/8/2014 23:41	65.2	4/8/2014 0:46	54.8	5/8/2014 1:51	50.6	6/8/2014 2:56	62.2	7/8/2014 4:01	62.3	8/8/2014 5:06	57.1
2/8/2014 23:46	70.1	4/8/2014 0:51	60.0	5/8/2014 1:56	63.1	6/8/2014 3:01	62.7	7/8/2014 4:06	63.1	8/8/2014 5:11	47.6
2/8/2014 23:51	70.4	4/8/2014 0:56	56.4	5/8/2014 2:01	62.7	6/8/2014 3:06	62.8	7/8/2014 4:11	62.4	8/8/2014 5:16	53.4
2/8/2014 23:56	70.6	4/8/2014 1:01	58.5	5/8/2014 2:06	51.3	6/8/2014 3:11	50.6	7/8/2014 4:16	45.2	8/8/2014 5:21	61.2
3/8/2014 0:01	70.0	4/8/2014 1:06	52.2	5/8/2014 2:11	62.6	6/8/2014 3:16	62.9	7/8/2014 4:21	62.4	8/8/2014 5:26	59.7
3/8/2014 0:06	69.4	4/8/2014 1:11	58.6	5/8/2014 2:16	62.9	6/8/2014 3:21	48.6	7/8/2014 4:26	62.0	8/8/2014 5:31	56.7
3/8/2014 0:11	70.1	4/8/2014 1:16	55.8	5/8/2014 2:21	62.8	6/8/2014 3:26	62.6	7/8/2014 4:31	62.2	8/8/2014 5:36	55.9
3/8/2014 0:16	70.8	4/8/2014 1:21	51.5	5/8/2014 2:26	49.1	6/8/2014 3:31	54.0	7/8/2014 4:36	47.9	8/8/2014 5:41	57.8
3/8/2014 0:21	70.9	4/8/2014 1:26	45.2	5/8/2014 2:31	56.7	6/8/2014 3:36	41.5	7/8/2014 4:41	62.3	8/8/2014 5:46	61.2
3/8/2014 0:26	70.5	4/8/2014 1:31	50.8	5/8/2014 2:36	62.6	6/8/2014 3:41	62.3	7/8/2014 4:46	60.9	8/8/2014 5:51	61.3
3/8/2014 0:31	70.5	4/8/2014 1:36	62.8	5/8/2014 2:41	61.4	6/8/2014 3:46	52.1	7/8/2014 4:51	63.0	8/8/2014 5:56	59.5
3/8/2014 0:36	69.8	4/8/2014 1:41	39.7	5/8/2014 2:46	62.4	6/8/2014 3:51	44.5	7/8/2014 4:56	62.2	8/8/2014 6:01	62.2
3/8/2014 0:41	68.2	4/8/2014 1:46	62.6	5/8/2014 2:51	61.7	6/8/2014 3:56	62.7	7/8/2014 5:01	62.8	8/8/2014 6:06	64.8
3/8/2014 0:46	65.7	4/8/2014 1:51	62.4	5/8/2014 2:56	61.6	6/8/2014 4:01	63.0	7/8/2014 5:06	62.3	8/8/2014 6:11	65.8
3/8/2014 0:51	65.8	4/8/2014 1:56	62.9	5/8/2014 3:01	48.3	6/8/2014 4:06	62.5	7/8/2014 5:11	60.2	8/8/2014 6:16	64.6
3/8/2014 0:56	64.6	4/8/2014 2:01	62.5	5/8/2014 3:06	61.2	6/8/2014 4:11	49.6	7/8/2014 5:16	62.9	8/8/2014 6:21	63.5
3/8/2014 1:01	64.7	4/8/2014 2:06	62.1	5/8/2014 3:11	62.6	6/8/2014 4:16	62.6	7/8/2014 5:21	56.4	8/8/2014 6:26	64.6
3/8/2014 1:06	64.9	4/8/2014 2:11	62.3	5/8/2014 3:16	62.2	6/8/2014 4:21	62.5	7/8/2014 5:26	52.5	8/8/2014 6:31	63.6
3/8/2014 1:11	65.4	4/8/2014 2:16	62.0	5/8/2014 3:21	61.9	6/8/2014 4:26	62.7	7/8/2014 5:31	59.0	8/8/2014 6:36	64.9
3/8/2014 1:16	64.3	4/8/2014 2:21	61.8	5/8/2014 3:26	50.0	6/8/2014 4:31	62.3	7/8/2014 5:36	58.7	8/8/2014 6:41	66.4
3/8/2014 1:21	64.6	4/8/2014 2:26	61.8	5/8/2014 3:31	62.4	6/8/2014 4:36	62.9	7/8/2014 5:41	60.3	8/8/2014 6:46	66.4
3/8/2014 1:26	65.1	4/8/2014 2:31	60.6	5/8/2014 3:36	62.0	6/8/2014 4:41	62.8	7/8/2014 5:46	65.3	8/8/2014 6:51	67.0
3/8/2014 1:31	64.3	4/8/2014 2:36	61.3	5/8/2014 3:41	61.3	6/8/2014 4:46	53.1	7/8/2014 5:51	65.9	8/8/2014 6:56	67.0
3/8/2014 1:36	63.2	4/8/2014 2:41	60.9	5/8/2014 3:46	60.8	6/8/2014 4:51	57.5	7/8/2014 5:56	62.8	8/8/2014 23:01	65.9
3/8/2014 1:41	63.6	4/8/2014 2:46	60.5	5/8/2014 3:51	61.3	6/8/2014 4:56	45.8	7/8/2014 6:01	58.9	8/8/2014 23:06	66.7
3/8/2014 1:46	64.0	4/8/2014 2:51	61.4	5/8/2014 3:56	62.7	6/8/2014 5:01	52.5	7/8/2014 6:06	60.7	8/8/2014 23:11	68.2
3/8/2014 1:51	62.6	4/8/2014 2:56	61.5	5/8/2014 4:01	61.4	6/8/2014 5:06	48.6	7/8/2014 6:11	62.4	8/8/2014 23:16	65.7
3/8/2014 1:56	63.8	4/8/2014 3:01	60.7	5/8/2014 4:06	61.5	6/8/2014 5:11	46.3	7/8/2014 6:16	65.7	8/8/2014 23:21	66.4
3/8/2014 2:01	63.5	4/8/2014 3:06	60.8	5/8/2014 4:11	61.6	6/8/2014 5:16	60.6	7/8/2014 6:21	60.6	8/8/2014 23:26	65.6
3/8/2014 2:06	62.1	4/8/2014 3:11	60.8	5/8/2014 4:16	60.8	6/8/2014 5:21	63.0	7/8/2014 6:26	66.0	8/8/2014 23:31	65.3
3/8/2014 2:11	63.0	4/8/2014 3:16	60.8	5/8/2014 4:21	61.3	6/8/2014 5:26	54.7	7/8/2014 6:31	68.8	8/8/2014 23:36	66.1
3/8/2014 2:16	63.1	4/8/2014 3:21	60.3	5/8/2014 4:26	61.4	6/8/2014 5:31	56.2	7/8/2014 6:36	69.0	8/8/2014 23:41	66.4
3/8/2014 2:21	63.1	4/8/2014 3:26	61.1	5/8/2014 4:31	62.2	6/8/2014 5:36	57.6	7/8/2014 6:41	69.4	8/8/2014 23:46	65.7
3/8/2014 2:26	64.1	4/8/2014 3:31	60.8	5/8/2014 4:36	60.6	6/8/2014 5:41	59.4	7/8/2014 6:46	68.7	8/8/2014 23:51	66.4
3/8/2014 2:31	62.0	4/8/2014 3:36	61.3	5/8/2014 4:41	60.9	6/8/2014 5:46	60.2	7/8/2014 6:51	68.7	8/8/2014 23:56	65.9
3/8/2014 2:36	62.7	4/8/2014 3:41	60.4	5/8/2014 4:46	61.6	6/8/2014 5:51	61.8	7/8/2014 6:56	67.9	9/8/2014 0:01	66.0
3/8/2014 2:41	61.8	4/8/2014 3:46	59.8	5/8/2014 4:51	61.9	6/8/2014 5:56	62.0	7/8/2014 23:01	65.1	9/8/2014 0:06	65.3
3/8/2014 2:46	62.7	4/8/2014 3:51	60.4	5/8/2014 4:56	61.7	6/8/2014 6:01	61.8	7/8/2014 23:06	69.5	9/8/2014 0:11	65.6
3/8/2014 2:51	60.0	4/8/2014 3:56	60.8	5/8/2014 5:01	59.9	6/8/2014 6:06	61.9	7/8/2014 23:11	70.1	9/8/2014 0:16	64.8
3/8/2014 2:56	62.5	4/8/2014 4:01	60.3	5/8/2014 5:06	61.8	6/8/2014 6:11	63.6	7/8/2014 23:16	69.1	9/8/2014 0:21	66.3
3/8/2014 3:01	61.3	4/8/2014 4:06	60.7	5/8/2014 5:11	61.7	6/8/2014 6:16	65.5	7/8/2014 23:21	67.6	9/8/2014 0:26	63.8
3/8/2014 3:06	61.8	4/8/2014 4:11	60.1	5/8/2014 5:16	51.5	6/8/2014 6:21	64.2	7/8/2014 23:26	67.1	9/8/2014 0:31	63.5
3/8/2014 3:11	64.8	4/8/2014 4:16	61.1	5/8/2014 5:21	61.7	6/8/2014 6:26	65.0	7/8/2014 23:31	66.8	9/8/201	

Real-time Noise Data		RTN3 (Po Leung Kuk Yu Lee Mo Fan Memorial School)							
9/8/2014 3:41	56.6	10/8/2014 4:46	63.0	11/8/2014 5:51	55.4	12/8/2014 6:56	66.0	14/8/2014 0:01	66.7
9/8/2014 3:46	53.1	10/8/2014 4:51	62.5	11/8/2014 5:56	57.3	12/8/2014 23:01	67.1	14/8/2014 0:06	66.4
9/8/2014 3:51	59.9	10/8/2014 4:56	62.8	11/8/2014 6:01	58.3	12/8/2014 23:06	66.9	14/8/2014 0:11	66.6
9/8/2014 3:56	50.6	10/8/2014 5:01	62.7	11/8/2014 6:06	59.6	12/8/2014 23:11	67.0	14/8/2014 0:16	66.7
9/8/2014 4:01	63.0	10/8/2014 5:06	56.4	11/8/2014 6:11	58.0	12/8/2014 23:16	67.0	14/8/2014 0:21	65.2
9/8/2014 4:06	55.0	10/8/2014 5:11	63.1	11/8/2014 6:16	62.7	12/8/2014 23:21	67.1	14/8/2014 0:26	64.9
9/8/2014 4:11	50.5	10/8/2014 5:16	62.9	11/8/2014 6:21	63.5	12/8/2014 23:26	66.6	14/8/2014 0:31	66.1
9/8/2014 4:16	52.1	10/8/2014 5:21	52.3	11/8/2014 6:26	62.0	12/8/2014 23:31	66.5	14/8/2014 0:36	66.1
9/8/2014 4:21	56.0	10/8/2014 5:26	55.6	11/8/2014 6:31	63.3	12/8/2014 23:36	67.2	14/8/2014 0:41	65.9
9/8/2014 4:26	63.1	10/8/2014 5:31	56.8	11/8/2014 6:36	65.0	12/8/2014 23:41	66.2	14/8/2014 0:46	64.7
9/8/2014 4:31	53.3	10/8/2014 5:36	52.1	11/8/2014 6:41	64.8	12/8/2014 23:46	66.3	14/8/2014 0:51	63.9
9/8/2014 4:36	64.5	10/8/2014 5:41	56.5	11/8/2014 6:46	64.7	12/8/2014 23:51	66.4	14/8/2014 0:56	65.0
9/8/2014 4:41	52.3	10/8/2014 5:46	53.1	11/8/2014 6:51	65.4	12/8/2014 23:56	66.5	14/8/2014 1:01	64.2
9/8/2014 4:46	55.7	10/8/2014 5:51	58.5	11/8/2014 6:56	65.9	13/8/2014 0:01	66.2	14/8/2014 1:06	61.9
9/8/2014 4:51	62.5	10/8/2014 5:56	55.0	11/8/2014 23:01	64.8	13/8/2014 0:06	66.7	14/8/2014 1:11	63.9
9/8/2014 4:56	60.7	10/8/2014 6:01	56.6	11/8/2014 23:06	64.5	13/8/2014 0:11	65.7	14/8/2014 1:16	63.1
9/8/2014 5:01	63.0	10/8/2014 6:06	61.2	11/8/2014 23:11	63.8	13/8/2014 0:16	65.1	14/8/2014 1:21	63.1
9/8/2014 5:06	56.3	10/8/2014 6:11	59.1	11/8/2014 23:16	65.2	13/8/2014 0:21	65.2	14/8/2014 1:26	63.5
9/8/2014 5:11	63.0	10/8/2014 6:16	60.7	11/8/2014 23:21	64.9	13/8/2014 0:26	64.2	14/8/2014 1:31	63.2
9/8/2014 5:16	53.4	10/8/2014 6:21	60.0	11/8/2014 23:26	64.8	13/8/2014 0:31	64.0	14/8/2014 1:36	62.9
9/8/2014 5:21	57.9	10/8/2014 6:26	62.2	11/8/2014 23:31	64.3	13/8/2014 0:36	64.6	14/8/2014 1:41	62.9
9/8/2014 5:26	52.8	10/8/2014 6:31	61.5	11/8/2014 23:36	64.6	13/8/2014 0:41	63.4	14/8/2014 1:46	61.1
9/8/2014 5:31	57.9	10/8/2014 6:36	61.9	11/8/2014 23:41	63.1	13/8/2014 0:46	63.6	14/8/2014 1:51	60.6
9/8/2014 5:36	59.0	10/8/2014 6:41	62.4	11/8/2014 23:46	62.7	13/8/2014 0:51	63.4	14/8/2014 1:56	60.5
9/8/2014 5:41	57.8	10/8/2014 6:46	62.5	11/8/2014 23:51	63.4	13/8/2014 0:56	63.9	14/8/2014 2:01	61.4
9/8/2014 5:46	58.3	10/8/2014 6:51	64.9	11/8/2014 23:56	64.6	13/8/2014 1:01	61.3	14/8/2014 2:06	62.3
9/8/2014 5:51	62.0	10/8/2014 6:56	63.2	12/8/2014 0:01	63.3	13/8/2014 1:06	61.2	14/8/2014 2:11	60.1
9/8/2014 5:56	60.4	10/8/2014 23:01	64.5	12/8/2014 0:06	64.0	13/8/2014 1:11	62.9	14/8/2014 2:16	60.5
9/8/2014 6:01	62.0	10/8/2014 23:06	64.8	12/8/2014 0:11	62.0	13/8/2014 1:16	61.4	14/8/2014 2:21	59.8
9/8/2014 6:06	63.8	10/8/2014 23:11	64.0	12/8/2014 0:16	63.7	13/8/2014 1:21	61.9	14/8/2014 2:26	59.2
9/8/2014 6:11	61.1	10/8/2014 23:16	62.2	12/8/2014 0:21	62.3	13/8/2014 1:26	61.8	14/8/2014 2:31	58.8
9/8/2014 6:16	62.2	10/8/2014 23:21	66.2	12/8/2014 0:26	61.2	13/8/2014 1:31	60.9	14/8/2014 2:36	57.7
9/8/2014 6:21	61.4	10/8/2014 23:26	64.1	12/8/2014 0:31	62.9	13/8/2014 1:36	60.3	14/8/2014 2:41	58.8
9/8/2014 6:26	62.7	10/8/2014 23:31	62.3	12/8/2014 0:36	61.5	13/8/2014 1:41	57.9	14/8/2014 2:46	59.6
9/8/2014 6:31	62.7	10/8/2014 23:36	62.1	12/8/2014 0:41	60.9	13/8/2014 1:46	58.8	14/8/2014 2:51	60.6
9/8/2014 6:36	62.1	10/8/2014 23:41	63.5	12/8/2014 0:46	60.6	13/8/2014 1:51	61.5	14/8/2014 2:56	59.0
9/8/2014 6:41	63.4	10/8/2014 23:46	63.3	12/8/2014 0:51	57.1	13/8/2014 1:56	57.7	14/8/2014 3:01	53.4
9/8/2014 6:46	63.2	10/8/2014 23:51	62.9	12/8/2014 0:56	60.3	13/8/2014 2:01	59.6	14/8/2014 3:06	63.0
9/8/2014 6:51	63.8	10/8/2014 23:56	62.5	12/8/2014 1:01	58.3	13/8/2014 2:06	62.0	14/8/2014 3:11	51.5
9/8/2014 6:56	64.4	11/8/2014 0:01	61.9	12/8/2014 1:06	59.5	13/8/2014 2:11	58.0	14/8/2014 3:16	52.7
9/8/2014 23:01	64.7	11/8/2014 0:06	63.5	12/8/2014 1:11	56.4	13/8/2014 2:16	58.8	14/8/2014 3:21	63.1
9/8/2014 23:06	65.9	11/8/2014 0:11	62.1	12/8/2014 1:16	60.6	13/8/2014 2:21	56.7	14/8/2014 3:26	62.8
9/8/2014 23:11	64.6	11/8/2014 0:16	61.6	12/8/2014 1:21	59.3	13/8/2014 2:26	55.0	14/8/2014 3:31	56.4
9/8/2014 23:16	65.1	11/8/2014 0:21	62.2	12/8/2014 1:26	58.9	13/8/2014 2:31	56.2	14/8/2014 3:36	52.6
9/8/2014 23:21	64.9	11/8/2014 0:26	61.9	12/8/2014 1:31	56.2	13/8/2014 2:36	62.7	14/8/2014 3:41	62.7
9/8/2014 23:26	64.3	11/8/2014 0:31	62.3	12/8/2014 1:36	57.2	13/8/2014 2:41	49.6	14/8/2014 3:46	62.1
9/8/2014 23:31	65.5	11/8/2014 0:36	61.1	12/8/2014 1:41	55.3	13/8/2014 2:46	57.3	14/8/2014 3:51	55.6
9/8/2014 23:36	65.2	11/8/2014 0:41	63.7	12/8/2014 1:46	51.9	13/8/2014 2:51	62.6	14/8/2014 3:56	56.0
9/8/2014 23:41	64.0	11/8/2014 0:46	60.9	12/8/2014 1:51	53.5	13/8/2014 2:56	50.5	14/8/2014 4:01	49.1
9/8/2014 23:46	63.8	11/8/2014 0:51	59.7	12/8/2014 1:56	58.9	13/8/2014 3:01	45.2	14/8/2014 4:06	54.3
9/8/2014 23:51	64.6	11/8/2014 0:56	59.0	12/8/2014 2:01	48.8	13/8/2014 3:06	62.8	14/8/2014 4:11	52.5
9/8/2014 23:56	64.8	11/8/2014 1:01	54.4	12/8/2014 2:06	48.8	13/8/2014 3:11	61.8	14/8/2014 4:16	62.0
10/8/2014 0:01	64.3	11/8/2014 1:06	57.6	12/8/2014 2:11	62.9	13/8/2014 3:16	62.4	14/8/2014 4:21	63.0
10/8/2014 0:06	63.6	11/8/2014 1:11	55.7	12/8/2014 2:16	62.4	13/8/2014 3:21	62.3	14/8/2014 4:26	62.0
10/8/2014 0:11	64.5	11/8/2014 1:16	64.6	12/8/2014 2:21	62.3	13/8/2014 3:26	62.9	14/8/2014 4:31	50.6
10/8/2014 0:16	62.7	11/8/2014 1:21	52.6	12/8/2014 2:26	62.5	13/8/2014 3:31	61.2	14/8/2014 4:36	62.4
10/8/2014 0:21	65.7	11/8/2014 1:26	50.8	12/8/2014 2:31	62.6	13/8/2014 3:36	61.5	14/8/2014 4:41	55.7
10/8/2014 0:26	64.9	11/8/2014 1:31	50.5	12/8/2014 2:36	62.2	13/8/2014 3:41	49.4	14/8/2014 4:46	62.2
10/8/2014 0:31	62.9	11/8/2014 1:36	48.6	12/8/2014 2:41	62.4	13/8/2014 3:46	62.1	14/8/2014 4:51	62.9
10/8/2014 0:36	63.1	11/8/2014 1:41	47.6	12/8/2014 2:46	62.4	13/8/2014 3:51	62.9	14/8/2014 4:56	62.8
10/8/2014 0:41	62.8	11/8/2014 1:46	63.1	12/8/2014 2:51	62.0	13/8/2014 3:56	62.6	14/8/2014 5:01	54.6
10/8/2014 0:46	63.1	11/8/2014 1:51	63.0	12/8/2014 2:56	62.0	13/8/2014 4:01	61.9	14/8/2014 5:06	49.6
10/8/2014 0:51	61.6	11/8/2014 1:56	61.6	12/8/2014 3:01	61.6	13/8/2014 4:06	62.8	14/8/2014 5:11	55.5
10/8/2014 0:56	60.6	11/8/2014 2:01	62.8	12/8/2014 3:06	60.6	13/8/2014 4:11	62.3	14/8/2014 5:16	55.3
10/8/2014 1:01	59.7	11/8/2014 2:06	62.1	12/8/2014 3:11	61.8	13/8/2014 4:16	62.8	14/8/2014 5:21	55.0
10/8/2014 1:06	60.6	11/8/2014 2:11	62.1	12/8/2014 3:16	61.7	13/8/2014 4:21	62.7	14/8/2014 5:26	59.9
10/8/2014 1:11	59.1	11/8/2014 2:16	62.0	12/8/2014 3:21	62.1	13/8/2014 4:26	61.8	14/8/2014 5:31	53.7
10/8/2014 1:16	60.1	11/8/2014 2:21	61.3	12/8/2014 3:26	62.1	13/8/2014 4:31	62.2	14/8/2014 5:36	55.5
10/8/2014 1:21	61.4	11/8/2014 2:26	62.1	12/8/2014 3:31	61.5	13/8/2014 4:36	61.4	14/8/2014 5:41	58.3
10/8/2014 1:26	59.1	11/8/2014 2:31	62.4	12/8/2014 3:36	61.4	13/8/2014 4:41	61.5	14/8/2014 5:46	61.1
10/8/2014 1:31	60.7	11/8/2014 2:36	61.5	12/8/2014 3:41	61.1	13/8/2014 4:46	65.3	14/8/2014 5:51	59.5
10/8/2014 1:36	59.5	11/8/2014 2:41	61.7	12/8/2014 3:46	60.7	13/8/2014 4:51	68.2	14/8/2014 5:56	64.1
10/8/2014 1:41	60.0	11/8/2014 2:46	61.5	12/8/2014 3:51	60.4	13/8/2014 4:56	64.8	14/8/2014 6:01	62.8
10/8/2014 1:46	57.2	11/8/2014 2:51	53.5	12/8/2014 3:56	60.7	13/8/2014 5:01	66.9	14/8/2014 6:06	62.7
10/8/2014 1:51	60.4	11/8/2014 2:56	61.1	12/8/2014 4:01	60.5	13/8/2014 5:06	66.6	14/8/2014 6:11	63.5
10/8/2014 1:56	54.6	11/8/2014 3:01	61.1	12/8/2014 4:06	61.9	13/8/2014 5:11	59.8	14/8/2014 6:16	64.1
10/8/2014 2:01	56.6	11/8/2014 3:06	61.1	12/8/2014 4:11	61.0	13/8/2014 5:16	64.7	14/8/2014 6:21	63.6
10/8/2014 2:06	59.6	11/8/2014 3:11	60.6	12/8/2014 4:16	61.7	13/8/2014 5:21	66.9	14/8/2014 6:26	66.0
10/8/2014 2:11	57.3	11/8/2014 3:16	59.6	12/8/2014 4:21	61.3	13/8/2014 5:26	62.2	14/8/2014 6:31	68.9
10/8/2014 2:16	62.1	11/8/2014 3:21	61.1	12/8/2014 4:26	61.1	13/8/2014 5:31	63.1	14/8/2014 6:36	67.2
10/8/2014 2:21	48.6	11/8/2014 3:26	61.2	12/8/2014 4:31	61.0	13/8/2014 5:36	66.9	14/8/2014 6:41	66.9
10/8/2014 2:26	58.6	11/8/2014 3:31	61.3	12/8/2014 4:36	62.1	13/8/2014 5:41	64.3	14/8/2014 6:46	67.4
10/8/2014 2:31	57.5	11/8/2014 3:36	61.4	12/8/2014 4:41	61.6	13/8/2014 5:46	68.3	14/8/2014 6:51	67.5
10/8/2014 2:36	55.9	11/8/2014 3:41	61.0	12/8/2014 4:46	61.9	13/8/2014 5:51	67.9	14/8/2014 6:56	67.2
10/8/2014 2:41	58.8	11/8/2014 3:							

Real-time Noise Data		RTN3 (Po Leung Kuk Yu Lee Mo Fan Memorial School)									
16/8/2014 2:11	61.2	17/8/2014 3:16	59.9	18/8/2014 4:21	60.8	19/8/2014 5:26	62.7	20/8/2014 6:31	67.0	21/8/2014 23:36	65.5
16/8/2014 2:16	61.5	17/8/2014 3:21	55.4	18/8/2014 4:26	59.2	19/8/2014 5:31	55.3	20/8/2014 6:36	67.9	21/8/2014 23:41	65.2
16/8/2014 2:21	60.7	17/8/2014 3:26	56.8	18/8/2014 4:31	62.0	19/8/2014 5:36	61.1	20/8/2014 6:41	67.5	21/8/2014 23:46	66.6
16/8/2014 2:26	62.0	17/8/2014 3:31	53.2	18/8/2014 4:36	61.2	19/8/2014 5:41	41.5	20/8/2014 6:46	68.3	21/8/2014 23:51	65.5
16/8/2014 2:31	59.1	17/8/2014 3:36	59.7	18/8/2014 4:41	60.7	19/8/2014 5:46	54.2	20/8/2014 6:51	68.6	21/8/2014 23:56	65.1
16/8/2014 2:36	61.3	17/8/2014 3:41	54.7	18/8/2014 4:46	61.1	19/8/2014 5:51	65.1	20/8/2014 6:56	68.1	22/8/2014 0:01	65.1
16/8/2014 2:41	59.6	17/8/2014 3:46	54.7	18/8/2014 4:51	60.8	19/8/2014 5:56	63.8	20/8/2014 7:01	67.0	22/8/2014 0:06	64.5
16/8/2014 2:46	60.6	17/8/2014 3:51	55.3	18/8/2014 4:56	60.9	19/8/2014 6:01	62.3	20/8/2014 7:06	67.0	22/8/2014 0:11	64.1
16/8/2014 2:51	57.7	17/8/2014 3:56	56.1	18/8/2014 5:01	60.9	19/8/2014 6:06	62.6	20/8/2014 7:11	67.5	22/8/2014 0:16	63.9
16/8/2014 2:56	60.6	17/8/2014 4:01	63.0	18/8/2014 5:06	60.6	19/8/2014 6:11	63.2	20/8/2014 7:16	67.7	22/8/2014 0:21	64.2
16/8/2014 3:01	57.5	17/8/2014 4:06	63.1	18/8/2014 5:11	62.0	19/8/2014 6:16	66.1	20/8/2014 7:21	67.7	22/8/2014 0:26	64.1
16/8/2014 3:06	60.1	17/8/2014 4:11	62.5	18/8/2014 5:16	62.1	19/8/2014 6:21	65.0	20/8/2014 7:26	68.0	22/8/2014 0:31	63.7
16/8/2014 3:11	57.3	17/8/2014 4:16	51.9	18/8/2014 5:21	62.6	19/8/2014 6:26	66.6	20/8/2014 7:31	67.7	22/8/2014 0:36	64.4
16/8/2014 3:16	50.6	17/8/2014 4:21	62.6	18/8/2014 5:26	62.9	19/8/2014 6:31	66.7	20/8/2014 7:36	67.2	22/8/2014 0:41	62.5
16/8/2014 3:21	57.5	17/8/2014 4:26	45.2	18/8/2014 5:31	62.2	19/8/2014 6:36	66.7	20/8/2014 7:41	68.1	22/8/2014 0:46	62.6
16/8/2014 3:26	55.9	17/8/2014 4:31	48.3	18/8/2014 5:36	62.7	19/8/2014 6:41	67.5	20/8/2014 7:46	67.4	22/8/2014 0:51	62.1
16/8/2014 3:31	58.3	17/8/2014 4:36	62.9	18/8/2014 5:41	62.5	19/8/2014 6:46	67.2	20/8/2014 7:51	67.5	22/8/2014 0:56	62.2
16/8/2014 3:36	58.6	17/8/2014 4:41	55.0	18/8/2014 5:46	52.3	19/8/2014 6:51	67.8	20/8/2014 7:56	66.9	22/8/2014 1:01	61.9
16/8/2014 3:41	58.2	17/8/2014 4:46	52.3	18/8/2014 5:51	57.1	19/8/2014 6:56	67.6	21/8/2014 0:01	67.4	22/8/2014 1:06	60.5
16/8/2014 3:46	59.7	17/8/2014 4:51	47.2	18/8/2014 5:56	57.7	19/8/2014 7:01	67.2	21/8/2014 0:06	67.7	22/8/2014 1:11	62.0
16/8/2014 3:51	54.8	17/8/2014 4:56	62.9	18/8/2014 6:01	60.6	19/8/2014 7:06	67.8	21/8/2014 0:11	66.6	22/8/2014 1:16	60.7
16/8/2014 3:56	57.9	17/8/2014 5:01	55.5	18/8/2014 6:06	62.2	19/8/2014 7:11	67.7	21/8/2014 0:16	66.9	22/8/2014 1:21	60.1
16/8/2014 4:01	55.5	17/8/2014 5:06	50.5	18/8/2014 6:11	60.6	19/8/2014 7:16	67.2	21/8/2014 0:21	66.0	22/8/2014 1:26	61.6
16/8/2014 4:06	58.9	17/8/2014 5:11	53.3	18/8/2014 6:16	61.7	19/8/2014 7:21	67.4	21/8/2014 0:26	66.6	22/8/2014 1:31	60.2
16/8/2014 4:11	56.7	17/8/2014 5:16	58.3	18/8/2014 6:21	62.0	19/8/2014 7:26	67.4	21/8/2014 0:31	66.1	22/8/2014 1:36	60.7
16/8/2014 4:16	56.7	17/8/2014 5:21	51.0	18/8/2014 6:26	62.4	19/8/2014 7:31	68.2	21/8/2014 0:36	65.2	22/8/2014 1:41	57.7
16/8/2014 4:21	46.8	17/8/2014 5:26	55.0	18/8/2014 6:31	63.0	19/8/2014 7:36	66.7	21/8/2014 0:41	65.9	22/8/2014 1:46	58.9
16/8/2014 4:26	63.1	17/8/2014 5:31	49.1	18/8/2014 6:36	63.3	19/8/2014 7:41	68.2	21/8/2014 0:46	65.3	22/8/2014 1:51	57.6
16/8/2014 4:31	47.9	17/8/2014 5:36	50.8	18/8/2014 6:41	63.7	19/8/2014 7:46	66.5	21/8/2014 0:51	64.9	22/8/2014 1:56	51.6
16/8/2014 4:36	62.7	17/8/2014 5:41	58.0	18/8/2014 6:46	63.8	19/8/2014 7:51	67.0	21/8/2014 0:56	64.7	22/8/2014 2:01	57.8
16/8/2014 4:41	52.1	17/8/2014 5:46	54.2	18/8/2014 6:51	65.0	19/8/2014 7:56	66.9	21/8/2014 1:01	64.4	22/8/2014 2:06	57.6
16/8/2014 4:46	56.1	17/8/2014 5:51	56.4	18/8/2014 6:56	65.5	20/8/2014 0:01	66.2	21/8/2014 1:06	64.3	22/8/2014 2:11	53.2
16/8/2014 4:51	63.0	17/8/2014 5:56	55.8	18/8/2014 7:01	64.4	20/8/2014 0:06	65.6	21/8/2014 1:11	65.0	22/8/2014 2:16	53.7
16/8/2014 4:56	63.1	17/8/2014 6:01	60.1	18/8/2014 7:06	64.1	20/8/2014 0:11	65.8	21/8/2014 1:16	64.5	22/8/2014 2:21	52.1
16/8/2014 5:01	62.9	17/8/2014 6:06	62.1	18/8/2014 7:11	64.3	20/8/2014 0:16	66.6	21/8/2014 1:21	64.6	22/8/2014 2:26	50.5
16/8/2014 5:06	52.1	17/8/2014 6:11	61.2	18/8/2014 7:16	64.3	20/8/2014 0:21	65.9	21/8/2014 1:26	63.4	22/8/2014 2:31	52.2
16/8/2014 5:11	41.5	17/8/2014 6:16	61.1	18/8/2014 7:21	64.1	20/8/2014 0:26	66.1	21/8/2014 1:31	63.6	22/8/2014 2:36	62.4
16/8/2014 5:16	57.0	17/8/2014 6:21	61.3	18/8/2014 7:26	64.8	20/8/2014 0:31	65.7	21/8/2014 1:36	63.6	22/8/2014 2:41	48.3
16/8/2014 5:21	63.0	17/8/2014 6:26	61.4	18/8/2014 7:31	64.6	20/8/2014 0:36	65.2	21/8/2014 1:41	63.7	22/8/2014 2:46	62.8
16/8/2014 5:26	54.3	17/8/2014 6:31	60.8	18/8/2014 7:36	65.1	20/8/2014 0:41	65.6	21/8/2014 1:46	60.7	22/8/2014 2:51	53.7
16/8/2014 5:31	48.8	17/8/2014 6:36	61.1	18/8/2014 7:41	63.5	20/8/2014 0:46	65.3	21/8/2014 1:51	60.6	22/8/2014 2:56	62.8
16/8/2014 5:36	57.2	17/8/2014 6:41	61.2	18/8/2014 7:46	64.2	20/8/2014 0:51	64.7	21/8/2014 1:56	62.7	22/8/2014 3:01	49.6
16/8/2014 5:41	58.2	17/8/2014 6:46	62.0	18/8/2014 7:51	63.2	20/8/2014 0:56	64.5	21/8/2014 2:01	60.3	22/8/2014 3:06	62.7
16/8/2014 5:46	58.3	17/8/2014 6:51	61.2	18/8/2014 7:56	63.8	20/8/2014 1:01	62.2	21/8/2014 2:06	60.2	22/8/2014 3:11	47.9
16/8/2014 5:51	58.2	17/8/2014 6:56	61.4	19/8/2014 0:01	61.4	20/8/2014 1:06	62.9	21/8/2014 2:11	60.7	22/8/2014 3:16	62.6
16/8/2014 5:56	60.3	17/8/2014 7:01	64.6	19/8/2014 0:06	64.1	20/8/2014 1:11	62.5	21/8/2014 2:16	58.4	22/8/2014 3:21	62.7
16/8/2014 6:01	55.0	17/8/2014 7:06	63.9	19/8/2014 0:11	62.8	20/8/2014 1:16	63.7	21/8/2014 2:21	60.1	22/8/2014 3:26	50.5
16/8/2014 6:06	61.9	17/8/2014 7:11	65.1	19/8/2014 0:16	63.1	20/8/2014 1:21	62.5	21/8/2014 2:26	61.2	22/8/2014 3:31	62.3
16/8/2014 6:11	60.2	17/8/2014 7:16	64.2	19/8/2014 0:21	63.8	20/8/2014 1:26	62.3	21/8/2014 2:31	59.6	22/8/2014 3:36	62.8
16/8/2014 6:16	60.1	17/8/2014 7:21	64.4	19/8/2014 0:26	62.1	20/8/2014 1:31	63.2	21/8/2014 2:36	58.7	22/8/2014 3:41	62.1
16/8/2014 6:21	60.9	17/8/2014 7:26	63.9	19/8/2014 0:31	62.5	20/8/2014 1:36	62.4	21/8/2014 2:41	59.0	22/8/2014 3:46	62.1
16/8/2014 6:26	61.7	17/8/2014 7:31	64.0	19/8/2014 0:36	61.4	20/8/2014 1:41	62.1	21/8/2014 2:46	59.8	22/8/2014 3:51	62.3
16/8/2014 6:31	60.3	17/8/2014 7:36	62.3	19/8/2014 0:41	60.8	20/8/2014 1:46	60.5	21/8/2014 2:51	49.1	22/8/2014 3:56	62.7
16/8/2014 6:36	62.4	17/8/2014 7:41	63.2	19/8/2014 0:46	59.3	20/8/2014 1:51	63.2	21/8/2014 2:56	54.5	22/8/2014 4:01	61.1
16/8/2014 6:41	62.7	17/8/2014 7:46	65.0	19/8/2014 0:51	60.3	20/8/2014 1:56	60.4	21/8/2014 3:01	48.8	22/8/2014 4:06	62.0
16/8/2014 6:46	62.9	17/8/2014 7:51	62.9	19/8/2014 0:56	58.7	20/8/2014 2:01	59.5	21/8/2014 3:06	54.1	22/8/2014 4:11	62.9
16/8/2014 6:51	62.8	17/8/2014 7:56	63.1	19/8/2014 1:01	58.9	20/8/2014 2:06	60.0	21/8/2014 3:11	58.6	22/8/2014 4:16	61.9
16/8/2014 6:56	63.6	18/8/2014 0:01	61.6	19/8/2014 1:06	62.3	20/8/2014 2:11	65.7	21/8/2014 3:16	55.9	22/8/2014 4:21	61.7
16/8/2014 7:01	65.8	18/8/2014 0:06	62.2	19/8/2014 1:11	58.3	20/8/2014 2:16	66.3	21/8/2014 3:21	53.4	22/8/2014 4:26	61.4
16/8/2014 7:06	65.7	18/8/2014 0:11	59.8	19/8/2014 1:16	56.5	20/8/2014 2:21	64.0	21/8/2014 3:26	55.3	22/8/2014 4:31	62.5
16/8/2014 7:11	65.7	18/8/2014 0:16	58.4	19/8/2014 1:21	58.8	20/8/2014 2:26	60.3	21/8/2014 3:31	55.8	22/8/2014 4:36	61.9
16/8/2014 7:16	64.7	18/8/2014 0:21	61.2	19/8/2014 1:26	56.4	20/8/2014 2:31	56.4	21/8/2014 3:36	59.0	22/8/2014 4:41	62.7
16/8/2014 7:21	65.8	18/8/2014 0:26	60.7	19/8/2014 1:31	55.0	20/8/2014 2:36	56.2	21/8/2014 3:41	46.3	22/8/2014 4:46	61.0
16/8/2014 7:26	65.0	18/8/2014 0:31	60.8	19/8/2014 1:36	55.7	20/8/2014 2:41	56.9	21/8/2014 3:46	47.6	22/8/2014 4:51	51.3
16/8/2014 7:31	64.9	18/8/2014 0:36	61.3	19/8/2014 1:41	55.4	20/8/2014 2:46	39.7	21/8/2014 3:51	41.5	22/8/2014 4:56	62.2
16/8/2014 7:36	65.8	18/8/2014 0:41	60.1	19/8/2014 1:46	47.9	20/8/2014 2:51	51.6	21/8/2014 3:56	51.0	22/8/2014 5:01	61.4
16/8/2014 7:41	65.2	18/8/2014 0:46	59.3	19/8/2014 1:51	54.0	20/8/2014 2:56	51.3	21/8/2014 4:01	62.9	22/8/2014 5:06	62.8
16/8/2014 7:46	64.7	18/8/2014 0:51	57.9	19/8/2014 1:56	47.9	20/8/2014 3:01	62.7	21/8/2014 4:06	63.1	22/8/2014 5:11	62.0
16/8/2014 7:51	65.2	18/8/2014 0:56	59.7	19/8/2014 2:01	62.5	20/8/2014 3:06	55.0	21/8/2014 4:11	54.5	22/8/2014 5:16	62.9
16/8/2014 7:56	65.1	18/8/2014 1:01	58.6	19/8/2014 2:06	62.7	20/8/2014 3:11	54.7	21/8/2014 4:16	42.8	22/8/2014 5:21	62.7
17/8/2014 0:01	65.0	18/8/2014 1:06	50.6	19/8/2014 2:11	61.8	20/8/2014 3:16					

Real-time Noise Data		RTN3 (Po Leung Kuk Yu Lee Mo Fan Memorial School)									
23/8/2014 0:41	65.0	24/8/2014 1:46	61.7	25/8/2014 2:51	60.5	26/8/2014 3:56	60.9	27/8/2014 5:01	62.3		
23/8/2014 0:46	65.4	24/8/2014 1:51	61.1	25/8/2014 2:56	60.7	26/8/2014 4:01	61.0	27/8/2014 5:06	62.0		
23/8/2014 0:51	63.5	24/8/2014 1:56	65.3	25/8/2014 3:01	62.3	26/8/2014 4:06	60.4	27/8/2014 5:11	62.1		
23/8/2014 0:56	64.0	24/8/2014 2:01	57.4	25/8/2014 3:06	61.7	26/8/2014 4:11	61.2	27/8/2014 5:16	62.0		
23/8/2014 1:01	64.3	24/8/2014 2:06	58.8	25/8/2014 3:11	60.4	26/8/2014 4:16	61.3	27/8/2014 5:21	61.8		
23/8/2014 1:06	64.3	24/8/2014 2:11	58.8	25/8/2014 3:16	61.0	26/8/2014 4:21	60.7	27/8/2014 5:26	51.2		
23/8/2014 1:11	63.7	24/8/2014 2:16	60.9	25/8/2014 3:21	61.7	26/8/2014 4:26	62.0	27/8/2014 5:31	54.9		
23/8/2014 1:16	63.2	24/8/2014 2:21	58.8	25/8/2014 3:26	60.3	26/8/2014 4:31	60.9	27/8/2014 5:36	63.0		
23/8/2014 1:21	63.8	24/8/2014 2:26	60.7	25/8/2014 3:31	61.1	26/8/2014 4:36	62.2	27/8/2014 5:41	62.8		
23/8/2014 1:26	64.5	24/8/2014 2:31	60.2	25/8/2014 3:36	61.5	26/8/2014 4:41	60.3	27/8/2014 5:46	63.0		
23/8/2014 1:31	63.4	24/8/2014 2:36	60.0	25/8/2014 3:41	59.8	26/8/2014 4:46	61.0	27/8/2014 5:51	58.8		
23/8/2014 1:36	64.5	24/8/2014 2:41	63.8	25/8/2014 3:46	60.1	26/8/2014 4:51	61.8	27/8/2014 5:56	51.6		
23/8/2014 1:41	64.3	24/8/2014 2:46	58.1	25/8/2014 3:51	61.2	26/8/2014 4:56	61.7	27/8/2014 6:01	59.2		
23/8/2014 1:46	62.0	24/8/2014 2:51	59.0	25/8/2014 3:56	60.7	26/8/2014 5:01	62.0	27/8/2014 6:06	59.7		
23/8/2014 1:51	62.5	24/8/2014 2:56	57.7	25/8/2014 4:01	61.7	26/8/2014 5:06	62.5	27/8/2014 6:11	59.8		
23/8/2014 1:56	61.1	24/8/2014 3:01	60.2	25/8/2014 4:06	62.0	26/8/2014 5:11	60.9	27/8/2014 6:16	61.7		
23/8/2014 2:01	61.6	24/8/2014 3:06	58.0	25/8/2014 4:11	60.9	26/8/2014 5:16	62.7	27/8/2014 6:21	61.5		
23/8/2014 2:06	63.1	24/8/2014 3:11	58.7	25/8/2014 4:16	61.3	26/8/2014 5:21	56.0	27/8/2014 6:26	61.8		
23/8/2014 2:11	61.3	24/8/2014 3:16	51.8	25/8/2014 4:21	60.9	26/8/2014 5:26	63.0	27/8/2014 6:31	63.8		
23/8/2014 2:16	61.1	24/8/2014 3:21	65.2	25/8/2014 4:26	60.5	26/8/2014 5:31	62.1	27/8/2014 6:36	63.0		
23/8/2014 2:21	61.5	24/8/2014 3:26	57.5	25/8/2014 4:31	61.2	26/8/2014 5:36	62.7	27/8/2014 6:41	64.3		
23/8/2014 2:26	59.8	24/8/2014 3:31	58.3	25/8/2014 4:36	61.3	26/8/2014 5:41	62.7	27/8/2014 6:46	64.2		
23/8/2014 2:31	62.1	24/8/2014 3:36	57.0	25/8/2014 4:41	60.4	26/8/2014 5:46	50.5	27/8/2014 6:51	65.4		
23/8/2014 2:36	62.2	24/8/2014 3:41	62.8	25/8/2014 4:46	60.8	26/8/2014 5:51	57.8	27/8/2014 6:56	66.1		
23/8/2014 2:41	59.6	24/8/2014 3:46	57.0	25/8/2014 4:51	60.7	26/8/2014 5:56	55.5	27/8/2014 23:01	65.8		
23/8/2014 2:46	62.0	24/8/2014 3:51	57.3	25/8/2014 4:56	61.3	26/8/2014 6:01	59.2	27/8/2014 23:06	65.9		
23/8/2014 2:51	60.5	24/8/2014 3:56	54.4	25/8/2014 5:01	60.4	26/8/2014 6:06	57.3	27/8/2014 23:11	65.6		
23/8/2014 2:56	60.5	24/8/2014 4:01	55.0	25/8/2014 5:06	62.7	26/8/2014 6:11	59.4	27/8/2014 23:16	66.1		
23/8/2014 3:01	60.3	24/8/2014 4:06	58.3	25/8/2014 5:11	61.5	26/8/2014 6:16	61.8	27/8/2014 23:21	66.7		
23/8/2014 3:06	60.0	24/8/2014 4:11	57.5	25/8/2014 5:16	61.3	26/8/2014 6:21	62.8	27/8/2014 23:26	65.7		
23/8/2014 3:11	59.7	24/8/2014 4:16	48.8	25/8/2014 5:21	63.0	26/8/2014 6:26	61.9	27/8/2014 23:31	65.9		
23/8/2014 3:16	59.7	24/8/2014 4:21	48.6	25/8/2014 5:26	62.8	26/8/2014 6:31	63.5	27/8/2014 23:36	66.1		
23/8/2014 3:21	61.6	24/8/2014 4:26	62.9	25/8/2014 5:31	62.8	26/8/2014 6:36	63.5	27/8/2014 23:41	65.2		
23/8/2014 3:26	57.1	24/8/2014 4:31	49.1	25/8/2014 5:36	49.8	26/8/2014 6:41	63.1	27/8/2014 23:46	65.9		
23/8/2014 3:31	61.1	24/8/2014 4:36	49.4	25/8/2014 5:41	52.3	26/8/2014 6:46	65.0	27/8/2014 23:51	65.5		
23/8/2014 3:36	60.8	24/8/2014 4:41	63.0	25/8/2014 5:46	53.6	26/8/2014 6:51	66.0	27/8/2014 23:56	65.0		
23/8/2014 3:41	57.2	24/8/2014 4:46	52.1	25/8/2014 5:51	58.5	26/8/2014 6:56	65.4				
23/8/2014 3:46	58.2	24/8/2014 4:51	51.2	25/8/2014 5:56	59.0	26/8/2014 23:01	64.9				
23/8/2014 3:51	59.8	24/8/2014 4:56	62.2	25/8/2014 6:01	58.5	26/8/2014 23:06	65.3				
23/8/2014 3:56	56.3	24/8/2014 5:01	56.9	25/8/2014 6:06	60.9	26/8/2014 23:11	64.9				
23/8/2014 4:01	58.5	24/8/2014 5:06	49.8	25/8/2014 6:11	58.5	26/8/2014 23:16	64.3				
23/8/2014 4:06	55.3	24/8/2014 5:11	53.5	25/8/2014 6:16	60.9	26/8/2014 23:21	65.2				
23/8/2014 4:11	53.2	24/8/2014 5:16	57.2	25/8/2014 6:21	62.3	26/8/2014 23:26	65.0				
23/8/2014 4:16	55.7	24/8/2014 5:21	56.4	25/8/2014 6:26	63.5	26/8/2014 23:31	65.3				
23/8/2014 4:21	58.2	24/8/2014 5:26	51.9	25/8/2014 6:31	63.6	26/8/2014 23:36	64.8				
23/8/2014 4:26	55.5	24/8/2014 5:31	61.7	25/8/2014 6:36	64.3	26/8/2014 23:41	64.4				
23/8/2014 4:31	57.0	24/8/2014 5:36	47.2	25/8/2014 6:41	64.0	26/8/2014 23:46	64.5				
23/8/2014 4:36	56.0	24/8/2014 5:41	62.9	25/8/2014 6:46	64.9	26/8/2014 23:51	64.6				
23/8/2014 4:41	55.3	24/8/2014 5:46	62.8	25/8/2014 6:51	66.2	26/8/2014 23:56	63.9				
23/8/2014 4:46	48.6	24/8/2014 5:51	62.8	25/8/2014 6:56	65.5	27/8/2014 0:01	63.9				
23/8/2014 4:51	62.4	24/8/2014 5:56	63.1	25/8/2014 23:01	65.1	27/8/2014 0:06	63.5				
23/8/2014 4:56	58.4	24/8/2014 6:01	52.3	25/8/2014 23:06	64.7	27/8/2014 0:11	64.1				
23/8/2014 5:01	62.9	24/8/2014 6:06	53.2	25/8/2014 23:11	64.4	27/8/2014 0:16	62.8				
23/8/2014 5:06	58.8	24/8/2014 6:11	51.0	25/8/2014 23:16	64.5	27/8/2014 0:21	63.5				
23/8/2014 5:11	57.7	24/8/2014 6:16	55.9	25/8/2014 23:21	64.2	27/8/2014 0:26	62.5				
23/8/2014 5:16	51.8	24/8/2014 6:21	53.6	25/8/2014 23:26	64.5	27/8/2014 0:31	62.4				
23/8/2014 5:21	56.2	24/8/2014 6:26	57.1	25/8/2014 23:31	64.7	27/8/2014 0:36	61.3				
23/8/2014 5:26	55.5	24/8/2014 6:31	56.0	25/8/2014 23:36	64.0	27/8/2014 0:41	61.8				
23/8/2014 5:31	58.0	24/8/2014 6:36	58.7	25/8/2014 23:41	65.6	27/8/2014 0:46	66.6				
23/8/2014 5:36	59.4	24/8/2014 6:41	59.7	25/8/2014 23:46	63.8	27/8/2014 0:51	60.4				
23/8/2014 5:41	60.9	24/8/2014 6:46	57.4	25/8/2014 23:51	64.0	27/8/2014 0:56	63.6				
23/8/2014 5:46	59.3	24/8/2014 6:51	58.7	25/8/2014 23:56	64.0	27/8/2014 1:01	64.7				
23/8/2014 5:51	61.0	24/8/2014 6:56	60.1	26/8/2014 0:01	63.6	27/8/2014 1:06	60.0				
23/8/2014 5:56	59.2	24/8/2014 23:01	65.7	26/8/2014 0:06	63.2	27/8/2014 1:11	54.6				
23/8/2014 6:01	58.6	24/8/2014 23:06	65.0	26/8/2014 0:11	63.8	27/8/2014 1:16	59.7				
23/8/2014 6:06	62.2	24/8/2014 23:11	64.8	26/8/2014 0:16	62.2	27/8/2014 1:21	60.7				
23/8/2014 6:11	60.8	24/8/2014 23:16	64.9	26/8/2014 0:21	63.2	27/8/2014 1:26	53.7				
23/8/2014 6:16	61.3	24/8/2014 23:21	65.6	26/8/2014 0:26	63.3	27/8/2014 1:31	56.8				
23/8/2014 6:21	59.6	24/8/2014 23:26	64.4	26/8/2014 0:31	62.0	27/8/2014 1:36	55.1				
23/8/2014 6:26	62.2	24/8/2014 23:31	64.5	26/8/2014 0:36	60.1	27/8/2014 1:41	54.5				
23/8/2014 6:31	62.3	24/8/2014 23:36	65.4	26/8/2014 0:41	61.5	27/8/2014 1:46	57.1				
23/8/2014 6:36	63.5	24/8/2014 23:41	65.1	26/8/2014 0:46	62.9	27/8/2014 1:51	53.9				
23/8/2014 6:41	64.3	24/8/2014 23:46	64.0	26/8/2014 0:51	62.6	27/8/2014 1:56	62.4				
23/8/2014 6:46	66.2	24/8/2014 23:51	62.3	26/8/2014 0:56	60.5	27/8/2014 2:01	63.1				
23/8/2014 6:51	62.4	24/8/2014 23:56	63.0	26/8/2014 1:01	59.7	27/8/2014 2:06	36.7				
23/8/2014 6:56	63.6	25/8/2014 0:01	64.6	26/8/2014 1:06	59.4	27/8/2014 2:11	63.1				
23/8/2014 23:01	67.3	25/8/2014 0:06	62.9	26/8/2014 1:11	57.7	27/8/2014 2:16	63.1				
23/8/2014 23:06	65.1	25/8/2014 0:11	62.1	26/8/2014 1:16	57.6	27/8/2014 2:21	57.8				
23/8/2014 23:11	65.5	25/8/2014 0:16	62.3	26/8/2014 1:21	58.8	27/8/2014 2:26	63.0				
23/8/2014 23:16	64.8	25/8/2014 0:21	60.9	26/8/2014 1:26	56.0	27/8/2014 2:31	62.8				
23/8/2014 23:21	64.5	25/8/2014 0:26	61.8	26/8/2014 1:31	58.3	27/8/2014 2:36	62.3				
23/8/2014 23:26	64.7	25/8/2014 0:31	61.0	26/8/2014 1:36	48.6	27/8/2014 2:41	62.4				
23/8/2014 23:31	64.8	25/8/2014 0:36	60.2	26/8/2014 1:41	51.8	27/8/2014 2:46	62.7				
23/8/2014 23:36	64.3	25/8/2014 0:41	59.9	26/8/2014 1:46	54.6	27/8/2014 2:51	63.1				
23/8/2014 23:41	64.9	25/8/2014 0:46	59.3	26/8/2014 1:51	55.7	27/8/2014 2:56	61.5				
23/8/2014 23:46	64.5	25/8/2014 0:51	59.9	26/8/2014 1:56	44.5	27/8/2014 3:01	62.2				
2											

Real-time Noise Data		RTN4 (Causeway Bay Community Centre)									
Normal Day 07:00-19:00		1/8/2014 12:01	64.7	6/8/2014 18:31	64.6	12/8/2014 13:01	65.3	18/8/2014 7:31	64.9	22/8/2014 14:01	65.5
		1/8/2014 12:31	64.7	7/8/2014 7:01	64.8	12/8/2014 13:31	66.1	18/8/2014 8:01	63.8	22/8/2014 14:31	66.0
		1/8/2014 13:01	66.0	7/8/2014 7:31	64.3	12/8/2014 14:01	65.5	18/8/2014 8:31	63.4	22/8/2014 15:01	65.5
28/7/2014 7:01	65.0	1/8/2014 13:31	65.4	7/8/2014 8:01	63.4	12/8/2014 14:31	64.8	18/8/2014 9:01	64.0	22/8/2014 15:31	65.7
28/7/2014 7:31	65.6	1/8/2014 14:01	66.3	7/8/2014 8:31	63.9	12/8/2014 15:01	66.0	18/8/2014 9:31	64.6	22/8/2014 16:01	65.1
28/7/2014 8:01	63.7	1/8/2014 14:31	65.5	7/8/2014 9:01	64.7	12/8/2014 15:31	66.3	18/8/2014 10:01	65.1	22/8/2014 16:31	66.3
28/7/2014 8:31	64.3	1/8/2014 15:01	65.4	7/8/2014 9:31	65.2	12/8/2014 16:01	65.9	18/8/2014 10:31	65.1	22/8/2014 17:01	66.8
28/7/2014 9:01	64.9	1/8/2014 15:31	65.5	7/8/2014 10:01	65.3	12/8/2014 16:31	65.3	18/8/2014 11:01	65.2	22/8/2014 17:31	65.9
28/7/2014 9:31	65.2	1/8/2014 16:01	65.9	7/8/2014 10:31	65.8	12/8/2014 17:01	64.7	18/8/2014 11:31	64.9	22/8/2014 18:01	65.3
28/7/2014 10:01	66.1	1/8/2014 16:31	65.4	7/8/2014 11:01	65.8	12/8/2014 17:31	64.8	18/8/2014 12:01	64.7	22/8/2014 18:31	62.9
28/7/2014 10:31	65.7	1/8/2014 17:01	65.0	7/8/2014 11:31	64.7	12/8/2014 18:01	63.3	18/8/2014 12:31	65.2	23/8/2014 7:01	63.9
28/7/2014 11:01	65.9	1/8/2014 17:31	64.8	7/8/2014 12:01	64.4	12/8/2014 18:31	63.1	18/8/2014 13:01	65.6	23/8/2014 7:31	64.6
28/7/2014 11:31	65.2	1/8/2014 18:01	65.6	7/8/2014 12:31	65.5	13/8/2014 7:01	64.4	18/8/2014 13:31	65.9	23/8/2014 8:01	65.9
28/7/2014 12:01	64.0	1/8/2014 18:31	61.6	7/8/2014 13:01	66.6	13/8/2014 7:31	64.4	18/8/2014 14:01	65.2	23/8/2014 8:31	65.1
28/7/2014 12:31	65.0	2/8/2014 7:01	64.3	7/8/2014 13:31	66.3	13/8/2014 8:01	61.5	18/8/2014 14:31	63.8	23/8/2014 9:01	64.9
28/7/2014 13:01	66.2	2/8/2014 7:31	65.3	7/8/2014 14:01	65.5	13/8/2014 8:31	61.6	18/8/2014 15:01	64.6	23/8/2014 9:31	65.4
28/7/2014 13:31	66.0	2/8/2014 8:01	66.5	7/8/2014 14:31	65.5	13/8/2014 9:01	61.8	18/8/2014 15:31	66.0	23/8/2014 10:01	65.7
28/7/2014 14:01	66.0	2/8/2014 8:31	66.4	7/8/2014 15:01	66.1	13/8/2014 9:31	63.1	18/8/2014 16:01	66.3	23/8/2014 10:31	65.3
28/7/2014 14:31	65.5	2/8/2014 9:01	65.9	7/8/2014 15:31	65.8	13/8/2014 10:01	63.6	18/8/2014 16:31	65.6	23/8/2014 11:01	66.0
28/7/2014 15:01	64.5	2/8/2014 9:31	65.5	7/8/2014 16:01	66.5	13/8/2014 10:31	64.3	18/8/2014 17:01	64.8	23/8/2014 11:31	65.3
28/7/2014 15:31	65.4	2/8/2014 10:01	65.6	7/8/2014 16:31	66.4	13/8/2014 11:01	64.6	18/8/2014 17:31	65.6	23/8/2014 12:01	63.3
28/7/2014 16:01	65.2	2/8/2014 10:31	65.6	7/8/2014 17:01	65.6	13/8/2014 11:31	65.1	18/8/2014 18:01	65.0	23/8/2014 12:31	63.3
28/7/2014 16:31	65.9	2/8/2014 11:01	65.3	7/8/2014 17:31	65.9	13/8/2014 12:01	65.6	18/8/2014 18:31	63.8	23/8/2014 13:01	64.7
28/7/2014 17:01	66.3	2/8/2014 11:31	64.6	7/8/2014 18:01	65.7	13/8/2014 12:31	64.8	19/8/2014 7:01	65.0	23/8/2014 13:31	65.0
28/7/2014 17:31	64.6	2/8/2014 12:01	64.2	7/8/2014 18:31	65.5	13/8/2014 13:01	65.0	19/8/2014 7:31	64.7	23/8/2014 14:01	64.5
28/7/2014 18:01	64.9	2/8/2014 12:31	64.6	8/8/2014 7:01	65.3	13/8/2014 13:31	64.5	19/8/2014 8:01	64.7	23/8/2014 14:31	64.8
28/7/2014 18:31	64.2	2/8/2014 13:01	66.2	8/8/2014 7:31	65.5	13/8/2014 14:01	65.3	19/8/2014 8:31	64.2	23/8/2014 15:01	64.7
29/7/2014 7:01	64.8	2/8/2014 13:31	65.3	8/8/2014 8:01	65.2	13/8/2014 14:31	64.8	19/8/2014 9:01	65.1	23/8/2014 15:31	65.4
29/7/2014 7:31	65.2	2/8/2014 14:01	66.1	8/8/2014 8:31	65.2	13/8/2014 15:01	65.4	19/8/2014 9:31	65.6	23/8/2014 16:01	64.7
29/7/2014 8:01	64.8	2/8/2014 14:31	65.2	8/8/2014 9:01	66.0	13/8/2014 15:31	65.9	19/8/2014 10:01	66.2	23/8/2014 16:31	64.8
29/7/2014 8:31	64.6	2/8/2014 15:01	65.0	8/8/2014 9:31	66.4	13/8/2014 16:01	66.1	19/8/2014 10:31	66.3	23/8/2014 17:01	64.7
29/7/2014 9:01	64.6	2/8/2014 15:31	65.1	8/8/2014 10:01	66.3	13/8/2014 16:31	65.6	19/8/2014 11:01	66.4	23/8/2014 17:31	65.4
29/7/2014 9:31	65.1	2/8/2014 16:01	65.6	8/8/2014 10:31	64.2	13/8/2014 17:01	65.8	19/8/2014 11:31	65.4	23/8/2014 18:01	65.1
29/7/2014 10:01	65.1	2/8/2014 16:31	65.6	8/8/2014 11:01	64.5	13/8/2014 17:31	65.0	19/8/2014 12:01	65.7	23/8/2014 18:31	64.1
29/7/2014 10:31	64.8	2/8/2014 17:01	65.4	8/8/2014 11:31	63.7	13/8/2014 18:01	64.3	19/8/2014 12:31	66.0	25/8/2014 7:01	64.5
29/7/2014 11:01	65.1	2/8/2014 17:31	65.1	8/8/2014 12:01	64.4	13/8/2014 18:31	62.2	19/8/2014 13:01	66.4	25/8/2014 7:31	63.4
29/7/2014 11:31	65.5	2/8/2014 18:01	65.3	8/8/2014 12:31	65.0	14/8/2014 7:01	64.9	19/8/2014 13:31	66.4	25/8/2014 8:01	63.1
29/7/2014 12:01	64.3	2/8/2014 18:31	64.1	8/8/2014 13:01	65.1	14/8/2014 7:31	65.1	19/8/2014 14:01	65.5	25/8/2014 8:31	64.4
29/7/2014 12:31	64.5	4/8/2014 7:01	64.4	8/8/2014 13:31	65.6	14/8/2014 8:01	64.3	19/8/2014 14:31	64.9	25/8/2014 9:01	64.7
29/7/2014 13:01	66.3	4/8/2014 7:31	65.7	8/8/2014 14:01	65.9	14/8/2014 8:31	64.0	19/8/2014 15:01	65.7	25/8/2014 9:31	65.8
29/7/2014 13:31	65.8	4/8/2014 8:01	64.4	8/8/2014 14:31	65.8	14/8/2014 9:01	65.7	19/8/2014 15:31	65.2	25/8/2014 10:01	65.8
29/7/2014 14:01	65.3	4/8/2014 8:31	64.3	8/8/2014 15:01	65.5	14/8/2014 9:31	64.4	19/8/2014 16:01	65.9	25/8/2014 10:31	66.2
29/7/2014 14:31	65.3	4/8/2014 9:01	65.0	8/8/2014 15:31	65.9	14/8/2014 10:01	64.7	19/8/2014 16:31	66.6	25/8/2014 11:01	66.1
29/7/2014 15:01	65.0	4/8/2014 9:31	66.5	8/8/2014 16:01	66.5	14/8/2014 10:31	63.9	19/8/2014 17:01	65.6	25/8/2014 11:31	64.6
29/7/2014 15:31	64.8	4/8/2014 10:01	66.2	8/8/2014 16:31	66.6	14/8/2014 11:01	63.9	19/8/2014 17:31	65.9	25/8/2014 12:01	63.4
29/7/2014 16:01	64.9	4/8/2014 10:31	65.8	8/8/2014 17:01	66.5	14/8/2014 11:31	62.2	19/8/2014 18:01	65.1	25/8/2014 12:31	63.9
29/7/2014 16:31	64.3	4/8/2014 11:01	65.6	8/8/2014 17:31	65.4	14/8/2014 12:01	63.1	19/8/2014 18:31	64.8	25/8/2014 13:01	65.7
29/7/2014 17:01	65.9	4/8/2014 11:31	65.5	8/8/2014 18:01	65.0	14/8/2014 12:31	64.1	20/8/2014 7:01	64.0	25/8/2014 13:31	65.8
29/7/2014 17:31	65.0	4/8/2014 12:01	64.4	8/8/2014 18:31	62.7	14/8/2014 13:01	66.5	20/8/2014 7:31	63.5	25/8/2014 14:01	66.3
29/7/2014 18:01	64.4	4/8/2014 12:31	65.5	9/8/2014 7:01	63.6	14/8/2014 13:31	66.5	20/8/2014 8:01	63.3	25/8/2014 14:31	65.2
29/7/2014 18:31	63.3	4/8/2014 13:01	66.4	9/8/2014 7:31	65.1	14/8/2014 14:01	66.0	20/8/2014 8:31	63.9	25/8/2014 15:01	65.0
30/7/2014 7:01	64.4	4/8/2014 13:31	66.4	9/8/2014 8:01	65.9	14/8/2014 14:31	66.5	20/8/2014 9:01	64.0	25/8/2014 15:31	65.1
30/7/2014 7:31	65.0	4/8/2014 14:01	66.2	9/8/2014 8:31	66.0	14/8/2014 15:01	65.7	20/8/2014 9:31	64.0	25/8/2014 16:01	64.2
30/7/2014 8:01	64.6	4/8/2014 14:31	65.4	9/8/2014 9:01	65.9	14/8/2014 15:31	65.3	20/8/2014 10:01	64.3	25/8/2014 16:31	64.0
30/7/2014 8:31	63.8	4/8/2014 15:01	64.8	9/8/2014 9:31	65.5	14/8/2014 16:01	66.0	20/8/2014 10:31	64.8	25/8/2014 17:01	64.3
30/7/2014 9:01	63.6	4/8/2014 15:31	66.0	9/8/2014 10:01	65.2	14/8/2014 16:31	66.4	20/8/2014 11:01	64.9	25/8/2014 17:31	64.5
30/7/2014 9:31	64.4	4/8/2014 16:01	66.7	9/8/2014 10:31	64.8	14/8/2014 17:01	66.7	20/8/2014 11:31	64.2	25/8/2014 18:01	63.6
30/7/2014 10:01	64.6	4/8/2014 16:31	66.5	9/8/2014 11:01	65.2	14/8/2014 17:31	66.0	20/8/2014 12:01	64.5	25/8/2014 18:31	61.0
30/7/2014 10:31	65.2	4/8/2014 17:01	66.4	9/8/2014 11:31	65.2	14/8/2014 18:01	63.2	20/8/2014 12:31	65.8	26/8/2014 7:01	63.7
30/7/2014 11:01	65.4	4/8/2014 17:31	66.1	9/8/2014 12:01	65.2	14/8/2014 18:31	61.4	20/8/2014 13:01	66.4	26/8/2014 7:31	63.6
30/7/2014 11:31	64.9	4/8/2014 18:01	66.3	9/8/2014 12:31	64.7	15/8/2014 7:01	64.9	20/8/2014 13:31	66.0	26/8/2014 8:01	63.1
30/7/2014 12:01	64.6	4/8/2014 18:31	65.1	9/8/2014 13:01	65.8	15/8/2014 7:31	65.1	20/8/2014 14:01	65.7	26/8/2014 8:31	64.1
30/7/2014 12:31	65.3	5/8/2014 7:01	64.4	9/8/2014 13:31	65.8	15/8/2014 8:01	64.3	20/8/2014 14:31	65.7	26/8/2014 9:01	64.7
30/7/2014 13:01	65.4	5/8/2014 7:31	65.0	9/8/2014 14:01	65.8	15/8/2014 8:31	63.6	20/8/2014 15:01	65.7	26/8/2014 9:31	65.4
30/7/2014 13:31	65.6	5/8/2014 8:01	63.6	9/8/2014 14:31	65.2	15/8/2014 9:01	64.0	20/8/2014 15:31	65.4	26/8/2014 10:01	65.6
30/7/2014 14:01	65.5	5/8/2014 8:31	64.9	9/8/2014 15:01	64.9	15/8/2014 9:31	65.7	20/8/2014 16:01	66.6	26/8/2014 10:31	65.6
30/7/2014 14:31	65.0	5/8/2014 9:01	65.5	9/8/2014 15:31	64.9	15/8/2014 10:01	65.3	20/8/2014 16:31	67.3	26/8/2014 11:01	64.9
30/7/2014 15:01	66.1	5/8/2014 9:31	66.1	9/8/2014 16:01	65.1	15/8/2014 10:31	65.1	20/8/2014 17:01	66.9	26/8/2014 11:31	64.8
30/7/2014 15:31	66.2	5/8/2014 10:01	65.8	9/8/2014 16:31	65.1	15/8/2014 11:01	65.6	20/8/2014 17:31	66.3	26/8/2014 12:01	64.0
30/7/2014 16:01	65.8	5/8/2014 10:31	65.2	9/8/2014 17:01	65.5						

Real-time Noise Data		RTN4 (Causeway Bay Community Centre)							
<u>Normal Day 19:00-23:00</u>		30/7/2014 19:41	58.9	1/8/2014 20:46	55.5	3/8/2014 9:51	58.7	3/8/2014 18:56	51.2
<u>Sunday & Holiday</u>		30/7/2014 19:46	49.4	1/8/2014 20:51	56.1	3/8/2014 9:56	61.2	3/8/2014 19:01	51.9
<u>07:00-23:00</u>		30/7/2014 19:51	54.4	1/8/2014 20:56	57.3	3/8/2014 10:01	59.3	3/8/2014 19:06	50.9
		30/7/2014 19:56	54.7	1/8/2014 21:01	53.5	3/8/2014 10:06	59.3	3/8/2014 19:11	54.9
		30/7/2014 20:01	56.6	1/8/2014 21:06	63.5	3/8/2014 10:11	60.9	3/8/2014 19:16	55.3
		30/7/2014 20:06	57.2	1/8/2014 21:11	63.5	3/8/2014 10:16	58.4	3/8/2014 19:21	53.9
28/7/2014 19:01	62.8	30/7/2014 20:11	51.2	1/8/2014 21:16	63.5	3/8/2014 10:21	60.3	3/8/2014 19:26	44.3
28/7/2014 19:06	62.4	30/7/2014 20:16	63.6	1/8/2014 21:21	63.3	3/8/2014 10:26	60.1	3/8/2014 19:31	52.2
28/7/2014 19:11	62.9	30/7/2014 20:21	55.9	1/8/2014 21:26	63.2	3/8/2014 10:31	60.2	3/8/2014 19:36	63.5
28/7/2014 19:16	60.6	30/7/2014 20:26	47.8	1/8/2014 21:31	63.5	3/8/2014 10:36	56.0	3/8/2014 19:41	42.1
28/7/2014 19:21	60.9	30/7/2014 20:31	42.1	1/8/2014 21:36	46.9	3/8/2014 10:41	58.2	3/8/2014 19:46	48.9
28/7/2014 19:26	60.9	30/7/2014 20:36	63.7	1/8/2014 21:41	62.8	3/8/2014 10:46	57.2	3/8/2014 19:51	53.4
28/7/2014 19:31	62.5	30/7/2014 20:41	48.5	1/8/2014 21:46	63.2	3/8/2014 10:51	57.5	3/8/2014 19:56	59.3
28/7/2014 19:36	59.6	30/7/2014 20:46	63.5	1/8/2014 21:51	63.3	3/8/2014 10:56	56.3	3/8/2014 20:01	48.2
28/7/2014 19:41	60.0	30/7/2014 20:51	50.0	1/8/2014 21:56	63.2	3/8/2014 11:01	59.4	3/8/2014 20:06	47.4
28/7/2014 19:46	60.6	30/7/2014 20:56	63.6	1/8/2014 22:01	63.2	3/8/2014 11:06	60.0	3/8/2014 20:11	63.4
28/7/2014 19:51	60.5	30/7/2014 21:01	52.4	1/8/2014 22:06	63.2	3/8/2014 11:11	52.9	3/8/2014 20:16	63.7
28/7/2014 19:56	57.8	30/7/2014 21:06	50.0	1/8/2014 22:11	63.0	3/8/2014 11:16	63.6	3/8/2014 20:21	63.4
28/7/2014 20:01	59.2	30/7/2014 21:11	63.6	1/8/2014 22:16	62.9	3/8/2014 11:21	49.7	3/8/2014 20:26	59.8
28/7/2014 20:06	58.1	30/7/2014 21:16	51.4	1/8/2014 22:21	62.1	3/8/2014 11:26	48.9	3/8/2014 20:31	63.7
28/7/2014 20:11	60.5	30/7/2014 21:21	54.6	1/8/2014 22:26	63.2	3/8/2014 11:31	54.4	3/8/2014 20:36	63.5
28/7/2014 20:16	59.2	30/7/2014 21:26	50.6	1/8/2014 22:31	63.1	3/8/2014 11:36	59.2	3/8/2014 20:41	62.8
28/7/2014 20:21	57.2	30/7/2014 21:31	63.2	1/8/2014 22:36	62.8	3/8/2014 11:41	54.0	3/8/2014 20:46	63.0
28/7/2014 20:26	57.2	30/7/2014 21:36	63.0	1/8/2014 22:41	63.2	3/8/2014 11:46	40.3	3/8/2014 20:51	63.3
28/7/2014 20:31	59.3	30/7/2014 21:41	63.1	1/8/2014 22:46	50.9	3/8/2014 11:51	63.1	3/8/2014 20:56	62.8
28/7/2014 20:36	59.3	30/7/2014 21:46	46.9	1/8/2014 22:51	63.5	3/8/2014 11:56	48.9	3/8/2014 21:01	63.2
28/7/2014 20:41	56.5	30/7/2014 21:51	63.4	1/8/2014 22:56	63.4	3/8/2014 12:01	37.3	3/8/2014 21:06	63.3
28/7/2014 20:46	57.2	30/7/2014 21:56	52.2	2/8/2014 19:01	60.1	3/8/2014 12:06	57.5	3/8/2014 21:11	63.0
28/7/2014 20:51	58.0	30/7/2014 22:01	63.3	2/8/2014 19:06	52.8	3/8/2014 12:11	61.0	3/8/2014 21:16	63.4
28/7/2014 20:56	57.5	30/7/2014 22:06	63.6	2/8/2014 19:11	59.6	3/8/2014 12:16	58.2	3/8/2014 21:21	63.4
28/7/2014 21:01	55.2	30/7/2014 22:11	63.5	2/8/2014 19:16	57.9	3/8/2014 12:21	58.3	3/8/2014 21:26	63.1
28/7/2014 21:06	52.7	30/7/2014 22:16	63.6	2/8/2014 19:21	59.5	3/8/2014 12:26	63.6	3/8/2014 21:31	63.2
28/7/2014 21:11	59.0	30/7/2014 22:21	63.4	2/8/2014 19:26	51.1	3/8/2014 12:31	63.5	3/8/2014 21:36	63.3
28/7/2014 21:16	55.8	30/7/2014 22:26	63.1	2/8/2014 19:31	55.9	3/8/2014 12:36	63.5	3/8/2014 21:41	63.0
28/7/2014 21:21	54.6	30/7/2014 22:31	47.4	2/8/2014 19:36	53.7	3/8/2014 12:41	57.5	3/8/2014 21:46	63.2
28/7/2014 21:26	57.7	30/7/2014 22:36	63.0	2/8/2014 19:41	52.9	3/8/2014 12:46	53.3	3/8/2014 21:51	63.3
28/7/2014 21:31	55.1	30/7/2014 22:41	62.2	2/8/2014 19:46	58.5	3/8/2014 12:51	63.7	3/8/2014 21:56	63.2
28/7/2014 21:36	54.8	30/7/2014 22:46	62.6	2/8/2014 19:51	55.5	3/8/2014 12:56	63.7	3/8/2014 22:01	62.8
28/7/2014 21:41	44.3	30/7/2014 22:51	63.3	2/8/2014 19:56	45.8	3/8/2014 13:01	57.6	3/8/2014 22:06	63.3
28/7/2014 21:46	52.7	30/7/2014 22:56	62.7	2/8/2014 20:01	56.6	3/8/2014 13:06	50.4	3/8/2014 22:11	63.1
28/7/2014 21:51	63.6	31/7/2014 19:01	60.1	2/8/2014 20:06	57.3	3/8/2014 13:11	63.0	3/8/2014 22:16	62.6
28/7/2014 21:56	63.4	31/7/2014 19:06	57.3	2/8/2014 20:11	51.2	3/8/2014 13:16	63.0	3/8/2014 22:21	63.3
28/7/2014 22:01	63.2	31/7/2014 19:11	59.4	2/8/2014 20:16	63.6	3/8/2014 13:21	57.0	3/8/2014 22:26	63.5
28/7/2014 22:06	52.4	31/7/2014 19:16	58.8	2/8/2014 20:21	55.7	3/8/2014 13:26	58.4	3/8/2014 22:31	63.6
28/7/2014 22:11	63.3	31/7/2014 19:21	58.7	2/8/2014 20:26	63.6	3/8/2014 13:31	60.1	3/8/2014 22:36	63.1
28/7/2014 22:16	50.2	31/7/2014 19:26	58.1	2/8/2014 20:31	63.4	3/8/2014 13:36	45.1	3/8/2014 22:41	63.2
28/7/2014 22:21	63.7	31/7/2014 19:31	57.3	2/8/2014 20:36	62.7	3/8/2014 13:41	59.1	3/8/2014 22:46	63.5
28/7/2014 22:26	53.8	31/7/2014 19:36	54.2	2/8/2014 20:41	63.4	3/8/2014 13:46	59.6	3/8/2014 22:51	63.3
28/7/2014 22:31	63.2	31/7/2014 19:41	58.5	2/8/2014 20:46	50.4	3/8/2014 13:51	53.1	3/8/2014 22:56	62.3
28/7/2014 22:36	63.2	31/7/2014 19:46	61.0	2/8/2014 20:51	63.4	3/8/2014 13:56	56.7	4/8/2014 19:01	56.7
28/7/2014 22:41	50.6	31/7/2014 19:51	56.5	2/8/2014 20:56	53.5	3/8/2014 14:01	58.9	4/8/2014 19:06	59.2
28/7/2014 22:46	63.0	31/7/2014 19:56	58.4	2/8/2014 21:01	54.8	3/8/2014 14:06	58.0	4/8/2014 19:11	52.9
28/7/2014 22:51	63.3	31/7/2014 20:01	58.7	2/8/2014 21:06	58.6	3/8/2014 14:11	60.3	4/8/2014 19:16	52.4
28/7/2014 22:56	63.3	31/7/2014 20:06	59.2	2/8/2014 21:11	63.7	3/8/2014 14:16	60.1	4/8/2014 19:21	57.2
29/7/2014 19:01	63.3	31/7/2014 20:11	59.0	2/8/2014 21:16	63.4	3/8/2014 14:21	58.3	4/8/2014 19:26	47.4
29/7/2014 19:06	62.9	31/7/2014 20:16	58.3	2/8/2014 21:21	52.1	3/8/2014 14:26	58.4	4/8/2014 19:31	51.8
29/7/2014 19:11	63.5	31/7/2014 20:21	57.3	2/8/2014 21:26	56.4	3/8/2014 14:31	54.5	4/8/2014 19:36	63.7
29/7/2014 19:16	57.8	31/7/2014 20:26	55.3	2/8/2014 21:31	51.9	3/8/2014 14:36	56.6	4/8/2014 19:41	54.7
29/7/2014 19:21	54.5	31/7/2014 20:31	54.5	2/8/2014 21:36	50.2	3/8/2014 14:41	55.9	4/8/2014 19:46	57.6
29/7/2014 19:26	54.4	31/7/2014 20:36	51.8	2/8/2014 21:41	62.0	3/8/2014 14:46	59.6	4/8/2014 19:51	60.2
29/7/2014 19:31	48.2	31/7/2014 20:41	53.2	2/8/2014 21:46	53.1	3/8/2014 14:51	55.3	4/8/2014 19:56	59.2
29/7/2014 19:36	47.8	31/7/2014 20:46	55.0	2/8/2014 21:51	40.3	3/8/2014 14:56	56.2	4/8/2014 20:01	54.7
29/7/2014 19:41	63.6	31/7/2014 20:51	55.3	2/8/2014 21:56	63.3	3/8/2014 15:01	49.2	4/8/2014 20:06	54.2
29/7/2014 19:46	53.2	31/7/2014 20:56	46.4	2/8/2014 22:01	63.3	3/8/2014 15:06	52.7	4/8/2014 20:11	56.2
29/7/2014 19:51	52.2	31/7/2014 21:01	52.7	2/8/2014 22:06	52.1	3/8/2014 15:11	61.0	4/8/2014 20:16	52.7
29/7/2014 19:56	54.7	31/7/2014 21:06	42.1	2/8/2014 22:11	54.5	3/8/2014 15:16	57.7	4/8/2014 20:21	56.5
29/7/2014 20:01	54.2	31/7/2014 21:11	53.8	2/8/2014 22:16	55.2	3/8/2014 15:21	56.9	4/8/2014 20:26	55.1
29/7/2014 20:06	54.2	31/7/2014 21:16	46.9	2/8/2014 22:21	55.0	3/8/2014 15:26	54.8	4/8/2014 20:31	51.8
29/7/2014 20:11	57.4	31/7/2014 21:21	53.3	2/8/2014 22:26	53.1	3/8/2014 15:31	56.6	4/8/2014 20:36	63.7
29/7/2014 20:16	47.4	31/7/2014 21:26	63.5	2/8/2014 22:31	63.4	3/8/2014 15:36	56.9	4/8/2014 20:41	54.4
29/7/2014 20:21	63.6	31/7/2014 21:31	49.7	2/8/2014 22:36	52.5	3/8/2014 15:41	56.3	4/8/2014 20:46	46.4
29/7/2014 20:26	63.7	31/7/2014 21:36	63.3	2/8/2014 22:41	54.0	3/8/2014 15:46	55.3	4/8/2014 20:51	43.4
29/7/2014 20:31	53.8	31/7/2014 21:41	44.3	2/8/2014 22:46	40.3	3/8/2014 15:51	48.5	4/8/2014 20:56	63.7
29/7/2014 20:36	47.8	31/7/2014 21:46	53.3	2/8/2014 22:51	56.7	3/8/2014 15:56	52.7	4/8/2014 21:01	63.5
29/7/2014 20:41	54.2	31/7/2014 21:51	63.2	3/8/2014 7:01	62.5	3/8/2014 16:01	53.1	4/8/2014 21:06	40.3
29/7/2014 20:46	63.4	31/7/2014 21:56	62.9	3/8/2014 7:06	62.1	3/8/2014 16:06	50.4	4/8/2014 21:11	50.9
29/7/2014 20:51	59.4	31/7/2014 22:01	63.3	3/8/2014 7:11	65.1	3/8/2014 16:11	53.7	4/8/2014 21:16	49.4
29/7/2014 20:56	63.3	31/7/2014 22:06	63.6	3/8/2014 7:16	61.1	3/8/2014 16:16	52.7	4/8/2014 21:21	63.7
29/7/2014 21:01	63.5	31/7/2014 22:11	63.7	3/8/2014 7:21	62.1	3/8/2014 16:21	52.9	4/8/2014 21:26	50.2
29/7/2014 21:06	63.6	31/7/2014 22:16	63.4	3/8/2014 7:26	65.0	3/8/2014 16:26	56.6	4/8/2014 21:31	63.1
29/7/2014 21:11	56.4	31/7/2014 22:21	46.4	3/8/2014 7:31	63.1	3/8/2014 16:31	57.0	4/8/2014 21:36	48.9
29/7/2014 21:16	48.2	31/7/2014 22:26	63.4	3/8/2014 7:36	63.2	3/8/2014 16:36	52.5	4/8/2014 21:41	49.7
29/7/2014 21:21	52.7	31/7/2014 22:31	63.5	3/8/2014 7:41	63.3	3/8/20			

Real-time Noise Data		RTN4 (Causeway Bay Community Centre)					
7/8/2014 21:06	53.4	9/8/2014 22:11	52.8	10/8/2014 15:16	37.3	11/8/2014 20:21	63.7
7/8/2014 21:11	51.1	9/8/2014 22:16	63.2	10/8/2014 15:21	52.9	11/8/2014 20:26	46.4
7/8/2014 21:16	52.2	9/8/2014 22:21	63.4	10/8/2014 15:26	53.9	11/8/2014 20:31	37.3
7/8/2014 21:21	50.6	9/8/2014 22:26	67.1	10/8/2014 15:31	52.9	11/8/2014 20:36	51.6
7/8/2014 21:26	54.5	9/8/2014 22:31	52.5	10/8/2014 15:36	55.9	11/8/2014 20:41	63.6
7/8/2014 21:31	45.8	9/8/2014 22:36	58.3	10/8/2014 15:41	49.4	11/8/2014 20:46	63.6
7/8/2014 21:36	57.0	9/8/2014 22:41	63.3	10/8/2014 15:46	57.4	11/8/2014 20:51	55.0
7/8/2014 21:41	63.7	9/8/2014 22:46	54.5	10/8/2014 15:51	56.3	11/8/2014 20:56	44.3
7/8/2014 21:46	63.7	9/8/2014 22:51	63.0	10/8/2014 15:56	51.4	11/8/2014 21:01	63.7
7/8/2014 21:51	56.4	9/8/2014 22:56	63.1	10/8/2014 16:01	46.9	11/8/2014 21:06	51.2
7/8/2014 21:56	43.4	10/8/2014 7:01	62.2	10/8/2014 16:06	51.4	11/8/2014 21:11	44.3
7/8/2014 22:01	42.1	10/8/2014 7:06	63.5	10/8/2014 16:11	57.0	11/8/2014 21:16	52.9
7/8/2014 22:06	47.8	10/8/2014 7:11	61.1	10/8/2014 16:16	53.7	11/8/2014 21:21	40.3
7/8/2014 22:11	49.2	10/8/2014 7:16	63.5	10/8/2014 16:21	54.9	11/8/2014 21:26	53.9
7/8/2014 22:16	56.6	10/8/2014 7:21	62.8	10/8/2014 16:26	55.0	11/8/2014 21:31	53.2
7/8/2014 22:21	63.4	10/8/2014 7:26	62.8	10/8/2014 16:31	52.4	11/8/2014 21:36	51.1
7/8/2014 22:26	63.5	10/8/2014 7:31	62.5	10/8/2014 16:36	63.5	11/8/2014 21:41	63.7
7/8/2014 22:31	63.4	10/8/2014 7:36	63.1	10/8/2014 16:41	51.4	11/8/2014 21:46	63.7
7/8/2014 22:36	54.5	10/8/2014 7:41	63.1	10/8/2014 16:46	57.0	11/8/2014 21:51	63.1
7/8/2014 22:41	63.2	10/8/2014 7:46	50.2	10/8/2014 16:51	50.2	11/8/2014 21:56	63.0
7/8/2014 22:46	62.1	10/8/2014 7:51	62.5	10/8/2014 16:56	56.9	11/8/2014 22:01	63.5
7/8/2014 22:51	62.9	10/8/2014 7:56	63.7	10/8/2014 17:01	56.1	11/8/2014 22:06	63.3
7/8/2014 22:56	63.2	10/8/2014 8:01	63.4	10/8/2014 17:06	56.0	11/8/2014 22:11	51.6
8/8/2014 19:01	63.6	10/8/2014 8:06	63.4	10/8/2014 17:11	56.0	11/8/2014 22:16	52.1
8/8/2014 19:06	56.5	10/8/2014 8:11	46.4	10/8/2014 17:16	61.0	11/8/2014 22:21	50.2
8/8/2014 19:11	46.9	10/8/2014 8:16	57.6	10/8/2014 17:21	56.8	11/8/2014 22:26	63.7
8/8/2014 19:16	50.6	10/8/2014 8:21	62.9	10/8/2014 17:26	56.6	11/8/2014 22:31	63.5
8/8/2014 19:21	62.9	10/8/2014 8:26	63.6	10/8/2014 17:31	57.5	11/8/2014 22:36	63.3
8/8/2014 19:26	63.2	10/8/2014 8:31	63.4	10/8/2014 17:36	58.1	11/8/2014 22:41	53.7
8/8/2014 19:31	60.7	10/8/2014 8:36	52.1	10/8/2014 17:41	60.0	11/8/2014 22:46	63.0
8/8/2014 19:36	60.9	10/8/2014 8:41	63.7	10/8/2014 17:46	57.0	11/8/2014 22:51	63.6
8/8/2014 19:41	59.5	10/8/2014 8:46	51.1	10/8/2014 17:51	57.5	11/8/2014 22:56	63.4
8/8/2014 19:46	59.7	10/8/2014 8:51	58.9	10/8/2014 17:56	59.9	12/8/2014 19:01	48.9
8/8/2014 19:51	57.0	10/8/2014 8:56	58.2	10/8/2014 18:01	56.7	12/8/2014 19:06	53.5
8/8/2014 19:56	57.6	10/8/2014 9:01	54.0	10/8/2014 18:06	54.8	12/8/2014 19:11	63.2
8/8/2014 20:01	54.8	10/8/2014 9:06	58.7	10/8/2014 18:11	54.7	12/8/2014 19:16	50.6
8/8/2014 20:06	58.4	10/8/2014 9:11	60.2	10/8/2014 18:16	57.3	12/8/2014 19:21	62.7
8/8/2014 20:11	57.8	10/8/2014 9:16	60.3	10/8/2014 18:21	59.1	12/8/2014 19:26	62.6
8/8/2014 20:16	60.0	10/8/2014 9:21	60.5	10/8/2014 18:26	58.6	12/8/2014 19:31	62.1
8/8/2014 20:21	59.9	10/8/2014 9:26	61.2	10/8/2014 18:31	58.2	12/8/2014 19:36	62.6
8/8/2014 20:26	56.6	10/8/2014 9:31	63.1	10/8/2014 18:36	59.3	12/8/2014 19:41	63.1
8/8/2014 20:31	58.1	10/8/2014 9:36	55.9	10/8/2014 18:41	59.2	12/8/2014 19:46	62.0
8/8/2014 20:36	59.6	10/8/2014 9:41	57.5	10/8/2014 18:46	54.4	12/8/2014 19:51	62.6
8/8/2014 20:41	59.4	10/8/2014 9:46	63.3	10/8/2014 18:51	57.1	12/8/2014 19:56	62.6
8/8/2014 20:46	58.0	10/8/2014 9:51	48.5	10/8/2014 18:56	54.7	12/8/2014 20:01	55.6
8/8/2014 20:51	58.4	10/8/2014 9:56	56.1	10/8/2014 19:01	57.9	12/8/2014 20:06	52.8
8/8/2014 20:56	54.3	10/8/2014 10:01	59.5	10/8/2014 19:06	63.6	12/8/2014 20:11	52.8
8/8/2014 21:01	52.4	10/8/2014 10:06	58.4	10/8/2014 19:11	57.6	12/8/2014 20:16	52.2
8/8/2014 21:06	59.0	10/8/2014 10:11	59.3	10/8/2014 19:16	54.6	12/8/2014 20:21	63.0
8/8/2014 21:11	63.6	10/8/2014 10:16	58.1	10/8/2014 19:21	57.8	12/8/2014 20:26	62.6
8/8/2014 21:16	54.0	10/8/2014 10:21	57.3	10/8/2014 19:26	53.8	12/8/2014 20:31	63.1
8/8/2014 21:21	63.5	10/8/2014 10:26	56.0	10/8/2014 19:31	52.8	12/8/2014 20:36	49.7
8/8/2014 21:26	58.0	10/8/2014 10:31	63.2	10/8/2014 19:36	53.5	12/8/2014 20:41	55.2
8/8/2014 21:31	52.9	10/8/2014 10:36	63.2	10/8/2014 19:41	54.2	12/8/2014 20:46	63.6
8/8/2014 21:36	56.5	10/8/2014 10:41	63.0	10/8/2014 19:46	47.4	12/8/2014 20:51	63.5
8/8/2014 21:41	57.3	10/8/2014 10:46	43.4	10/8/2014 19:51	54.5	12/8/2014 20:56	62.8
8/8/2014 21:46	55.4	10/8/2014 10:51	63.2	10/8/2014 19:56	54.4	12/8/2014 21:01	53.7
8/8/2014 21:51	58.2	10/8/2014 10:56	51.2	10/8/2014 20:01	55.2	12/8/2014 21:06	54.9
8/8/2014 21:56	50.4	10/8/2014 11:01	63.7	10/8/2014 20:06	63.6	12/8/2014 21:11	54.7
8/8/2014 22:01	63.0	10/8/2014 11:06	63.6	10/8/2014 20:11	56.1	12/8/2014 21:16	54.9
8/8/2014 22:06	51.4	10/8/2014 11:11	56.8	10/8/2014 20:16	52.7	12/8/2014 21:21	53.8
8/8/2014 22:11	51.1	10/8/2014 11:16	62.4	10/8/2014 20:21	53.8	12/8/2014 21:26	63.6
8/8/2014 22:16	54.4	10/8/2014 11:21	62.8	10/8/2014 20:26	63.6	12/8/2014 21:31	53.1
8/8/2014 22:21	59.9	10/8/2014 11:26	62.2	10/8/2014 20:31	52.5	12/8/2014 21:36	58.4
8/8/2014 22:26	47.4	10/8/2014 11:31	63.6	10/8/2014 20:36	51.1	12/8/2014 21:41	50.4
8/8/2014 22:31	58.3	10/8/2014 11:36	58.3	10/8/2014 20:41	62.7	12/8/2014 21:46	51.2
8/8/2014 22:36	56.9	10/8/2014 11:41	62.6	10/8/2014 20:46	49.4	12/8/2014 21:51	52.4
8/8/2014 22:41	52.2	10/8/2014 11:46	61.7	10/8/2014 20:51	52.5	12/8/2014 21:56	51.6
8/8/2014 22:46	55.6	10/8/2014 11:51	61.4	10/8/2014 20:56	63.4	12/8/2014 22:01	48.2
8/8/2014 22:51	56.2	10/8/2014 11:56	62.9	10/8/2014 21:01	63.4	12/8/2014 22:06	63.7
8/8/2014 22:56	63.1	10/8/2014 12:01	63.2	10/8/2014 21:06	63.3	12/8/2014 22:11	63.7
9/8/2014 19:01	54.2	10/8/2014 12:06	54.0	10/8/2014 21:11	54.0	12/8/2014 22:16	63.2
9/8/2014 19:06	53.5	10/8/2014 12:11	63.2	10/8/2014 21:16	51.2	12/8/2014 22:21	63.6
9/8/2014 19:11	57.6	10/8/2014 12:16	62.2	10/8/2014 21:21	63.0	12/8/2014 22:26	63.0
9/8/2014 19:16	49.4	10/8/2014 12:21	47.8	10/8/2014 21:26	53.8	12/8/2014 22:31	63.1
9/8/2014 19:21	63.4	10/8/2014 12:26	58.9	10/8/2014 21:31	56.6	12/8/2014 22:36	49.4
9/8/2014 19:26	54.7	10/8/2014 12:31	53.4	10/8/2014 21:36	63.5	12/8/2014 22:41	63.4
9/8/2014 19:31	57.0	10/8/2014 12:36	63.4	10/8/2014 21:41	51.9	12/8/2014 22:46	63.3
9/8/2014 19:36	55.0	10/8/2014 12:41	51.2	10/8/2014 21:46	63.4	12/8/2014 22:51	62.7
9/8/2014 19:41	55.6	10/8/2014 12:46	63.4	10/8/2014 21:51	63.3	12/8/2014 22:56	62.6
9/8/2014 19:46	55.3	10/8/2014 12:51	63.7	10/8/2014 21:56	63.2	13/8/2014 19:01	62.5
9/8/2014 19:51	54.9	10/8/2014 12:56	51.4	10/8/2014 22:01	51.1	13/8/2014 19:06	62.7
9/8/2014 19:56	58.4	10/8/2014 13:01	53.8	10/8/2014 22:06	63.7	13/8/2014 19:11	63.2
9/8/2014 20:01	61.0	10/8/2014 13:06	47.4	10/8/2014 22:11	63.1	13/8/2014 19:16	63.0
9/8/2014 20:06	51.8	10/8/2014 13:11	63.0	10/8/2014 22:16	63.1	13/8/2014 19:21	63.2
9/8/2014 20:11	55.6	10/8/2014 13:16	63.4	10/8/2014 22:21	63.3	13/8/2014 19:26	50.9
9/8/2014 20:16	56.9	10/8/2014 13:21	62.9	10/8/2014 22:26	63.3	13/8/2014 19:31	59.2
9/8/2014 20:21	52.4	10/8/2014 13:26	63.6	10/8/2014 22:31	63.6	13/8/2014 19:36	62.9
9/8/2014 20:26	52.2	10/8/2014 13:31	63.0	10/8/2014 22:36	63.1	13/8/2014 19:41	37.3
9/8/2014 20:31	49.2	10/8/2014 13:36	63.6	10/8/2014 22:41	44.3	13/8/2014 19:46	51.8
9/8/2014 20:36	56.7	10/8/2014 13:41	48.5	10/8/2014 22:46	63.0	13/8/2014 19:51	63.3
9/8/2014 20:41	63.7	10/8/2014 13:46	51.4	10/8/2014 22:51	63.3	13/8/2014 19:56	56.0
9/8/2014 20:46	51.8	10/8/2014 13:51	63.6	10/8/2014 22:56	62.3	13/8/2014 20:01	54.0
9/8/2014 20:51	54.2	10/8/2014 13:56	55.7	11/8/2014 19:01	57.4	13/8/2014 20:06	51.9
9/8/2014 20:56	63.7	10/8/2014 14:01	55.2	11/8/2014 19:06	56.4	13/8/2014 20:11	55.2
9/8/2014 21:01	47.4	10/8/2014 14:06	56.6	11/8/2014 19:11	54.4	13/8/2014 20:16	57.7
9/8/2014 21:06	63.6	10/8/2014 14:11	54.2	11/8/2014 19:16	50.4	13/8/2014 20:21	55.7
9/8/2014 21:11	49.2	10/8/2014 14:16	63.6	11/8/2014 19:21	63.5	13/8/2014 20:26	58.1
9/8/2014 21:16	53.7	10/8/2014 14:21	63.7	11/8/2014 19:26	49.2	13/8/2014 20:31	63.2
9/8/2014 21:21	63.2	10/8/2014 14:26	51.6	11/8/2014 19:31	63.7	13/8/2014 20:36	56.2
9/8/2014 21:26	51.2	10/8/2014 14:31	56.4	11/8/2014 19:36	63.3	13/8/2014 20:41	55.6
9/8/2014 21:31	45.1	10/8/2014 14:36	37.3	11/8/2014 19:41	63.3	13/8/2014 20:46	57.6
9/8/2014 21:36	63.6	10/8/2014 14:41	52.7	11/8/2014 19:46			

Real-time Noise Data		RTN4 (Causeway Bay Community Centre)									
17/8/2014 11:36	63.0	17/8/2014 20:41	63.4	19/8/2014 21:46	63.4	21/8/2014 22:51	63.7	24/8/2014 7:56	61.8	24/8/2014 17:01	50.4
17/8/2014 11:41	50.4	17/8/2014 20:46	63.5	19/8/2014 21:51	43.4	21/8/2014 22:56	37.3	24/8/2014 8:01	58.3	24/8/2014 17:06	63.6
17/8/2014 11:46	63.0	17/8/2014 20:51	58.3	19/8/2014 21:56	63.3	22/8/2014 19:01	62.9	24/8/2014 8:06	62.0	24/8/2014 17:11	63.4
17/8/2014 11:51	63.5	17/8/2014 20:56	63.4	19/8/2014 22:01	63.4	22/8/2014 19:06	62.3	24/8/2014 8:11	62.7	24/8/2014 17:16	63.3
17/8/2014 11:56	63.3	17/8/2014 21:01	46.9	19/8/2014 22:06	46.9	22/8/2014 19:11	61.6	24/8/2014 8:16	58.2	24/8/2014 17:21	52.5
17/8/2014 12:01	63.0	17/8/2014 21:06	63.7	19/8/2014 22:11	42.1	22/8/2014 19:16	61.6	24/8/2014 8:21	63.4	24/8/2014 17:26	63.5
17/8/2014 12:06	63.0	17/8/2014 21:11	47.8	19/8/2014 22:16	53.8	22/8/2014 19:21	61.9	24/8/2014 8:26	62.2	24/8/2014 17:31	63.5
17/8/2014 12:11	63.2	17/8/2014 21:16	63.5	19/8/2014 22:21	42.1	22/8/2014 19:26	62.5	24/8/2014 8:31	62.5	24/8/2014 17:36	63.2
17/8/2014 12:16	62.1	17/8/2014 21:21	46.4	19/8/2014 22:26	63.5	22/8/2014 19:31	62.4	24/8/2014 8:36	63.0	24/8/2014 17:41	63.4
17/8/2014 12:21	62.6	17/8/2014 21:26	63.3	19/8/2014 22:31	63.4	22/8/2014 19:36	63.7	24/8/2014 8:41	63.5	24/8/2014 17:46	63.2
17/8/2014 12:26	62.8	17/8/2014 21:31	54.8	19/8/2014 22:36	51.2	22/8/2014 19:41	55.9	24/8/2014 8:46	63.5	24/8/2014 17:51	63.3
17/8/2014 12:31	62.7	17/8/2014 21:36	63.2	19/8/2014 22:41	63.6	22/8/2014 19:46	58.0	24/8/2014 8:51	51.6	24/8/2014 17:56	50.2
17/8/2014 12:36	62.0	17/8/2014 21:41	44.3	19/8/2014 22:46	50.6	22/8/2014 19:51	55.9	24/8/2014 8:56	54.1	24/8/2014 18:01	45.1
17/8/2014 12:41	61.4	17/8/2014 21:46	62.7	19/8/2014 22:51	63.3	22/8/2014 19:56	58.2	24/8/2014 9:01	53.5	24/8/2014 18:06	63.6
17/8/2014 12:46	61.0	17/8/2014 21:51	63.2	19/8/2014 22:56	46.9	22/8/2014 20:01	59.8	24/8/2014 9:06	53.5	24/8/2014 18:11	55.1
17/8/2014 12:51	61.2	17/8/2014 21:56	63.1	20/8/2014 19:01	61.1	22/8/2014 20:06	57.5	24/8/2014 9:11	56.5	24/8/2014 18:16	50.4
17/8/2014 12:56	61.6	17/8/2014 22:01	63.3	20/8/2014 19:06	61.5	22/8/2014 20:11	55.4	24/8/2014 9:16	56.1	24/8/2014 18:21	43.4
17/8/2014 13:01	62.0	17/8/2014 22:06	63.2	20/8/2014 19:11	62.9	22/8/2014 20:16	57.6	24/8/2014 9:21	58.2	24/8/2014 18:26	54.7
17/8/2014 13:06	62.5	17/8/2014 22:11	63.2	20/8/2014 19:16	56.6	22/8/2014 20:21	63.7	24/8/2014 9:26	54.5	24/8/2014 18:31	52.4
17/8/2014 13:11	62.2	17/8/2014 22:16	63.6	20/8/2014 19:21	57.4	22/8/2014 20:26	59.1	24/8/2014 9:31	54.8	24/8/2014 18:36	52.2
17/8/2014 13:16	62.4	17/8/2014 22:21	46.4	20/8/2014 19:26	59.2	22/8/2014 20:31	58.0	24/8/2014 9:36	58.2	24/8/2014 18:41	63.6
17/8/2014 13:21	62.4	17/8/2014 22:26	63.6	20/8/2014 19:31	59.6	22/8/2014 20:36	56.4	24/8/2014 9:41	54.0	24/8/2014 18:46	49.2
17/8/2014 13:26	61.8	17/8/2014 22:31	63.5	20/8/2014 19:36	58.3	22/8/2014 20:41	58.7	24/8/2014 9:46	55.9	24/8/2014 18:51	58.3
17/8/2014 13:31	62.4	17/8/2014 22:36	62.9	20/8/2014 19:41	56.6	22/8/2014 20:46	61.3	24/8/2014 9:51	63.7	24/8/2014 18:56	54.9
17/8/2014 13:36	62.4	17/8/2014 22:41	62.7	20/8/2014 19:46	56.9	22/8/2014 20:51	51.8	24/8/2014 9:56	55.8	24/8/2014 19:01	63.7
17/8/2014 13:41	62.5	17/8/2014 22:46	43.4	20/8/2014 19:51	58.8	22/8/2014 20:56	58.3	24/8/2014 10:01	52.4	24/8/2014 19:06	52.1
17/8/2014 13:46	63.1	17/8/2014 22:51	63.6	20/8/2014 19:56	58.9	22/8/2014 21:01	57.4	24/8/2014 10:06	53.1	24/8/2014 19:11	48.2
17/8/2014 13:51	63.1	17/8/2014 22:56	62.6	20/8/2014 20:01	55.7	22/8/2014 21:06	50.9	24/8/2014 10:11	57.1	24/8/2014 19:16	52.7
17/8/2014 13:56	63.7	18/8/2014 19:01	58.0	20/8/2014 20:06	57.9	22/8/2014 21:11	50.4	24/8/2014 10:16	63.6	24/8/2014 19:21	54.7
17/8/2014 14:01	63.2	18/8/2014 19:06	57.9	20/8/2014 20:11	59.5	22/8/2014 21:16	57.2	24/8/2014 10:21	63.2	24/8/2014 19:26	52.1
17/8/2014 14:06	63.2	18/8/2014 19:11	59.6	20/8/2014 20:16	58.7	22/8/2014 21:21	56.6	24/8/2014 10:26	63.6	24/8/2014 19:31	50.9
17/8/2014 14:11	63.1	18/8/2014 19:16	56.3	20/8/2014 20:21	56.9	22/8/2014 21:26	64.9	24/8/2014 10:31	63.3	24/8/2014 19:36	50.9
17/8/2014 14:16	63.2	18/8/2014 19:21	59.0	20/8/2014 20:26	57.8	22/8/2014 21:31	55.2	24/8/2014 10:36	63.1	24/8/2014 19:41	53.2
17/8/2014 14:21	63.2	18/8/2014 19:26	59.3	20/8/2014 20:31	57.0	22/8/2014 21:36	63.6	24/8/2014 10:41	63.1	24/8/2014 19:46	52.9
17/8/2014 14:26	63.6	18/8/2014 19:31	58.8	20/8/2014 20:36	58.7	22/8/2014 21:41	53.2	24/8/2014 10:46	63.6	24/8/2014 19:51	63.6
17/8/2014 14:31	50.4	18/8/2014 19:36	58.1	20/8/2014 20:41	56.7	22/8/2014 21:46	37.3	24/8/2014 10:51	62.8	24/8/2014 19:56	54.3
17/8/2014 14:36	63.3	18/8/2014 19:41	55.2	20/8/2014 20:46	59.5	22/8/2014 21:51	52.4	24/8/2014 10:56	48.2	24/8/2014 20:01	63.4
17/8/2014 14:41	56.7	18/8/2014 19:46	57.2	20/8/2014 20:51	54.7	22/8/2014 21:56	63.6	24/8/2014 11:01	49.4	24/8/2014 20:06	63.7
17/8/2014 14:46	52.7	18/8/2014 19:51	58.1	20/8/2014 20:56	58.1	22/8/2014 22:01	54.8	24/8/2014 11:06	63.3	24/8/2014 20:11	63.4
17/8/2014 14:51	63.7	18/8/2014 19:56	58.5	20/8/2014 21:01	57.8	22/8/2014 22:06	50.2	24/8/2014 11:11	62.9	24/8/2014 20:16	53.5
17/8/2014 14:56	63.5	18/8/2014 20:01	56.6	20/8/2014 21:06	57.0	22/8/2014 22:11	46.9	24/8/2014 11:16	63.3	24/8/2014 20:21	63.5
17/8/2014 15:01	51.6	18/8/2014 20:06	55.6	20/8/2014 21:11	55.2	22/8/2014 22:16	51.2	24/8/2014 11:21	63.1	24/8/2014 20:26	63.6
17/8/2014 15:06	51.8	18/8/2014 20:11	57.6	20/8/2014 21:16	58.0	22/8/2014 22:21	46.4	24/8/2014 11:26	62.9	24/8/2014 20:31	57.8
17/8/2014 15:11	63.7	18/8/2014 20:16	54.1	20/8/2014 21:21	59.1	22/8/2014 22:26	57.8	24/8/2014 11:31	63.3	24/8/2014 20:36	51.9
17/8/2014 15:16	62.6	18/8/2014 20:21	55.9	20/8/2014 21:26	55.4	22/8/2014 22:31	63.4	24/8/2014 11:36	63.4	24/8/2014 20:41	63.4
17/8/2014 15:21	62.8	18/8/2014 20:26	59.4	20/8/2014 21:31	55.2	22/8/2014 22:36	63.6	24/8/2014 11:41	63.3	24/8/2014 20:46	63.3
17/8/2014 15:26	47.8	18/8/2014 20:31	49.7	20/8/2014 21:36	56.2	22/8/2014 22:41	53.7	24/8/2014 11:46	63.4	24/8/2014 20:51	63.4
17/8/2014 15:31	63.6	18/8/2014 20:36	55.4	20/8/2014 21:41	56.5	22/8/2014 22:46	63.7	24/8/2014 11:51	49.7	24/8/2014 20:56	63.4
17/8/2014 15:36	56.8	18/8/2014 20:41	55.6	20/8/2014 21:46	57.9	22/8/2014 22:51	63.6	24/8/2014 11:56	63.5	24/8/2014 21:01	62.8
17/8/2014 15:41	63.5	18/8/2014 20:46	45.8	20/8/2014 21:51	58.7	22/8/2014 22:56	63.2	24/8/2014 12:01	62.9	24/8/2014 21:06	61.2
17/8/2014 15:46	56.1	18/8/2014 20:51	55.3	20/8/2014 21:56	54.5	23/8/2014 19:01	58.0	24/8/2014 12:06	63.7	24/8/2014 21:11	61.0
17/8/2014 15:51	57.4	18/8/2014 20:56	63.5	20/8/2014 22:01	51.6	23/8/2014 19:06	55.6	24/8/2014 12:11	63.1	24/8/2014 21:16	62.0
17/8/2014 15:56	58.2	18/8/2014 21:01	49.2	20/8/2014 22:06	54.6	23/8/2014 19:11	57.5	24/8/2014 12:16	62.9	24/8/2014 21:21	63.0
17/8/2014 16:01	54.6	18/8/2014 21:06	52.8	20/8/2014 22:11	50.4	23/8/2014 19:16	57.8	24/8/2014 12:21	62.7	24/8/2014 21:26	63.4
17/8/2014 16:06	63.6	18/8/2014 21:11	53.5	20/8/2014 22:16	54.7	23/8/2014 19:21	63.6	24/8/2014 12:26	63.3	24/8/2014 21:31	62.9
17/8/2014 16:11	63.3	18/8/2014 21:16	42.1	20/8/2014 22:21	54.6	23/8/2014 19:26	63.7	24/8/2014 12:31	44.3	24/8/2014 21:36	63.4
17/8/2014 16:16	52.7	18/8/2014 21:21	57.8	20/8/2014 22:26	49.7	23/8/2014 19:31	63.4	24/8/2014 12:36	63.0	24/8/2014 21:41	63.1
17/8/2014 16:21	52.9	18/8/2014 21:26	54.0	20/8/2014 22:31	55.1	23/8/2014 19:36	50.0	24/8/2014 12:41	62.7	24/8/2014 21:46	63.1
17/8/2014 16:26	58.1	18/8/2014 21:31	63.7	20/8/2014 22:36	52.9	23/8/2014 19:41	47.4	24/8/2014 12:46	50.9	24/8/2014 21:51	62.6
17/8/2014 16:31	59.4	18/8/2014 21:36	60.8	20/8/2014 22:41	55.7	23/8/2014 19:46	63.7	24/8/2014 12:51	43.4	24/8/2014 21:56	62.6
17/8/2014 16:36	58.3	18/8/2014 21:41	49.4	20/8/2014 22:46	51.2	23/8/2014 19:51	54.0	24/8/2014 12:56	63.7	24/8/2014 22:01	63.0
17/8/2014 16:41	48.9	18/8/2014 21:46	52.8	20/8/2014 22:51	51.9	23/8/2014 19:56	54.8	24/8/2014 13:01	62.9	24/8/2014 22:06	63.3
17/8/2014 16:46	57.1	18/8/2014 21:51	62.9	20/8/2014 22:56	63.5	23/8/2014 20:01	45.1	24/8/2014 13:06	63.5	24/8/2014 22:11	62.9
17/8/2014 16:51	62.1	18/8/2014 21:56	63.0	21/8/2014 19:01	61.8	23/8/2014 20:06	63.5	24/8/2014 13:11	62.6	24/8/2014 22:16	63.5
17/8/2014 16:56	56.6	18/8/2014 22:01	63.0	21/8/2014 19:06	61.1	23/8/2014 20:11	53.9	24/8/2014 13:16	61.8	24/8/2014 22:21	63.5
17/8/2014 17:01	58.9	18/8/2014 22:06	62.9	21/8/2014 19:11	61.7	23/8/2014 20:16	52.8	24/8/2014 13:21	61.6	24/8/2014 22:26	63.3
17/8/2014 17:06	57.5	18/8/2014 22:11	62.8	21/8/2014 19:16	62.8	23/8/2014 20:21	63.5	24/8/2014 13:26	61.6	24/8/2014 22:31	63.4
17/8/2014 17:11	53.9	18/8/2014 22:16	63.4	21/8/2014 19:21	62.6	23/8/2014 20:26	63.4	24/8/2014 13:31	61.5	24/8/2014 22:36	63.4
17/8/2014 17:16	63.6	18/8/2014 22:21	63.5	21/8/2014 19:26	63.2	23/8/2014 20:31	63.4				

Real-time Noise Data		RTN4 (Causeway Bay Community Centre)	
25/8/2014 22:06	63.5		29/7/2014 0:51 52.7
25/8/2014 22:11	63.1	Night time: 23:00-07:00	29/7/2014 0:56 60.9
25/8/2014 22:16	63.0		29/7/2014 1:01 60.3
25/8/2014 22:21	62.5	28/7/2014 0:01 57.2	29/7/2014 1:06 59.2
25/8/2014 22:26	62.9	28/7/2014 0:06 59.3	29/7/2014 1:11 60.2
25/8/2014 22:31	62.8	28/7/2014 0:11 46.4	29/7/2014 1:16 59.9
25/8/2014 22:36	63.0	28/7/2014 0:16 51.6	29/7/2014 1:21 46.1
25/8/2014 22:41	63.3	28/7/2014 0:21 53.7	29/7/2014 1:26 59.2
25/8/2014 22:46	63.2	28/7/2014 0:26 49.0	29/7/2014 1:31 59.5
25/8/2014 22:51	62.8	28/7/2014 0:31 60.7	29/7/2014 1:36 60.5
25/8/2014 22:56	62.5	28/7/2014 0:36 60.2	29/7/2014 1:41 60.5
26/8/2014 19:01	61.1	28/7/2014 0:41 60.6	29/7/2014 1:46 60.7
26/8/2014 19:06	53.8	28/7/2014 0:46 51.9	29/7/2014 1:51 58.6
26/8/2014 19:11	58.6	28/7/2014 0:51 60.0	29/7/2014 1:56 59.1
26/8/2014 19:16	59.6	28/7/2014 0:56 60.3	29/7/2014 2:01 58.9
26/8/2014 19:21	59.8	28/7/2014 1:01 49.0	29/7/2014 2:06 58.8
26/8/2014 19:26	60.8	28/7/2014 1:06 59.3	29/7/2014 2:11 57.6
26/8/2014 19:31	60.9	28/7/2014 1:11 59.3	29/7/2014 2:16 58.8
26/8/2014 19:36	58.9	28/7/2014 1:16 60.9	29/7/2014 2:21 57.8
26/8/2014 19:41	59.3	28/7/2014 1:21 59.2	29/7/2014 2:26 57.8
26/8/2014 19:46	54.6	28/7/2014 1:26 59.3	29/7/2014 2:31 59.8
26/8/2014 19:51	57.3	28/7/2014 1:31 47.6	29/7/2014 2:36 57.9
26/8/2014 19:56	57.9	28/7/2014 1:36 59.6	29/7/2014 2:41 57.8
26/8/2014 20:01	57.3	28/7/2014 1:41 60.2	29/7/2014 2:46 58.2
26/8/2014 20:06	57.5	28/7/2014 1:46 59.8	29/7/2014 2:51 58.6
26/8/2014 20:11	58.0	28/7/2014 1:51 57.1	29/7/2014 2:56 57.3
26/8/2014 20:16	54.1	28/7/2014 1:56 59.2	29/7/2014 3:01 58.3
26/8/2014 20:21	52.9	28/7/2014 2:01 58.8	29/7/2014 3:06 57.6
26/8/2014 20:26	47.4	28/7/2014 2:06 58.3	29/7/2014 3:11 57.0
26/8/2014 20:31	56.9	28/7/2014 2:11 57.7	29/7/2014 3:16 57.3
26/8/2014 20:36	54.6	28/7/2014 2:16 60.2	29/7/2014 3:21 56.3
26/8/2014 20:41	53.2	28/7/2014 2:21 58.2	29/7/2014 3:26 57.7
26/8/2014 20:46	56.9	28/7/2014 2:26 57.2	29/7/2014 3:31 58.3
26/8/2014 20:51	56.3	28/7/2014 2:31 57.4	29/7/2014 3:36 58.5
26/8/2014 20:56	51.2	28/7/2014 2:36 57.7	29/7/2014 3:41 58.7
26/8/2014 21:01	52.1	28/7/2014 2:41 58.9	29/7/2014 3:46 57.4
26/8/2014 21:06	54.5	28/7/2014 2:46 48.3	29/7/2014 3:51 58.3
26/8/2014 21:11	58.4	28/7/2014 2:51 58.3	29/7/2014 3:56 57.7
26/8/2014 21:16	50.9	28/7/2014 2:56 59.8	29/7/2014 4:01 59.0
26/8/2014 21:21	48.9	28/7/2014 3:01 57.0	29/7/2014 4:06 58.0
26/8/2014 21:26	48.9	28/7/2014 3:06 58.8	29/7/2014 4:11 57.2
26/8/2014 21:31	49.4	28/7/2014 3:11 57.7	29/7/2014 4:16 57.1
26/8/2014 21:36	53.8	28/7/2014 3:16 58.0	29/7/2014 4:21 56.2
26/8/2014 21:41	51.8	28/7/2014 3:21 57.2	29/7/2014 4:26 58.0
26/8/2014 21:46	63.7	28/7/2014 3:26 56.4	29/7/2014 4:31 58.0
26/8/2014 21:51	63.0	28/7/2014 3:31 57.6	29/7/2014 4:36 57.2
26/8/2014 21:56	63.2	28/7/2014 3:36 56.2	29/7/2014 4:41 57.7
26/8/2014 22:01	63.3	28/7/2014 3:41 55.5	29/7/2014 4:46 59.6
26/8/2014 22:06	63.5	28/7/2014 3:46 59.5	29/7/2014 4:51 57.4
26/8/2014 22:11	63.0	28/7/2014 3:51 57.2	29/7/2014 4:56 57.0
26/8/2014 22:16	53.7	28/7/2014 3:56 57.1	29/7/2014 5:01 58.3
26/8/2014 22:21	63.5	28/7/2014 4:01 56.2	29/7/2014 5:06 58.8
26/8/2014 22:26	63.6	28/7/2014 4:06 56.7	29/7/2014 5:11 57.1
26/8/2014 22:31	63.3	28/7/2014 4:11 55.9	29/7/2014 5:16 58.3
26/8/2014 22:36	63.0	28/7/2014 4:16 57.0	29/7/2014 5:21 58.9
26/8/2014 22:41	63.1	28/7/2014 4:21 56.9	29/7/2014 5:26 59.3
26/8/2014 22:46	63.3	28/7/2014 4:26 58.1	29/7/2014 5:31 59.5
26/8/2014 22:51	63.0	28/7/2014 4:31 58.4	29/7/2014 5:36 59.4
26/8/2014 22:56	62.5	28/7/2014 4:36 55.8	29/7/2014 5:41 59.6
27/8/2014 19:01	52.4	28/7/2014 4:41 57.4	29/7/2014 5:46 60.6
27/8/2014 19:06	54.6	28/7/2014 4:46 56.1	29/7/2014 5:51 60.3
27/8/2014 19:11	62.9	28/7/2014 4:51 58.6	29/7/2014 5:56 59.9
27/8/2014 19:16	63.3	28/7/2014 4:56 58.5	29/7/2014 6:01 60.6
27/8/2014 19:21	40.3	28/7/2014 5:01 58.3	29/7/2014 6:06 51.9
27/8/2014 19:26	52.5	28/7/2014 5:06 57.6	29/7/2014 6:11 55.8
27/8/2014 19:31	63.2	28/7/2014 5:11 58.2	29/7/2014 6:16 54.1
27/8/2014 19:36	63.5	28/7/2014 5:16 60.1	29/7/2014 6:21 55.8
27/8/2014 19:41	52.2	28/7/2014 5:21 57.9	29/7/2014 6:26 56.5
27/8/2014 19:46	58.9	28/7/2014 5:26 57.5	29/7/2014 6:31 58.7
27/8/2014 19:51	56.8	28/7/2014 5:31 59.5	29/7/2014 6:36 60.4
27/8/2014 19:56	63.4	28/7/2014 5:36 59.6	29/7/2014 6:41 61.0
27/8/2014 20:01	51.9	28/7/2014 5:41 60.3	29/7/2014 6:46 61.4
27/8/2014 20:06	56.3	28/7/2014 5:46 50.4	29/7/2014 6:51 60.8
27/8/2014 20:11	56.3	28/7/2014 5:51 60.3	29/7/2014 6:56 60.2
27/8/2014 20:16	63.7	28/7/2014 5:56 60.2	29/7/2014 7:01 60.2
27/8/2014 20:21	63.5	28/7/2014 6:01 49.4	29/7/2014 7:06 58.6
27/8/2014 20:26	63.5	28/7/2014 6:06 49.3	29/7/2014 7:11 59.4
27/8/2014 20:31	53.7	28/7/2014 6:11 60.6	29/7/2014 7:16 60.4
27/8/2014 20:36	63.1	28/7/2014 6:16 53.1	29/7/2014 7:21 58.9
27/8/2014 20:41	54.9	28/7/2014 6:21 57.9	29/7/2014 7:26 58.9
27/8/2014 20:46	62.9	28/7/2014 6:26 58.9	29/7/2014 7:31 58.2
27/8/2014 20:51	62.8	28/7/2014 6:31 59.4	29/7/2014 7:36 56.5
27/8/2014 20:56	62.9	28/7/2014 6:36 60.7	29/7/2014 7:41 60.5
27/8/2014 21:01	62.8	28/7/2014 6:41 60.6	29/7/2014 7:46 56.7
27/8/2014 21:06	62.6	28/7/2014 6:46 61.7	29/7/2014 7:51 58.4
27/8/2014 21:11	63.0	28/7/2014 6:51 60.1	29/7/2014 7:56 57.8
27/8/2014 21:16	63.5	28/7/2014 6:56 61.3	30/7/2014 0:01 54.6
27/8/2014 21:21	63.0	28/7/2014 7:01 59.7	30/7/2014 0:06 54.1
27/8/2014 21:26	62.8	28/7/2014 7:06 59.6	30/7/2014 0:11 53.5
27/8/2014 21:31	62.6	28/7/2014 7:11 58.4	30/7/2014 0:16 56.8
27/8/2014 21:36	62.2	28/7/2014 7:16 59.1	30/7/2014 0:21 53.8
27/8/2014 21:41	62.9	28/7/2014 7:21 57.8	30/7/2014 0:26 56.1
27/8/2014 21:46	62.6	28/7/2014 7:26 58.7	30/7/2014 0:31 49.9
27/8/2014 21:51	62.5	28/7/2014 7:31 55.5	30/7/2014 0:36 51.1
27/8/2014 21:56	63.1	28/7/2014 7:36 58.0	30/7/2014 0:41 60.5
27/8/2014 22:01	47.4	28/7/2014 7:41 58.1	30/7/2014 0:46 60.8
27/8/2014 22:06	63.5	28/7/2014 7:46 54.8	30/7/2014 0:51 60.6
27/8/2014 22:11	63.6	28/7/2014 7:51 57.7	30/7/2014 0:56 60.3
27/8/2014 22:16	63.7	28/7/2014 7:56 58.2	30/7/2014 1:01 60.7
27/8/2014 22:21	63.6	29/7/2014 0:01 57.9	30/7/2014 1:06 60.7
27/8/2014 22:26	63.4	29/7/2014 0:06 56.7	30/7/2014 1:11 53.8
27/8/2014 22:31	52.4	29/7/2014 0:11 55.9	30/7/2014 1:16 59.4
27/8/2014 22:36	63.0	29/7/2014 0:16 55.2	30/7/2014 1:21 58.4
27/8/2014 22:41	63.6	29/7/2014 0:21 59.0	30/7/2014 1:26 60.6
27/8/2014 22:46	63.5	29/7/2014 0:26 52.8	30/7/2014 1:31 60.3
27/8/2014 22:51	63.3	29/7/2014 0:31 52.8	30/7/2014 1:36 60.2
27/8/2014 22:56	63.0	29/7/2014 0:36 45.7	30/7/2014 1:41 59.8
		29/7/2014 0:41 60.7	30/7/2014 1:46 59.1
		29/7/2014 0:46 60.9	30/7/2014 1:51 59.8
			30/7/2014 1:56 58.6
			30/7/2014 2:01 59.1
			30/7/2014 2:06 58.0
			30/7/2014 2:11 59.1
			30/7/2014 2:16 58.4
			30/7/2014 2:21 57.5
			30/7/2014 2:26 59.7
			30/7/2014 2:31 59.0
			30/7/2014 2:36 58.1
			30/7/2014 2:41 57.8
			30/7/2014 2:46 57.6
			30/7/2014 2:51 58.0
			30/7/2014 2:56 59.2
			30/7/2014 3:01 58.1
			30/7/2014 3:06 58.3
			30/7/2014 3:11 57.5
			30/7/2014 3:16 56.4
			30/7/2014 3:21 58.3
			30/7/2014 3:26 58.8
			30/7/2014 3:31 57.8
			30/7/2014 3:36 57.4
			30/7/2014 3:41 59.7
			30/7/2014 3:46 56.9
			30/7/2014 3:51 56.8
			30/7/2014 3:56 55.9
			30/7/2014 4:01 57.9
			30/7/2014 4:06 57.2
			30/7/2014 4:11 59.0
			30/7/2014 4:16 57.1
			30/7/2014 4:21 55.9
			30/7/2014 4:26 57.3
			30/7/2014 4:31 58.1
			30/7/2014 4:36 57.6
			30/7/2014 4:41 56.4
			30/7/2014 4:46 57.3
			30/7/2014 4:51 57.9
			30/7/2014 4:56 56.9
			30/7/2014 5:01 57.9
			30/7/2014 5:06 43.6
			30/7/2014 5:11 57.9
			30/7/2014 5:16 58.8
			30/7/2014 5:21 50.4
			30/7/2014 5:26 55.8
			30/7/2014 5:31 58.5
			30/7/2014 5:36 57.8
			30/7/2014 5:41 59.8
			30/7/2014 5:46 60.1
			30/7/2014 5:51 60.3
			30/7/2014 5:56 59.7
			30/7/2014 6:01 58.8
			30/7/2014 6:06 58.9
			30/7/2014 6:11 58.5
			30/7/2014 6:16 59.0
			30/7/2014 6:21 59.9
			30/7/2014 6:26 58.8
			30/7/2014 6:31 56.4
			30/7/2014 6:36 58.4
			30/7/2014 6:41 59.5
			30/7/2014 6:46 59.6
			30/7/2014 6:51 58.9
			30/7/2014 6:56 59.1
			30/7/2014 7:01 59.0
			30/7/2014 7:06 60.3
			30/7/2014 7:11 58.1
			30/7/2014 7:16 59.4
			30/7/2014 7:21 58.3
			30/7/2014 7:26 58.9
			30/7/2014 7:31 58.2
			30/7/2014 7:36 56.5
			30/7/2014 7:41 60.5
			30/7/2014 7:46 56.7
			30/7/2014 7:51 58.4
			30/7/2014 7:56 57.8
			30/7/2014 8:01 54.6
			30/7/2014 8:06 54.1
			30/7/2014 8:11 53.5
			30/7/2014 8:16 56.8
			30/7/2014 8:21 53.8
			30/7/2014 8:26 56.1

Real-time Noise Data		RTN4 (Causeway Bay Community Centre)									
2/8/2014 5:11	37.5	3/8/2014 6:16	57.0	4/8/2014 23:21	58.0	6/8/2014 0:26	51.8	7/8/2014 1:31	60.8	8/8/2014 2:36	59.5
2/8/2014 5:16	59.5	3/8/2014 6:21	59.4	4/8/2014 23:26	58.4	6/8/2014 0:31	53.1	7/8/2014 1:36	60.4	8/8/2014 2:41	58.8
2/8/2014 5:21	59.9	3/8/2014 6:26	59.0	4/8/2014 23:31	58.1	6/8/2014 0:36	60.5	7/8/2014 1:41	53.7	8/8/2014 2:46	59.3
2/8/2014 5:26	58.9	3/8/2014 6:31	57.3	4/8/2014 23:36	58.4	6/8/2014 0:41	60.4	7/8/2014 1:46	60.7	8/8/2014 2:51	59.7
2/8/2014 5:31	60.4	3/8/2014 6:36	57.7	4/8/2014 23:41	55.8	6/8/2014 0:46	60.0	7/8/2014 1:51	60.5	8/8/2014 2:56	59.6
2/8/2014 5:36	60.3	3/8/2014 6:41	58.4	4/8/2014 23:46	57.8	6/8/2014 0:51	60.1	7/8/2014 1:56	60.2	8/8/2014 3:01	58.9
2/8/2014 5:41	40.6	3/8/2014 6:46	65.2	4/8/2014 23:51	58.5	6/8/2014 0:56	59.9	7/8/2014 2:01	60.0	8/8/2014 3:06	59.1
2/8/2014 5:46	52.2	3/8/2014 6:51	57.0	4/8/2014 23:56	56.8	6/8/2014 1:01	65.5	7/8/2014 2:06	60.0	8/8/2014 3:11	59.5
2/8/2014 5:51	34.5	3/8/2014 6:56	58.3	5/8/2014 0:01	57.3	6/8/2014 1:06	56.9	7/8/2014 2:11	59.6	8/8/2014 3:16	59.6
2/8/2014 5:56	60.5	3/8/2014 23:01	57.2	5/8/2014 0:06	56.3	6/8/2014 1:11	53.1	7/8/2014 2:16	59.4	8/8/2014 3:21	58.2
2/8/2014 6:01	49.0	3/8/2014 23:06	58.7	5/8/2014 0:11	56.8	6/8/2014 1:16	51.7	7/8/2014 2:21	58.4	8/8/2014 3:26	58.5
2/8/2014 6:06	53.0	3/8/2014 23:11	58.3	5/8/2014 0:16	51.0	6/8/2014 1:21	60.4	7/8/2014 2:26	60.4	8/8/2014 3:31	59.8
2/8/2014 6:11	54.9	3/8/2014 23:16	58.2	5/8/2014 0:21	56.3	6/8/2014 1:26	60.3	7/8/2014 2:31	60.8	8/8/2014 3:36	59.1
2/8/2014 6:16	54.2	3/8/2014 23:21	55.5	5/8/2014 0:26	60.6	6/8/2014 1:31	59.9	7/8/2014 2:36	59.9	8/8/2014 3:41	59.6
2/8/2014 6:21	56.9	3/8/2014 23:26	54.5	5/8/2014 0:31	54.3	6/8/2014 1:36	59.7	7/8/2014 2:41	59.7	8/8/2014 3:46	59.8
2/8/2014 6:26	57.8	3/8/2014 23:31	57.8	5/8/2014 0:36	53.8	6/8/2014 1:41	60.6	7/8/2014 2:46	59.0	8/8/2014 3:51	58.3
2/8/2014 6:31	58.2	3/8/2014 23:36	58.8	5/8/2014 0:41	60.5	6/8/2014 1:46	60.0	7/8/2014 2:51	58.0	8/8/2014 3:56	59.5
2/8/2014 6:36	59.1	3/8/2014 23:41	56.8	5/8/2014 0:46	60.1	6/8/2014 1:51	59.0	7/8/2014 2:56	59.4	8/8/2014 4:01	58.6
2/8/2014 6:41	60.0	3/8/2014 23:46	51.8	5/8/2014 0:51	47.8	6/8/2014 1:56	59.1	7/8/2014 3:01	58.4	8/8/2014 4:06	58.7
2/8/2014 6:46	57.9	3/8/2014 23:51	59.6	5/8/2014 0:56	60.2	6/8/2014 2:01	59.7	7/8/2014 3:06	60.3	8/8/2014 4:11	57.9
2/8/2014 6:51	59.5	3/8/2014 23:56	60.7	5/8/2014 1:01	60.3	6/8/2014 2:06	58.5	7/8/2014 3:11	54.6	8/8/2014 4:16	59.3
2/8/2014 6:56	59.0	4/8/2014 0:01	34.5	5/8/2014 1:06	60.6	6/8/2014 2:11	58.6	7/8/2014 3:16	60.2	8/8/2014 4:21	56.8
2/8/2014 23:01	60.0	4/8/2014 0:06	57.4	5/8/2014 1:11	56.6	6/8/2014 2:16	58.9	7/8/2014 3:21	56.6	8/8/2014 4:26	58.7
2/8/2014 23:06	59.7	4/8/2014 0:11	53.6	5/8/2014 1:16	59.1	6/8/2014 2:21	58.8	7/8/2014 3:26	59.4	8/8/2014 4:31	58.1
2/8/2014 23:11	59.6	4/8/2014 0:16	62.9	5/8/2014 1:21	60.7	6/8/2014 2:26	58.5	7/8/2014 3:31	59.1	8/8/2014 4:36	58.3
2/8/2014 23:16	59.8	4/8/2014 0:21	58.0	5/8/2014 1:26	59.2	6/8/2014 2:31	58.6	7/8/2014 3:36	58.3	8/8/2014 4:41	56.8
2/8/2014 23:21	56.4	4/8/2014 0:26	50.4	5/8/2014 1:31	59.2	6/8/2014 2:36	57.6	7/8/2014 3:41	58.4	8/8/2014 4:46	59.1
2/8/2014 23:26	60.1	4/8/2014 0:31	59.9	5/8/2014 1:36	59.3	6/8/2014 2:41	59.0	7/8/2014 3:46	59.1	8/8/2014 4:51	58.7
2/8/2014 23:31	59.1	4/8/2014 0:36	59.3	5/8/2014 1:41	58.2	6/8/2014 2:46	58.5	7/8/2014 3:51	59.3	8/8/2014 4:56	59.8
2/8/2014 23:36	60.2	4/8/2014 0:41	59.6	5/8/2014 1:46	59.5	6/8/2014 2:51	58.1	7/8/2014 3:56	60.5	8/8/2014 5:01	58.1
2/8/2014 23:41	60.5	4/8/2014 0:46	60.0	5/8/2014 1:51	58.0	6/8/2014 2:56	58.1	7/8/2014 4:01	57.4	8/8/2014 5:06	58.1
2/8/2014 23:46	60.4	4/8/2014 0:51	60.3	5/8/2014 1:56	58.4	6/8/2014 3:01	57.7	7/8/2014 4:06	58.2	8/8/2014 5:11	60.0
2/8/2014 23:51	59.6	4/8/2014 0:56	59.6	5/8/2014 2:01	58.0	6/8/2014 3:06	58.2	7/8/2014 4:11	58.3	8/8/2014 5:16	46.9
2/8/2014 23:56	59.4	4/8/2014 1:01	59.6	5/8/2014 2:06	58.6	6/8/2014 3:11	58.4	7/8/2014 4:16	57.3	8/8/2014 5:21	60.8
3/8/2014 0:01	59.1	4/8/2014 1:06	60.8	5/8/2014 2:11	58.0	6/8/2014 3:16	58.0	7/8/2014 4:21	57.3	8/8/2014 5:26	58.1
3/8/2014 0:06	60.3	4/8/2014 1:11	58.8	5/8/2014 2:16	58.1	6/8/2014 3:21	59.2	7/8/2014 4:26	58.5	8/8/2014 5:31	60.1
3/8/2014 0:11	61.8	4/8/2014 1:16	59.0	5/8/2014 2:21	59.9	6/8/2014 3:26	58.5	7/8/2014 4:31	58.8	8/8/2014 5:36	59.9
3/8/2014 0:16	60.7	4/8/2014 1:21	58.8	5/8/2014 2:26	57.4	6/8/2014 3:31	57.9	7/8/2014 4:36	56.8	8/8/2014 5:41	46.1
3/8/2014 0:21	60.3	4/8/2014 1:26	60.1	5/8/2014 2:31	57.3	6/8/2014 3:36	58.2	7/8/2014 4:41	56.6	8/8/2014 5:46	60.3
3/8/2014 0:26	60.6	4/8/2014 1:31	58.9	5/8/2014 2:36	56.8	6/8/2014 3:41	59.2	7/8/2014 4:46	58.3	8/8/2014 5:51	50.0
3/8/2014 0:31	58.8	4/8/2014 1:36	59.7	5/8/2014 2:41	57.8	6/8/2014 3:46	57.6	7/8/2014 4:51	58.2	8/8/2014 5:56	60.7
3/8/2014 0:36	55.1	4/8/2014 1:41	59.2	5/8/2014 2:46	56.9	6/8/2014 3:51	57.9	7/8/2014 4:56	57.9	8/8/2014 6:01	54.0
3/8/2014 0:41	57.5	4/8/2014 1:46	59.8	5/8/2014 2:51	58.5	6/8/2014 3:56	58.5	7/8/2014 5:01	58.2	8/8/2014 6:06	57.1
3/8/2014 0:46	56.5	4/8/2014 1:51	59.8	5/8/2014 2:56	57.3	6/8/2014 4:01	57.8	7/8/2014 5:06	60.2	8/8/2014 6:11	59.1
3/8/2014 0:51	54.0	4/8/2014 1:56	59.0	5/8/2014 3:01	57.3	6/8/2014 4:06	58.5	7/8/2014 5:11	59.6	8/8/2014 6:16	56.5
3/8/2014 0:56	56.6	4/8/2014 2:01	58.0	5/8/2014 3:06	57.5	6/8/2014 4:11	57.4	7/8/2014 5:16	58.2	8/8/2014 6:21	58.5
3/8/2014 1:01	54.2	4/8/2014 2:06	58.9	5/8/2014 3:11	57.2	6/8/2014 4:16	57.9	7/8/2014 5:21	51.8	8/8/2014 6:26	58.4
3/8/2014 1:06	54.6	4/8/2014 2:11	59.2	5/8/2014 3:16	57.9	6/8/2014 4:21	58.0	7/8/2014 5:26	59.0	8/8/2014 6:31	59.2
3/8/2014 1:11	53.1	4/8/2014 2:16	58.9	5/8/2014 3:21	59.4	6/8/2014 4:26	57.8	7/8/2014 5:31	60.2	8/8/2014 6:36	61.9
3/8/2014 1:16	52.4	4/8/2014 2:21	58.9	5/8/2014 3:26	57.7	6/8/2014 4:31	57.5	7/8/2014 5:36	59.7	8/8/2014 6:41	61.3
3/8/2014 1:21	56.1	4/8/2014 2:26	57.2	5/8/2014 3:31	58.4	6/8/2014 4:36	59.0	7/8/2014 5:41	60.0	8/8/2014 6:46	61.0
3/8/2014 1:26	48.1	4/8/2014 2:31	57.4	5/8/2014 3:36	55.3	6/8/2014 4:41	59.0	7/8/2014 5:46	45.7	8/8/2014 6:51	61.2
3/8/2014 1:31	51.5	4/8/2014 2:36	56.8	5/8/2014 3:41	57.0	6/8/2014 4:46	58.2	7/8/2014 5:51	59.5	8/8/2014 6:56	62.8
3/8/2014 1:36	53.3	4/8/2014 2:41	57.5	5/8/2014 3:46	57.5	6/8/2014 4:51	58.5	7/8/2014 5:56	60.0	8/8/2014 23:01	63.4
3/8/2014 1:41	52.2	4/8/2014 2:46	56.6	5/8/2014 3:51	57.7	6/8/2014 4:56	57.8	7/8/2014 6:01	47.8	8/8/2014 23:06	62.1
3/8/2014 1:46	60.7	4/8/2014 2:51	57.5	5/8/2014 3:56	57.7	6/8/2014 5:01	58.6	7/8/2014 6:06	52.0	8/8/2014 23:11	60.9
3/8/2014 1:51	50.9	4/8/2014 2:56	57.1	5/8/2014 4:01	57.4	6/8/2014 5:06	59.0	7/8/2014 6:11	53.6	8/8/2014 23:16	61.5
3/8/2014 1:56	40.6	4/8/2014 3:01	56.8	5/8/2014 4:06	57.0	6/8/2014 5:11	42.3	7/8/2014 6:16	53.3	8/8/2014 23:21	59.5
3/8/2014 2:01	60.5	4/8/2014 3:06	58.0	5/8/2014 4:11	55.9	6/8/2014 5:16	59.0	7/8/2014 6:21	54.5	8/8/2014 23:26	59.8
3/8/2014 2:06	60.6	4/8/2014 3:11	56.1	5/8/2014 4:16	57.5	6/8/2014 5:21	57.4	7/8/2014 6:26	58.8	8/8/2014 23:31	61.4
3/8/2014 2:11	60.9	4/8/2014 3:16	56.6	5/8/2014 4:21	56.7	6/8/2014 5:26	60.1	7/8/2014 6:31	59.1	8/8/2014 23:36	60.3
3/8/2014 2:16	53.4	4/8/2014 3:21	56.9	5/8/2014 4:26	56.8	6/8/2014 5:31	59.1	7/8/2014 6:36	60.7	8/8/2014 23:41	61.0
3/8/2014 2:21	44.1	4/8/2014 3:26	57.2	5/8/2014 4:31	57.3	6/8/2014 5:36	59.3	7/8/2014 6:41	61.2	8/8/2014 23:46	60.7
3/8/2014 2:26	47.8	4/8/2014 3:31	56.8	5/8/2014 4:36	56.3	6/8/2014 5:41	60.6	7/8/2014 6:46	61.0	8/8/2014 23:51	61.0
3/8/2014 2:31	47.4	4/8/2014 3:36	56.9	5/8/2014 4:41	57.5	6/8/2014 5:46	60.4	7/8/2014 6:51	61.0	8/8/2014 23:56	59.5
3/8/2014 2:36	59.4	4/8/2014 3:41	57.3	5/8/2014 4:46	57.6	6/8/2014 5:51	49.9	7/8/2014 6:56	61.3	9/8/2014 0:01	59.5
3/8/2014 2:41	53.7	4/8/2014 3:46	58.8	5/8/2014 4:51	56.9	6/8/2014 5:56	60.7	7/8/2014 23:01	61.3	9/8/2014 0:06	58.2
3/8/2014 2:46	60.8	4/8/2014 3:51	57.9	5/8/2014 4:56	55.8	6/8/2014 6:01	50.6	7/8/2014 23:06	61.7	9/8/2014 0:11	61.3
3/8/2014 2:51	51.5	4/8/2014 3:56	58.0	5/8/2014 5:01	57.9	6/8/2014 6:06	57.8	7/8/2014 23:11	59.9	9/8/2014 0:16	62.8
3/8/2014 2:56	60.8	4/8/2014 4:01	56.3	5/8/2014 5:06	59.0	6/8/2014 6:11	58.2	7/8/2014 23:16	59.8	9/8/2014 0:21	57.2
3/8/2014 3:01	57.7	4/8/2014 4:06	57.1	5/8/2014 5:11	57.4	6/8/2014 6:16	57.0	7/8/2014 23:21	60.7	9/8/2014 0:26	52.4
3/8/2014 3:06	60.2	4/8/2014 4:11	56.9	5/8/2014 5:16	57.3	6/8/2014 6:21	57.8	7/8/2014 23:26	60.4	9/8/2014 0:31	57.9
3/8/2014 3:11	60.1	4/8/2014 4:16	57.6	5/8/2014 5:21	57.5	6/8/2014 6:26	58.2	7/8/2014 23:31	59.4	9/8/2014 0:3	


Real-time Noise Data		RTN4 (Causeway Bay Community Centre)									
9/8/2014 3:41	60.5	10/8/2014 4:46	57.5	11/8/2014 5:51	60.3	12/8/2014 6:56	60.5	14/8/2014 0:01	58.1	15/8/2014 1:06	60.6
9/8/2014 3:46	60.3	10/8/2014 4:51	58.0	11/8/2014 5:56	60.3	12/8/2014 23:01	58.8	14/8/2014 0:06	57.3	15/8/2014 1:11	60.8
9/8/2014 3:51	58.7	10/8/2014 4:56	59.4	11/8/2014 6:01	60.2	12/8/2014 23:06	58.3	14/8/2014 0:11	55.3	15/8/2014 1:16	60.8
9/8/2014 3:56	58.9	10/8/2014 5:01	59.6	11/8/2014 6:06	52.3	12/8/2014 23:11	59.4	14/8/2014 0:16	55.0	15/8/2014 1:21	60.7
9/8/2014 4:01	59.7	10/8/2014 5:06	58.2	11/8/2014 6:11	49.4	12/8/2014 23:16	57.6	14/8/2014 0:21	55.5	15/8/2014 1:26	44.1
9/8/2014 4:06	59.2	10/8/2014 5:11	59.2	11/8/2014 6:16	56.2	12/8/2014 23:21	57.3	14/8/2014 0:26	55.6	15/8/2014 1:31	60.7
9/8/2014 4:11	59.6	10/8/2014 5:16	60.0	11/8/2014 6:21	55.1	12/8/2014 23:26	58.7	14/8/2014 0:31	55.2	15/8/2014 1:36	43.6
9/8/2014 4:16	58.8	10/8/2014 5:21	59.1	11/8/2014 6:26	58.1	12/8/2014 23:31	58.5	14/8/2014 0:36	56.5	15/8/2014 1:41	60.8
9/8/2014 4:21	59.4	10/8/2014 5:26	58.9	11/8/2014 6:31	60.3	12/8/2014 23:36	54.9	14/8/2014 0:41	49.4	15/8/2014 1:46	53.8
9/8/2014 4:26	59.5	10/8/2014 5:31	59.7	11/8/2014 6:36	58.9	12/8/2014 23:41	57.1	14/8/2014 0:46	51.1	15/8/2014 1:51	59.9
9/8/2014 4:31	57.2	10/8/2014 5:36	60.0	11/8/2014 6:41	59.9	12/8/2014 23:46	57.5	14/8/2014 0:51	51.4	15/8/2014 1:56	55.3
9/8/2014 4:36	59.6	10/8/2014 5:41	59.6	11/8/2014 6:46	61.0	12/8/2014 23:51	56.6	14/8/2014 0:56	48.6	15/8/2014 2:01	46.1
9/8/2014 4:41	54.5	10/8/2014 5:46	60.4	11/8/2014 6:51	61.1	12/8/2014 23:56	56.0	14/8/2014 1:01	60.5	15/8/2014 2:06	60.4
9/8/2014 4:46	59.1	10/8/2014 5:51	59.4	11/8/2014 6:56	61.0	13/8/2014 0:01	56.0	14/8/2014 1:06	44.6	15/8/2014 2:11	60.3
9/8/2014 4:51	65.0	10/8/2014 5:56	60.6	11/8/2014 23:01	58.2	13/8/2014 0:06	56.0	14/8/2014 1:11	60.0	15/8/2014 2:16	51.4
9/8/2014 4:56	58.9	10/8/2014 6:01	42.3	11/8/2014 23:06	60.0	13/8/2014 0:11	54.3	14/8/2014 1:16	48.4	15/8/2014 2:21	52.1
9/8/2014 5:01	59.4	10/8/2014 6:06	47.6	11/8/2014 23:11	60.4	13/8/2014 0:16	50.7	14/8/2014 1:21	60.1	15/8/2014 2:26	60.5
9/8/2014 5:06	58.8	10/8/2014 6:11	52.1	11/8/2014 23:16	59.6	13/8/2014 0:21	53.3	14/8/2014 1:26	41.5	15/8/2014 2:31	60.1
9/8/2014 5:11	59.8	10/8/2014 6:16	53.0	11/8/2014 23:21	56.1	13/8/2014 0:26	51.2	14/8/2014 1:31	60.8	15/8/2014 2:36	60.0
9/8/2014 5:16	59.3	10/8/2014 6:21	55.6	11/8/2014 23:26	59.4	13/8/2014 0:31	60.3	14/8/2014 1:36	60.1	15/8/2014 2:41	60.5
9/8/2014 5:21	59.5	10/8/2014 6:26	58.2	11/8/2014 23:31	59.6	13/8/2014 0:36	49.4	14/8/2014 1:41	59.5	15/8/2014 2:46	58.6
9/8/2014 5:26	50.6	10/8/2014 6:31	57.1	11/8/2014 23:36	56.3	13/8/2014 0:41	60.8	14/8/2014 1:46	58.8	15/8/2014 2:51	57.7
9/8/2014 5:31	60.3	10/8/2014 6:36	56.2	11/8/2014 23:41	55.8	13/8/2014 0:46	34.5	14/8/2014 1:51	59.5	15/8/2014 2:56	60.7
9/8/2014 5:36	60.3	10/8/2014 6:41	62.0	11/8/2014 23:46	60.0	13/8/2014 0:51	39.3	14/8/2014 1:56	45.4	15/8/2014 3:01	60.8
9/8/2014 5:41	59.4	10/8/2014 6:46	62.0	11/8/2014 23:51	59.2	13/8/2014 0:56	59.4	14/8/2014 2:01	58.8	15/8/2014 3:06	58.5
9/8/2014 5:46	51.9	10/8/2014 6:51	57.9	11/8/2014 23:56	57.2	13/8/2014 1:01	60.6	14/8/2014 2:06	59.0	15/8/2014 3:11	59.0
9/8/2014 5:51	51.3	10/8/2014 6:56	55.2	12/8/2014 0:01	54.0	13/8/2014 1:06	60.1	14/8/2014 2:11	59.7	15/8/2014 3:16	59.3
9/8/2014 5:56	60.9	10/8/2014 23:01	58.2	12/8/2014 0:06	56.6	13/8/2014 1:11	60.3	14/8/2014 2:16	58.8	15/8/2014 3:21	58.5
9/8/2014 6:01	60.9	10/8/2014 23:06	55.5	12/8/2014 0:11	55.2	13/8/2014 1:16	60.4	14/8/2014 2:21	59.5	15/8/2014 3:26	59.0
9/8/2014 6:06	53.0	10/8/2014 23:11	56.4	12/8/2014 0:16	48.3	13/8/2014 1:21	60.3	14/8/2014 2:26	59.3	15/8/2014 3:31	60.2
9/8/2014 6:11	54.0	10/8/2014 23:16	60.6	12/8/2014 0:21	53.5	13/8/2014 1:26	59.7	14/8/2014 2:31	58.7	15/8/2014 3:36	57.6
9/8/2014 6:16	54.2	10/8/2014 23:21	56.3	12/8/2014 0:26	51.8	13/8/2014 1:31	59.4	14/8/2014 2:36	58.7	15/8/2014 3:41	58.3
9/8/2014 6:21	56.7	10/8/2014 23:26	57.0	12/8/2014 0:31	46.4	13/8/2014 1:36	59.4	14/8/2014 2:41	58.7	15/8/2014 3:46	59.3
9/8/2014 6:26	56.7	10/8/2014 23:31	55.6	12/8/2014 0:36	44.1	13/8/2014 1:41	59.3	14/8/2014 2:46	59.4	15/8/2014 3:51	57.8
9/8/2014 6:31	57.8	10/8/2014 23:36	57.1	12/8/2014 0:41	59.5	13/8/2014 1:46	59.9	14/8/2014 2:51	58.2	15/8/2014 3:56	59.5
9/8/2014 6:36	57.2	10/8/2014 23:41	47.4	12/8/2014 0:46	60.6	13/8/2014 1:51	58.9	14/8/2014 2:56	57.5	15/8/2014 4:01	58.3
9/8/2014 6:41	57.7	10/8/2014 23:46	55.8	12/8/2014 0:51	59.9	13/8/2014 1:56	59.9	14/8/2014 3:01	57.2	15/8/2014 4:06	58.7
9/8/2014 6:46	59.5	10/8/2014 23:51	57.7	12/8/2014 0:56	49.0	13/8/2014 2:01	59.1	14/8/2014 3:06	57.9	15/8/2014 4:11	57.8
9/8/2014 6:51	58.7	10/8/2014 23:56	58.7	12/8/2014 1:01	60.3	13/8/2014 2:06	58.7	14/8/2014 3:11	58.2	15/8/2014 4:16	59.2
9/8/2014 6:56	60.6	11/8/2014 0:01	58.4	12/8/2014 1:06	59.8	13/8/2014 2:11	58.8	14/8/2014 3:16	58.2	15/8/2014 4:21	58.1
9/8/2014 23:01	60.0	11/8/2014 0:06	51.1	12/8/2014 1:11	60.3	13/8/2014 2:16	59.3	14/8/2014 3:21	57.7	15/8/2014 4:26	58.2
9/8/2014 23:06	58.4	11/8/2014 0:11	50.5	12/8/2014 1:16	59.7	13/8/2014 2:21	59.0	14/8/2014 3:26	58.7	15/8/2014 4:31	58.3
9/8/2014 23:11	58.4	11/8/2014 0:16	57.3	12/8/2014 1:21	60.1	13/8/2014 2:26	57.6	14/8/2014 3:31	57.7	15/8/2014 4:36	58.0
9/8/2014 23:16	61.0	11/8/2014 0:21	54.7	12/8/2014 1:26	59.5	13/8/2014 2:31	58.2	14/8/2014 3:36	56.6	15/8/2014 4:41	57.9
9/8/2014 23:21	58.0	11/8/2014 0:26	46.9	12/8/2014 1:31	44.1	13/8/2014 2:36	58.8	14/8/2014 3:41	57.8	15/8/2014 4:46	58.3
9/8/2014 23:26	58.9	11/8/2014 0:31	53.9	12/8/2014 1:36	58.8	13/8/2014 2:41	57.7	14/8/2014 3:46	58.6	15/8/2014 4:51	58.3
9/8/2014 23:31	59.7	11/8/2014 0:36	52.8	12/8/2014 1:41	58.8	13/8/2014 2:46	57.7	14/8/2014 3:51	57.8	15/8/2014 4:56	59.6
9/8/2014 23:36	56.5	11/8/2014 0:41	45.4	12/8/2014 1:46	59.3	13/8/2014 2:51	58.6	14/8/2014 3:56	58.2	15/8/2014 5:01	58.5
9/8/2014 23:41	58.7	11/8/2014 0:46	50.3	12/8/2014 1:51	60.4	13/8/2014 2:56	57.7	14/8/2014 4:01	58.2	15/8/2014 5:06	58.5
9/8/2014 23:46	62.0	11/8/2014 0:51	60.2	12/8/2014 1:56	58.5	13/8/2014 3:01	57.9	14/8/2014 4:06	57.6	15/8/2014 5:11	59.1
9/8/2014 23:51	60.1	11/8/2014 0:56	59.7	12/8/2014 2:01	59.3	13/8/2014 3:06	58.1	14/8/2014 4:11	58.1	15/8/2014 5:16	60.4
9/8/2014 23:56	58.1	11/8/2014 1:01	59.6	12/8/2014 2:06	59.1	13/8/2014 3:11	58.1	14/8/2014 4:16	57.3	15/8/2014 5:21	59.6
10/8/2014 0:01	57.5	11/8/2014 1:06	58.4	12/8/2014 2:11	58.6	13/8/2014 3:16	57.7	14/8/2014 4:21	58.0	15/8/2014 5:26	59.9
10/8/2014 0:06	59.8	11/8/2014 1:11	58.9	12/8/2014 2:16	58.7	13/8/2014 3:21	58.0	14/8/2014 4:26	57.8	15/8/2014 5:31	60.7
10/8/2014 0:11	57.3	11/8/2014 1:16	59.7	12/8/2014 2:21	59.2	13/8/2014 3:26	56.5	14/8/2014 4:31	58.2	15/8/2014 5:36	55.4
10/8/2014 0:16	61.4	11/8/2014 1:21	58.7	12/8/2014 2:26	58.2	13/8/2014 3:31	57.8	14/8/2014 4:36	57.1	15/8/2014 5:41	60.4
10/8/2014 0:21	56.7	11/8/2014 1:26	58.9	12/8/2014 2:31	58.5	13/8/2014 3:36	58.2	14/8/2014 4:41	57.4	15/8/2014 5:46	49.6
10/8/2014 0:26	54.3	11/8/2014 1:31	58.8	12/8/2014 2:36	57.9	13/8/2014 3:41	57.4	14/8/2014 4:46	57.3	15/8/2014 5:51	51.7
10/8/2014 0:31	56.4	11/8/2014 1:36	60.6	12/8/2014 2:41	58.5	13/8/2014 3:46	57.8	14/8/2014 4:51	58.8	15/8/2014 5:56	48.4
10/8/2014 0:36	61.4	11/8/2014 1:41	59.0	12/8/2014 2:46	59.2	13/8/2014 3:51	57.7	14/8/2014 4:56	58.7	15/8/2014 6:01	54.8
10/8/2014 0:41	60.8	11/8/2014 1:46	57.9	12/8/2014 2:51	56.9	13/8/2014 3:56	57.6	14/8/2014 5:01	58.6	15/8/2014 6:06	54.3
10/8/2014 0:46	51.5	11/8/2014 1:51	58.8	12/8/2014 2:56	57.1	13/8/2014 4:01	58.8	14/8/2014 5:06	58.4	15/8/2014 6:11	58.2
10/8/2014 0:51	49.6	11/8/2014 1:56	58.5	12/8/2014 3:01	57.2	13/8/2014 4:06	58.0	14/8/2014 5:11	58.6	15/8/2014 6:16	56.6
10/8/2014 0:56	59.9	11/8/2014 2:01	57.6	12/8/2014 3:06	57.6	13/8/2014 4:11	57.8	14/8/2014 5:16	58.9	15/8/2014 6:21	57.5
10/8/2014 1:01	60.6	11/8/2014 2:06	57.8	12/8/2014 3:11	57.0	13/8/2014 4:16	57.5	14/8/2014 5:21	58.9	15/8/2014 6:26	58.8
10/8/2014 1:06	59.7	11/8/2014 2:11	57.7	12/8/2014 3:16	57.8	13/8/2014 4:21	58.0	14/8/2014 5:26	59.2	15/8/2014 6:31	61.0
10/8/2014 1:11	60.7	11/8/2014 2:16	57.3	12/8/2014 3:21	60.4	13/8/2014 4:26	56.9	14/8/2014 5:31	59.5	15/8/2014 6:36	60.8
10/8/2014 1:16	60.6	11/8/2014 2:21	57.3	12/8/2014 3:26	56.4	13/8/2014 4:31	57.2	14/8/2014 5:36	59.6	15/8/2014 6:41	61.3
10/8/2014 1:21	34.5	11/8/2014 2:26	57.8	12/8/2014 3:31	58.2	13/8/2014 4:36	58.4	14/8/2014 5:41	60.7	15/8/2014 6:46	61.6
10/8/2014 1:26	45.0	11/8/2014 2:31	57.9	12/8/2014 3:36	56.2	13/8/2014 4:41	60.1	14/8/2014 5:46	60.0	15/8/2014 6:51	62.1
10/8/2014 1:31	46.6	11/8/2014 2:36	57.6	12/8/2014 3:41	56.6	13/8/2014					

Real-time Noise Data		RTN4 (Causeway Bay Community Centre)									
16/8/2014 2:11	53.7	17/8/2014 3:16	60.2	18/8/2014 4:21	57.2	19/8/2014 5:26	57.0	20/8/2014 6:31	59.5	21/8/2014 23:36	59.3
16/8/2014 2:16	60.8	17/8/2014 3:21	59.4	18/8/2014 4:26	57.4	19/8/2014 5:31	59.3	20/8/2014 6:36	59.7	21/8/2014 23:41	60.3
16/8/2014 2:21	54.4	17/8/2014 3:26	60.6	18/8/2014 4:31	57.3	19/8/2014 5:36	59.3	20/8/2014 6:41	60.9	21/8/2014 23:46	57.2
16/8/2014 2:26	55.5	17/8/2014 3:31	60.4	18/8/2014 4:36	57.7	19/8/2014 5:41	60.0	20/8/2014 6:46	60.2	21/8/2014 23:51	57.5
16/8/2014 2:31	60.6	17/8/2014 3:36	58.9	18/8/2014 4:41	55.6	19/8/2014 5:46	59.3	20/8/2014 6:51	59.7	21/8/2014 23:56	57.2
16/8/2014 2:36	60.9	17/8/2014 3:41	59.7	18/8/2014 4:46	56.5	19/8/2014 5:51	60.3	20/8/2014 6:56	61.2	22/8/2014 0:01	56.9
16/8/2014 2:41	60.5	17/8/2014 3:46	59.9	18/8/2014 4:51	56.3	19/8/2014 5:56	60.0	20/8/2014 23:01	60.6	22/8/2014 0:06	57.8
16/8/2014 2:46	60.7	17/8/2014 3:51	59.7	18/8/2014 4:56	56.8	19/8/2014 6:01	47.6	20/8/2014 23:06	60.7	22/8/2014 0:11	57.7
16/8/2014 2:51	59.8	17/8/2014 3:56	58.6	18/8/2014 5:01	56.9	19/8/2014 6:06	56.6	20/8/2014 23:11	60.4	22/8/2014 0:16	58.2
16/8/2014 2:56	60.2	17/8/2014 4:01	58.8	18/8/2014 5:06	57.7	19/8/2014 6:11	56.2	20/8/2014 23:16	60.6	22/8/2014 0:21	57.7
16/8/2014 3:01	60.5	17/8/2014 4:06	59.3	18/8/2014 5:11	58.0	19/8/2014 6:16	55.6	20/8/2014 23:21	60.7	22/8/2014 0:26	58.2
16/8/2014 3:06	59.8	17/8/2014 4:11	59.0	18/8/2014 5:16	59.0	19/8/2014 6:21	58.1	20/8/2014 23:26	60.7	22/8/2014 0:31	58.0
16/8/2014 3:11	59.3	17/8/2014 4:16	58.9	18/8/2014 5:21	58.8	19/8/2014 6:26	60.1	20/8/2014 23:31	60.1	22/8/2014 0:36	55.5
16/8/2014 3:16	49.1	17/8/2014 4:21	58.6	18/8/2014 5:26	58.4	19/8/2014 6:31	59.8	20/8/2014 23:36	60.0	22/8/2014 0:41	53.7
16/8/2014 3:21	59.8	17/8/2014 4:26	58.6	18/8/2014 5:31	58.9	19/8/2014 6:36	61.3	20/8/2014 23:41	59.9	22/8/2014 0:46	60.9
16/8/2014 3:26	60.8	17/8/2014 4:31	59.1	18/8/2014 5:36	59.0	19/8/2014 6:41	60.6	20/8/2014 23:46	58.7	22/8/2014 0:51	53.2
16/8/2014 3:31	39.3	17/8/2014 4:36	59.8	18/8/2014 5:41	59.6	19/8/2014 6:46	60.8	20/8/2014 23:51	59.1	22/8/2014 0:56	60.8
16/8/2014 3:36	49.0	17/8/2014 4:41	58.7	18/8/2014 5:46	60.3	19/8/2014 6:51	61.1	20/8/2014 23:56	60.5	22/8/2014 1:01	60.0
16/8/2014 3:41	45.0	17/8/2014 4:46	58.7	18/8/2014 5:51	60.3	19/8/2014 6:56	62.2	21/8/2014 0:01	58.1	22/8/2014 1:06	49.0
16/8/2014 3:46	48.4	17/8/2014 4:51	59.7	18/8/2014 5:56	60.2	19/8/2014 23:01	59.3	21/8/2014 0:06	60.0	22/8/2014 1:11	60.2
16/8/2014 3:51	60.5	17/8/2014 4:56	59.1	18/8/2014 6:01	48.3	19/8/2014 23:06	60.8	21/8/2014 0:11	57.1	22/8/2014 1:16	60.7
16/8/2014 3:56	44.1	17/8/2014 5:01	58.9	18/8/2014 6:06	54.5	19/8/2014 23:11	58.6	21/8/2014 0:16	57.2	22/8/2014 1:21	60.4
16/8/2014 4:01	60.8	17/8/2014 5:06	58.7	18/8/2014 6:11	55.1	19/8/2014 23:16	59.3	21/8/2014 0:21	57.7	22/8/2014 1:26	60.3
16/8/2014 4:06	60.4	17/8/2014 5:11	60.2	18/8/2014 6:16	53.5	19/8/2014 23:21	59.7	21/8/2014 0:26	58.1	22/8/2014 1:31	60.8
16/8/2014 4:11	59.8	17/8/2014 5:16	58.7	18/8/2014 6:21	57.3	19/8/2014 23:26	59.1	21/8/2014 0:31	55.8	22/8/2014 1:36	59.3
16/8/2014 4:16	60.5	17/8/2014 5:21	59.4	18/8/2014 6:26	59.3	19/8/2014 23:31	59.3	21/8/2014 0:36	55.3	22/8/2014 1:41	60.3
16/8/2014 4:21	60.0	17/8/2014 5:26	59.6	18/8/2014 6:31	56.5	19/8/2014 23:36	58.4	21/8/2014 0:41	55.8	22/8/2014 1:46	59.4
16/8/2014 4:26	59.9	17/8/2014 5:31	60.0	18/8/2014 6:36	58.6	19/8/2014 23:41	58.7	21/8/2014 0:46	53.4	22/8/2014 1:51	59.2
16/8/2014 4:31	60.4	17/8/2014 5:36	60.4	18/8/2014 6:41	59.2	19/8/2014 23:46	58.8	21/8/2014 0:51	51.9	22/8/2014 1:56	60.3
16/8/2014 4:36	60.4	17/8/2014 5:41	59.9	18/8/2014 6:46	60.2	19/8/2014 23:51	58.4	21/8/2014 0:56	53.3	22/8/2014 2:01	59.1
16/8/2014 4:41	60.0	17/8/2014 5:46	60.6	18/8/2014 6:51	61.6	19/8/2014 23:56	57.5	21/8/2014 1:01	50.6	22/8/2014 2:06	58.5
16/8/2014 4:46	60.1	17/8/2014 5:51	59.7	18/8/2014 6:56	62.1	20/8/2014 0:01	54.7	21/8/2014 1:06	50.4	22/8/2014 2:11	59.0
16/8/2014 4:51	59.2	17/8/2014 5:56	48.4	18/8/2014 23:01	56.4	20/8/2014 0:06	58.9	21/8/2014 1:11	54.8	22/8/2014 2:16	58.7
16/8/2014 4:56	59.6	17/8/2014 6:01	45.4	18/8/2014 23:06	59.3	20/8/2014 0:11	56.9	21/8/2014 1:16	60.7	22/8/2014 2:21	58.7
16/8/2014 5:01	60.2	17/8/2014 6:06	50.6	18/8/2014 23:11	57.3	20/8/2014 0:16	57.1	21/8/2014 1:21	51.5	22/8/2014 2:26	58.6
16/8/2014 5:06	60.5	17/8/2014 6:11	53.8	18/8/2014 23:16	56.1	20/8/2014 0:21	58.8	21/8/2014 1:26	50.4	22/8/2014 2:31	57.8
16/8/2014 5:11	59.2	17/8/2014 6:16	57.5	18/8/2014 23:21	56.9	20/8/2014 0:26	55.6	21/8/2014 1:31	58.2	22/8/2014 2:36	58.9
16/8/2014 5:16	59.5	17/8/2014 6:21	50.3	18/8/2014 23:26	57.5	20/8/2014 0:31	55.2	21/8/2014 1:36	59.7	22/8/2014 2:41	58.9
16/8/2014 5:21	60.2	17/8/2014 6:26	58.4	18/8/2014 23:31	59.4	20/8/2014 0:36	55.9	21/8/2014 1:41	59.6	22/8/2014 2:46	59.5
16/8/2014 5:26	60.0	17/8/2014 6:31	56.0	18/8/2014 23:36	58.8	20/8/2014 0:41	57.5	21/8/2014 1:46	60.4	22/8/2014 2:51	58.2
16/8/2014 5:31	48.3	17/8/2014 6:36	55.8	18/8/2014 23:41	56.6	20/8/2014 0:46	52.9	21/8/2014 1:51	60.3	22/8/2014 2:56	58.9
16/8/2014 5:36	60.5	17/8/2014 6:41	54.5	18/8/2014 23:46	58.5	20/8/2014 0:51	53.1	21/8/2014 1:56	59.4	22/8/2014 3:01	58.0
16/8/2014 5:41	44.6	17/8/2014 6:46	63.5	18/8/2014 23:51	56.4	20/8/2014 0:56	59.6	21/8/2014 2:01	59.8	22/8/2014 3:06	57.4
16/8/2014 5:46	60.1	17/8/2014 6:51	55.0	18/8/2014 23:56	57.6	20/8/2014 1:01	60.5	21/8/2014 2:06	59.6	22/8/2014 3:11	58.9
16/8/2014 5:51	60.7	17/8/2014 6:56	54.8	19/8/2014 0:01	54.7	20/8/2014 1:06	48.6	21/8/2014 2:11	58.4	22/8/2014 3:16	58.5
16/8/2014 5:56	59.6	17/8/2014 23:01	57.9	19/8/2014 0:06	54.9	20/8/2014 1:11	60.1	21/8/2014 2:16	60.8	22/8/2014 3:21	58.9
16/8/2014 6:01	52.9	17/8/2014 23:06	62.5	19/8/2014 0:11	55.5	20/8/2014 1:16	60.5	21/8/2014 2:21	59.2	22/8/2014 3:26	57.9
16/8/2014 6:06	50.0	17/8/2014 23:11	56.5	19/8/2014 0:16	51.6	20/8/2014 1:21	59.6	21/8/2014 2:26	59.1	22/8/2014 3:31	58.4
16/8/2014 6:11	52.8	17/8/2014 23:16	56.0	19/8/2014 0:21	56.4	20/8/2014 1:26	60.4	21/8/2014 2:31	59.4	22/8/2014 3:36	57.2
16/8/2014 6:16	55.5	17/8/2014 23:21	56.6	19/8/2014 0:26	39.3	20/8/2014 1:31	52.2	21/8/2014 2:36	59.2	22/8/2014 3:41	57.4
16/8/2014 6:21	56.6	17/8/2014 23:26	56.6	19/8/2014 0:31	47.8	20/8/2014 1:36	59.5	21/8/2014 2:41	59.2	22/8/2014 3:46	58.4
16/8/2014 6:26	56.5	17/8/2014 23:31	51.9	19/8/2014 0:36	60.4	20/8/2014 1:41	59.8	21/8/2014 2:46	57.8	22/8/2014 3:51	57.5
16/8/2014 6:31	60.0	17/8/2014 23:36	61.5	19/8/2014 0:41	60.8	20/8/2014 1:46	60.4	21/8/2014 2:51	58.5	22/8/2014 3:56	58.6
16/8/2014 6:36	57.4	17/8/2014 23:41	61.1	19/8/2014 0:46	60.9	20/8/2014 1:51	59.5	21/8/2014 2:56	58.2	22/8/2014 4:01	58.4
16/8/2014 6:41	57.3	17/8/2014 23:46	57.3	19/8/2014 0:51	60.8	20/8/2014 1:56	58.4	21/8/2014 3:01	58.6	22/8/2014 4:06	58.1
16/8/2014 6:46	58.4	17/8/2014 23:51	57.4	19/8/2014 0:56	50.4	20/8/2014 2:01	59.2	21/8/2014 3:06	59.7	22/8/2014 4:11	57.2
16/8/2014 6:51	60.0	17/8/2014 23:56	54.5	19/8/2014 1:01	59.6	20/8/2014 2:06	59.7	21/8/2014 3:11	59.0	22/8/2014 4:16	58.3
16/8/2014 6:56	60.1	18/8/2014 0:01	48.1	19/8/2014 1:06	60.3	20/8/2014 2:11	59.1	21/8/2014 3:16	58.4	22/8/2014 4:21	56.9
16/8/2014 23:01	60.2	18/8/2014 0:06	49.9	19/8/2014 1:11	59.9	20/8/2014 2:16	58.3	21/8/2014 3:21	59.0	22/8/2014 4:26	58.2
16/8/2014 23:06	60.0	18/8/2014 0:11	60.4	19/8/2014 1:16	60.2	20/8/2014 2:21	58.3	21/8/2014 3:26	58.9	22/8/2014 4:31	56.7
16/8/2014 23:11	58.8	18/8/2014 0:16	50.6	19/8/2014 1:21	60.1	20/8/2014 2:26	58.2	21/8/2014 3:31	59.9	22/8/2014 4:36	57.7
16/8/2014 23:16	61.2	18/8/2014 0:21	47.2	19/8/2014 1:26	59.3	20/8/2014 2:31	57.9	21/8/2014 3:36	58.3	22/8/2014 4:41	57.0
16/8/2014 23:21	59.6	18/8/2014 0:26	42.3	19/8/2014 1:31	59.8	20/8/2014 2:36	58.3	21/8/2014 3:41	58.7	22/8/2014 4:46	58.8
16/8/2014 23:26	60.2	18/8/2014 0:31	37.5	19/8/2014 1:36	59.8	20/8/2014 2:41	57.1	21/8/2014 3:46	58.5	22/8/2014 4:51	57.1
16/8/2014 23:31	59.2	18/8/2014 0:36	52.1	19/8/2014 1:41	60.2	20/8/2014 2:46	57.7	21/8/2014 3:51	58.3	22/8/2014 4:56	56.6
16/8/2014 23:36	59.9	18/8/2014 0:41	60.8	19/8/2014 1:46	60.0	20/8/2014 2:51	57.2	21/8/2014 3:56	58.6	22/8/2014 5:01	58.2
16/8/2014 23:41	59.2	18/8/2014 0:46	59.8	19/8/2014 1:51	59.4	20/8/2014 2:56	57.9	21/8/2014 4:01	58.5	22/8/2014 5:06	57.3
16/8/2014 23:46	59.5	18/8/2014 0:51	51.9	19/8/2014 1:56	58.8	20/8/2014 3:01	58.4	21/8/2014 4:06	58.0	22/8/2014 5:11	58.3
16/8/2014 23:51	59.4	18/8/2014 0:56	58.9	19/8/2014 2:01	58.9	20/8/2014 3:06	58.5	21/8/2014 4:11	59.1	22/8/2014 5:16	59.0
16/8/2014 23:56	58.5	18/8/2014 1:01	58.9	19/8/2014 2:06	58.6	20/8/2014 3:11	56.9	21/8/2014 4:16	57.5	22/8/2014 5:21	59.7
17/8/2014 0:01	59.7	18/8/2014 1:06	59.1	19/8/2014 2:11	59.0	20/8/2014 3:16	59.1	21/8/2014 4:21	60.0	22/8/2014 5:26	59.1
17/8/2014 0:06	56.8	18/8/2014 1:11	59.1	19/8/2014 2							


Real-time Noise Data		RTN4 (Causeway Bay Community Centre)					
23/8/2014 0:41	53.8	24/8/2014 1:46	40.6	25/8/2014 2:51	56.3	26/8/2014 3:56	56.6
23/8/2014 0:46	54.5	24/8/2014 1:51	58.3	25/8/2014 2:56	57.4	26/8/2014 4:01	55.0
23/8/2014 0:51	56.4	24/8/2014 1:56	59.9	25/8/2014 3:01	56.5	26/8/2014 4:06	57.8
23/8/2014 0:56	56.1	24/8/2014 2:01	60.7	25/8/2014 3:06	56.1	26/8/2014 4:11	56.8
23/8/2014 1:01	55.8	24/8/2014 2:06	60.4	25/8/2014 3:11	57.3	26/8/2014 4:16	56.1
23/8/2014 1:06	49.1	24/8/2014 2:11	60.8	25/8/2014 3:16	55.9	26/8/2014 4:21	57.5
23/8/2014 1:11	55.7	24/8/2014 2:16	47.8	25/8/2014 3:21	56.4	26/8/2014 4:26	56.8
23/8/2014 1:16	56.6	24/8/2014 2:21	60.4	25/8/2014 3:26	56.5	26/8/2014 4:31	57.7
23/8/2014 1:21	54.5	24/8/2014 2:26	60.7	25/8/2014 3:31	56.7	26/8/2014 4:36	56.9
23/8/2014 1:26	53.5	24/8/2014 2:31	60.2	25/8/2014 3:36	56.2	26/8/2014 4:41	57.0
23/8/2014 1:31	53.1	24/8/2014 2:36	60.8	25/8/2014 3:41	57.5	26/8/2014 4:46	56.4
23/8/2014 1:36	57.5	24/8/2014 2:41	60.7	25/8/2014 3:46	55.7	26/8/2014 4:51	56.4
23/8/2014 1:41	53.1	24/8/2014 2:46	60.5	25/8/2014 3:51	56.7	26/8/2014 4:56	57.2
23/8/2014 1:46	51.7	24/8/2014 2:51	49.6	25/8/2014 3:56	58.8	26/8/2014 5:01	57.2
23/8/2014 1:51	60.5	24/8/2014 2:56	39.3	25/8/2014 4:01	55.5	26/8/2014 5:06	57.3
23/8/2014 1:56	43.0	24/8/2014 3:01	59.5	25/8/2014 4:06	57.0	26/8/2014 5:11	59.2
23/8/2014 2:01	49.7	24/8/2014 3:06	59.7	25/8/2014 4:11	57.4	26/8/2014 5:16	58.6
23/8/2014 2:06	59.9	24/8/2014 3:11	39.3	25/8/2014 4:16	56.4	26/8/2014 5:21	58.9
23/8/2014 2:11	60.8	24/8/2014 3:16	59.6	25/8/2014 4:21	55.7	26/8/2014 5:26	57.7
23/8/2014 2:16	60.4	24/8/2014 3:21	50.5	25/8/2014 4:26	56.6	26/8/2014 5:31	58.5
23/8/2014 2:21	60.2	24/8/2014 3:26	58.8	25/8/2014 4:31	56.3	26/8/2014 5:36	59.6
23/8/2014 2:26	55.0	24/8/2014 3:31	59.5	25/8/2014 4:36	55.3	26/8/2014 5:41	59.3
23/8/2014 2:31	60.1	24/8/2014 3:36	58.8	25/8/2014 4:41	57.1	26/8/2014 5:46	59.3
23/8/2014 2:36	42.3	24/8/2014 3:41	59.3	25/8/2014 4:46	55.8	26/8/2014 5:51	59.5
23/8/2014 2:41	60.6	24/8/2014 3:46	60.2	25/8/2014 4:51	56.6	26/8/2014 5:56	60.1
23/8/2014 2:46	60.2	24/8/2014 3:51	57.9	25/8/2014 4:56	56.4	26/8/2014 6:01	59.8
23/8/2014 2:51	60.2	24/8/2014 3:56	60.3	25/8/2014 5:01	58.2	26/8/2014 6:06	60.2
23/8/2014 2:56	59.9	24/8/2014 4:01	59.3	25/8/2014 5:06	56.8	26/8/2014 6:11	55.6
23/8/2014 3:01	60.0	24/8/2014 4:06	60.3	25/8/2014 5:11	57.7	26/8/2014 6:16	54.9
23/8/2014 3:06	59.9	24/8/2014 4:11	58.2	25/8/2014 5:16	59.5	26/8/2014 6:21	54.2
23/8/2014 3:11	60.1	24/8/2014 4:16	58.5	25/8/2014 5:21	57.4	26/8/2014 6:26	57.0
23/8/2014 3:16	59.2	24/8/2014 4:21	58.2	25/8/2014 5:26	58.9	26/8/2014 6:31	56.3
23/8/2014 3:21	59.9	24/8/2014 4:26	58.9	25/8/2014 5:31	59.2	26/8/2014 6:36	59.0
23/8/2014 3:26	60.0	24/8/2014 4:31	58.0	25/8/2014 5:36	59.4	26/8/2014 6:41	61.0
23/8/2014 3:31	60.7	24/8/2014 4:36	57.7	25/8/2014 5:41	59.2	26/8/2014 6:46	60.5
23/8/2014 3:36	59.6	24/8/2014 4:41	58.9	25/8/2014 5:46	49.6	26/8/2014 6:51	60.8
23/8/2014 3:41	60.0	24/8/2014 4:46	58.9	25/8/2014 5:51	60.2	26/8/2014 6:56	60.5
23/8/2014 3:46	60.1	24/8/2014 4:51	58.5	25/8/2014 5:56	59.6	26/8/2014 23:01	58.3
23/8/2014 3:51	59.1	24/8/2014 4:56	59.6	25/8/2014 6:01	60.9	26/8/2014 23:06	58.2
23/8/2014 3:56	58.9	24/8/2014 5:01	57.7	25/8/2014 6:06	41.5	26/8/2014 23:11	59.2
23/8/2014 4:01	59.3	24/8/2014 5:06	59.3	25/8/2014 6:11	54.4	26/8/2014 23:16	55.8
23/8/2014 4:06	58.9	24/8/2014 5:11	49.0	25/8/2014 6:16	58.3	26/8/2014 23:21	59.5
23/8/2014 4:11	59.2	24/8/2014 5:16	59.4	25/8/2014 6:21	57.8	26/8/2014 23:26	57.8
23/8/2014 4:16	59.6	24/8/2014 5:21	58.5	25/8/2014 6:26	57.6	26/8/2014 23:31	59.4
23/8/2014 4:21	59.2	24/8/2014 5:26	60.3	25/8/2014 6:31	58.9	26/8/2014 23:36	57.6
23/8/2014 4:26	58.6	24/8/2014 5:31	59.1	25/8/2014 6:36	60.3	26/8/2014 23:41	57.0
23/8/2014 4:31	59.1	24/8/2014 5:36	59.4	25/8/2014 6:41	60.1	26/8/2014 23:46	55.4
23/8/2014 4:36	58.4	24/8/2014 5:41	58.9	25/8/2014 6:46	61.3	26/8/2014 23:51	57.4
23/8/2014 4:41	58.5	24/8/2014 5:46	59.6	25/8/2014 6:51	61.7	26/8/2014 23:56	56.3
23/8/2014 4:46	59.8	24/8/2014 5:51	55.9	25/8/2014 6:56	60.7	27/8/2014 0:01	53.4
23/8/2014 4:51	57.7	24/8/2014 5:56	59.2	25/8/2014 23:01	57.3	27/8/2014 0:06	57.8
23/8/2014 4:56	59.6	24/8/2014 6:01	60.6	25/8/2014 23:06	58.2	27/8/2014 0:11	53.1
23/8/2014 5:01	59.2	24/8/2014 6:06	60.6	25/8/2014 23:11	57.5	27/8/2014 0:16	56.0
23/8/2014 5:06	59.2	24/8/2014 6:11	60.3	25/8/2014 23:16	57.1	27/8/2014 0:21	47.2
23/8/2014 5:11	59.1	24/8/2014 6:16	52.0	25/8/2014 23:21	60.3	27/8/2014 0:26	52.5
23/8/2014 5:16	59.4	24/8/2014 6:21	51.9	25/8/2014 23:26	57.6	27/8/2014 0:31	45.7
23/8/2014 5:21	58.7	24/8/2014 6:26	55.1	25/8/2014 23:31	57.8	27/8/2014 0:36	57.0
23/8/2014 5:26	60.0	24/8/2014 6:31	55.8	25/8/2014 23:36	58.1	27/8/2014 0:41	52.2
23/8/2014 5:31	59.7	24/8/2014 6:36	44.6	25/8/2014 23:41	56.9	27/8/2014 0:46	60.1
23/8/2014 5:36	60.0	24/8/2014 6:41	53.9	25/8/2014 23:46	55.6	27/8/2014 0:51	61.1
23/8/2014 5:41	49.1	24/8/2014 6:46	60.8	25/8/2014 23:51	54.9	27/8/2014 0:56	60.1
23/8/2014 5:46	59.8	24/8/2014 6:51	60.8	25/8/2014 23:56	56.2	27/8/2014 1:01	59.9
23/8/2014 5:51	60.7	24/8/2014 6:56	52.0	26/8/2014 0:01	51.1	27/8/2014 1:06	59.5
23/8/2014 5:56	60.6	24/8/2014 23:01	57.5	26/8/2014 0:06	57.6	27/8/2014 1:11	60.5
23/8/2014 6:01	50.5	24/8/2014 23:06	58.3	26/8/2014 0:11	56.5	27/8/2014 1:16	59.6
23/8/2014 6:06	53.0	24/8/2014 23:11	58.8	26/8/2014 0:16	58.1	27/8/2014 1:21	58.7
23/8/2014 6:11	60.9	24/8/2014 23:16	58.3	26/8/2014 0:21	54.5	27/8/2014 1:26	59.7
23/8/2014 6:16	54.0	24/8/2014 23:21	57.9	26/8/2014 0:26	60.5	27/8/2014 1:31	59.1
23/8/2014 6:21	54.3	24/8/2014 23:26	58.0	26/8/2014 0:31	49.0	27/8/2014 1:36	60.7
23/8/2014 6:26	55.4	24/8/2014 23:31	57.8	26/8/2014 0:36	50.1	27/8/2014 1:41	58.7
23/8/2014 6:31	55.3	24/8/2014 23:36	56.5	26/8/2014 0:41	49.4	27/8/2014 1:46	58.8
23/8/2014 6:36	59.8	24/8/2014 23:41	55.0	26/8/2014 0:46	50.3	27/8/2014 1:51	58.8
23/8/2014 6:41	56.1	24/8/2014 23:46	51.3	26/8/2014 0:51	60.8	27/8/2014 1:56	58.4
23/8/2014 6:46	58.3	24/8/2014 23:51	58.0	26/8/2014 0:56	60.0	27/8/2014 2:01	58.5
23/8/2014 6:51	62.6	24/8/2014 23:56	59.9	26/8/2014 1:01	60.8	27/8/2014 2:06	57.4
23/8/2014 6:56	60.3	25/8/2014 0:01	54.4	26/8/2014 1:06	59.6	27/8/2014 2:11	60.1
23/8/2014 23:01	61.7	25/8/2014 0:06	60.8	26/8/2014 1:11	58.9	27/8/2014 2:16	59.1
23/8/2014 23:06	58.8	25/8/2014 0:11	60.6	26/8/2014 1:16	60.3	27/8/2014 2:21	59.0
23/8/2014 23:11	58.6	25/8/2014 0:16	51.0	26/8/2014 1:21	60.3	27/8/2014 2:26	58.0
23/8/2014 23:16	59.4	25/8/2014 0:21	45.0	26/8/2014 1:26	58.2	27/8/2014 2:31	58.4
23/8/2014 23:21	60.1	25/8/2014 0:26	45.4	26/8/2014 1:31	59.2	27/8/2014 2:36	58.5
23/8/2014 23:26	58.7	25/8/2014 0:31	59.6	26/8/2014 1:36	58.8	27/8/2014 2:41	58.9
23/8/2014 23:31	60.9	25/8/2014 0:36	60.5	26/8/2014 1:41	59.2	27/8/2014 2:46	57.2
23/8/2014 23:36	59.0	25/8/2014 0:41	60.9	26/8/2014 1:46	58.6	27/8/2014 2:51	57.5
23/8/2014 23:41	56.7	25/8/2014 0:46	59.5	26/8/2014 1:51	58.8	27/8/2014 2:56	58.9
23/8/2014 23:46	58.2	25/8/2014 0:51	60.0	26/8/2014 1:56	57.7	27/8/2014 3:01	58.6
23/8/2014 23:51	59.2	25/8/2014 0:56	60.0	26/8/2014 2:01	58.2	27/8/2014 3:06	56.6
23/8/2014 23:56	59.5	25/8/2014 1:01	59.6	26/8/2014 2:06	58.8	27/8/2014 3:11	58.3
24/8/2014 0:01	60.5	25/8/2014 1:06	59.7	26/8/2014 2:11	57.0	27/8/2014 3:16	57.3
24/8/2014 0:06	56.7	25/8/2014 1:11	58.4	26/8/2014 2:16	57.8	27/8/2014 3:21	57.6
24/8/2014 0:11	57.8	25/8/2014 1:16	59.7	26/8/2014 2:21	57.1	27/8/2014 3:26	57.2
24/8/2014 0:16	54.1	25/8/2014 1:21	57.9	26/8/2014 2:26	57.7	27/8/2014 3:31	58.2
24/8/2014 0:21	55.4	25/8/2014 1:26	58.4	26/8/2014 2:31	58.1	27/8/2014 3:36	56.3
24/8/2014 0:26	57.9	25/8/2014 1:31	58.7	26/8/2014 2:36	57.3	27/8/2014 3:41	57.8
24/8/2014 0:31	53.1	25/8/2014 1:36	58.6	26/8/2014 2:41	57.5	27/8/2014 3:46	57.4
24/8/2014 0:36	53.3	25/8/2014 1:41	58.5	26/8/2014 2:46	56.6	27/8/2014 3:51	57.5
24/8/2014 0:41	52.8	25/8/2014 1:46	57.7	26/8/2014 2:51	58.2	27/8/2014 3:56	57.2
24/8/2014 0:46	56.4	25/8/2014 1:51	58.2	26/8/2014 2:56	57.6	27/8/2014 4:01	56.4
24/8/2014 0:51	57.1	25/8/2014 1:56	58.3	26/8/2014 3:01	57.5	27/8/2014 4:06	56.0
24/8/2014 0:56	60.1	25/8/2014 2:01	58.6	26/8/2014 3:06	57.4	27/8/2014 4:11	57.8
24/8/2014 1:01	60.4	25/8/2014 2:06	57.2	26/8/2014 3:11	58.2	27/8/2014 4:16	56.7
24/8/2014 1:06	60.6	25/8/2014 2:11	57.1	26/8/2014 3:16	57.7	27/8/2014 4:21	57.1
24/8/2014 1:11	46.1	25/8/2014 2:16	57.0	26/8/2014 3:21	57.0	27/8/2014 4:26	57.0
24/8/2014 1:16	53.1	25/8/2014 2:21	56.3	26/8/2014 3:26	57.9	27/8/2014 4:31	56.6
24/8/2014 1:21	59.8						

Graphic Presentation of Real Time Noise Monitoring Result (RTN1-Food and Environmental Hygiene Department Depot)


Day Time (0700 -1900 hrs on normal weekdays)

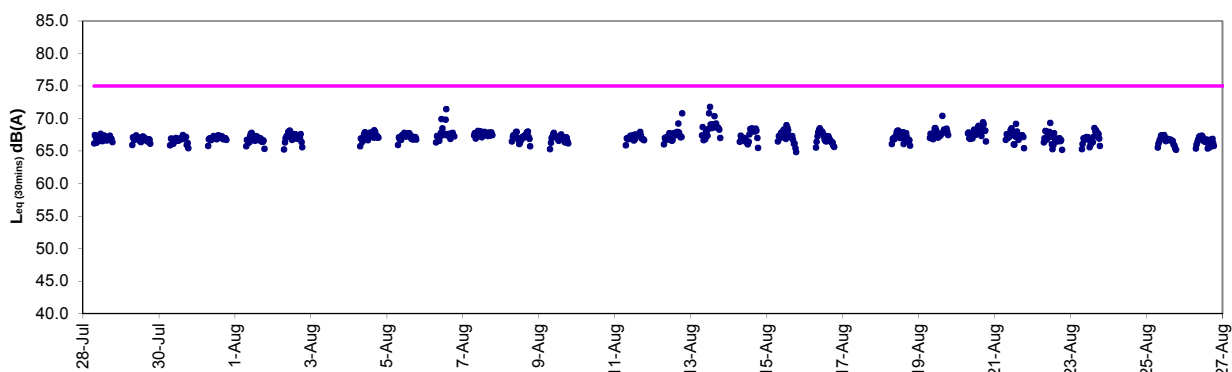


Restricted hours (1900 - 2300) on normal weekdays and 0700 - 2300 hrs on public holidays)

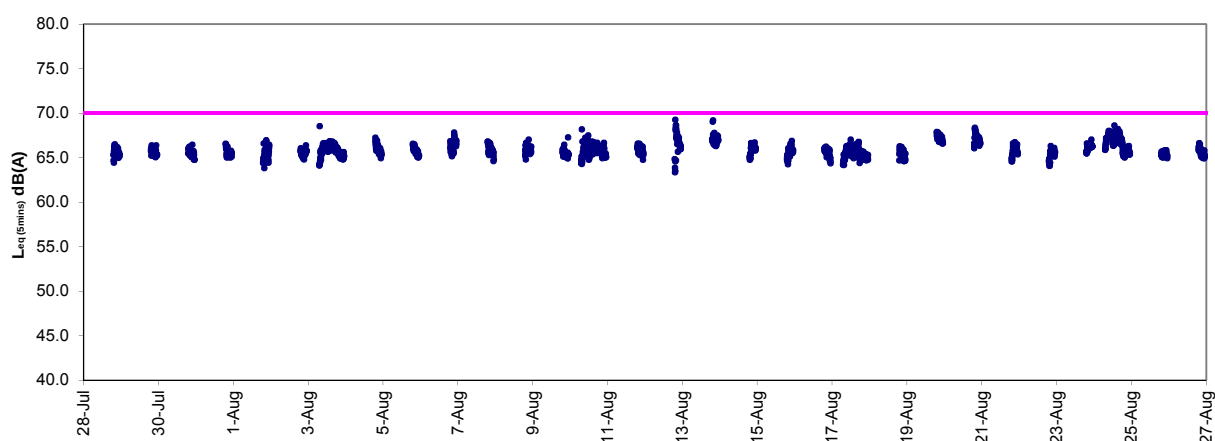

Night Time (2300 - 0700hrs)

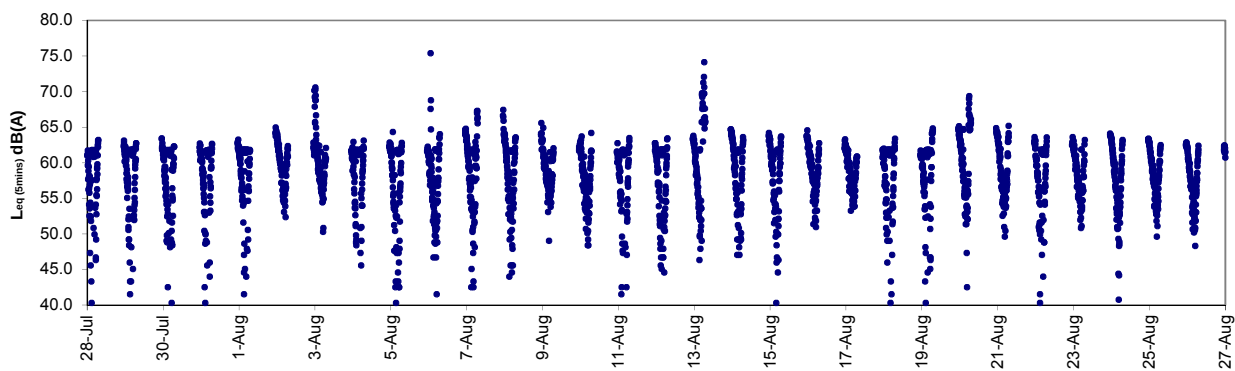

Graphic Presentation of Real Time Noise Monitoring Result (RTN2a- Hong Kong Electric Centre)

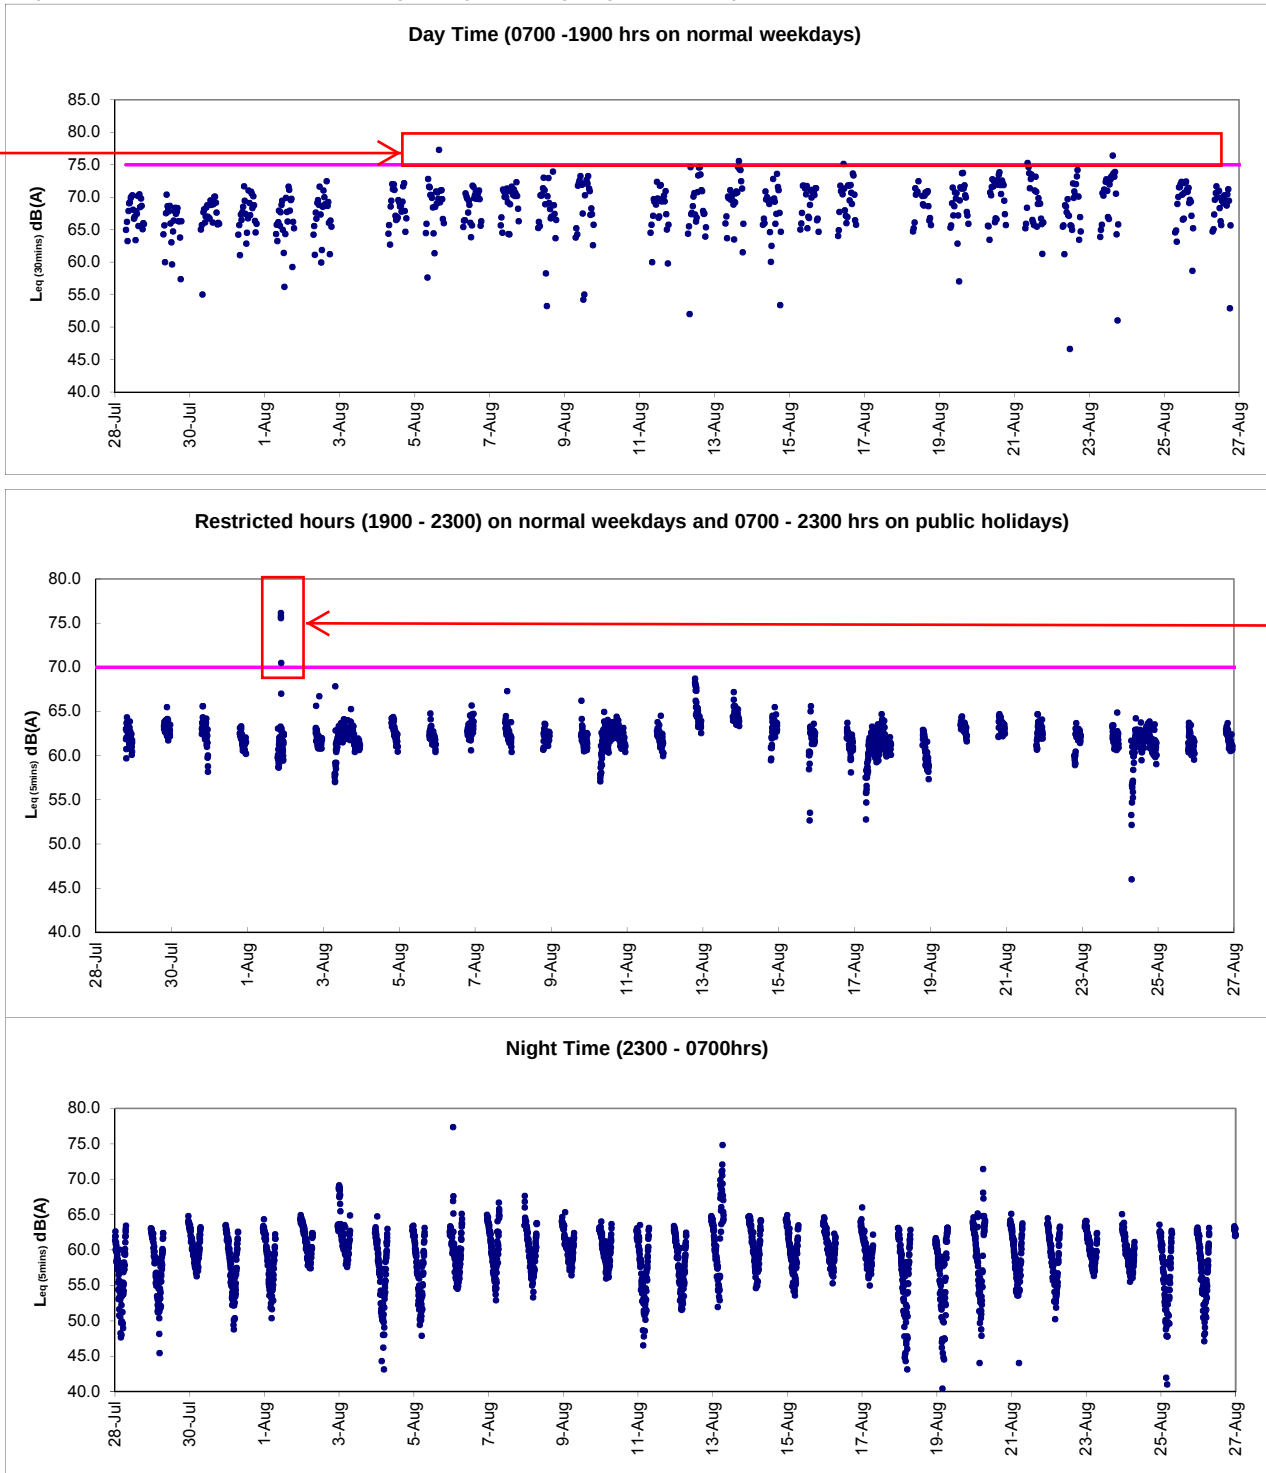


After checking with contractor HY/2009/19, despite bored piling works and occasionally breaking works were conducted, contractor mitigation measures including erection of temporary noise barrier was in place. In view of the exceedances are non-continuous, the exceedances are considered to be non-Project related and contributed by the IEC traffic and piling works at adjacent non-CWB piling site.


After checking with contractor HY/2009/19, bored piling work was conducted at the concerned location during the recorded period. Temporary noise barrier was implemented and CNP GW-RS0752-14 was in place and complied. The exceedance was considered to be contributed by nearby IEC traffic and not related to Project.

Graphic Presentation of Real Time Noise Monitoring Result (RTN3-Yu Lee Mo Fan Memorial School)


Day Time (0700 -1900 hrs on normal weekdays)

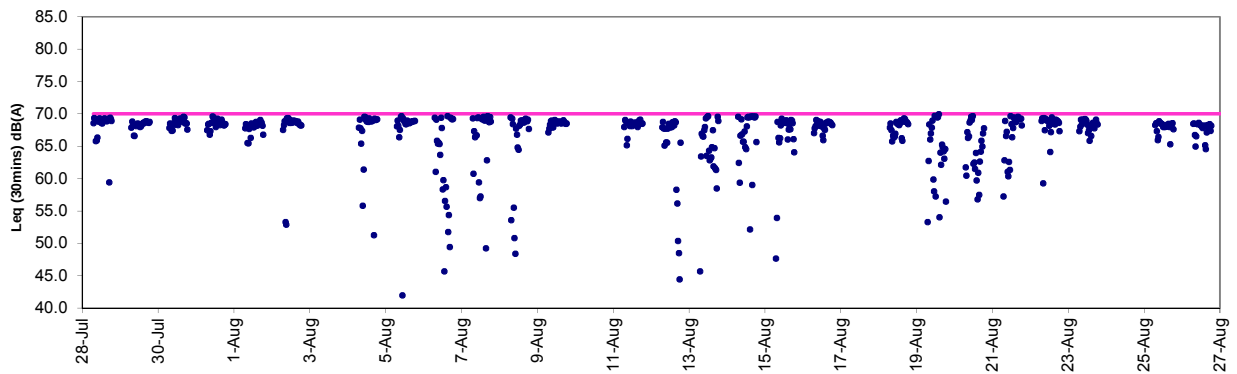

Restricted hours (1900 - 2300) on normal weekdays and 0700 - 2300 hrs on public holidays)

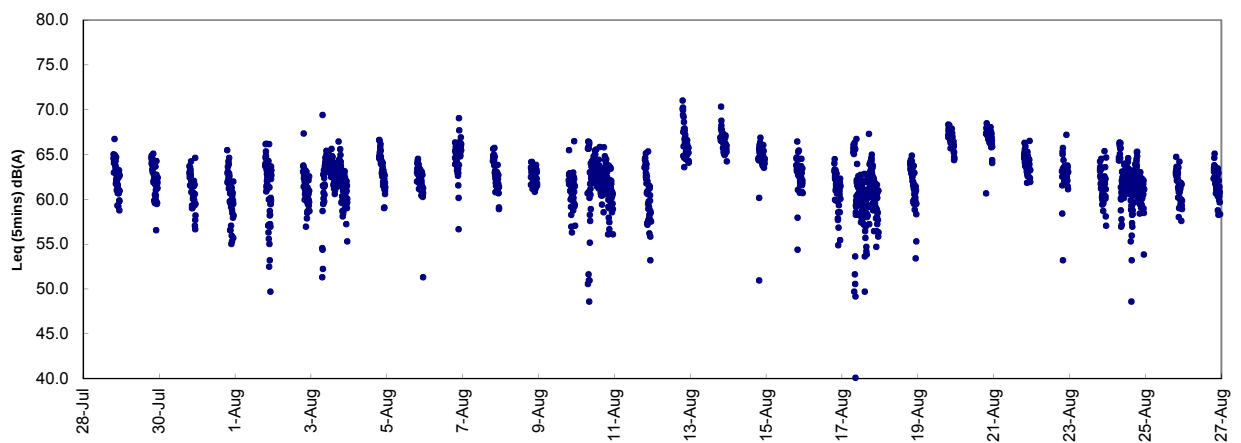

Night Time (2300 - 0700hrs)

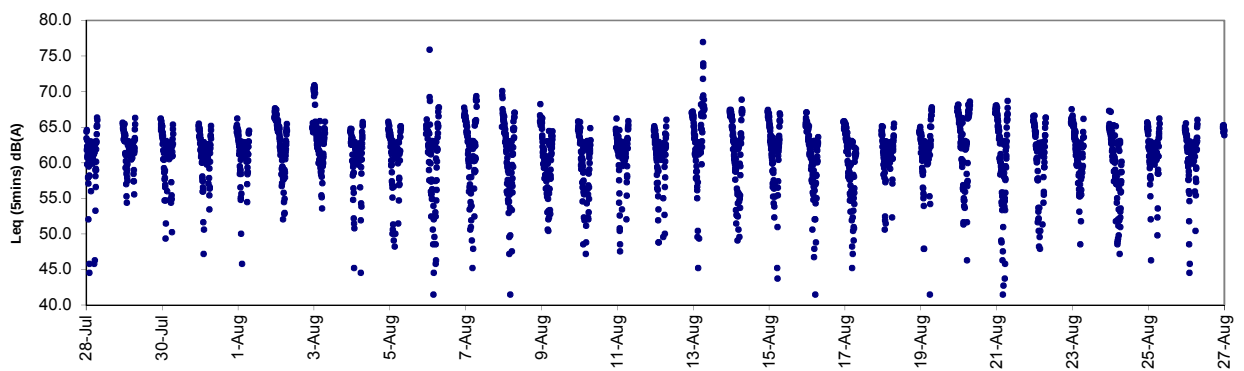




Contract no. HK/2011/07


Wanchai Development Phase II and Central Wanchai Bypass
Sampling, Field Measurement and Testing Works (Stage 2)

Graphic Presentation of Real Time Noise Monitoring Result (RTN4-Causeway Bay Community Centre)


Day Time (0700 -1900 hrs on normal weekdays)

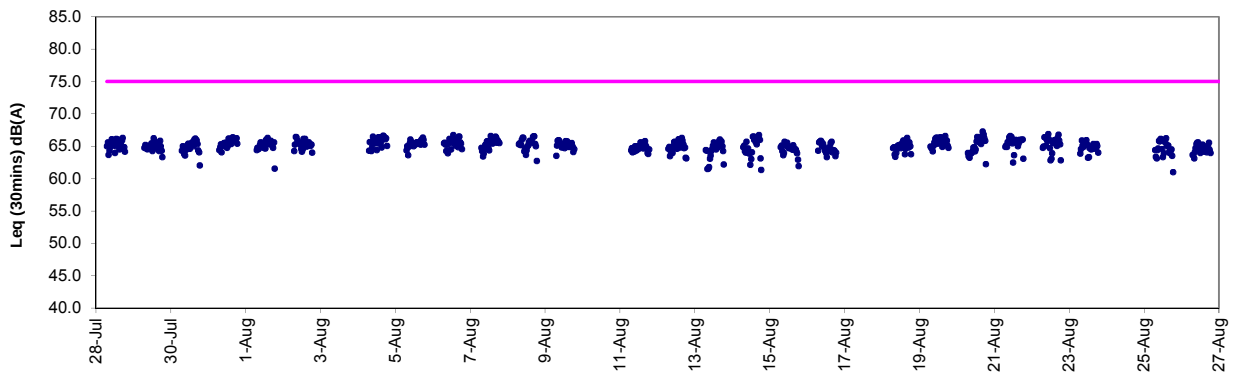

Restricted hours (1900 - 2300) on normal weekdays and 0700 - 2300 hrs on public holidays)

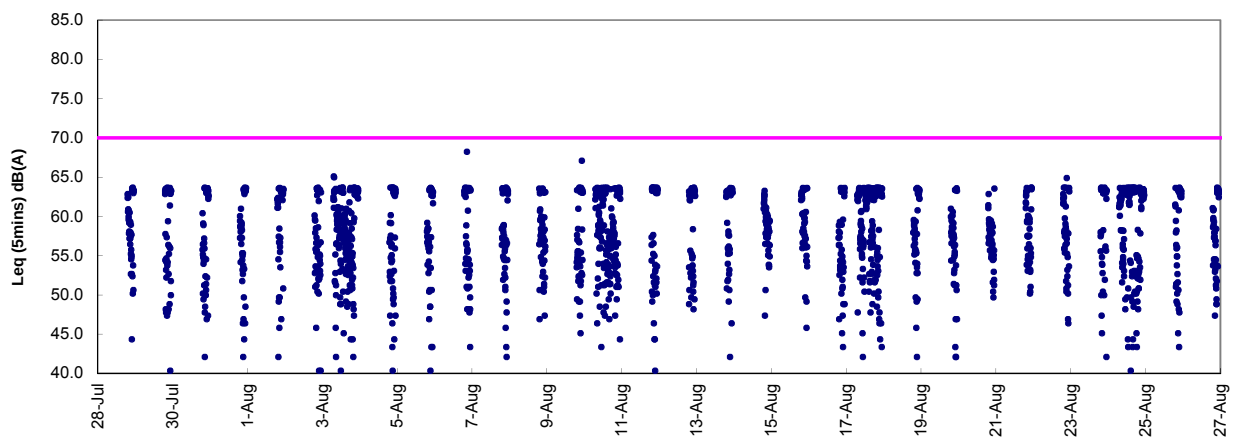

Night Time (2300 - 0700hrs)

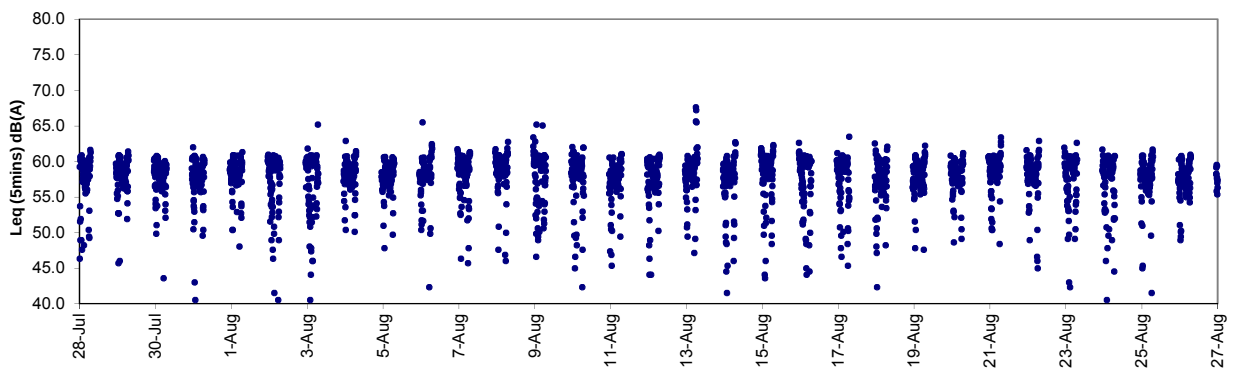



Appendix 6.1

Event Action Plans



Event/Action Plan for Construction Noise

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
Action Level being exceeded	1. Notify ER, IEC and Contractor; 2. Carry out investigation; 3. Report the results of investigation to the IEC, ER and Contractor; 4. Discuss with the IEC and Contractor on remedial measures required; 5. Increase monitoring frequency to check mitigation effectiveness. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Review the investigation results submitted by the ET; 2. Review the proposed remedial measures by the Contractor and advise the ER accordingly; 3. Advise the ER on the effectiveness of the proposed remedial measures. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Supervise the implementation of remedial measures. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Submit noise mitigation proposals to IEC and ER; 2. Implement noise mitigation proposals. (The above actions should be taken within 2 working days after the exceedance is identified)



EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
Limit Level being exceeded	1. Inform IEC, ER, Contractor and EPD; 2. Repeat measurements to confirm findings; 3. Increase monitoring frequency; 4. Identify source and investigate the cause of exceedance; 5. Carry out analysis of Contractor's working procedures; 6. Discuss with the IEC, Contractor and ER on remedial measures required; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; 8. If exceedance stops, cease additional monitoring. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Discuss amongst ER, ET, and Contractor on the potential remedial actions; 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Supervise the implementation of remedial measures; 5. If exceedance continues, consider stopping the Contractor to continue working on that portion of work which causes the exceedance until the exceedance is abated. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC and ER within 3 working days of notification; 3. Implement the agreed proposals; 4. Submit further proposal if problem still not under control; 5. Stop the relevant portion of works as instructed by the ER until the exceedance is abated. (The above actions should be taken within 2 working days after the exceedance is identified)

**Event / Action Plan for Construction Air Quality**

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
ACTION LEVEL				
1. Exceedance for one sample	1. Identify source, investigate the causes of exceedance and propose remedial measures; Inform IEC and ER; 2. Repeat measurement to confirm finding; 3. Increase monitoring frequency to daily. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Check monitoring data submitted by ET; 2. Check Contractor's working method. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Notify Contractor. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Rectify any unacceptable practice; 2. Amend working methods if appropriate. (The above actions should be taken within 2 working days after the exceedance is identified)
2. Exceedance for two or more consecutive samples	1. Identify source; 2. Inform IEC and ER; 3. Advise the ER on the effectiveness of the proposed remedial measures; 4. Repeat measurements to confirm findings; 5. Increase monitoring frequency to daily; 6. Discuss with IEC and Contractor on remedial actions required; 7. If exceedance continues, arrange meeting with IEC and ER; 8. If exceedance stops, cease additional monitoring. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the ET on the effectiveness of the proposed remedial measures; 5. Supervise Implementation of remedial measures. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Ensure remedial measures properly implemented. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Submit proposals for remedial to ER within 3 working days of notification; 2. Implement the agreed proposals; 3. Amend proposal if appropriate. (The above actions should be taken within 2 working days after the exceedance is identified)
LIMIT LEVEL				
1. Exceedance for one sample	1. Identify source, investigate the causes of exceedance and propose remedial measures; Inform ER, Contractor and EPD; 2. Repeat measurement to confirm finding; 3. Increase monitoring frequency to daily; 4. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the ER on the effectiveness of the proposed remedial measures; 5. Supervise implementation of remedial measures. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Ensure remedial measures properly implemented. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Amend proposal if appropriate. (The above actions should be taken within 2 working days after the exceedance is identified)
2. Exceedance for two or more consecutive samples	1. Notify IEC, ER, Contractor and EPD; 2. Identify source; 3. Repeat measurement to confirm findings; 4. Increase monitoring frequency to daily; 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; 6. Arrange meeting with IEC and ER to discuss the remedial actions to be taken; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; 8. If exceedance stops, cease additional monitoring. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Discuss amongst ER, ET, and Contractor on the potential remedial actions; 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; 3. Supervise the implementation of remedial measures.	1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Ensure remedial measures properly implemented; 5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not under control; 5. Stop the relevant portion of works as determined by the ER until the exceedance is abated. (The above actions should be taken within 2 working days after the exceedance is identified)



Appendix 6.2

Summary for Notification of Exceedance



Ref. No.	Date	Time	Location	Construction Noise Level	Unit	Action Level	Limit Level	Follow-up action
X_10N172	28-Jul-14	15:11	M6 - HK Baptist Church Henrietta Secondary School	71	Leq(30-min)	when one documented complaint was received.	70	Possible reason: Traffic nearby was observed during monitoring and was considered as the major noise contribution. Action taken / to be taken: Repeat measurement to confirm result and reviewed the trend of noise measurement. Analysis of contractor's working procedure. Remarks / Other Obs: Concreting and pile sleeve installation for dolphin cap under Contract HY/2009/19 were conducted around the concerned location during the time of measurement. It was observed that traffic noise was a major noise source during monitoring. It is concluded that the exceedance was not due to project but to traffic noise nearby.
X_10N173	5-Aug-14	9:28	M2b- Noon Day Gun Area	78	Leq(30-min)	when one documented complaint was received.	75	Possible reason: Barge operation and concrete breaking works at TS4 area were found to be in operation during measurement and were considered as the major noise contribution. No acoustic screen was provide to the breaker. Action taken / to be taken: Immediate repeat measurement was conducted to confirm the result at the same location . The construction noise level of repeated measurement at the same location on the same date was: <u>5 Aug 2014 at 10:01 77 dB(A)</u>. Contractor was advised to prepare and submit the remediation plan for the concerned procedure. Additional monitoring was conducted on 8 Aug 2014. No further exceedances were recorded and rectification measures including provision of noise blanket to breaker and to the pulley system at the derrick barge were implemented by the Contractor. The construction noise level during additional monitoring was found to be <u>8 August 2014 at 15:40 75 dB(A)</u>. No further exceedance was recorded. Remarks / Other Obs: Concrete breaking works and barge operation for Contract HY/2009/15 were conducted during the measurement on 5 August 2014, it was observed that barge operation and the breaking works were the major noise contribution during measurement. It was concluded that the exceedance was project related and the contractor was requested to submit a proposal for remediation measures following the Event and Action Plan. Rectification measurse including provision of noise blanket to breaker and provision of noise blanket to the pulley system at the derrick barge in case more than one derrick barges are operating concurrently were comitted by the Contractor and no further exceedance was observed.



Appendix 9.1

Complaint Log



Environmental Complaints Log

Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
110723a	23/07/2011	Ms. Law at Victoria Centre by ICC no. 1-303887687	North Point	She concerned that Highways Department published a notice in their Management Office about construction works will be conducted from 0700 hours to 2300 hours during July to December 2011 including Saturday, Sunday and public holiday.	1) It was referred by AECOM to ET on 28 July 2011 2) RSS confirmed that the notice was prepared by Victoria Centre 'a Management office to their resident and the advice was only given on the extension construction works (for Contract HY/2009/15) to 7am-9pm Monday to Saturday except Public Holidays and Sundays. 3) As a mitigation measure to minimize the noise nuisance in the vicinity of the residents, rock breaking activities will be started at 8am and is expected to be completed by mid-August 2011. 4) No noise exceedance was recorded at construction noise monitoring station at Victoria Centre on 19 and 25 July 2011 during daytime and evening time period while breaking and excavation works were observed during monitoring. 5) In conclusion, it was related to the construction works under Contract HY/2009/15 and mitigation measure was provided. The complainant was satisfied with the arrangement and no further complaint was received after proposed measures.	Closed
110723b	23/07/2011	Ms. Yau at Block 2, Victoria Centre by ICC no. 1-304013959	North Point	Reclamation work was conducted at Causeway Bay Typhoon Shelter at 7am on 23 July 2011. She complained that the works shall be started later to minimize the noise nuisance to the vicinity of the residents in early morning	1) It was referred by AECOM to ET on 8 August 2011 2) RSS confirmed to start the rock breaking activities for Contract HY/2009/15 at 8am as a mitigation measure to minimize the noise nuisance in the vicinity of the residents. 3) With reference to the construction noise monitoring at Victoria Centre, no exceedance was recorded on 19 and 25 July 2011 during daytime while breaking and excavation works were undertaken during monitoring 4) In conclusion, it was related to the construction works under Contract HY/2009/15 and mitigation measure was provided. The complainant was satisfied with the arrangement and no further complaint was received after proposed measures.	Closed
110727a	27/07/2011	Mr. Law from Victoria Centre Management Office by ICC no. 1-304616162	North Point	It was complained by Mr. Law from Victoria Centre Management Office on 27 July 2011 regarding construction noise generated by the construction operations of	1) It was referred by AECOM to ET on 28 July 2011 2) RSS confirmed to start the rock breaking activities for Contract HY/2009/15 at 8am as a mitigation measure to minimize the noise nuisance in the vicinity of the residents. 3) No noise exceedance was recorded at construction noise monitoring station at Victoria Centre on 25 July and	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
				Central-Wanchai Bypass at noon rather than in morning at 7am.	4 August 2011 during daytime and evening time period while breaking and excavation works were observed during monitoring. 5) In conclusion, it was related to the construction works under Contract HY/2009/15 and mitigation measure was provided. No further complaint from complainant was received after proposed the mitigation measure.	
110727b	27/07/2011	Ms. Chiu by ICC no.1-304615409	North Point	Noise nuisance from the excavation works for the Highways Department adjacent to the Victoria Centre was conducted from 7am	1) It was referred by AECOM to ET on 28 July 2011 2) With reference to the construction noise monitoring at Vitoria Centre, no exceedance was recorded on 25 July and 4 and 10 August 2011 during daytime while breaking and excavation works were undertaken during monitoring. 3) As a mitigation measure to minimize the noise nuisance in the vicinity of the residents, rock breaking activities will be started at 8am.	Closed
	07/08/2011				4) However, complainant did not satisfy with the response on the noise nuisance from the rock-breaking during morning in front of Victoria Centre and then further complaint via 1823 on 7 August 2011. 5) Highways contacted the complainant on 15 August 2011 that the noisy rock breaking operation had been completed. <i>Remarks: There will be counted as two complaints in this complaint log.</i>	
110730	30/07/2011	Mr. Tsui by ICC no. 1-305074350	Central	Construction noise generated by operations of Central-Interchange which is near the spa room at Four-Season Hotel. Also, the complaint enquired the commencement time of the construction on Saturday.	1) It was referred by AECOM to ET on 1 August 2011. 2) RSS confirmed that noisy plants from 2 vibratory hammers have been conducted in alternating manner for piling and drilling works for diaphragm wall construction. 3) With reference to the construction noise monitoring at IFC Western End of Podium, no exceedance was recorded on 4 August 2011 during monitoring while sheet piling works were undertaken during monitoring. 4) In order to reduce the noise impact to nearby noise sensitive receivers, Contractor has been implemented the following noise mitigation measures: - Erection of acoustic lining at the hoarding next to Four Seasons Hotel; - Temporary noise barrier with extended acoustic lining; - Reduced in plant such that only have one vibration hammer operating at the west side near Four	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					Seasons Hotel instead of 2 5) In conclusion, it was related to the construction works under Contract HY/2009/18 and mitigation measure was provided. The complainant was satisfied with the arrangement and no further complaint was received after proposed measures.	
110810	10/08/2011	Mr. Yip by ICC no. 1 – 306740207	North Point	Muddy water was discharged from work site to the seafront near Oil Street during heavy rain. The environmental protection measures were not good enough and are needed to rectify.	1) It was referred by AECOM to ET on 17 August 2011. 2) Confirmed with RE, Muddy water was caused by a heap of earth being washed to the sea by heavy rain. The heap of earth was referred as a small stockpile placed close to the seafront in front of Oil Street within the site area under handover transition period from contract HY/2009/11 to contract HY/2009/19. The necessary mitigation measures to protect the small stockpile against rainfall were missing at the time of complaint. 3) Due to the missing of mitigation measures to protect the small stockpile during handover transition period, loose material was washed into the harbour when heavy rain came. Muddy water was formed and dispersed in the sea that caused the water quality and visual concern to the public. The complaint was considered as valid. 4) Contractors were advised to relocate the loose materials away from the coastline as far as practicable. Any loose material placed which needed to be placed near the coastline shall be properly compacted or covered as appropriate. To avoid any further environmental deficiency, Contractors shall ensure all necessary environmental mitigation measures will not be missing during site area handover.	Closed
110817	17/08/2011	ICC no. 1-307657681	North Point	Visual impact generated by light from a large amount of spot-lights on the barge during mid-night nearby City Garden.	1) It was referred by AECOM to ET on 23 August 2011 2) RSS confirmed that some non-essential lights were turned on during night-time period which caused the nuisance to the nearby residents. In addition, absence of lighting shields at flood lights results in visual glare to the complaint at night-time. 3) Follow-up action had been taken by contractor that switches off all non-essential lights to minimized nuisance to the nearby residents. The complainant satisfied to the practice and no further complaint was received after that.	Closed
110826	26/08/2011	Grand Hyatt and a complainant by ICC	Wan Chai	Construction noise and vibration nuisance generated from the works at Convention Avenue and inside the HKCEC1	1) Confirmed with the Resident Site Staff that the construction works were referred to the Contractor HK/2009/01. 2) The Excavator mounted breaker at Convention Avenue	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
				reclamation area.	and Drilling rig at HKCEC1 reclamation area were the dominant construction noise source during this period. 3) The drilling rig at HKCEC1 reclamation area and excavator mounted breaker at Convention Avenue were then temporary suspended after received the complaint. 4) Investigation revealed that the erected noise barrier (4m cantilevered movable noise barrier for the drilling rig and 1m movable noise barrier for the excavator mounted breaker) were not located close to the plants to provide adequate noise screening. 5) Contractor was advised to avoid concurrent operation of construction plants at site. Further enhancement of movable noise barriers at HKCEC1 and providing noise enclosure for the excavator mounted breaker at Convention Avenue are needed. 6) Further site investigation and checking on 31 August and 7 September 2011 revealed that the implemented noise mitigation measures were in proper and minimize the noise impact.	
110826A	26/08/2011	A complaint letter from Mr. Au of Cayley Property of City Garden	North Point	Harbor front adjacent to their water intake suction which caused 3 times of system breakdown of the sea water pump on 9, 22 and 25 August 2011.	1) It was referred by AECOM to ET on 29 August 2011 2) Confirmed with the Resident Site Staff that the construction works were referred to the Contractors HY/2009/11 and HY/2009/19. 3) The pump is located on the site area of HY/2009/19 4) A temporary garbage defender was installed on 23 July 2011 by HY/2009/11 and the shape of the defender was adjusted on 8 August 2011 in order to exclude the outfall. 5) An ad hoc inspection of the effectiveness of garbage defender was conducted with RSS (CWB project team), contractor of HY/2009/11 and HY/2009/19 and IECon 29 August 2011. Inspection report of it was submitted to RSS on 19 September 2011. 5) Daily cleaning near the water intake was conducted twice a day by contractor HY/2009/19. 6) In response to City Garden request, the contractors have set up the temporary garbage defender in function and collect the floating refuses, but cannot eliminate all refuses, in particular the refuse come from sea bed from entering the intake. 6) According to the complaint letter from Cayley Property, the outcomes of the preventive measures were not complying with their expectation. 7) During on-site inspection, floating refuses observed	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					occasionally outside the garbage defender. No conclusion could be made for the source of these floating refuses. On the other hand, some of the floating refuses were observed immigrating in the protective zone during investigation 8) All daily cleaning actions had been taken by contractor to minimize floating refuse inside the construction site. It was noted that the intake (land side) is open access to public, so that many activities such as fishing, feeding fish were conducted there even though a notice has already hoisted. Also, tripping of rubbish by the passers-by could result in a lot of rubbish accumulated around the intake point. 9) Referring to the record provided by CPML, there were a lot of nylon/ plastic bags and nylon wire mesh that matched those rubbishes generated from the public activities. 10) Contractors have fulfilled the requirement of site cleanness and no exceedance was recorded during Water Quality Monitoring. It is consider the cause of this complaint is not related to project and environmental issue in this project as well. No more complaint received after ad-hoc inspection	
111014	14/10/2011	The complainant, Ms. Tam complained via hotline 1823	Wan Chai	The polluted fumes and exhaust from the excavation by sub-contractor of CEDD on pedestrian way outside no.25 Harbour Road (in front of the Harbour Centre)	1) RSS notified ET to carry out investigation on 17 October 2011. 2) ET confirmed with the Resident Site Staff that the location of the excavator was within site area of Contract no. HK/2009/02 undertaking the water cooling main reprovision works along the Harbour Road. The plants including the excavator have been checked before using at the site. However, the polluted fumes and exhausted from the excavator was caused due to insufficient maintenance of the plant after using at site. 3) After receiving the complaint, the excavator was then removal off-site for checking and maintenance works on 17 October 2011. 4) Contractor was reminded to enhance regular checking and maintenance to all plants at site. 5) RSS has replied to the complainant on the arrangement of the measures taken on 17 October 2011. Complainant was satisfied with the response and follow-up action taken by the Contractor.	Closed
111104	04/11/2011	Mr. Liu from	Wan Chai	Complain about a tree near the	1) ET confirmed with the Resident Site Staff that	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
		LCSD complained via Contractor Complaint Hotline		site of pipe installation works outside Wan Chai Swimming Pool at Harbour Road, the status is not healthy and roof ball of two trees inside the site near Renaissance Hong Kong Harbour View Hotel at Convention Avenue were half cut.	- A tree near the site of pipe installation works outside Wan Chai Swimming Pool at Harbour Road is the Tree no. TA1122 under Contract no. HK/2009/02. Leaves of a branch of this tree were shrivelled. - Two trees inside the site near Renaissance Hong Kong Harbour View Hotel at Convention Avenue are the tree nos. A160 and A161 under Contract no. HK/2009/01. Part of roof ball of these two trees was covered by the metal plate. 2) Independent Tree Specialists for these two inspected the trees. Contractor HK/2009/01 has taken the measure as recommend downgrading the soil level around the trunk base. Reinstating of the ground works will be conducted in mid-December 2011. For the tree no. TA1122 under Contract no. HK/2009/02, the brown leaves were removed and fenced the tree with orange net is provided to prevent damage of tree trunk by construction works. The distance between the tree and the edge of the trench is kept approximate 2m. Two Contractors were reminded to carry out regular watering to the trees within their site area.	
111106	06/11/2011	Police officer	Wan Chai	Construction noise generated from the site at about 6:30 a.m on 6 November 2011 and require to stop the machine operation	1) According to the information reported by Contractor, one BC cutter and hoist were operated for Diaphragm Wall construction of Shatin-Central Link to inspect bentonite pipes and ensure no damages and all the joints are tightened in good position. Then, the subcontractor for Diaphragm wall, SAMBO Korean foreman stopped the engine of the BC cutter immediately. The police officer recorded the details and HKID number of the foreman and then left. Due to the different language communication between the police officer and the Korean foreman, no CNP was checked by the police officer. 2) ET confirmed with the Resident Site Staff that same issue was also raised out by RSS at about 7:00a.m on the same day. Besides, it was confirmed that there is no valid Construction Noise Permit for the conducted construction works in the period between 2300 and 0700. 3) Due to insufficient communication between Contractor HK/2009/01 and their Korean Sub-contractor, Korean Sub-contractor had not notified to Contractor before carrying out the inspection of the BC cutter, hoists and	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					bentonite pipes at about 6:00a.m to ensure no damages and all the pipe joints should be tightened and in good position. 4) Contractor was advised to enhance the communication between Contractor and sub-contractor and provide sufficient environmental training to all foreman and operators on restricted hour operation. Furthermore, Construction Noise Permit should be checked and in place for the construction works during restricted hour 5) This complaint was considered in relation to the conducted construction works during restricted hours without valid Construction Noise Permit. No more construction works were conducted during night time period. The construction works will be conducted in accordance with the time period stated in valid CNP. This complaint will be kept in view of any follow-up action from the relevant government activities.	
111212	12/12/2011	The complainant, Mr Tsui from IFCII's management office complained via hotline 1823	Central	A visual impact complaint from hotline 1823 was received by ET on 9 January 2011 (ICC Ref. No.: ICC#1-333037096 dated on 12 December 2011). The complaint, Mr Tsui was reported that visual nuisance caused by lighting in the construction site during night time.	1) RSS notified ET on 9 Jan 2012. 2) ET confirmed with the Resident Site Staff that A joint inspection was conducted by Mr Tsui and contractor on that night to see whether there is any improvement. 3) Due to safety reason, igniting enough lights should not be avoided in construction site. However, the light sources were not directed away from pointing to the sensitive receiver and results in visual glare to the complaint. 4) Confirmed with the Resident Site Staff the complainant was satisfied the new arrangement of the lights with contractor after the joint inspection. No further complaint received after that.	Closed
111220	20/12/2011	The complainant, Ms. Poon complained via hotline 1823 (ICC Ref. No.: ICC#1-334683841)	North Point	Construction air and noise nuisance generated that many trucks carrying construction materials driving along Watson Road and Oil Street and possibly entering/leaving the construction site near the IEC during 0800 to 1900 hours.	1) RSS notified ET on 22 Dec 2011. 2) ET confirmed with the Resident Site Staff that the complainant cannot identify whether the trucks were working under the CWB project or not. 3) The dominant construction air and noise nuisances were emitted by the trucks along Oil Street and Waston Road, however, this is the public road for all vehicles. Reviewing the air quality monitoring and noise monitoring results. No exceedance was recorded during this period. 4) Confirmed with the Resident Site Staff that they provided a contact no. for any future enquiries regarding	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					CWB project to the complainant and she was satisfied on the arrangement and no further complaint was received after that.	
111230	30/12/2011	Residents of Harbour Heights	North Point	Construction air and noise nuisance generated by construction vehicles were found parked illegally at King Wah Road and lining up at Oil Street without the engine turning off.	1) RSS notified ET on 6 January 2011. 2) ET confirmed with the Resident Site Staff that a number of construction activities are concurrently proceeding in the vicinity of Oil Street, King Wah Street and a private development project in King Wah Street 3) The dominant construction air and noise nuisances were emitted by the trucks along Oil Street and King Wah Road, however, this is the public road for all vehicles. Reviewing the results of air quality monitoring station (CMA1b) and noise monitoring (M4b). No exceedance was recorded during this period. Site inspections for HY/2009/19 were conducted on 4 January 2012. The condition of the site access at Oil Street and the public road nearby were found satisfactory. It is noted that HyD also allow and encourage their contractors to maximize the use of marine access, where available, to work sites, so as to minimize burdening nearby public roads. When land trips are unavoidable, they require contractors to tidy up their construction vehicles before leaving works sites. No contractor under CWB project parked their vehicles illegally at King Wah Street, and HyD still reminded them not to commit such offence. 4) According to HyD's staff replied the complaint letter on 10 January 2012, there is a private development project under construction at King Wah Road. To access these works sites, construction vehicles have to use public roads nearby. No further complaint received after HyD's reply.	Closed
120118	18/01/2012	N/A	North Point	A complaint regarding a tree located in front of Victoria Centre under IECL was covered by one meter mud without any protection. The complainant concerns the health of the tree in such condition.	1) RSS notified ET on 20 January 2012. 2) ET confirmed with the Resident Site Staff that The tree is inside the site area of HY/2009/19 and The Botanical name of the tree is Ficus superba var. japonica and the I.D. of the tree is UT48 3) According to the information provided by RSS on 20 Jan 2012, the tree shall be felled that has been approved by DLO on 29 August 2011. Moreover, the tree was felled	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					by contractor on 19 January 2012. 4) No further complaint received after HyD's reply.	
120305	03/03/2012	Resident of Harbour Heights complained via hotline 1823 (ICC Ref. No.: ICC#1-344632511)	North Point	A complaint regarding excessive noise from construction sites of CWB was observed outside Harbour Heights from Monday to Saturday before 8am. The plants were frequently turned on before 7:30am creating nuisance. The complainant requested a speedy follow-up and reply from relevant department.	1) RSS notified ET on 5 March 2012. 2) ET confirmed with the Resident Site Staff that PME for diaphragm wall construction started to operate at about 7:30am whilst the other PME, including those for land bored piling work, started to operate after 8am. 3) After reviewing the results of noise monitoring (M4b), no exceedance was recorded during daytime period and the noise level were below 75dB(A). Site inspection for HY/2009/19 was conducted on 7 March 2012. The condition of noise mitigation measures near Harbour Heights was found satisfactory. RSS confirmed that no operation was active before 7:00am everyday. The suspected nuisance was to be considered caused by the PME for diaphragm wall construction. A surprise check was performed on 13 March 2012 by RSS. It was found that no noisy PME was in operation by Contractor of HY/2009/19 before 8am, and the construction noise level was minimal and not disturbing. The noise level and operation time both complied with statutory requirements set up in NCO. 4) Complainant called ICC on 8 March 2012 to confirm HyD has provided a response. No further complaint was received after the response.	Closed
120405	05/04/2012	N/A	North Point	A complaint regarding excessive noise from construction sites of CBTS was observed daily before 7:30am except on public holidays, and the noise source was mainly from piling works. The complainant requested that construction works should start after 8:30am to avoid nuisance to nearby residents and a speedy follow-up and reply.	1) RSS notified ET on 5 April 2012. 2) ET confirmed with the Resident Site Staff that no piling works were performed during the concerned period. 3) After reviewing the results of noise monitoring (M2b and M3a), no exceedance was recorded during daytime period and the noise level was below 75dB(A). Site inspection for HY/2009/15 was conducted on 10 April 2012. The condition of noise mitigation measures around CBTS was found satisfactory. RSS confirmed that no pilings were performed during the concerned period. The major works included drilling, diaphragm wall construction and excavations. 4) HyD made a reply to the complainant on 16 April	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					2012 via 1823. HyD replied that the current works at CBTS were drilling, diaphragm wall construction and deep excavations. In order to minimize the noise generated from the above works, the Contractor had erected temporary noise barriers and provided noise blankets on plants. RSS would continue to work with the Contractor on the effectiveness of the environmental mitigation measures implemented on site. No further complaint was received after the response.	
120415	15/04/2012	The complainant Ms. Law, resident of Fu Lee Loy Mansion, complained via hotline 1823 (ICC Ref. No.: 1-351021108)	North Point	A complaint regarding excessive noise generated from a HyD project that is located at the connection point of CWB and IEC affecting nearby residents. Lately during the middle of the night (around 00:00 to 05:00), low frequency noise, which possibly came from the operating power generator and the barges which were parked along the Oil Street work site, were making a nuisance to the complainant and residents nearby. The complainant requested that relevant department should follow-up.	1) RSS notified ET on 17 April 2012. 2) ET confirmed with the Resident Site Staff that there was no operation of power generators for HY/2009/19 and HY/2009/17 (HY/2009/11 had no physical work on site) during the concerned period. Although there were a few barges mooring at the seafront of HY/2009/19, they were not in operation and hence no operational noise would be emitted. 3) After reviewing the results of noise monitoring (M4b and M5b), no exceedance was recorded during day time period and the noise level was below 75dB(A). Site inspection for HY/2009/19 was conducted on 18 April 2012. The condition of noise mitigation measures near Harbour Heights were found satisfactory. RSS confirmed that no operation of power generators for HY/2009/19 and HY/2009/17 (HY/2009/11 had no physical work on site) during the concerned period. Although there were a few barges mooring at the seafront of HY/2009/19, they were not in operation and hence no operational noise would be emitted. 4) HyD made a reply to the complainant on 30 April 2012 via email. HyD replied that the current works near Oil Street, North Point, included CWB tunnel works, IEC connections and associated foundation works. According to RSS records, no operations were performed during the early hours of March and April at Oil Street and the waterbody nearby, and so it was believed that the noise nuisance was not generated from the CWB project. Despite that, RSS would continue to monitor the Contractor on the operations and effectiveness of the environmental mitigation measures implemented on site, as not to affect daily life of local residents nearby. No further complaint was received after the response.	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
130308	06/03/2013	ICC Case#1-407181502	Tin Hau	A complaint regarding the dropping of fine rock material into surrounding waterbody was observed during rock breaking operation with two excavators in active operation at the Eastern Breakwater of Causeway Bay Typhoon Shelter near the North Point lighthouse.	1) RSS notified ET on 8 Marc 2013 2) ET confirmed with RSS that excavation works, installation of buoy, flashing light and silt curtain and dredging works were undertaken at Eastern Breakwater during the concerned period on 6 March 2013. One backhoe equipped with breaker and one derrick barge were confirmed in operation while another backhoe was at idle during the concerned period on 6 March 2013. 3) Reviewing the photo record provided by RSS, the condition of the silt curtain deployed around the Eastern Breakwater on 6 March 2013 was found to be in good condition. It is considered that the silt curtain was properly in place during the concerned period and the concerned act of dropping of fine rock material was confined within the silt curtain boundary without adverse impact to the nearby water quality. Further follow up was conducted on 12 March 2013 during weekly environmental audit inspection, the silt curtain deployed around the concerned area was found to be maintained in good condition and the water quality at the concerned work area was generally satisfactory. No violation of the Environmental Permit condition was found. The contracotr was advised and committed to implement preventive meaures to mimize the potential impact of work including conducting regular diver check to ensure the integrity and the extend of silt curtain deployment and to provide adequtae back up stock of silt curtain for emergency use.	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
130606	30/5/2013	ICC Ref. No.: #1-430164728	Central – Man Kat Street	1. A number of trees (approximately more than ten) along Man Kat Street were found to be in poor health condition with withered and yellow leaves. The complainant has requested a follow-up by relevant department.	1) RSS notify ET on 6 June 2013 2) ET confirmed with the Resident Site Staff that According to the information provided by RSS, 13 no. of the trees - Roystonea regia (T1674, T1675, T1676, T1677, T1678, T1679, T1680, T1681, T1683, T1644, T1643, T1641, T1639) at the concerned location raised by the complainant was found to be with withered and yellow leaves and 1 no. of tree- Khaya senegalensis (T1712) raised by the complainant was found to be in poor health condition. No construction works was undertaken by Contract HY/2009/18 at the concerned planter area where the affected trees are located. It was also observed that an active CEDD construction works area under a separate contractor not related to Central Wan Chai Bypass Project was found to be located within the concerned planter area. 3) A follow-up joint inspection with RSS and Landscape specialist was conducted on 10 June 2013, it was considered that the withered and yellow leaves of the affected trees (T1674, T1675, T1676, T1677, T1678, T1679, T1680, T1681, T1683, T1644, T1643, T1641, T1639) at the concerned planter area were contributed by natural life cycle of the affected trees and the health condition of the affected trees were considered to be fair. It was also noted that an active CEDD works area was located within the concerned planter area in close proximity to few of the concerned trees (T1644, T1643, T1641, T1639) According to tree inspection records from Jan 2013 to May 2013 confirmed by RSS (Document Ref: CI-F1-043b, CI-F1-044b, CI-F1-045b, CI-F1-046b, CI-F1-047b), the affected tree (T1712) at the concerned planter area was considered to show sign of withering and considered to be in poor health condition in latest tree survey report confirmed by RSS.	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					During the follow-up inspection on 10 June 2013, It was observed that construction material and oil drum were placed near the the roots area of other trees within the CEDD works. Despite the above observation, no direct evidence was found on site which indicates the work front have contributed to the poor health condition of the affected tree (T1712) at the time of investigation. 4) The relevant contractor have removed the construction material near the root area of the trees retained on site and conduct pruning to remove the withered and yellow leaves retained on tree trunk to minimize impact on the trees appearance.In addition, safety supporting wire was provided for concerned tree (T1712) 5) ET recommended the contractor to keep in view the health condition of the concerned tree (T1712) and apply permission for tree felling together with tree compensation plan if considered necessary. Furthermore, the contractor was reminded to implement regular checking of tree health condition and regular removal of withered leaves to maintain the overall tree appearance.	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
130611	30 May 2013 and 1 June 2013	EPD Ref.:H04/RS/000 11587-13	Area near Central Pier	1. Noise was emanated from the construction site near the Central Piers at around 0900 hrs on 30 May 2013 and other days and requested follow up action by relevant department.	1) RSS notify ET on 11 June 2013 2) ET confirmed with the Resident Site Staff that According the information confirmed by RSS, major noise generating construction activities undertaken at works area near Central Pier during the concerned time include - Breaking up existing D-wall concrete and excavation at portion 4B and 4C - Sheet piling works at Portion VI (Man Kat Street) 3) Total 1 no. of Backhoe with breaker, 1 no. of Backhoe with vibratory hammer and 4 no.s of pneumatic breakers were deployed for the above construction activities. Reviewing the noise monitoring data at monitoring stations (M7e- International Finance Centre Eastern End of Podium and M7w- International Finance Centre Western End of Podium), no limit level exceedances were recorded during routine noise monitoring event on 28 May 2013 and 03 June 2013. As similar construction works activities conducted on 30 May 2013 was continued across the above monitoring period, the noise emanated from the construction activities under Contract HY/2009/18 was considered to complied with the statutory requirement. In addition, weekly environmental site inspection was conducted on 30 May 2013 at around 10:00. According to the inspection record, no particular observation regarding noise impact was recorded and the mitigation measures including erection of of temporary noise barrier was observed in place. As such, no direct information associated with the noise concerned raised was considered available and no non-conformity was identified. 4) ET recommend the contractor to review the need of additional noise mitigation measures to further reduce the noise enmated during construction works for pier side public area.	Interim report submitted to EPD on 19 June 2013, EPD advised no further comment on 5 Aug 2013and final report for case closing submitted on 6 Aug 2013.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
131010	03 Oct 2013	ICC Ref. No.1-467000768	Area between Central Pier and International Finance Centre	Noise and air quality impact was experienced at the area located between IFC and Central Pier during peak hours.	ET confirmed with the Resident Site Staff that 1) The major construction activities at the concerned location conducted over the past three months include; - Formwork, rebar and concreting - Backfilling - Water-proofing - Scaffolding erection 2) Mitigation measures implemented by the Contractor for the above construction works include - Select quiet plant and work methods; - Check plant and equipment for condition; - For use of powered mechanical equipment during restricted hours: Obtain necessary Construction Noise Permit and strictly comply with their conditions; - Frequently spray water to major haul road and stockpiles to suppress dust generation; and - Cover stockpiles with impervious sheets The construction activities including backfilling, concreting and other associated tunnel works were undertaken in the past three months. Having reviewing the monitoring data of the monitoring stations in the vicinity of the concerned location raised by the complainant, namely monitoring station M7e and M7w (Noise Monitoring Station) and MA1e and MA1w (Air Monitoring Station), no action or limit level exceedance was recorded. In addition, mitigations measures including water spraying and erection of noise barrier were observed during weekly site inspection in August and September 2013 and reminders on dust mitigations measures given during weekly site inspection to the contractor were rectified. As such, the construction activities under Contract HY/2009/18 were considered in compliance with the statutory requirement and no cumulative air/ noise quality impact was observed in the past three months.	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					Elevated noise level at monitoring station M7e (International Finance Centre East Podium) was noted on 24 September 2013. The Contractor is recommended to review the current measures and to implement additional noise mitigation measures to further avoid potential impact to nearby public area during construction works.	
131217	16 Dec 2013	ICC Case Ref.: 1-484998552	Victoria Park near Hing Fat Street Exit	Sweeping of muddy water into public drains.	ET confirmed with the Resident Site Staff that 1)The major construction activities around the concerned location conducted on 16 Dec 2013 a.m.includes: -Preparation work of rootball for tree transplanting According to the information provided by RSS, the construction activities around the concerned location on 16 Dec 2013 include preparation work of rootball for tree transplanting at Zone 17/18. A further investigation on the complaint was conducted on 19 Dec 2013 during weekly environmental inspection. It was observed that a tree worksarea comprised of mainly loosen soil was located near the concerned location. It was considered that the inclined surface and loosen soil nature of the concerned worksarea could have led to the muddy surface runoff in rain. Deposition of muddy runoff onto nearby public pavement outside worksarea was hence resulted and was subsequently cleaned into nearby public stormwater drain by the Contractor's workers on the complaint date. As such, the case was considered as works related. Sandbags, geotextile and gravels were immediately placed by the Contractor around the gullies at the concerned location to prevent leftover muddy runoff to the public stormwater drain as observed during the weekly inspection on 19 Dec 2013. With respect to the follow-up raised by the complainant on 19 Dec 2013, sandbags, geotextile and gravels placed at gullies located at public area were removed by the Contractor on the same day for maintaining passible public pavement. Follow up measures including sandbag bundle and covering of worksarea with impervious sheeting was immediately placed at the source of impact at the concerned worksarea boundary by the Contractor.	Final investigation report issued on 20 Dec 2013. Case closed on 3 Jan 2014.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
131224	24 Dec 2013	(ICC Case Ref.: 1-486434321	Victoria Park Children Playground	Odour and large amount of dust particles affecting the public user of the Victoria Park near Children playground	ET confirmed with the Resident Site Staff that 1) The major construction activities around the concerned location conducted on 24 Dec 2013 include: - Breaking up existing pillar box for new children playground Portion II - Pressing of sheet pile at bowling green for ELS works Portion XII - Welding work for preparation of sheetpiling work at bowling green Portion VI - Demolition of existing pavilion for bowling green Portion VI - Felling of tree TA50 at Victoria Park Zone 2) Mitigation measures implemented by the Contractor for the above construction works include - Water spraying for demolition and other dust generating works. According to the relevant site records, breaking up of existing pillar box, pressing of sheet pile, welding work for preparation of sheetpiling demolition of existing pavilion and felling of tree TA50 at Victoria Park Zone 13 were conducted at the concerned location during the time of complaint. Based on information and photo record provided by the RSS, dust mitigation measures including water spraying during dust generating works were implemented by the Contractor at the concerned location on 24 Dec 2013. Follow-up investigation was conducted on 27 Dec 2013 during weekly environmental inspection, dust mitigation measures including water spraying to dusty area and major dust generation works were confirmed in place despite a general reminder was given to the contractor to enhance the water spraying to dusty haul road during dry season. Based on on-going site inspection and the follow-up investigation, the site condition was considered generally satisfactory and no non-conformance was identified. Upon further review on the supplementary information provided by the complainant on 31 Dec 2013 and investigation conducted on 2 Jan 2014, the tree felling work of tree TA50 was located nearest to the location of the complainant. According to the location plan provided by the RSS and on site investigation, the tree felling work	Case closed and full investigation report issued on 3 Jan 2014.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					for TA50 was immediately in front of the location of the complainant. Based on site observation, scrap material of bark and leaves inevitably generated from cutting of branches during tree felling work was considered to be the most probable cause for the observation raised by the complainant at the concerned location on 24 Dec 2013. Furthermore, welding work was observed near the concerned location and was considered to be the potential source for the smell and exhaust fumes as described by the complainant. Notwithstanding the above, welding work was not identified as a work activity with air quality impact under Project EIA report but it would be desirable to implement preventive measures to minimize potential nuisance to nearby public.	
140123	22 Jan 2014	ICC Case Ref.:1-494077682	Causeway Bay Typhoon Shelter	Construction works have been undertaken during restricted hours until 2300 hrs and occasionally the working hours were extended to around 0100 hrs at nighttime period over the last two to three months at a construction site located within Causeway Bay Typhoon Shelter. For instance, concreting and excavation works were conducted at the concerned location on 22 Jan 2014 during nighttime hours and generated noise impact to the complainant.	ET confirmed with the Resident Site Staff that No construction activity was undertaken at workzone TS1 under HY/2009/15 within Causeway Bay Typhoon Shelter after 1900 hrs on 21 Jan 2014. No construction activity was undertaken at workzone TS3 under HY/2010/08 within Causeway Bay Typhoon Shelter after 1900 hrs on 21 Jan 2014. Concreting for base slab and hanger wall was conducted at workzone TS2 under HY/2009/15 within Causeway Bay Typhoon Shelter from 1900 to 0000 hrs on 21 Jan 2014; Total 8 no.s of concrete lorry mixers, 1 no. of water pump, 2 no.s of concrete pumps (lorry mounted), 1 no. of mobile crane QPME (diesel) and 3 no.s of vibratory pokers were operating from 1900 to 0000hrs on 21 Jan 2014. Concreting for base slab and hanger wall was conducted at workzone TS2 under HY/2009/15 within Causeway Bay Typhoon Shelter from 0000 to 0700 hrs on 22 Jan 2014; Total 1. no of concrete lorry mixer, 1 no. of water pump, 1 no. of concrete pump (lorry mounted), 1 no. of vibratory poker were operating from 1900 to 0000hrs on 22 Jan 2014	Case closed and full investigation report issued on 4 Feb 2014.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					According to the relevant site records, from 1900-0000hrs on 21 Jan 2014, concreting for base slab and hanger wall was conducted at workzone TS2 under HY/2009/15 within Causeway Bay Typhoon Shelter. Total 8 no.s of concrete lorry mixers, 1 no. of water pump, 2 no.s of concrete pumps (lorry mounted), 1 no. of mobile crane QPME (diesel) and 3 no.s of vibratory pokers were operating at the above period. From 0000 to 0700 hrs on 22 Jan 2014, concreting for base slab and hanger wall was conducted at workzone TS2 under HY/2009/15 within Causeway Bay Typhoon Shelter. Total 1. no of concrete lorry mixer, 1 no. of water pump, 1 no. of concrete pump (lorry mounted), 1 no. of vibratory poker were found operating at the above period. After reviewing relevant photo records and information verified by RSS and the Construction Noise Permit (CNP) no.GW-RS1384-13, it was considered that several conditions of CNP GW-RS1384-13 were not fulfilled by the Contractor in particular for the item(s) below, No acoustic installation was provided for the relevant PME(s) used as stated in CNP condition 3.d.during the concerned concreting works. From 1900 to 2300 hours on 21 Jan 2014, the PME(s) used on-site did not comply with any given PME grouping requirement(s) as stated in condition 3.a. and condition 3.d. in CNP no.GW-RS1384-13. From 0000 to 0700 hours on 22 Jan 2014, the PME(s) used by the Contractor on-site did not comply with any given PME grouping requirement(s) as stated in condition 3.a. and condition 3.d. in CNP no.GW-RS1384-13. From 1900 to 2300 hours on 21 Jan 2014 and from 0000 to 0700 hours on 22 Jan 2014, PME (Concrete Lorry Mixer) was deployed by the Contractor without barge enclosure and was unable to comply with condition 3.a. in CNP no.GW-RS1384-13.	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
140127	24 Jan 2014	ICC Case Ref.: 1-494612639	Works area adjacent to the Victoria Park Bowling Green	Noise generated from piling works conducted at the works area adjacent to the Victoria Park Bowling Green have created nuisance to the Bowling Green users.	ET confirmed with the Resident Site Staff that The major construction activities around the concerned location conducted on 23 Jan 2014 include: Pressing of sheetpile Ch.279-285 (RHS) and Ch.317 for ELS works on 23 Jan 2014. Splicing of sheetpile Ch.275-285 (LHS) for ELS works on 23 Jan 2014. Mitigation measures implemented by the Contractor for the above construction works include: Installation of acoustic panels along hoarding line at East Bowling Green; Installation of addition noise barriers on top of hoarding at East Bowling Green; Display of publicity notices along hoarding line; and No noisy work shall be carried out at the areas adjoining East Bowling Green as if there is any Bowling Green competition event to be held (i.e. Saturday afternoon). According to relevant site records, pressing of sheetpile Ch.279-285 (RHS) and Ch.317 for ELS works and splicing of sheetpile Ch.275-285 (LHS) for ELS works were conducted at the concerned location during the time of complaint. Based on the photo records and information verified by RSS, noise mitigation measures including installation of acoustic panels along hoarding line at East Bowling Green and installation of addition noise barriers on top of hoarding at East Bowling Green were implemented by the Contractor at the concerned location. Furthermore, no noisy work was conducted by contractor at the areas adjoining	Case closed and full investigation report issued on 6 Feb 2014.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					East Bowling Green when there is any Bowling Green competition event to be held. Follow-up investigation was conducted on 29 Jan 2014 during weekly environmental inspection, noise mitigation measures including noise barriers and acoustic panels were confirmed in place and maintained in good condition. According to previous environmental inspections recorded in Jan 2014, no particular observation regarding the noise impact was recorded. As such, no non-conformity was identified.	
140311	27 Feb 2014	EPD Complaint Case (Ref:H04/RS/00 04232-14) received by ET on 11 March 2014	Central IFC Area	Excessive noise (from the operation of compressors, other heavy machinery and concrete breaking) was emanated from the construction site near IFC in daytime on 27 Feb 2014.	ET confirmed with the Resident Site Staff that the major construction activities at the concerned location conducted on 27 Feb 2014 (Daytime) include: Backfilling works between north wall and sheetpiles and for roof slab; Site hoarding removal; Formwork erection and removal works, falsework erection; Concrete breaking works at roof slab and base slab and breaking up of existing tunnel corner; Concreting works for profile barrier inside cut and cover tunnel; and Rebar fixing works and WVB basement remediation works. Mitigation measures implemented by the Contractor for the above construction works include: Use of quiet plants (air compressor with a Noise Emission Label of 99 dB(A)).	Interim report submitted to EPD on 18 March 2014, EPD advised no further comment on 26 March 2014 and final report for case closing issued on 26 March 2014



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					According to relevant site records, major noise emanating construction activities conducted around the concerned location on 27 Feb 2014 include concrete breaking works at roof slab and base slab and breaking up of existing tunnel corner and concreting works. Based on information verified by the RSS, noise mitigation measure including utilization of quiet air compressor with noise emission label of 99 dB(A) was implemented by the Contractor on the 27 February 2014 to minimize the potential noise impact. Having reviewed the monitoring data of the monitoring stations in the vicinity of the construction site near IFC, namely noise monitoring stations M7e and M7w, no limit level exceedances were recorded on 24 Feb 2014 and 4 March 2014 and the major concrete breaking works at the concerned location conducted on 27 February 2014 was continued across the above monitoring period. In addition, no particular observations regarding noise impact were recorded during weekly site inspection conducted on 27 Feb 2014. No non-conformity was identified. As such, the construction activities under Contract HY/2009/18 were considered generally in compliance with the statutory requirement. Nevertheless, in view of the concern regarding noise nuisance raised by public, it is considered desirable for the Contractor to review and strengthen the noise mitigation measures around the concerned location. Follow-up inspection was conducted during weekly environmental inspection on 13 March 2014, additional noise mitigation measure including erection of noise blanket for concrete breaking works were implemented by the Contractor to further minimize the noise nuisance to nearby public	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
140623	11 June 2014	EPD Complaint Case (Ref:H04/RS/00 013590-14) received by ET on 23 June 2014	Foot Bridge to Central Pier 7	Excessive Paint Spray Odour	A public complaint regarding odour concern referred by EPD was received by ET on 23 June 2014. The complainant reported that excessive paint spray odour was detected at the foot-bridge to the Central Pier 7. ET confirmed with the Resident Site Staff that spraying of waterproofing membrane (integritank) from Ch1700 to Ch1705 was conducted at roof slab Bay12 on 11 June 2014 and Screeding concrete placing from Ch1700 to Ch1683 was conducted at roof slab Bay12 on 11 June 2014 and Backfilling and removal of concrete blocks was conducted at roof slab Bay 11 and Bay 10-north on 11 June 2014 According to relevant site records, major construction activities conducted around the concerned location on 11 June 2014 include spraying of waterproofing membrane (integritank) from Ch1700 to Ch1705; screeding concrete placing from Ch1700 to Ch1683 and backfilling and removal of concrete blocks. Having reviewed the relevant information verified by RSS, the chemicals applied at the concerned area on 11 June 2014 are waterproof paint and paint adhesives. In view of the concern regarding odour nuisance raised by the public, it is considered desirable for the Contractor to review the application method for waterproof layer nearby public area to minimize the nuisance caused to the surroundings.	Preliminary report issued on 25 June 2014. Interim report submitted to EPD on 30 June 2014.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					Follow-up inspection was conducted during weekly environmental inspection on 26 June 2014, no further spraying works was conducted by the Contractor at the concerned area and no particular odour was observed at the concerned location.	
ICC Case Ref.: 2-341537112	21 July 2014	ICC complaint received by ET on 23 July 2014	Area opposite to Ngan Tao Building	Noise nuisance due to works and machine at opposite project site during nighttime	A public complaint regarding construction noise impact referred by RSS was received by ET on 25 July 2014 (ICC Case Ref.: 2-341537112 dated 21 July 2014). The complainant reported that : At 00:57hrs on 21 July 2014, he could not sleep due to work and machine at the project site opposite to the building (Ngan Tao Building), where he was living, were still going on and in operation. Noise traveled to his flat despite it was some distance away. ET confirmed with the Resident Site Staff that dewatering works was conducted under HY/2009/19 at the works area at Watson Road from around 23:00hrs on 20 July 2014 to 01:00hrs on 21 July 2014. Total 1 no. of generator and 23 nos. of dewatering pumps were in operation. Mobilization of telescopic arm excavator to trailer truck was performed under HY/2009/19 at the works area at Watson Road from around 00:15hrs to 01:00hrs on 21 July 2014. Total 1 no. of telescopic arm excavator and 1 no. of trailer truck were in operation. According to the relevant site records under Contract HY/2009/19, from around 23:00hrs on 20 July 2014 to 01:00hrs on 21 July 2014, dewatering works was conducted under HY/2009/19 at the works area at Watson Road. Total 1 no. of generator and 23 nos. of dewatering pump were in	Final Investigation report (Issue1) issued on 31 July 2014. Final investigation report (Issue 2) based on further follow-up issued on 12 Aug 2014.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					operation at the above period. In addition, mobilization of telescopic arm excavator to trailer truck was performed under HY/2009/19 at the works area at Watson Road from around 00:15hrs to 01:00hrs on 21 July 2014. Total 1 no. of telescopic arm excavator and 1 no. of trailer truck were in operation. After reviewing relevant records and information verified by RSS and the Construction Noise Permit (CNP) no. GW-RS0152-14, it was considered that the below condition of CNP no.GW-RS0152-14 was not fulfilled by the Contractor of HY/2009/19. From 00:15hrs to 01:00hrs on 21 July 2014, the PME(s) (1 no. of telescopic arm excavator and 1 no. of trailer truck) operated under the Contractor of HY/2009/19 on-site could not follow any given PME grouping requirement(s) as stated in condition 3.a. and condition 3.d. in no.GW-RS0152-14. Notwithstanding the above, according to the information provided by the RSS, the telescopic arm excavator was mobilized at night time hours with consideration that passage of vehicle with large plant & machinery through cross harbour tunnel shall be conducted after mid-night. the Contractor of HY/2009/19 was advised to review the need to renew relevant CNP for PME grouping with respect to specific site operation requirements such that the Construction Noise Permit would be followed. Furthermore, the Contractor of HY/2009/19 was suggested to review the arrangement for PME mobilization with maintenance need to be conducted within specific period allowed under the relevant CNP(s).	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
ICC Case Ref.: 2-360638977	30 July 2014	ICC complaint received by ET on 01 August 2014	Area opposite to Harbour Heights	Noise of sand and gravel movements at area opposite to the Harbour Heights	A public complaint regarding construction noise impact referred by RSS was received by ET on 01 Aug 2014 (ICC Case Ref.: 2-360638977 dated 31 July 2014). The complainant reported that at 01:20hrs on 30 July 2014, the complainant was woken up by the noise of sand and gravel movements at area opposite to the Harbour Heights. ET confirmed with the Resident Site Staff that EVB excavation was undertaken at the works area around Watson Road under HY/2009/19 before 23:00hrs on 29 July 2014. (Total 1 no. of excavator, 1 no. of dump truck, 23 nos. of underground dewatering pump and 3 nos. of generator were in operation). Dewatering works was undertaken at works area around Watson Road under HY/2009/19 from 23:00hrs on 29 July 2104 to 01:00 hrs on 30 July 2014. (Total 23 nos. of underground dewatering pumps and 1 no. of generator were in operation). Mobilization of PMEs was performed at works area around Watson Road under HY/2009/19 from 00:45hrs to 01:30hrs on 30 July 2014. (1 no. of excavation machine and 1 no. of dump truck were in operation). No other construction activity or operation was performed at the area opposite to Harbour Heights from 23:00hrs on 29 July 2014 to 01:00hrs on 30 July 2014 under HY/2009/19. According to the relevant site records, before 2300hrs on 29 July 2014, EVB excavation at the works area around Watson Road was conducted under HY/2009/19. (Total 1 no. of dump truck , 1 no. of excavator, 3 nos. of generators and 23 nos. of dewatering pumps were in operation at the	Final investigation report issued on 12 Aug 2014.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					above period). From around 23:00hrs on 29 July 2014 to 01:00hrs on 30 July 2014, dewatering works at works area around Watson Road was conducted under HY/2009/19. Total 23 nos. of dewatering pumps were operating at the above period. In addition, mobilization of PMEs was performed at works area around Watson Road under HY/2009/19 from 00:45hrs to 01:30hrs on 30 July 2014. Total 1 no. of excavation machine and 1 no. of dump truck were in operation. After reviewing relevant records and information verified by RSS and the Construction Noise Permit (CNP) no. GW-RS0152-14, it was considered the below condition of CNP GW-RS0152-14 was not fulfilled by the Contractor of HY/2009/19. From around 00:45hrs to 01:30hrs on 30 July 2014, the operation of PME(s) (1 no. of excavator and 1 no. of dump truck) under the Contractor of HY/2009/19 on-site could not follow any given PME grouping requirement(s) as stated in condition 3.a. and condition 3.d. in no. GW-RS0152-14. Notwithstanding the above, according to the information provided by the RSS, the excavator and dump truck were mobilized away from the edge of the temporary ELS structure towards the area opposite to the Harbour Heights after 23:00hrs under safety consideration. The Contractor of HY/2009/19 was advised to review the arrangement and location for retaining and securing PME(s)/ plants to minimize the movements of PME or plants after completion of works such that the Construction Noise Permit would be followed.	



Appendix 10.1

Construction Programme of Individual Contracts

Activity ID	Activity Name	OD	RD	Start	Finish	% Comp	Total Float	2014				
								Jun		Jul	Qtr 3	
										Aug	Sep	
HK/2009/01 - Works Programme Rev.6D (Data Date: 20-Jun-14)												
Key Dates (Contractual)												
Major Works												
KD-0400B	Completion of Outstanding Works for Section 4 - Salt Watermains	0	0		20-Jun-14*	0%	-629					Completion of Outstanding Works for Section 4 - Salt Watermains
Key Dates (Forecast Completion)												
Major Works												
KD-0405B	Completion of Outstanding Works for Section 4 - Salt Watermains & Works in Area 3	0	0		02-Sep-14	0%	-704					Completion of Outstanding Works for Section 4 - Salt Watermains & Works in Area 3
KD-0805	Completion of Section 8 of Works - Works in Area 6	0	0		09-Aug-14	0%	87					Completion of Section 8 of Works - Works in Area 6
Preliminaries												
Method Statement & Design (Major) Approval by AECOM												
PRE-2000G	D-Wall Construction for CWB Tunnel (Stage 3)	60	1	05-Nov-13 A	20-Jun-14*	0%	-181					D-Wall Construction for CWB Tunnel (Stage 3)
PRE-2030B	ELS for CWB Stage 2	30	1	20-Mar-14 A	18-Jul-14	0%	758					ELS for CWB Stage 2
PRE-2030C	ELS for CWB Stage 3	30	0	19-Apr-14 A	18-Aug-14	100%	-156					ELS for CWB Stage 3
Statutory / Authority Approval												
PRE-3050B	ELS for CWB Tunneling Works Stage 2 (GEO)	28	28	21-Jun-14*	18-Jul-14	0%	-376					ELS for CWB Tunneling Works Stage 2 (GEO)
PRE-3050C	ELS for CWB Tunneling Works Stage 3 (GEO)	28	28	21-Jul-14	17-Aug-14	0%	-156					ELS for CWB Tunneling Works Stage 3 (GEO)
PRE-3050D	ELS for CWB Tunneling Works Stage 1b (GEO) for Bottom Up	28	1	20-Apr-11 A	20-Jun-14	0%	-376					ELS for CWB Tunneling Works Stage 1b (GEO) for Bottom Up
Watermains Connection Submission Approval by WSD/Stakeholders												
PRE-3200C	Salt Water Mains (S3)	28	28	01-Sep-14*	28-Sep-14	0%	0					Salt Water Mains (S3)
PRE-3200D	Salt Water Mains (S8)	28	28	20-Jun-14*	17-Jul-14	0%	-384					Salt Water Mains (S8)
PRE-3200E	Salt Water Mains (S9)	28	28	20-Jun-14*	17-Jul-14	0%	-671					Salt Water Mains (S9)
PRE-3200O	Cooling Watermains (BF)	28	28	01-Sep-14*	28-Sep-14	0%	0					Cooling Watermains (BF)
PRE-3200P	Cooling Watermains (BG)	28	28	01-Sep-14*	28-Sep-14	0%	0					Cooling Watermains (BG)
PRE-3200Q	Cooling Watermains (BI)	28	28	01-Sep-14*	28-Sep-14	0%	0					Cooling Watermains (BI)
Contractor's Design (CWB Diaphragm Wall)												
PRE-4020	Contractor's Detailed Design	30	1	09-Jul-11 A	20-Jun-14	40%	726					Contractor's Detailed Design
PRE-4030	AECOM's and GEO's approval on Detailed Design	60	60	21-Jun-14	19-Aug-14	0%	726					AECOM's and GEO's approval on Detailed Design
Contractor's Design (PS1.94)												
PRE-5100C	Approval of ICCP of Cross-Harbour Mains - by AECOM & Relevant Authorities	28	0	04-Mar-11 A	20-Jun-14	100%	787					Approval of ICCP of Cross-Harbour Mains - by AECOM & Relevant Authorities
TTA Implementation and Completion Summary Milestone												
Zone A2 (At Convention Avenue)												
TTAM-A2-1040D	TTA Completion - Zone A2-4B	0	0		02-Aug-14	0%	-673					TTA Completion - Zone A2-4B
Zone A3 (At Fenwick Pier Street)												
AA1030	TTA Completion - Combination of Zone A3-5D & A3-4D (Sewer)	0	0		20-Jun-14	0%	85					TTA Completion - Combination of Zone A3-5D & A3-4D (Sewer)
AA1040	TTA Implementation - Zone A3-2C (Sewer)	0	0	20-Jun-14*		0%	85					TTA Implementation - Zone A3-2C (Sewer)
AA1050	TTA Completion - Zone A3-2C (Sewer)	0	0		31-Jul-14	0%	745					TTA Completion - Zone A3-2C (Sewer)
AA1060	TTA Implementation - Zone A3-2D (Sewer)	0	0	20-Jun-14		0%	85					TTA Implementation - Zone A3-2D (Sewer)
AA1070	TTA Completion - Zone A3-2D (Sewer)	0	0		31-Jul-14	0%	745					TTA Completion - Zone A3-2D (Sewer)
TTAM-A3-1090B	TTA Completion - Zone A3-5C - Salt Water	0	0		29-Aug-14	0%	-700					TTA Completion - Zone A3-5C - Salt Water
Zone A4 (At Convention Avenue)												
TTAM-A4-1020D	TTA Completion - Zone A4-2B (Night Works)	0	0		29-Jun-14	0%	-690					TTA Completion - Zone A4-2B (Night Works)
TTAM-A4-1120A	TTA Implementation - Zone A4-2C	0	0	30-Jun-14		0%	-690					TTA Implementation - Zone A4-2C
TTAM-A4-1120B	TTA Completion - Zone A4-2C	0	0		13-Aug-14	0%	-684					TTA Completion - Zone A4-2C
Zone A5 (At Harbour Road)												
TTAM-A5-1050B	TTA Completion - Zone A5-6	0	0		27-Aug-14	0%	-698					TTA Completion - Zone A5-6
Area X3 (Fleming Road b/w Harbour Road & Convention Avenue)												
TTAM-X3-1000B	TTA Completion - Zone X1-1	0	0		03-Jul-14	0%	107					TTA Completion - Zone X1-1
TTAM-X3-1000D	TTA Completion - Zone X1-1A	0	0		26-Jun-14	0%	780					TTA Completion - Zone X1-1A
TTAM-X3-1010B	TTA Completion - Zone X1-2	0	0		23-Jul-14	0%	753					TTA Completion - Zone X1-2
TTAM-X3-1020B	TTA Completion - Zone X1-3	0	0		23-Jul-14	0%	753					TTA Completion - Zone X1-3
Zone C (Expo Drive East)												
TTAM-C1-1000B	TTA Completion - Zone C1-1	0	0		03-Jul-14	0%	27					TTA Completion - Zone C1-1
TTAM-C1-1010C	TTA Implementation - Zone C1-2A	0	0	04-Jul-14		0%	27					TTA Implementation - Zone C1-2A
TTAM-C1-1010D	TTA Completion - Zone C1-2A	0	0		02-Aug-14	0%	743					TTA Completion - Zone C1-2A

Activity ID	Activity Name	OD	RD	Start	Finish	% Comp	Total Float	2014											
								Qtr 3											
								Jun			Jul			Aug			Sep		
TTAM-C2-1100B	TTA Completion - Zone C2-2	0	0		23-Jul-14	0%	-8												
TTAM-C3-1000A	TTA Implementation - Zone C3-1	0	0	24-Jul-14		0%	-8												
Section 3 of the Works - CWB Tunnel, Slip Roads 2 & 3, Works in Area 8																			
CWB Tunnelling Works (Stage 1 : CH2947 - CH3045)																			
Stage 1 - Tunnel Structure Works (Bay 1 to Bay 7 : Ch2947 - Ch 3045)																			
Tunnel Structure at Stage 1A & 1B (CH2947 - CH3045)																			
S3A-TS-2000	Tunnel Structures Works including Waterproofing and OHVD	300	191	28-Feb-14 A	27-Dec-14	0%	224												
CWB Tunnelling Works (Stage 2 : Ch3045 - Ch3129)																			
Stage 2 - Foundation Works (Bottom Up Method : CH3045 - CH3129 / CH120 - CH225)																			
S3B-FW-1060B	Pre-bored H Piles for CWB (38 Piles w/ 1 piling rig) - 4th row & ED	90	73	27-Jan-14 A	31-Aug-14	0%	679												Pre-bored H Pile
Stage 2 - Excavation Works (For Bottom Slab Construction : CH3045 - CH3129)																			
S3B-EW-1020	Excavate to -3.0 mPD for installation of waling/strut at +1.5mPD & -2.0 mPD (30,000 cu.m)	185	156	22-May-14 A	22-Nov-14	0%	-130												
CWB Tunnelling Works (Stage 3 : Ch3129 - Ch3245)																			
Stage 3 - Reclamation Works																			
Demolition Works																			
Demolition Works - Stage 3																			
DW3-1000	Demolition of Existing 10nos. Pump Houses along Convention Avenue	90	73	21-May-14 A	31-Aug-14	18.89%	372												Demolition of Exis
DW3-1015	Partial Demolition of Existing Bridge from North to South	60	1	02-May-14 A	20-Jun-14	0%	-236												Partial Demolition of Existing Bridge from North to South
DW3-1020	Demolition of Remaining Existing Expo Drive East Bridge at Southern Bound	28	28	21-Jun-14	18-Jul-14	0%	-236												Demolition of Remaining Existing Expo Drive East Bridge at
Expo Drive East (Diversion and Reprovision)																			
AA1150	Zone X1-1A - Temporary UU Connection/Change Over Point	60	7	22-May-14 A	26-Jun-14	0%	780												Zone X1-1A - Temporary UU Connection/Change Over Point
EDE-1040	Temporary Utilities Diversion at existing footpath/road JO (incl. changeover, pressure test and	60	7	22-Apr-14 A	26-Jun-14	0%	780												Temporary Utilities Diversion at existing footpath/road JO (incl. changeover, press
Stage 3 - Foundation Works																			
S3C-FW-1040B	Remaining Stage 3 D- wall Construction for CWB (34 panels) - including adv. work & remov	96	96	03-Jun-14 A	23-Sep-14	0%	-202												
S3C-FW-1050E	Stage 3 Pre-bored H-pile for CWB - 179 piles w/2 ~ 4 piling rigs) incl piles for culvert & loadi	253	213	02-May-14 A	18-Jan-15	0%	-310												
Section 4 of the Works - Salt Water Mains, Works in Area 3																			
S8B (DN800) Salt Watermains																			
S4-1000	Zone A4-2C - S8B (20m)	45	45	30-Jun-14	13-Aug-14	0%	-690												Zone A4-2C - S8B (20m)
S4-1010C	Zone A4-2B - S8B (20m)	48	9	07-Oct-13 A	29-Jun-14	0%	-690												Zone A4-2B - S8B (20m)
S4-1010D	Zone A4-2Brev - S8B (10m)	21	10	14-Mar-14 A	29-Jun-14	0%	-690												Zone A4-2Brev - S8B (10m)
S4-1100	Zone A5-6 - S8B (15m)	25	58	09-Jan-14 A	27-Aug-14	100%	-563												Zone A5-6 - S8B (15
Testing and Commissioning																			
S4-1500	Pressure Test of S8B	6	6	28-Aug-14	02-Sep-14	0%	-704												Pressure Test of
S4-1510	Cleaning of S8B	7	7	03-Sep-14	09-Sep-14	0%	-360												Cleaning
S4-1520	Connection to Existing Mains (S8B)	14	14	10-Sep-14	23-Sep-14	0%	-360												Connection to Existing Ma
S9 (DN450) Salt Watermains & Sewer																			
S4-2080	Zone A2-4B - S9 (8m) - Testing point	24	37	04-Dec-13 A	02-Aug-14	0%	-560												Zone A2-4B - S9 (8m) - Testing point
S4-2120	Zone A3-5C - S9 (8m) - Testing point	14	20	16-Jul-13 A	02-Aug-14	0%	-537												Zone A3-5C - S9 (8m) - Testing point
Testing and Commissioning																			
S4-2500	Pressure Test of S9	6	6	03-Aug-14	08-Aug-14	0%	-700												Pressure Test of S9
S4-2510	Cleaning of S9	7	7	09-Aug-14	15-Aug-14	0%	-700												Cleaning of S9
S4-2520	Connection to Existing Mains (S9)	7	7	16-Aug-14	22-Aug-14	0%	-700												Connection to Existing Ma
Section 6A of the Works - Cooling Water Discharge System (3 nos. Govt Towers)																			
S6A-1000	Zone C2-2 - CHBF (7m)	45	34	20-Jan-14 A	23-Jul-14	0%	-8												Zone C2-2 - CHBF (7m)
S6A-1020A	Zone C1-2A - CHBF (18m)	30	30	04-Jul-14	02-Aug-14	0%	743												Zone C1-2A - CHBF (18m)
S6A-1030	Zone C1-1 - CHBF (20m)	21	14	21-Feb-14 A	03-Jul-14	0%	27												Zone C1-1 - CHBF (20m)
S6A-1200	Zone X1-1 - CHBF (11m)	24	14	20-Jun-14*	03-Jul-14	0%	72												Zone X1-1 - CHBF (11m)
S6A-1210	Zone X1-2 - CHBF (5m)	24	34	10-Mar-14 A	23-Jul-14	0%	52												Zone X1-2 - CHBF (5m)
S6A-1220	Zone X1-3 - CHBF (7m)	24	34	10-Mar-14 A	23-Jul-14	0%	52												Zone X1-3 - CHBF (7m)
S6A-1240	Zone C3-1 - CHBF (16m) Test and Connection Point	60	60	24-Jul-14	21-Sep-14	0%	-8												
Section 6B of the Works - Cooling Water Intake & Discharge System (Great Eagle / Harbour Centre)																			
S6B-1000	Zone C2-2 - CHBG (7m)	45	34	20-Jan-14 A	23-Jul-14	0%	-8												Zone C2-2 - CHBG (7m)
S6B-1020A	Zone C1-2A - CHBG (18m)	30	45	04-Jul-14	17-Aug-14	0%	27												Zone C1-2A - CHBG (18m)
S6B-1220	Zone C3-1 - CHBG (16m) Test and Connection Point	60	60	24-Jul-14	21-Sep-14	0%	-8												
Section 6C of the Works - Cooling Water Discharge System (China Resources Building)																			

Remaining Work

Actual Work

Summary Bar

Critical Remaining Work



Milestone

Summary Bar

Activity ID	Activity Name	OD	RD	Start	Finish	% Comp	Total Float	2014				
								Qtr 3				
								Jun	Jul	Aug	Sep	
S6C-1000	Zone C2-2 - CHBI (7m)	45	34	20-Jan-14 A	23-Jul-14	100%	-8					Zone C2-2 - CHBI (7m)
S6C-1020A	Zone C1-2A - CHBI (18m)	30	30	04-Jul-14	02-Aug-14	0%	42					Zone C1-2A - CHBI (18m)
S6C-1600	Zone C3-1 - CHBI (16m) Test and Connection Point	60	60	24-Jul-14	21-Sep-14	0%	-8					
Section 8 of the Works - Works in Area 6 (Utilities other than Watermains in Fenwick Pier Street)												
Sewerage Works												
AA1170	Relocation of existing light pole by Others	0	0		20-Jun-14*	0%	787					◆ Relocation of existing light pole by Others
S8-1040	Zone A3-2C - 9 m pipe	23	35	20-Jun-14	31-Jul-14	0%	71					Zone A3-2C - 9 m pipe
S8-1050	Zone A3-2D - 8m pipe & Connection with downstream existing manhole	23	35	20-Jun-14	31-Jul-14	0%	71					Zone A3-2D - 8m pipe & Connection with down
S8-2500	CCTV Survey	1	1	01-Aug-14	01-Aug-14	0%	71					CCTV Survey
S8-3000	Zone A2-1 - Connection with Upstream Existing Manhole & Abandon Used Pipe	7	7	02-Aug-14	09-Aug-14	0%	71					Zone A2-1 - Connection with Upstream
Section 9 of the Works - Remaindar of the Works												
Box Culvert Construction												
S9-1030	Construction of Transition Chamber for Existing Box Culvert Diversion	30	30	19-Jul-14	22-Aug-14	0%	-186					Construction of Transition
S9-1040	Pre-bored H Piles (8 nos) for Box Culvert	40	40	10-Jun-14 A	06-Aug-14	0%	-186					Pre-bored H Piles (8 nos) for Box Culvert
S9-1040A	Installation of Sheet Pile for Bay7	45	45	23-Aug-14	06-Oct-14	0%	-234					
S9-1040B	Installation of Sheet Pile for Bay 2	45	45	23-Aug-14	06-Oct-14	0%	-234					
Waterworks in Area 9												
Salt Water Mains (S3, S5A & S5B)												
S9-5500A	Zone X1-1 - S3 (5m)	0	0		03-Jul-14	0%	107					◆ Zone X1-1 - S3 (5m)
S9-5500B	Zone X1-2 - S3 (5m)	0	0		23-Jul-14	0%	167					◆ Zone X1-2 - S3 (5m)
S9-5500C	Zone X1-3 - S3 (5m)	0	0		23-Jul-14	0%	167					◆ Zone X1-3 - S3 (5m)
Fresh Water Mains (F3)												
AA1180	Zone X1-1 - F3 (5m)	0	0		03-Jul-14	0%	187					◆ Zone X1-1 - F3 (5m)
AA1190	Zone X1-2 - F3 (5m)	0	0		23-Jul-14	0%	167					◆ Zone X1-2 - F3 (5m)
AA1200	Zone X1-3 - F3 (5m)	0	0		23-Jul-14	0%	167					◆ Zone X1-3 - F3 (5m)
Section 13 of the Works - Works in Area 11 (other than Section 11)												
S13-3000	Completion of Backfilling to +5.0mPD	0	0		20-Jun-14	0%	253					◆ Completion of Backfilling to +5.0mPD
Section 9A of the Works - Landscape Softworks in Area 9												
S9A-1000	Transplanting at Expo Drive East and Convention Avenue Junction	180	180	20-Jun-14	16-Dec-14	0%	242					

CEDD CONTRACT HK/2009/02


CHUN WO - CRGL JOINT VENTURE

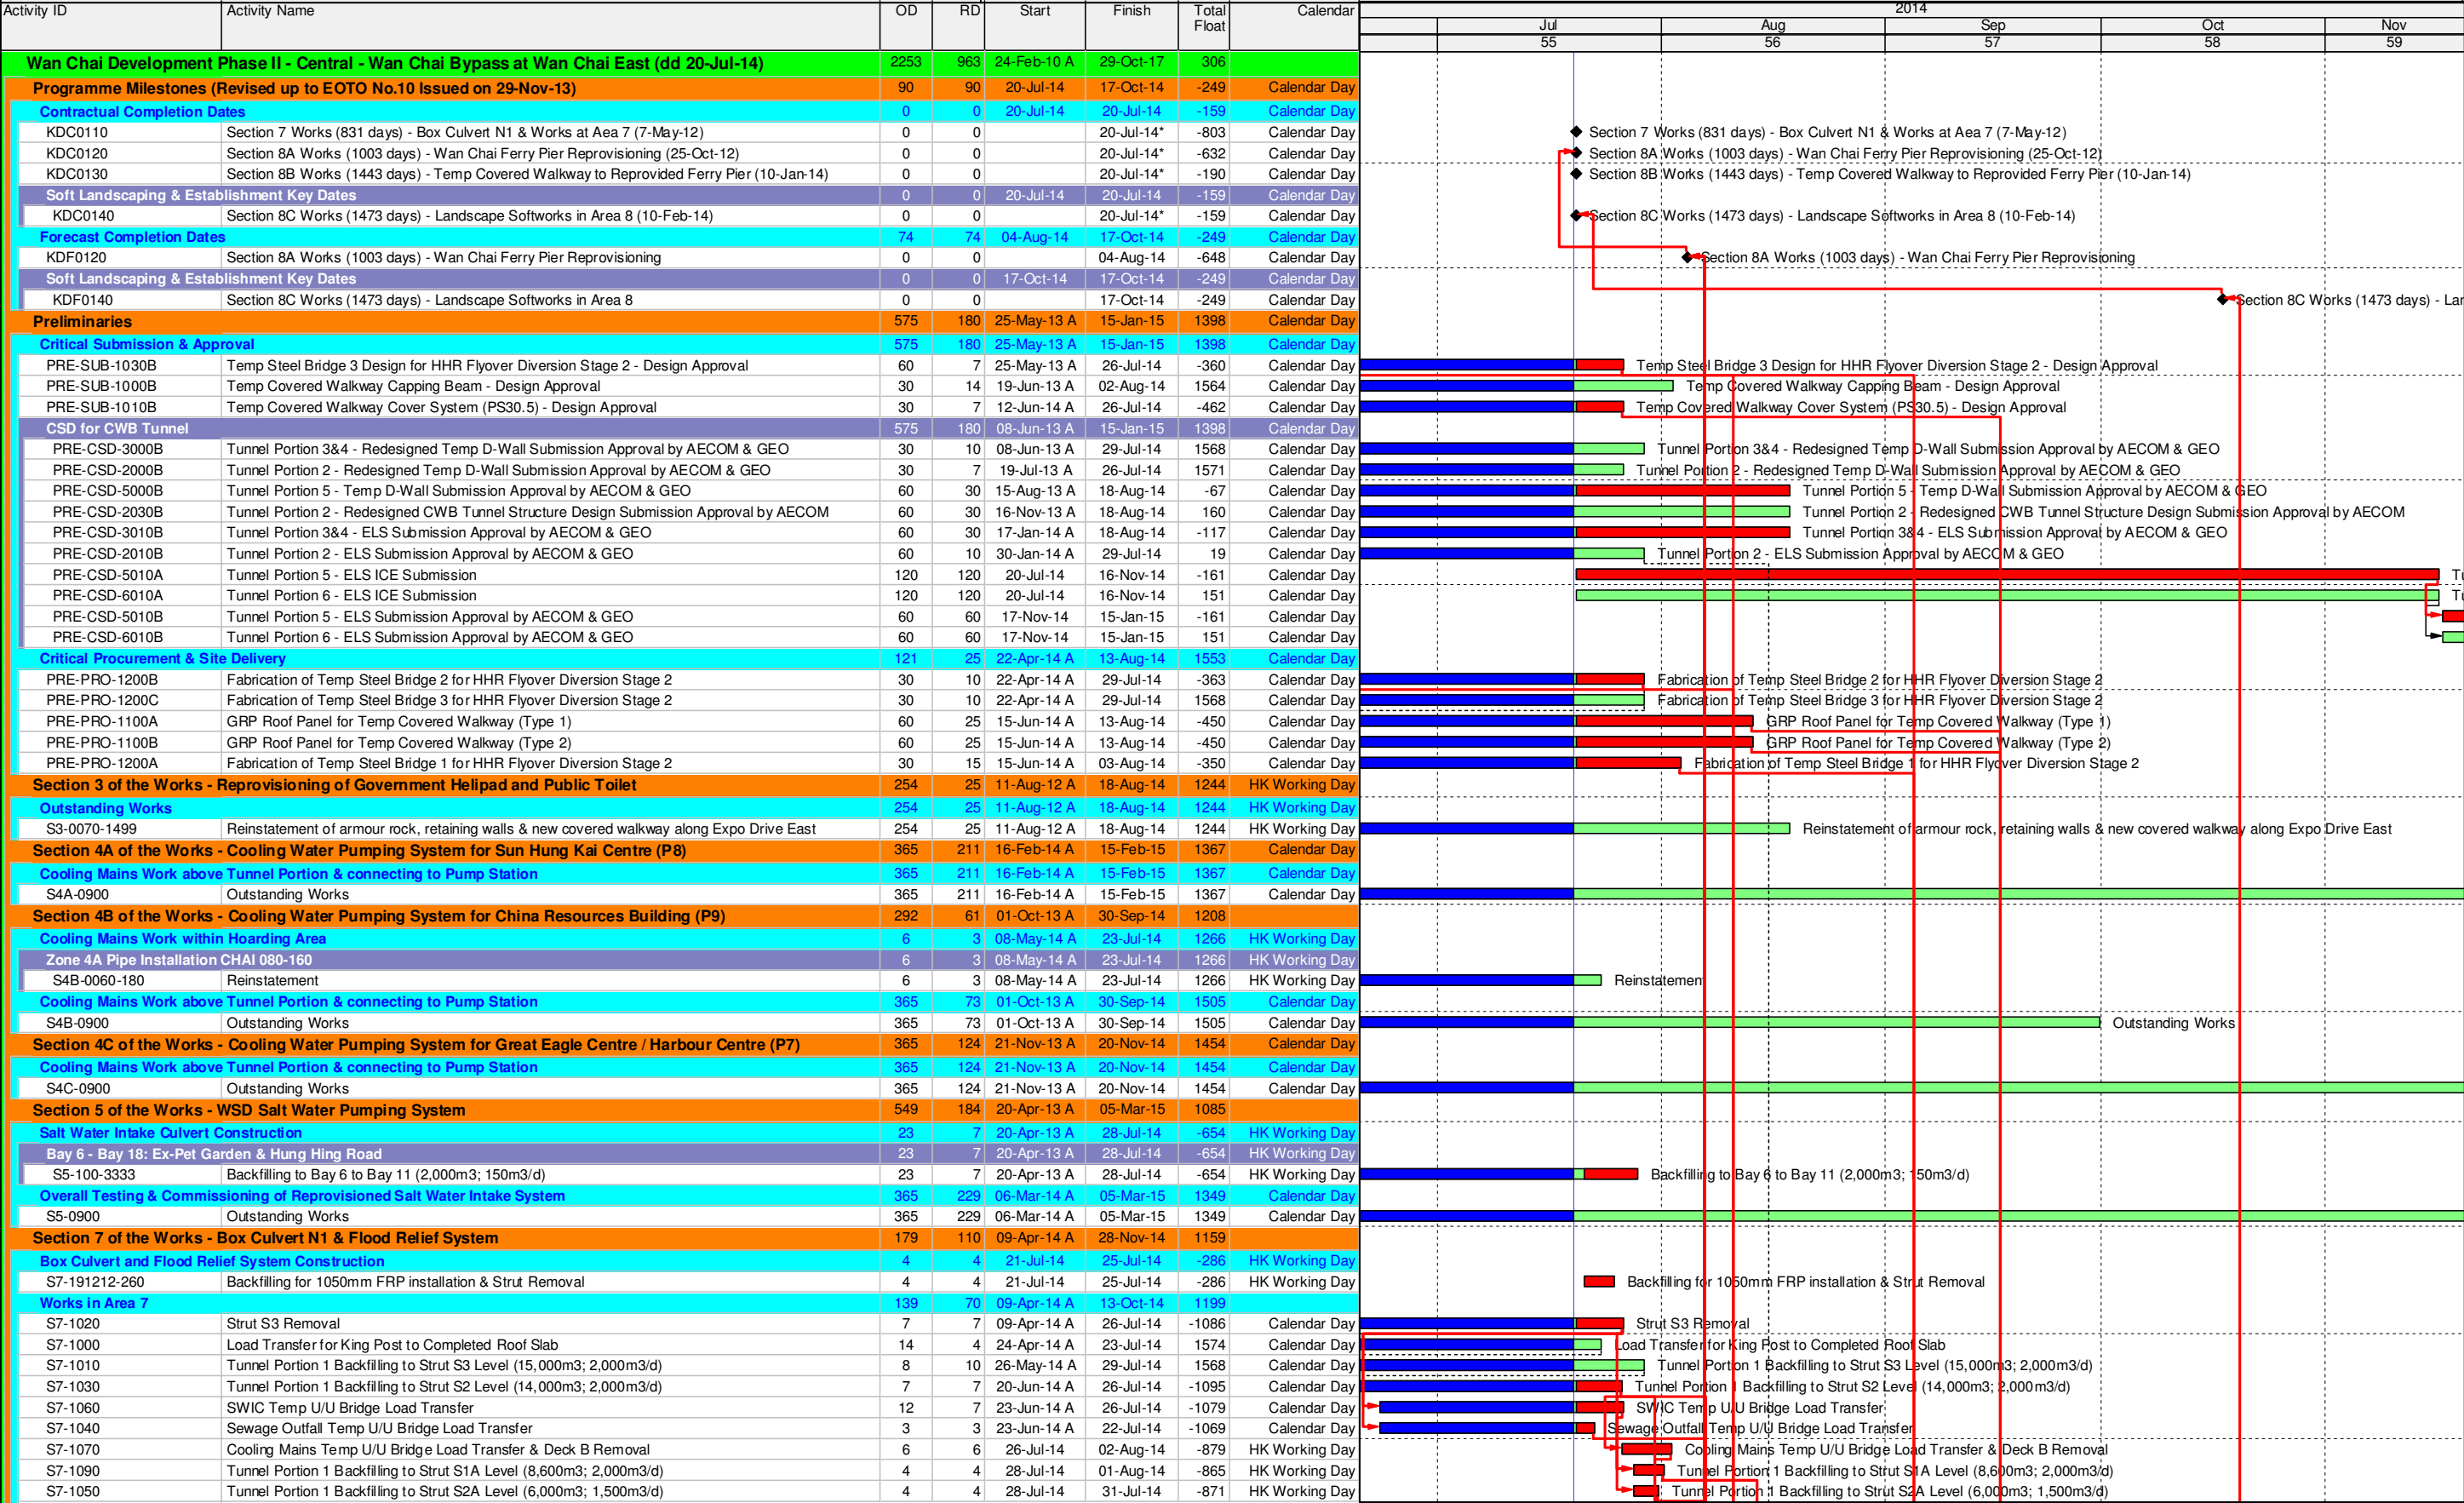

- Remaining Work
- Actual Work
- Summary Bar
- Critical Remaining Work
- Milestone

CEDD CONTRACT NO. HK/2009/02
Wan Chai Development Phase II - Central-Wan Chai Bypass at Wan Chai East (Contract 2)
3-MONTH ROLLING PROGRAMME (Data Date on:20-Jul-14)

Date	Revision	Checked	Approved
20-Jul-14	3MRP		
20-Feb-14	Baseline Prog		

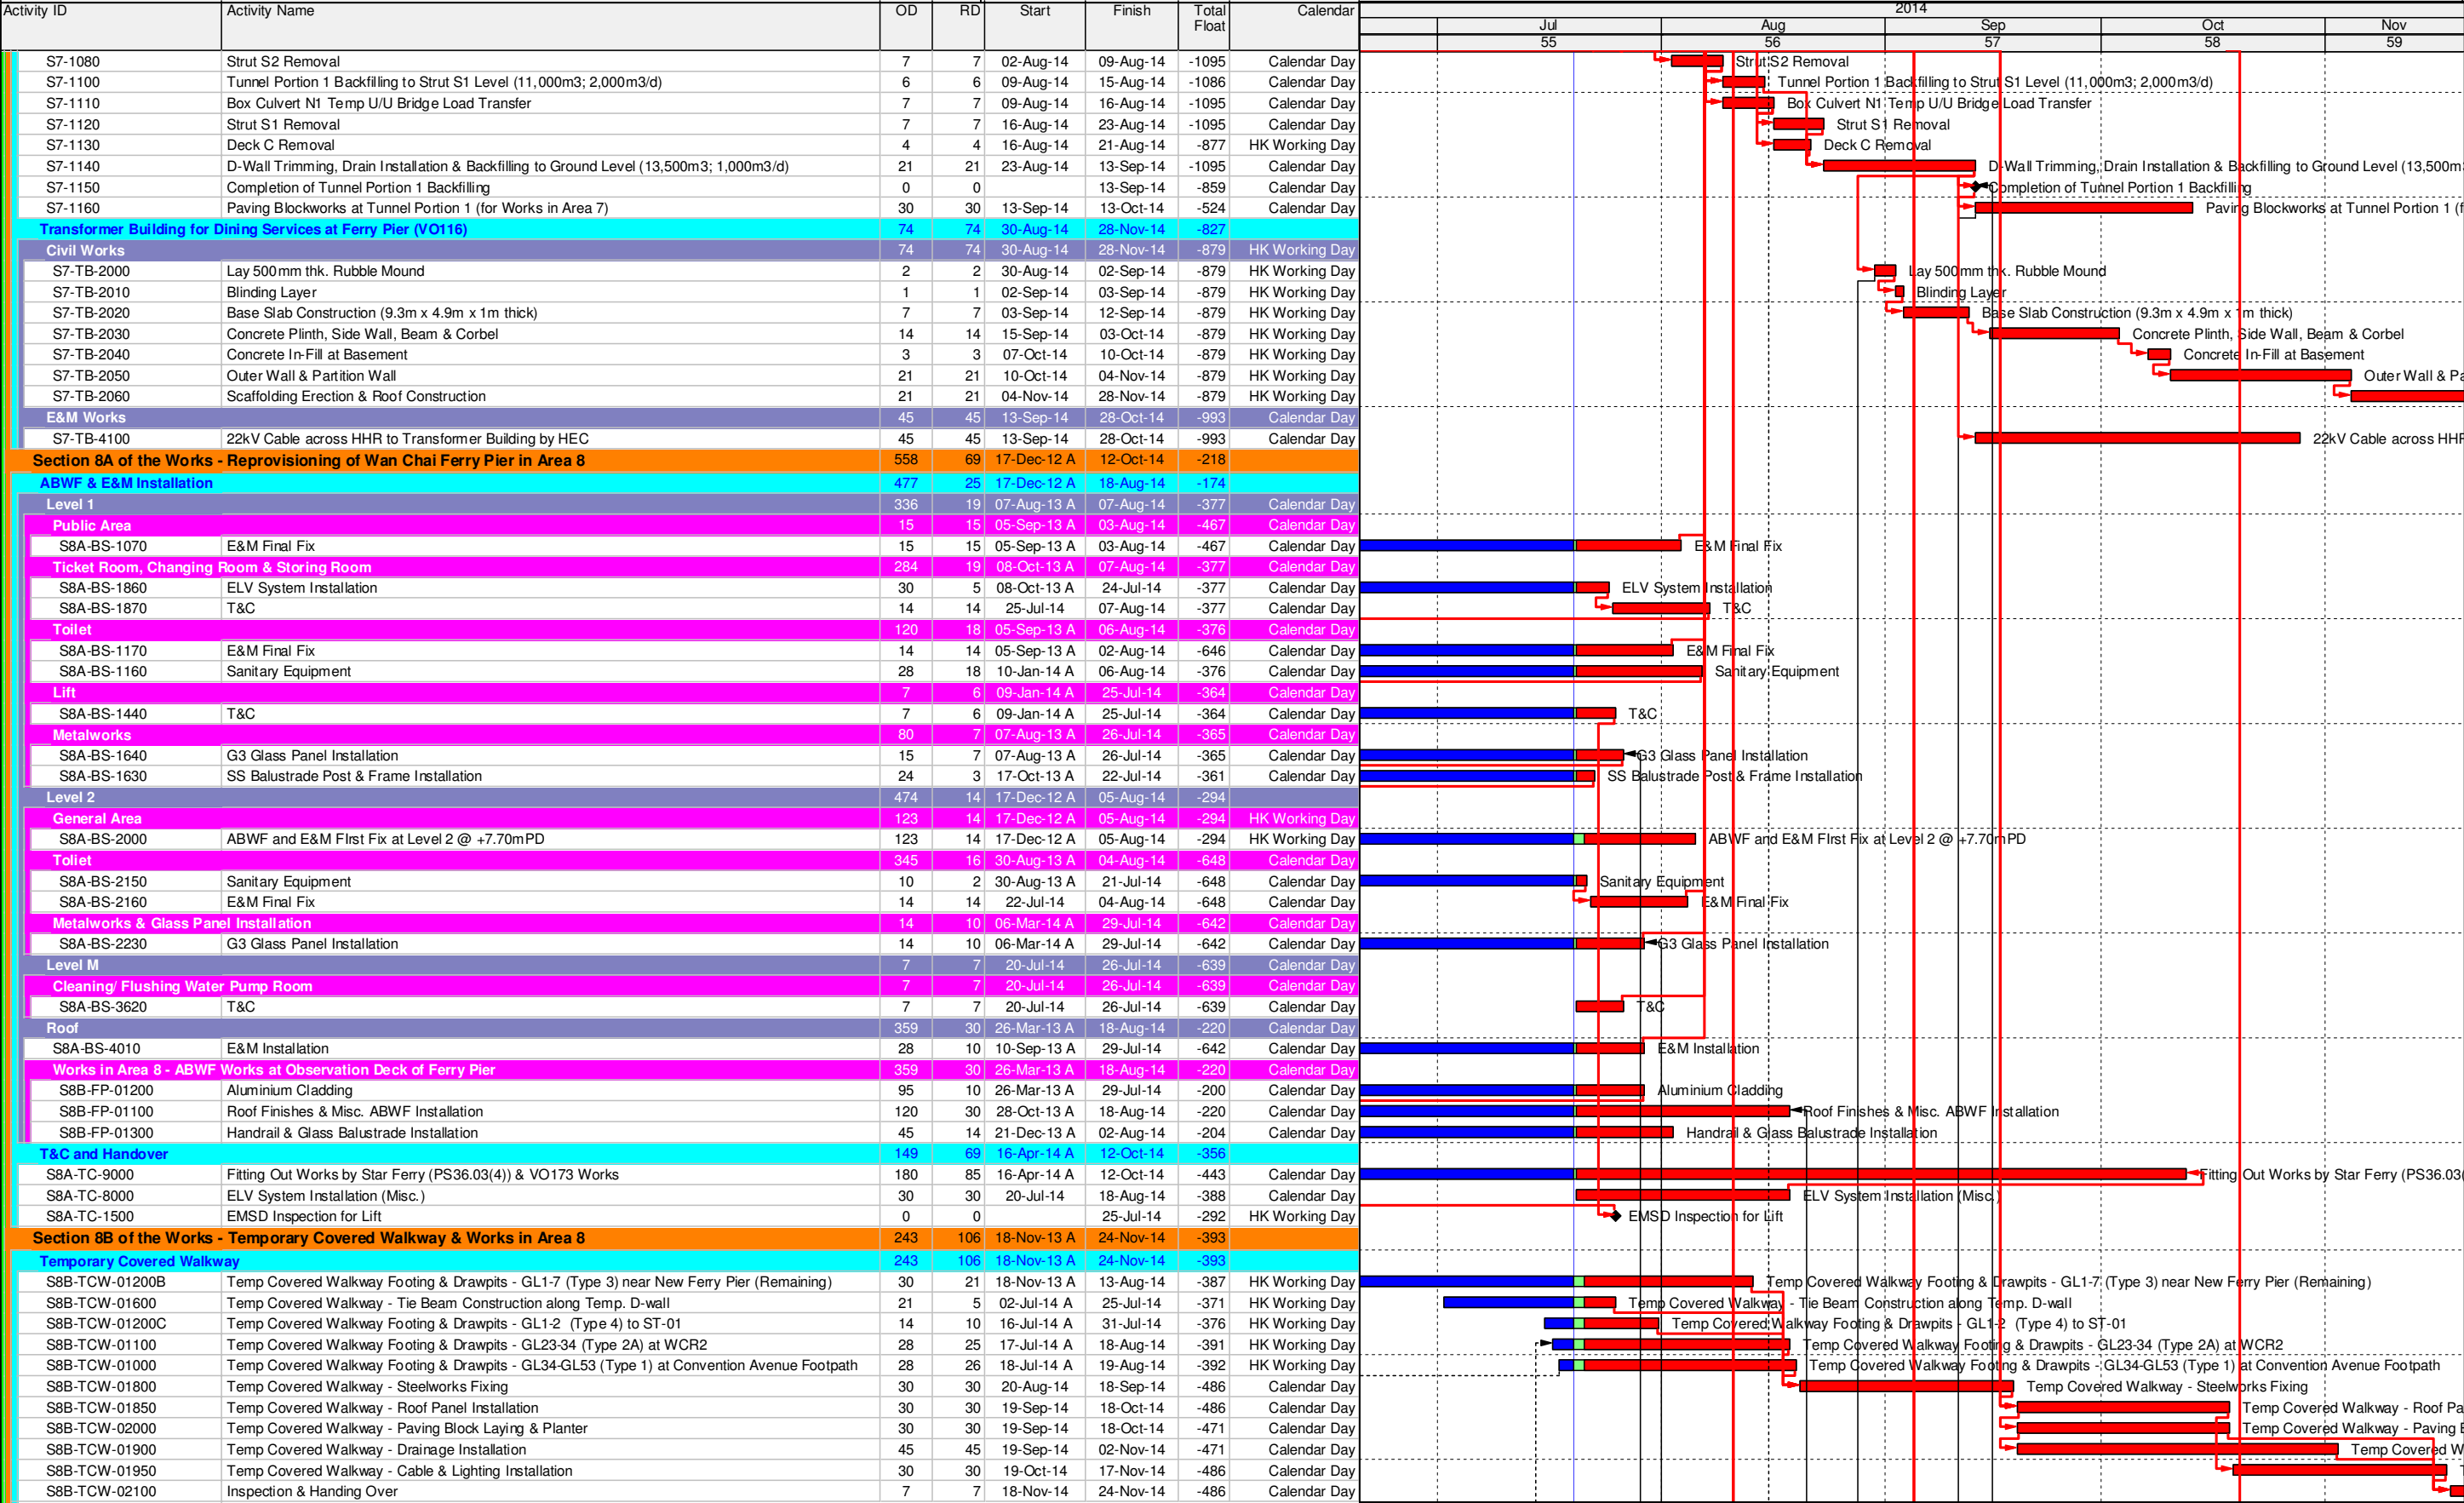

Activity ID	Activity Name	OD	RD	Start	Finish	Total Float	Calendar	2014											
									Jul	Aug	Sep	Oct	Nov						
									55	56	57	58	59						
Section 9B of the Works - CWB Tunnel Structure (CH3400 - CH3796)		270	149	11-Feb-14 A	16-Jan-15	1120													
Tunnel Portion 2 (CH3425-CH3500)		149	149	20-Jul-14	16-Jan-15	0													
Foundation		28	28	20-Jul-14	16-Aug-14	1	Calendar Day												
S9B-T2-1130	Tunnel portion 2 Pump Test	28	28	20-Jul-14	16-Aug-14	1	Calendar Day												
CWB Structural Works		125	125	18-Aug-14	16-Jan-15	0	HK Working Day												
S9B-T2-2000	Tunnel portion 2 ELSW excavation (62,500m3; 500m3/d)	125	125	18-Aug-14	16-Jan-15	0	HK Working Day												
Tunnel Portion 3 & Tunnel Portion 4 (CH3630-CH3790)		247	126	11-Feb-14 A	17-Dec-14	1143													
Foundation		247	126	11-Feb-14 A	17-Dec-14	1143													
Stage 2 - Southern Wall after HHR Flyover Diversion (Stage 1) (C130A-P131; P144-C154)		199	78	11-Feb-14 A	22-Oct-14	1191													
S9B-T34-1230C	Pre-grouting & Guidewall for P147-P154	28	14	11-Feb-14 A	02-Aug-14	1564	Calendar Day												
S9B-T34-1270	Existing 450mm Stormwater Drain Diversion	21	21	17-Feb-14 A	13-Aug-14	1248	HK Working Day												
S9B-T34-1260B	Bored Pile Construction (PS30-PS32; 14d/pile; 1 Rig)	42	42	20-Jul-14	30-Aug-14	-403	Calendar Day												
S9B-T34-1250D	D-wall Construction along HHR slow lane (P147-P153; 6d/Panel)	42	42	01-Sep-14	22-Oct-14	-326	HK Working Day												
Stage 3 - Northern Wall after TWCR4 Reclamation (P96-P101)		214	126	19-Feb-14 A	17-Dec-14	1143													
S9B-T34-1420C	Pre-grouting & Guide Wall Construction for P100-C105	21	14	19-Feb-14 A	02-Aug-14	1564	Calendar Day												
S9B-T34-1440E	Preboring works for Bored Pile Construction (PC28-PC30)	14	10	16-Jul-14 A	29-Jul-14	-161	Calendar Day												
S9B-T34-1440G	Bored Pile Construction (PN27; 14d/pile)	14	14	20-Jul-14	02-Aug-14	-326	Calendar Day												
S9B-T34-1440H	Bored Pile Construction (PC31; 14d/pile)	14	14	20-Jul-14	02-Aug-14	-115	Calendar Day												
S9B-T34-1440F	Bored Pile Construction (PC28-PC30; 14d/pile)	42	42	04-Aug-14	22-Sep-14	-134	HK Working Day												
S9B-T34-1430D	D-wall Construction at TWCR4 (C88-P95; 6d/Panel)	48	48	23-Oct-14	17-Dec-14	-326	HK Working Day												
Stage 4 - Southern Wall after HHR Flyover Diversion (Stage 2) (P132-P143)		26	26	08-Nov-14	03-Dec-14	-383	Calendar Day												
S9B-T34-1600	Complete Removal of Approach Ramp of Existing HHR Flyover	0	0	08-Nov-14		-383	Calendar Day												
S9B-T34-1610	Pre-drilling at HHR Flyover	26	26	08-Nov-14	03-Dec-14	-383	Calendar Day												
Temp Works for HHR Flyover Diversion (Stage 2)		136	98	19-May-14 A	14-Nov-14	1171													
Bridge 1		78	53	17-Jul-14 A	20-Sep-14	-309													
S9B-TTA-1000	Excavation & D-Wall Modification for Supporting Bridge 1	21	18	17-Jul-14 A	09-Aug-14	-310	HK Working Day												
S9B-TTA-1100	Overall Excavation to +1mPD	14	14	10-Aug-14	23-Aug-14	-384	Calendar Day												
S9B-TTA-1300	Installation of S1 Strut & Bracing	14	14	24-Aug-14	06-Sep-14	-384	Calendar Day												
S9B-TTA-1400	Installation of Bridge 1 spanning across CWB	14	14	07-Sep-14	20-Sep-14	-384	Calendar Day												
Bridge 2		57	32	19-May-14 A	26-Aug-14	1237													
S9B-TTA-2000	D-Wall Modification for Supporting Bridge 2	14	14	19-May-14 A	05-Aug-14	1255	HK Working Day												
S9B-TTA-2100	Excavation & Installation of S1 Strut	7	24	02-Jul-14 A	12-Aug-14	-377	Calendar Day												
S9B-TTA-2200	Installation of Bridge 2 spanning across CWB	14	14	13-Aug-14	26-Aug-14	-377	Calendar Day												
Bridge 3		14	7	30-May-14 A	26-Jul-14	-346	Calendar Day												
S9B-TTA-3500	Installation of Bridge 3 connecting with Existing HHR Flyover	14	7	30-May-14 A	26-Jul-14	-346	Calendar Day												
At-Grade Roadworks		123	98	30-Jun-14 A	14-Nov-14	1171													
S9B-TTA-4100	At-Grade Temp Roadworks, Drainage & Furniture Installation in TWCR4 Area	45	28	30-Jun-14 A	21-Aug-14	-269	HK Working Day												
S9B-TTA-4150	Concrete Deck & Steel Deck on Existing Box Culvert O Bay 17 - Bay 19	35	19	02-Jul-14 A	11-Aug-14	1250	HK Working Day												
S9B-TTA-4200	Road Furniture Installation & Pavement Works on Bridge 3	30	30	28-Jul-14	30-Aug-14	-277	HK Working Day												
S9B-TTA-4000	Road Furniture Installation & Pavement Works on Bridge 2	30	30	27-Aug-14	03-Oct-14	-303	HK Working Day												
S9B-TTA-4300	Road Furniture Installation & Pavement Works on Bridge 1	15	15	22-Sep-14	10-Oct-14	-309	HK Working Day												
S9B-TTA-4400	Diversion of Traffic to Steel Bridges & TWCR4 (Stage 2 TTA)	0	0		10-Oct-14	-387	Calendar Day												
S9B-TTA-4500	Demolish of Approach Ramp of Existing HHR Flyover for D-Wall Construction	24	24	11-Oct-14	07-Nov-14	-309	HK Working Day												
S9B-TTA-4600	Utility Diversion for D-Wall near Existing HHR Flyover Approach Ramp	35	35	11-Oct-14	14-Nov-14	-364	Calendar Day												
Section 11 of the Works - Remainder of Works		310	188	09-Apr-14 A	23-Jan-15	1390	Calendar Day												
Marine Works at WCR2		66	7	09-Apr-14 A	26-Jul-14	1571	Calendar Day												
S11-R2-1600	Removal of Existing SHK Pump House M&E equipment	7	5	09-Apr-14 A	24-Jul-14	1573	Calendar Day												
S11-R2-1800B	Complete remaining reclamation at WCR2 (Stage 2) - Remaining at WCR2	30	7	02-May-14 A	26-Jul-14	1571	Calendar Day												
Marine Works at WCR3		150	150	27-Aug-14	23-Jan-15	-382	Calendar Day												
S11-R3-0500A	Fabrication of Caisson Seawalls for WCR3 Reclamation (1st Stage - 2 Nos.)	60	60	27-Aug-14	25-Oct-14	-382	Calendar Day												
S11-R3-0500B	Fabrication of Caisson Seawalls for WCR3 Reclamation (2nd Stage - 3 Nos.)	90	90	26-Oct-14	23-Jan-15	-382	Calendar Day												
Soft Landscaping & Establishment Works		2375	770	24-Feb-10 A	27-Aug-16	0	Calendar Day												
Section 8C of the Works - Landscape Softworks in Area 8		90	90	20-Jul-14	17-Oct-14	-249	Calendar Day												
S8C-0010	Carry out landscape soft work on new ferry pier	90	90	20-Jul-14	17-Oct-14	-249	Calendar Day												
Section 8D of the Works - Establishment Works in Area 8		365	365	18-Oct-14	17-Oct-15	-249	Calendar Day												
S8D-0010	Carry out establishment work on new ferry pier	365	365	18-Oct-14	17-Oct-15	-249	Calendar Day												
Section 12 of the Works - Protection and Preservation of Existing Trees		2375	770	24-Feb-10 A	27-Aug-16	0	Calendar Day												
S12-0010	Protection and preservation of existing trees	2375	770	24-Feb-10 A	27-Aug-16	0	Calendar Day												
SUMMARY PROGRAMME		1923	1198	25-Jul-12 A	29-Oct-17	380	Calendar Day												
CWB Tunnel Construction & Remaining Works (Section 9A, 9B, 10 & 11)		1923	1198	25-Jul-12 A	29-Oct-17	380	Calendar Day												
CWB Tunnel Works in WCR1		97	56	26-May-14 A	13-Sep-14	-859	Calendar Day												
SUM-CWB-14000	Backfilling for Tunnel Portion 1	97	56	26-May-14 A	13-Sep-14	-859	Calendar Day												
CWB Tunnel Works in WCR2		906	181	25-Jul-12 A	16-Jan-15	1397	Calendar Day												
SUM-CWB-20000	Reclamation at WCR2	224	7	25-Jul-12 A	26-Jul-14	1571	Calendar Day												
SUM-CWB-22000	Pump Test & Excavation for Tunnel Portion 2	181	181	20-Jul-14	16-Jan-15	0	Calendar Day												
CWB Tunnel Works in WCR4/TWCR4		457	307	11-Nov-13 A	22-May-15	-327	Calendar Day												
SUM-CWB-41000B	Foundation for Tunnel Portion 3&4 (except Eastern Bulkhead Wall)	457	307	11-Nov-13 A	22-May-15	-327	Calendar Day												
Misc. Remaining Works		1198	1198	20-Jul-14	29-Oct-17	-428	Calendar Day												
SUM-CWB-52000	Interface Work with HY/2009/15 after Portion 7 Re-Possession	717	717	20-Jul-14	05-Jul-16	-277	Calendar Day												

Activity ID	Activity Name	OD	RD	Start	Finish	Total Float	Calendar	2014					
									Jul	Aug	Sep	Oct	Nov
									55	56	57	58	59
SUM-CWB-50000	Paving Block Installation (Whole Newly Reclaimed Area)	1142	1142	13-Sep-14	29-Oct-17	-428	Calendar Day						
Reprovisioning of Existing Facilities (Section 3, 4A, 4B, 4C, 5, 6, 7, 8A & 8B)													
Reprovisioning of Box Culvert N (Section 7)													
SUM-FAC-52000	VO116 - New Transformer Building to Ferry Pier	250	250	30-Aug-14	07-May-15	-1095	Calendar Day						
Reprovisioning of Wan Chai Ferry Pier & Covered Walkway (Section 8A & 8B)													
SUM-FAC-62000	Ferry Pier ABWF Works	155	10	17-Dec-12 A	29-Jul-14	-74	Calendar Day						
SUM-FAC-65000	ABWF Works on Observation Deck under Section 8B	150	30	07-May-13 A	18-Aug-14	-220	Calendar Day						
SUM-FAC-66000	Temp Covered Walkway	217	128	10-Aug-13 A	24-Nov-14	-486	Calendar Day						

CEDD Contract No. HK/2012/08 Wan Chai Development Phase II Central - Wan Chai Bypass at Wan Chai West						Page : 1 / 5			
Activity ID	Activity Name	Orig Dur	Early Start	Early Finish	Total Float	2014			
						Jun	Jul	Aug	Sep
HK/2012/08 3-Mth Rolling Programme for Jun 2014 - Aug 2014 Rev. 1 on 24Jun14									
Dredging and Reclamation									
Marine Work Construction									
Dredging									
Dredging - Zone D									
MAR11880	Zone D - Remove existing rock armour [S8-S10]	90	16-Apr-14 A	31-Aug-14	42				
MAR11900	Zone D - dredging [R8-R10]	22	02-Dec-13 A	31-Aug-14	9				
Seawall Construction									
Seawall Construction - Zone B									
MAR21430	Zone B - WDII Box 1 temp SW - place concrete block	6	31-May-14	05-Jun-14	1700				
Seawall Construction - Zone A2									
MAR10765	Zone A2 - seawall - Type 4, 13 - fill rock mound to temp diversion channel I.L. at -1.5 mPD	18	22-Mar-14 A	08-Jun-14	1				
MAR10769	Zone A2 - seawall - form temporary rock fill to temp diversion channel I.L. at -1.5 mPD	30	31-May-14	29-Jun-14	92				
Seawall Construction - Zone D									
MAR11820	Zone D - fill rock mound for seawall 2F	4	14-Jul-14	17-Jul-14	7				
MAR11882	Zone D - pile head treatment for caisson seawall 2F	24	18-Jul-14	14-Aug-14	7				
MAR11884	Zone D - complete fabrication of Caisson Seawall 2F and ready for delivery	0		30-Jul-14*	0				
MAR11885	Zone D - deliver and Install Caisson Seawall 2F	2	15-Aug-14	16-Aug-14	8				
MAR11925	Zone D - complete fabrication of Caisson Seawall 1C and ready for delivery	0		08-Aug-14*	0				
Filling									
Filling - Zone B									
MAR11135	Zone B - Public Fill (Remaining Area) -10.0 to +4.0mPD	39	05-May-14 A	26-Jun-14	0				
MAR11140	Zone B - Sorted & Compacted Fill above MTR TWL	30	07-Apr-14 A	15-Jul-14	86				
Filling - Zone A2									
MAR20360	Zone A2 - Public Fill -4.0 to +4.0mPD (portion beside Culvert L diversion only)	25	25-May-14 A	23-Jul-14	78				
Filling - Zone A1									
MAR20400	Zone A1 - Public Fill -4.0 to +4.0mPD	22	29-May-14 A	22-Jun-14	1				
MAR20420	Zone A1 & A2 - Form rock underlayer for temp channel	28	26-Jun-14	23-Jul-14	110				
Filling - Above C4 Unit									
MAR21450	Zone above C4 Unit - Public fill above MTR TWL	30	15-Apr-14 A	15-Jul-14	150				
Works for Section Completion									
Construction									
Box Culvert La, L1 & FRP-L Construction									
Sec VI A - Box Culvert La bay 1-3 and Roadwork									
Box Culvert La Bay 1-3									
CUL10480	Sec VI A - Area 1 - Culvert L bay 1-3 - excavation and ELS installation	90	14-Mar-14 A	20-Jun-14	-59				

◆

▼

Current Milestone

Actual Work

Critical Remaining Work

Remaining Work

Remaining Level of Effort

3 - Months Rolling Programme (June 2014 to August 2014)

For Zone Non-CRIII Works

Date	Revision	Checked	Approved
31-May-14			

利達 LEADER 中國建築 - 利達聯營 CHINA STATE - LEADER JOINT VENTURE						CEDD Contract No. HK/2012/08 Wan Chai Development Phase II Central - Wan Chai Bypass at Wan Chai West						Page : 2 / 5			
Activity ID	Activity Name		Orig Dur	Early Start	Early Finish	Total Float	2014								
							Jun	Jul	Aug	Sep					
	CUL10520	Sec VI A - Area 1 - Culvert L bay 1-3 - construct bay 3 - base slab	11	21-Jun-14	04-Jul-14	-59									
	CUL10540	Sec VI A - Area 1 - Culvert L bay 1-3 - construct bay 3 - wall	9	05-Jul-14	15-Jul-14	-59									
	CUL10560	Sec VI A - Area 1 - Culvert L bay 1-3 - construct bay 3 - top slab	8	31-May-14	10-Jun-14	-25									
	CUL10600	Sec VI A - Area 1 - Culvert L bay 1-3 - construct bay 2 - base slab	11	09-Jul-14	21-Jul-14	-59									
	CUL10620	Sec VI A - Area 1 - Culvert L bay 1-3 - construct bay 2 - wall	9	22-Jul-14	31-Jul-14	-59									
	CUL10640	Sec VI A - Area 1 - Culvert L bay 1-3 - construct bay 2 - top slab	8	01-Aug-14	09-Aug-14	-39									
	CUL10660	Sec VI A - Area 1 - Culvert L bay 1-3 - construct bay 1 - base slab	16	25-Jul-14	12-Aug-14	-59									
	CUL10680	Sec VI A - Area 1 - Culvert L bay 1-3 - construct bay 1 - wall	18	13-Aug-14	02-Sep-14	-59									
	CUL12040	Sec VI A - Area 1 - 9M completion of Kiosk reinstatement	0		01-Aug-14*	0									
Sec VI C - Box Culvert La bay 4 and Roadwork															
	CUL11570	Sec VI C - Culvert L - bay 4 - sheetpile, ELS & Excavation	45	06-Jan-14 A	15-Aug-14	69									
Box Culvert L1 & FRP-L - Bay 5 to 7															
	CUL10010	Drainage Impact Assessment for ex. box culvert L diversion - Eng, DSD comment and approve	60	22-Jul-13 A	25-Jun-14	0									
	CUL10015	Culvert L - form temp opening at existing box culvert bay 4 for temp flow diversion	35	31-May-14	12-Jul-14	99									
	CUL10215	Sec VI C - Culvert L - bay 5,6,7 - Design of Temp Platform for Predrill & Piling Works	12	14-Jun-14	27-Jun-14	0									
	CUL10218	Sec VI C - Culvert L - bay 5,6,7 - Engineer's comment and approve of Temp Platform for Predrill & Piling Works	28	28-Jun-14	31-Jul-14	0									
	CUL10225	Sec VI C - Culvert L - bay 5,6,7 - Erect Temp Platform for Predrill & Piling Works	75	01-Aug-14	30-Oct-14	0									
	CUL10860	Sec VI C - Culvert L - bay 5-7 - pile loading test	0	14-Jul-14	14-Jul-14	99									
	CUL10880	Sec VI C - Culvert L - bay 5-7 - install sheetpile	10	14-Jul-14	24-Jul-14	99									
	CUL10900	Sec VI C - Culvert L - bay 5-7 - excavation & ELS	26	25-Jul-14	23-Aug-14	99									
	CUL10940	Sec VI C - Culvert L - bay 5 - pile head treatment and construct pile cap	10	18-Aug-14	28-Aug-14	99									
	CUL11020	Sec VI C - Culvert L - bay 6 - pile head treatment and construct pile cap	10	29-Aug-14	10-Sep-14	99									
Section II - MVB Structure															
Section II - MVB Substructure - Design, Submission and Approval															
	SII10180	Sec II - MVB - MS for pumping test - prepare and submit to ICE	2	02-Aug-14	03-Aug-14	97									
	SII10200	Sec II - MVB - MS for pumping test - ICE check & issue cert	14	04-Aug-14	17-Aug-14	97									
	SII10220	Sec II - MVB - MS for pumping test - Eng comment and approve	28	18-Aug-14	14-Sep-14	97									
	SII10240	Sec II - MVB - MS & temp work design for bulk exc & ELS - prepare and submit to ICE	60	22-Apr-14 A	18-Jun-14	69									
	SII10260	Sec II - MVB - MS & temp work design for bulk exc & ELS - ICE check & issue cert	14	19-Jun-14	02-Jul-14	69									
	SII10280	Sec II - MVB - MS & temp work design for bulk exc & ELS - Eng comment and approve	28	03-Jul-14	30-Jul-14	69									
	SII12321	Sec II - MVB - Temp work design for bulk exc & ELS - Prepare tender and sub-contract	120	31-Jul-14	27-Nov-14	69									
MVB Substructure - Diaphragm Wall and Sheetpile Wall															
	SII10440	Sec II - MVB - predrilling and ground pretreatment for Dwall	158	17-Mar-14 A	24-Sep-14	21									
	SII10460	Sec II - MVB A - construct guide wall [P1-P13, P33-P41]	177	12-Apr-14 A	20-Nov-14	4									
	SII10480	Sec II - MVB A - construct Dwall [P1-P13, P33-P41] (1.5m thk on rock)	177	28-May-14 A	16-Dec-14	1									
	SII10520	Sec II - MVB B - construct guide wall [P14-P32]	177	07-Apr-14 A	21-Nov-14	0									
	SII10540	Sec II - MVB B - construct Dwall [P14-P32] (1.5m thk on rock)	187	16-Apr-14 A	05-Dec-14	0									
	SII10560	Sec II - MVB B - contact grout / fissure grout / install pumping well	90	15-Aug-14	01-Dec-14	17									
	SII10590	Sec II - MVB A&B - grout curtain and fissure grout	135	12-Jul-14	19-Dec-14	4									
MVB Substructure - Diaphragm Wall - Construction Sequences															
Group 1															

中國建築 - 利達聯營 CHINA STATE - LEADER JOINT VENTURE				CEDD Contract No. HK/2012/08 Wan Chai Development Phase II Central - Wan Chai Bypass at Wan Chai West				Page : 3 / 5						
Activity ID	Activity Name	Orig Dur	Early Start	Early Finish	Total Float	2014								
						Jun	Jul	Aug	Sep					
	SII-10110	Sec II - MVB - Dwall P19	13	26-May-14 A	20-Jun-14	8								
	SII-10120	Sec II - MVB - Dwall P17	25	21-Jun-14	21-Jul-14	8								
	SII-10140	Sec II - MVB - Dwall P28	26	08-Jul-14	06-Aug-14	8								
	SII-10150	Sec II - MVB - Dwall P18	23	25-Jul-14	20-Aug-14	8								
	SII-10160	Sec II - MVB - Dwall P27	20	12-Aug-14	03-Sep-14	8								
	SII-10170	Sec II - MVB - Dwall P22	22	26-Aug-14	20-Sep-14	8								
	Group 2													
	SII-10230	Sec II - MVB - Dwall P30	12	19-May-14 A	31-May-14	11								
	SII-10240	Sec II - MVB - Dwall P29	20	09-Jun-14	02-Jul-14	11								
	SII-10250	Sec II - MVB - Dwall P20	22	23-Jun-14	18-Jul-14	11								
	SII-10260	Sec II - MVB - Dwall P13	22	07-Jul-14	31-Jul-14	11								
	SII-10270	Sec II - MVB - Dwall P21	29	23-Jul-14	25-Aug-14	11								
	SII-10280	Sec II - MVB - Dwall P16	25	12-Aug-14	10-Sep-14	11								
	SII-10290	Sec II - MVB - Dwall P26	30	26-Aug-14	30-Sep-14	11								
	Group 3													
	SII-10330	Sec II - MVB - Dwall P37	23	28-May-14 A	24-Jun-14	19								
	SII-10340	Sec II - MVB - Dwall P01	19	10-Jun-14	02-Jul-14	19								
	SII-10350	Sec II - MVB - Dwall P11	21	26-Jun-14	21-Jul-14	19								
	SII-10360	Sec II - MVB - Dwall P36	21	05-Jul-14	29-Jul-14	19								
	SII-10370	Sec II - MVB - Dwall P02	19	14-Jul-14	04-Aug-14	19								
SII-10380	Sec II - MVB - Dwall P10	20	21-Jul-14	12-Aug-14	19									
SII-10390	Sec II - MVB - Dwall P39	20	28-Jul-14	19-Aug-14	19									
SII-10400	Sec II - MVB - Dwall P03	24	05-Aug-14	01-Sep-14	19									
SII-10410	Sec II - MVB - Dwall P09	21	14-Aug-14	06-Sep-14	19									
SII-10510	Sec II - MVB - Dwall P40	20	23-Aug-14	16-Sep-14	19									
MVB Substructure - Bored Pile and Prebored H-Pile														
SII10300	Sec II - MVB A&B - Bored Pile plant mobilisation	12	23-Jun-14	07-Jul-14	1									
SII10320	Sec II - MVB A&B - Predrilling for bored pile	90	23-Jun-14	09-Oct-14	38									
SII10340	Sec II - MVB A&B - Construct bored piles	148	26-Jun-14	19-Dec-14	1									
MVB Substructure - Bored Pile - Construction Sequences														
Group 1														
SII-11000	Ssec II - MVB - Bored Pile BC1-A	18	26-Jun-14	17-Jul-14	41									
SII-11020	Ssec II - MVB - Bored Pile BC2-A	18	18-Jul-14	07-Aug-14	41									
SII-11030	Ssec II - MVB - Bored Pile BC1-B	18	08-Aug-14	28-Aug-14	41									
SII-11040	Ssec II - MVB - Bored Pile BC8	18	29-Aug-14	19-Sep-14	41									
Group 2														
SII-11090	Ssec II - MVB - Bored Pile BC2-B	18	07-Jul-14	26-Jul-14	44									
SII-11100	Ssec II - MVB - Bored Pile BC3-A	18	28-Jul-14	16-Aug-14	45									
SII-11110	Ssec II - MVB - Bored Pile BC14	18	18-Aug-14	06-Sep-14	45									
Group 3														
SII-11160	Ssec II - MVB - Bored Pile BC4-A	18	11-Jul-14	31-Jul-14	44									

CEDD Contract No. HK/2012/08 Wan Chai Development Phase II Central - Wan Chai Bypass at Wan Chai West						Page : 4 / 5			
Activity ID	Activity Name	Orig Dur	Early Start	Early Finish	Total Float	2014			
						Jun	Jul	Aug	Sep
SII-11170	Ssec II - MVB - Bored Pile BC11	18	01-Aug-14	21-Aug-14	44				
SII-11180	Ssec II - MVB - Bored Pile BC4-B	18	22-Aug-14	12-Sep-14	44				
Section II A - CWB Tunnel & Slip Road Structures and Facilities									
Section II A - CWB Tunnel - Design, Submission and Approval									
SIIA10420	CWB Tunnel - MS for DWall Construction - prepare & submit to ICE	30	01-Aug-13 A	31-May-14	91				
SIIA10480	CWB Tunnel - MS & temp work design for bulk exc & ELS - prepare & submit to ICE	80	01-Aug-14	19-Oct-14	29				
CWB CRIII & A1									
CWB CRIII & A1 - Dwall and Pile Construction									
SIIA11060	Sec II A - CWB A1 - predrilling for Dwall and piles	30	26-Jun-14	31-Jul-14	2				
SIIA11080	Sec II A - CWB A1 - carry out ground pretreatment for Dwall	80	04-Jul-14	08-Oct-14	2				
SIIA11100	Sec II A - CWB A1 - construct Guide Wall	46	08-Jul-14	29-Aug-14	2				
SIIA11120	Sec II A - CWB A1 - construct temporary DWall and temp bulk head wall	70	11-Jul-14	03-Oct-14	2				
SIIA11140	Sec II A - CWB A1 - Construct pre-bored H-pile	65	25-Jul-14	11-Oct-14	2				
SIIA11180	Sec II A - CWB A1 - D-wall grout curtain / contact grout	90	19-Jun-14	06-Oct-14	7				
SIIA11220	Sec II A - CWB A1 - D-wall Sonic test / interface core	90	19-Jun-14	06-Oct-14	7				
SIIA11240	Sec II A - CWB A1 - install dewater/ recharge / observation well	90	19-Jun-14	06-Oct-14	7				
Section VI A - Area 1 & 2 - Lung King Street									
Roadwork & Utilities									
SVIA10040	Sec VI A - Area 1 - Summary of Box Culvert La Construction	136	11-Nov-13 A	22-Nov-14	-56				
Section VI B - Area 8									
Area 8 - Demolish Ex. Cooling Water Pumping Station									
SVIB10020	MS of cooling water pump station demolition - ICE check and issue check cert	14	22-Feb-14 A	04-Jun-14	1				
SVIB10040	MS of cooling water pump station demolition Works - Eng comment and approve	28	22-Feb-14 A	06-Jun-14	2				
SVIB10060	Completion of reclamation at Zone C	0		31-May-14	24				
SVIB10070	Sec VI B - site clearance, u/g utilities detection	12	07-Apr-14 A	07-Jun-14	0				
SVIB10080	Sec VI B - demolish existing air duct	20	09-Jun-14	02-Jul-14	0				
SVIB10100	Sec VI B - remove existing crane	4	03-Jul-14	07-Jul-14	0				
SVIB10120	Sec VI B - open cut excavation to expose ex. seawall and pump house	5	02-Jul-14	07-Jul-14	0				
SVIB10140	Sec VI B - demolish existing pump house (cell 1)	5	08-Jul-14	12-Jul-14	0				
SVIB10180	Sec VI B - demolish existing pump house (cell 2)	5	10-Jul-14	15-Jul-14	9				
SVIB10200	Sec VI B - demolish existing pump house (cell 3)	5	12-Jul-14	17-Jul-14	9				
SVIB10220	Sec VI B - demolish existing pump house (cell 4)	5	15-Jul-14	19-Jul-14	9				
SVIB10240	Sec VI B - demolish existing pump house (cell 5)	5	17-Jul-14	22-Jul-14	9				
SVIB10260	Sec VI B - demolish existing pump house (cell 6)	5	19-Jul-14	24-Jul-14	9				
SVIB10280	Sec VI B - demolish existing pump house (cell 7)	5	22-Jul-14	26-Jul-14	9				
SVIB10300	Sec VI B - demolish existing pump house (cell 8)	5	24-Jul-14	29-Jul-14	9				
SVIB10320	Sec VI B - demolish existing pump house (cell 9)	5	26-Jul-14	31-Jul-14	9				
SVIB10340	Sec VI B - demolish existing pump house (cell 10)	5	01-Aug-14	06-Aug-14	9				
SVIB10360	Sec VI B - fill up void inside existing pump house (cell 1)	2	14-Jul-14	15-Jul-14	0				
SVIB10380	Sec VI B - fill up void inside existing pump house (cell 2)	2	16-Jul-14	17-Jul-14	12				
SVIB10400	Sec VI B - fill up void inside existing pump house (cell 3)	2	18-Jul-14	19-Jul-14	12				

利達LEADER中國建築 - 利達聯營CHINA STATE - LEADER JOINT VENTURE					CEDD Contract No. HK/2012/08 Wan Chai Development Phase II Central - Wan Chai Bypass at Wan Chai West					Page : 5 / 5				
Activity ID	Activity Name	Orig Dur	Early Start	Early Finish	Total Float	2014								
						Jun	Jul	Aug	Sep					
SVIB10420	Sec VI B - fill up void inside existing pump house (cell 4)	2	21-Jul-14	22-Jul-14	12									
SVIB10440	Sec VI B - fill up void inside existing pump house (cell 5)	2	23-Jul-14	24-Jul-14	12									
SVIB10460	Sec VI B - fill up void inside existing pump house (cell 6)	2	25-Jul-14	26-Jul-14	12									
SVIB10480	Sec VI B - fill up void inside existing pump house (cell 7)	2	28-Jul-14	29-Jul-14	12									
SVIB10500	Sec VI B - fill up void inside existing pump house (cell 8)	2	30-Jul-14	31-Jul-14	12									
SVIB10520	Sec VI B - fill up void inside existing pump house (cell 9)	2	01-Aug-14	02-Aug-14	12									
SVIB10540	Sec VI B - fill up void inside existing pump house (cell 10)	2	07-Aug-14	08-Aug-14	9									
SVIB10560	Sec VI B - demolish existing seawall coping	11	16-Jul-14	28-Jul-14	0									
SVIB10580	Sec VI B - trim down existing seawall	33	23-Jul-14	29-Aug-14	0									
SVIB10600	Sec VI B - backfill and compaction to formation level	14	20-Aug-14	04-Sep-14	0									
Section VI C - Area 3, 6, 8A & 8C														
Area 8A & 8C - Seawall Modification (Reviewed)														
Design Submission & Approval														
PRS-1004	Sec VI C - Temp Work Design for Seawall Modification & MTR Pump Room Stabilization - Engineer / MTR comment and approve	28	02-Apr-14 A	19-Jun-14	95									
Tenders for Sub-contractor and Procurement														
PCU60310	Sec VI C - Prepare Sub-contract for Seawall Modification and Procurement of Materials	90	14-Nov-13 A	08-Aug-14	12									
PCU60320	Sec VI C - Assesment and Award of Sub-contract for Seawall Modification	28	09-Aug-14	05-Sep-14	12									
Area 3 - Box Culvert bay 4 and Roadwork														
SVIC10220	Sec VI C - [Summary] Construct Box Culvert Bay 4	116	06-Jan-14 A	06-Dec-14	107									
Section VI D - Area 8B & 10														
WDII Box 1 Construction (Reviewed)														
WDII Box 1 Submission and Approval / Material Procurement														
PCU60410	Sec VI D - WD II Box 1 - Prepare Subcontract for Box 1 structure	90	26-May-14 A	28-Aug-14	69									
S0721040	Sec VI D - WD II Box 1 - temp work design - ICE check and issue check cert	28	31-May-14	27-Jun-14	1678									
S0721060	Sec VI D - WD II Box 1 - temp work design - Engineer comment and approve	28	19-May-14 A	18-Jun-14	55									
S0721070	Sec VI D - WD II Box 1 - method statement and temp work design - MTR comment and approve	52	19-Jun-14	09-Aug-14	88									
S0721080	Sec VI D - WD II Box 1 - Prepare and submit method statement	28	19-Jun-14	16-Jul-14	55									
S0721090	Sec VI D - WD II Box 1 - method statement - Engineer comment and approve	28	17-Jul-14	13-Aug-14	55									
Pile Head Treatment and Dry Dock														
WD-C3030	Sec VI D - form dry dock	65	15-Aug-14	01-Nov-14	44									
Section VIII - Landscape Softworks														
Soft Landscaping Works														
SVIII10020	Sec VIII - Tree Felling/Transplanting at Portion 2 & 2A	90	20-Nov-13 A	24-Jun-14	305									
Section X - Protection & Preservation of Trees														
Soft Landscaping Works														
SX10020	Sec X - Protection & Preservation of Trees	1632	31-Jan-13 A	20-Jul-17	0									

[illegible]

 Actual Work	Date	Revision	Ch...	Approved
 Remaining Work	14-Aug-12	Rev. H	MF	KT
 Critical Remaining ...	19-Sep-12	Rev. I	MF	KT
 Milestone	21-Nov-12	Rev. J	MF	KT
 Summary	19-Feb-13	Rev. K	MF	KT
	05-Mar-13	Rev. L	MF	KT
	21-May-13	Rev. M	MF	KT
	20-Aug-13	Rev. N	MF	EY
	15-Nov-13	Rev. O	WC	EY

Contract No.: HK/2010/06


Wan Chai Development Phase II-


Central-Wan Chai Bypass over MTR Tuen Wan Line


(Works Programme - Rev. O)




Activity Name	Duration (cal days)	Start	Finish	Total Float	2011				2012				2013				2014				2015				2016			
					Q1	Q2	Q3	Q4	Q1	Q2	Q3	Q4	Q1	Q2	Q3	Q4	Q1	Q2	Q3	Q4	Q1	Q2	Q3	Q4	Q1	Q2	Q3	Q4
HY/2009/15 - Works Programme Rev. K (DD:20-Feb-14) 1st Submission																												
Works in East Ventilation Adit - Based on Alternative Method																												
EAST VENTILATION ADIT - SUMMARY	774d	00-Apr-12 A	20-Jun-14	18d																								
Works in T81 Area (Portion 13A, 13B) & CCT at Portion 1,2,4,6,22																												
T81 - Temporary Reclamation																												
T81 - TEMPORARY RECLAMATION SUMMARY	127d	07-Jan-11 A	13-Aug-11 A																									
T81 - Diaphragm Wall																												
T81 DIAPHRAGM WALL & PUMP TEST SUMMARY	215d	19-Mar-11 A	30-Dec-11 A																									
T81 - ELS Works																												
T81 ELS SUMMARY	197d	00-Jan-12 A	16-Apr-12 A																									
T81 - CCT RC Structure																												
T81 CCT - SUMMARY	180d	12-Jun-12 A	19-Jun-12 A																									
EV Adit at Portion 1,2,6,22																												
EVA AT PORTION 1 & 2	27d	12-Jun-12 A	17-Jul-12 A																									
T81 - Removal of Temp. Reclamation																												
T81 - REMOVAL OF TEMP. RECLAMATION SUMMARY	133d	04-Jun-12 A	15-Oct-12 A																									
REMOVAL OF TEMP. RECLAMATION T81E (MAX=391D)	604d	25-Jan-11 A	20-Sep-12 A																									
DURATION OF TEMP. RECLAMATION T81E (EXCLUDING T81W MAX=261D)	557d	13-Mar-11 A	20-Sep-12 A																									
Works in T82 Area (Portion 13A, 13B)																												
T82 - Temporary Reclamation																												
T82 - TEMPORARY RECLAMATION SUMMARY	450d	16-Apr-12 A	20-Jun-13 A																									
T82 - Diaphragm Wall																												
T82 - DIAPHRAGM WALL SUMMARY	281d	21-Feb-12 A	28-Aug-13 A																									
T82 - ELS Works																												
T82 ELS SUMMARY	87d	17-Sep-13 A	12-Dec-13 A																									
T82 - CCT RC Structure																												
T82 - CCT SUMMARY	123d	23-Nov-13 A	25-Mar-14	-59d																								
T82 - Removal of Temp. Reclamation																												
T82 REMOVAL OF TEMP. RECLAMATION SUMMARY	82d	11-Mar-14	31-Aug-14	+120d																								
REMOVAL OF TEMP. RECLAMATION T82 (MAX=580D)	1232d	15-Jan-11 A	31-Aug-14	-122d																								
DURATION OF TEMP. RECLAMATION T21 (MAX=900D)	1223d	25-Jan-11 A	31-Aug-14	-122d																								
Works in T81/T82 - Cable Trough/Maintenance Walkway																												
T82 CABLE TROUGH SUMMARY	218d	00-Jun-14 A	11-Aug-14	-58d																								
Works in T84/ME4 Area (Portion 14A, 14B, 15, 23)																												
T84 + ME4 (T84 + T26) Temporary Reclamation																												
T84 - TEMPORARY RECLAMATION SUMMARY	364d	20-Jan-11 A	16-Apr-12 A																									
T84ME4 - Diaphragm Wall																												
DIAPHRAGM WALL SUMMARY	310d	20-Dec-11 A	27-Oct-12 A																									
T84ME4 - ELS Works & Rock Excavation																												
T84 - ELS + ROCK EXCAVATION SUMMARY	378d	10-Oct-12 A	22-Oct-13 A																									
T84ME4 - Mined Tunnel East Portal Works																												
MT EAST PORTAL WORKS SUMMARY	201d	16-Aug-13 A	13-Mar-14	-205d																								
T84ME4 - CCT RC Structure																												
T84ME4 - C&B CCT SUMMARY	310d	20-May-13 A	06-Apr-14	-205d																								
T84ME4 - SOL CCT SUMMARY	125d	20-Dec-13 A	04-Aug-14	-205d																								
T84ME4 - Removal of Temporary Reclamation																												
DURATION OF TEMP. RECLAMATION T84 (MAX=1030D)	1109d	20-Apr-11 A	20-Jun-14	-218d																								
REMOVAL OF TEMP. RECLAMATION SUMMARY	64d	20-Apr-14	30-Jun-14	-218d																								
Re-provision of Permanent Jetty/Floating Pontoon																												
RE-PROVISION OF PERMANENT JETTY	150d	20-Feb-14	23-Aug-14	416d																								
CHT Protection Works at Location A,B,C																												
ADMS Installation																												
ADMS INSTALLATION - SUMMARY	74d	01-Feb-11 A	15-Apr-11 A																									
Standby Dewatering System(CSD: Grout Curtain Cut-off Wall Scheme)																												
STANDBY DEWATERING SYSTEM - SUMMARY	402d	19-Apr-11 A	13-Jul-12 A																									
VO NO. 8 & 14 - Steel Weights & Aluminum Cladding Inside CHT																												
VO NO. 8 & 14 - STEEL WEIGHTS & CLADDING SUMMARY	378d	20-Aug-11 A	31-Aug-12 A																									
Works in TPCWAE Area (Portion 20A, 20B)																												
TPCWAE - Temporary Reclamation																												
TPCWAE - TEMPORARY RECLAMATION SUMMARY	143d	00-Dec-10 A	07-Jun-11 A																									
TPCWAE - Diaphragm Wall																												
DIAPHRAGM WALL & PUMP TEST SUMMARY	252d	13-Jun-11 A	30-Jun-12 A																									
TPCWAE - ELS Works & Soft Excavation																												
TPCWAE - ELS SUMMARY (EXCEPT ROCK EXCAVATION)	240d	17-Jan-12 A	12-Sep-12 A																									
TPCWAE - Rock Excavation																												
TPCWAE - ROCK EXCAVATION SUMMARY	216d	19-Jun-12 A	05-Apr-13 A																									
MT West Portal Works																												
MT WEST PORTAL WORKS SUMMARY	375d	08-Nov-12 A	04-Dec-13 A																									
CCT RC Structure																												
CCT - AREA A	309d	24-Jan-13 A	18-Apr-14	+127d																								
CCT - AREA B, SWITCHING AREA	111d	27-Feb-13 A	23-Mar-14	-127d																								
Removal of Temporary Reclamation																												
REMOVAL OF RECLAMATION SUMMARY	45d	15-Mar-14	30-Apr-14	-145d																								
Works in TPCWAW Area																												
TPCWAW - Temporary Reclamation																												
TPCWAW - TEMPORARY RECLAMATION SUMMARY	89d	03-May-14	20-Jun-14	0d																								
TPCWAW - Diaphragm Wall																												
DIAPHRAGM WALL & PUMP TEST SUMMARY	193d	27-Jul-14	04-Feb-15	0d																								
TPCWAW - ELS Works																												
TPCWAW - ELS SUMMARY (EXCEPT ROCK EXCAVATION)	85d	06-Feb-15	04-May-15	0d																								
TPCWAW - ROCK EXCAVATION																												
TPCWAW - ROCK EXCAVATION SUMMARY	108d	29-Apr-15	19-Aug-15	1d																								
TPCWAW - CCT RC Structure																												
TPCWAW - CCT SUMMARY	94d	24-Jul-15	23-Oct-15	0d																								
TPCWAW - Removal of Temporary Reclamation																												
DURATION OF TEMP. RECLAMATION T23 (MAX=156D)	1812d	11-Feb-11 A	27-Jan-16	0d																								
DURATION OF TEMP. RECLAMATION TPCWAW MAX=160D	629d	09-May-14	27-Jan-16	0d																								
REMOVAL OF TEMP. RECLAMATION SUMMARY	95d	19-Oct-15	27-Jan-16	0d																								
Works for Mined Tunnel (Portion 16, 17, 18)																												
(SR) 81p Road 8 Tunnel, Total L = 167m, less 13m at WP and less 5m at EP= 149m Tunnel Excav																												
SR - MINED TUNNEL WORKS SUMMARY	515d	19-Oct-13 A	17-Mar-15	230d																								
(EB) East Bound Tunnel, L = 167m, less 7m at WP and less 1.5m at EP= 158.5m Tunnel Excav																												
EB - MINED TUNNEL WORKS SUMMARY	745d	19-Oct-13 A	02-Nov-15	0d																								
(WB) West Bound Tunnel, L = 153m, less 7m at WP and less 1.5m at EP= 144.5m Tunnel Excav																												
WB - MINED TUNNEL WORKS SUMMARY	745d	19-Oct-13 A	02-Nov-15	0d																								

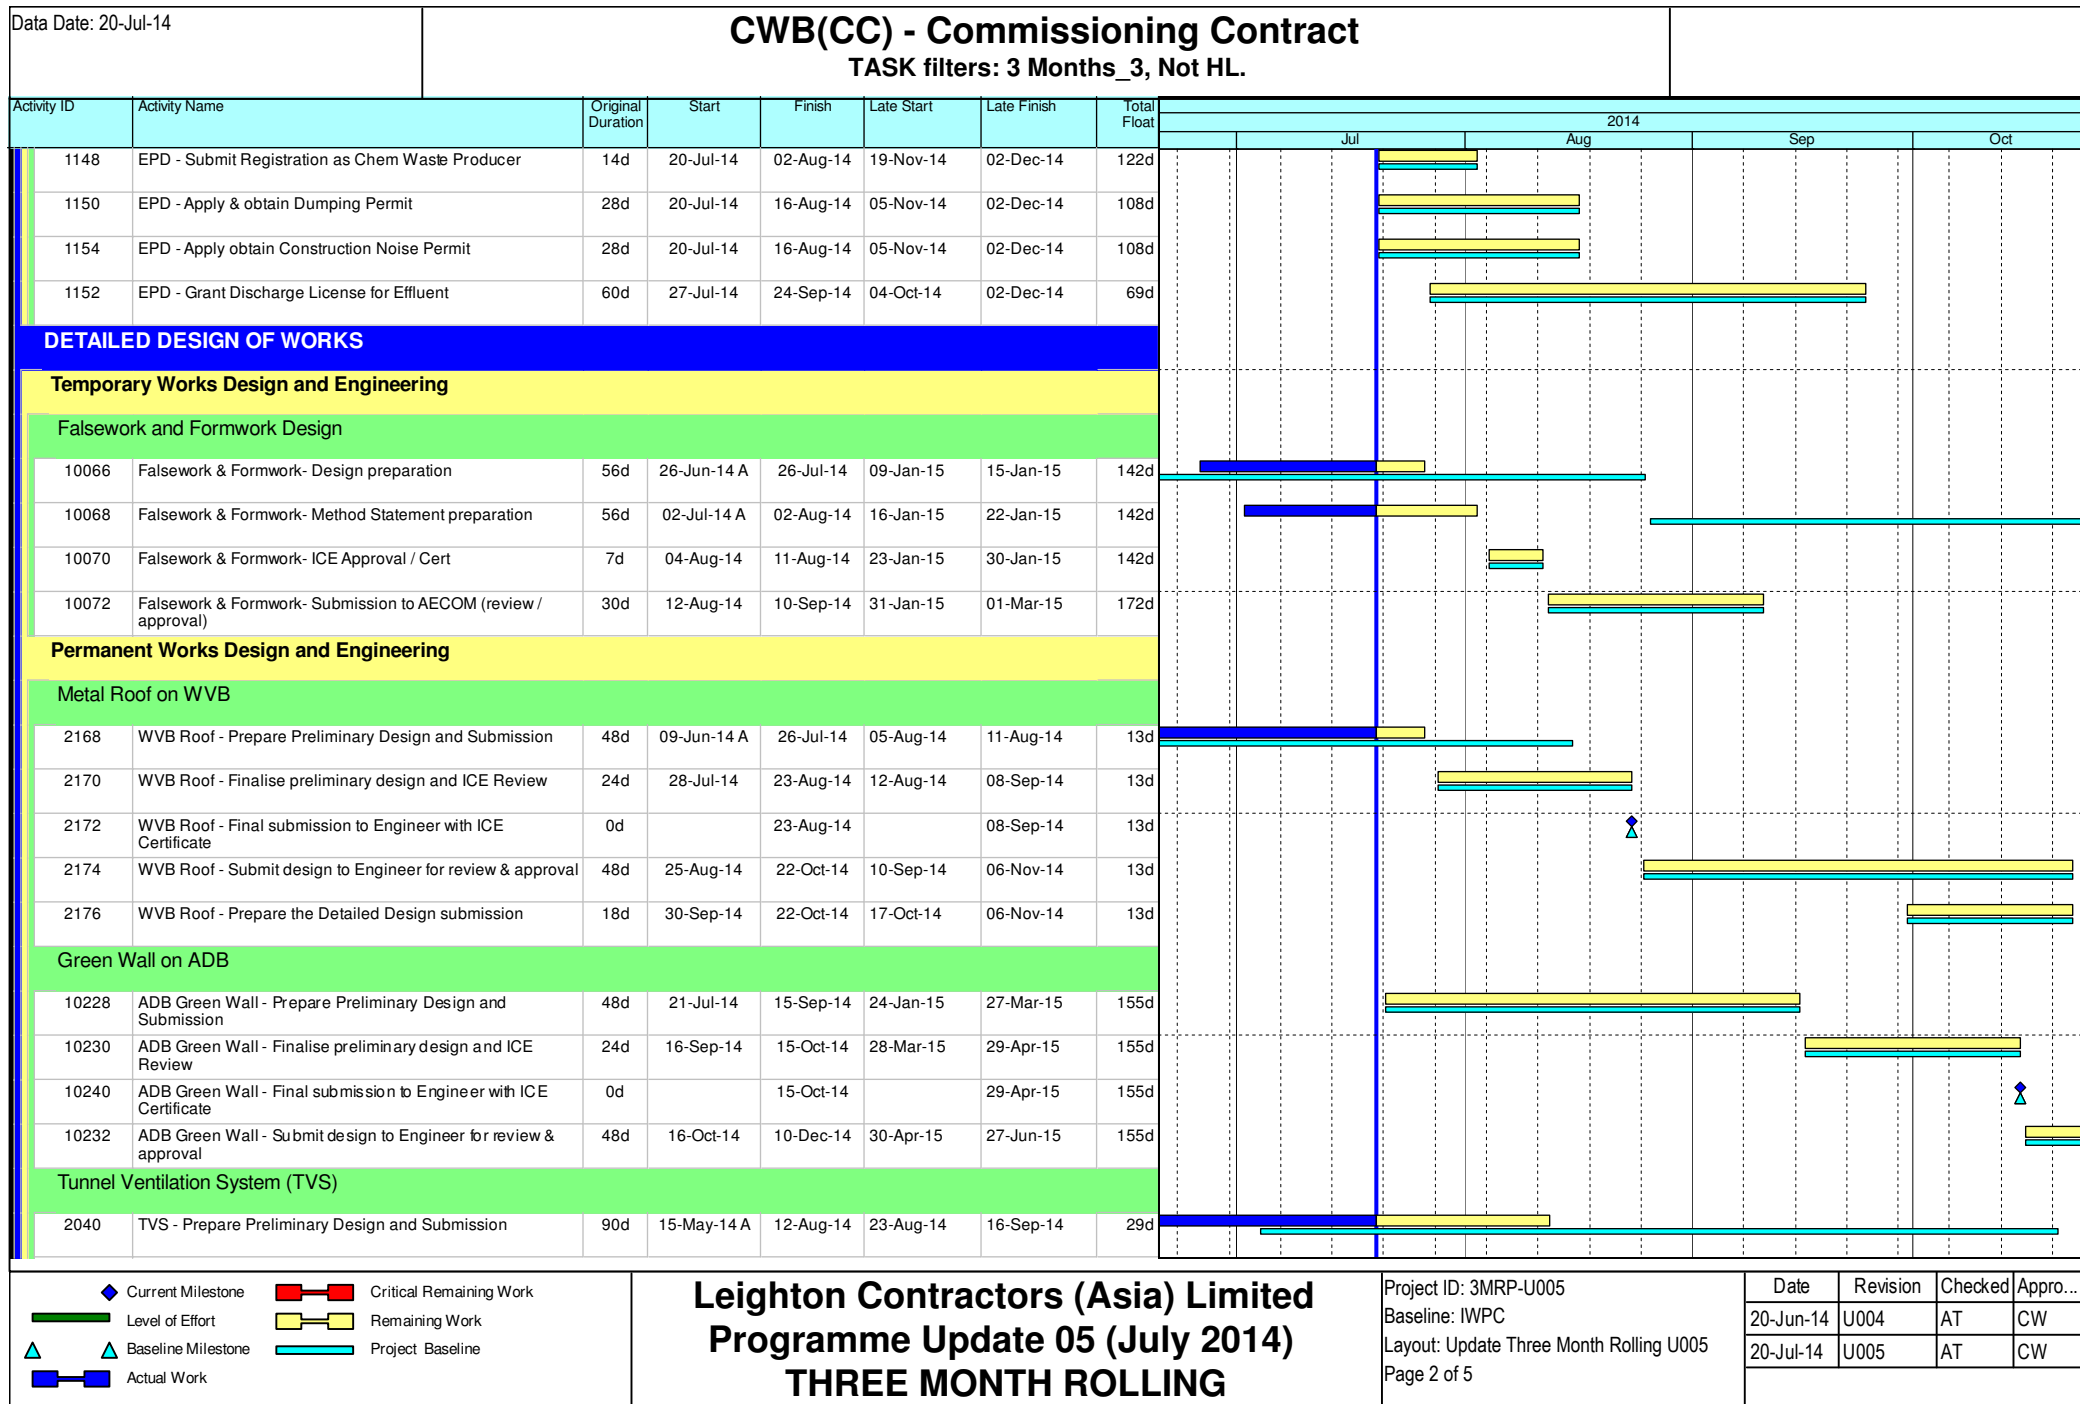


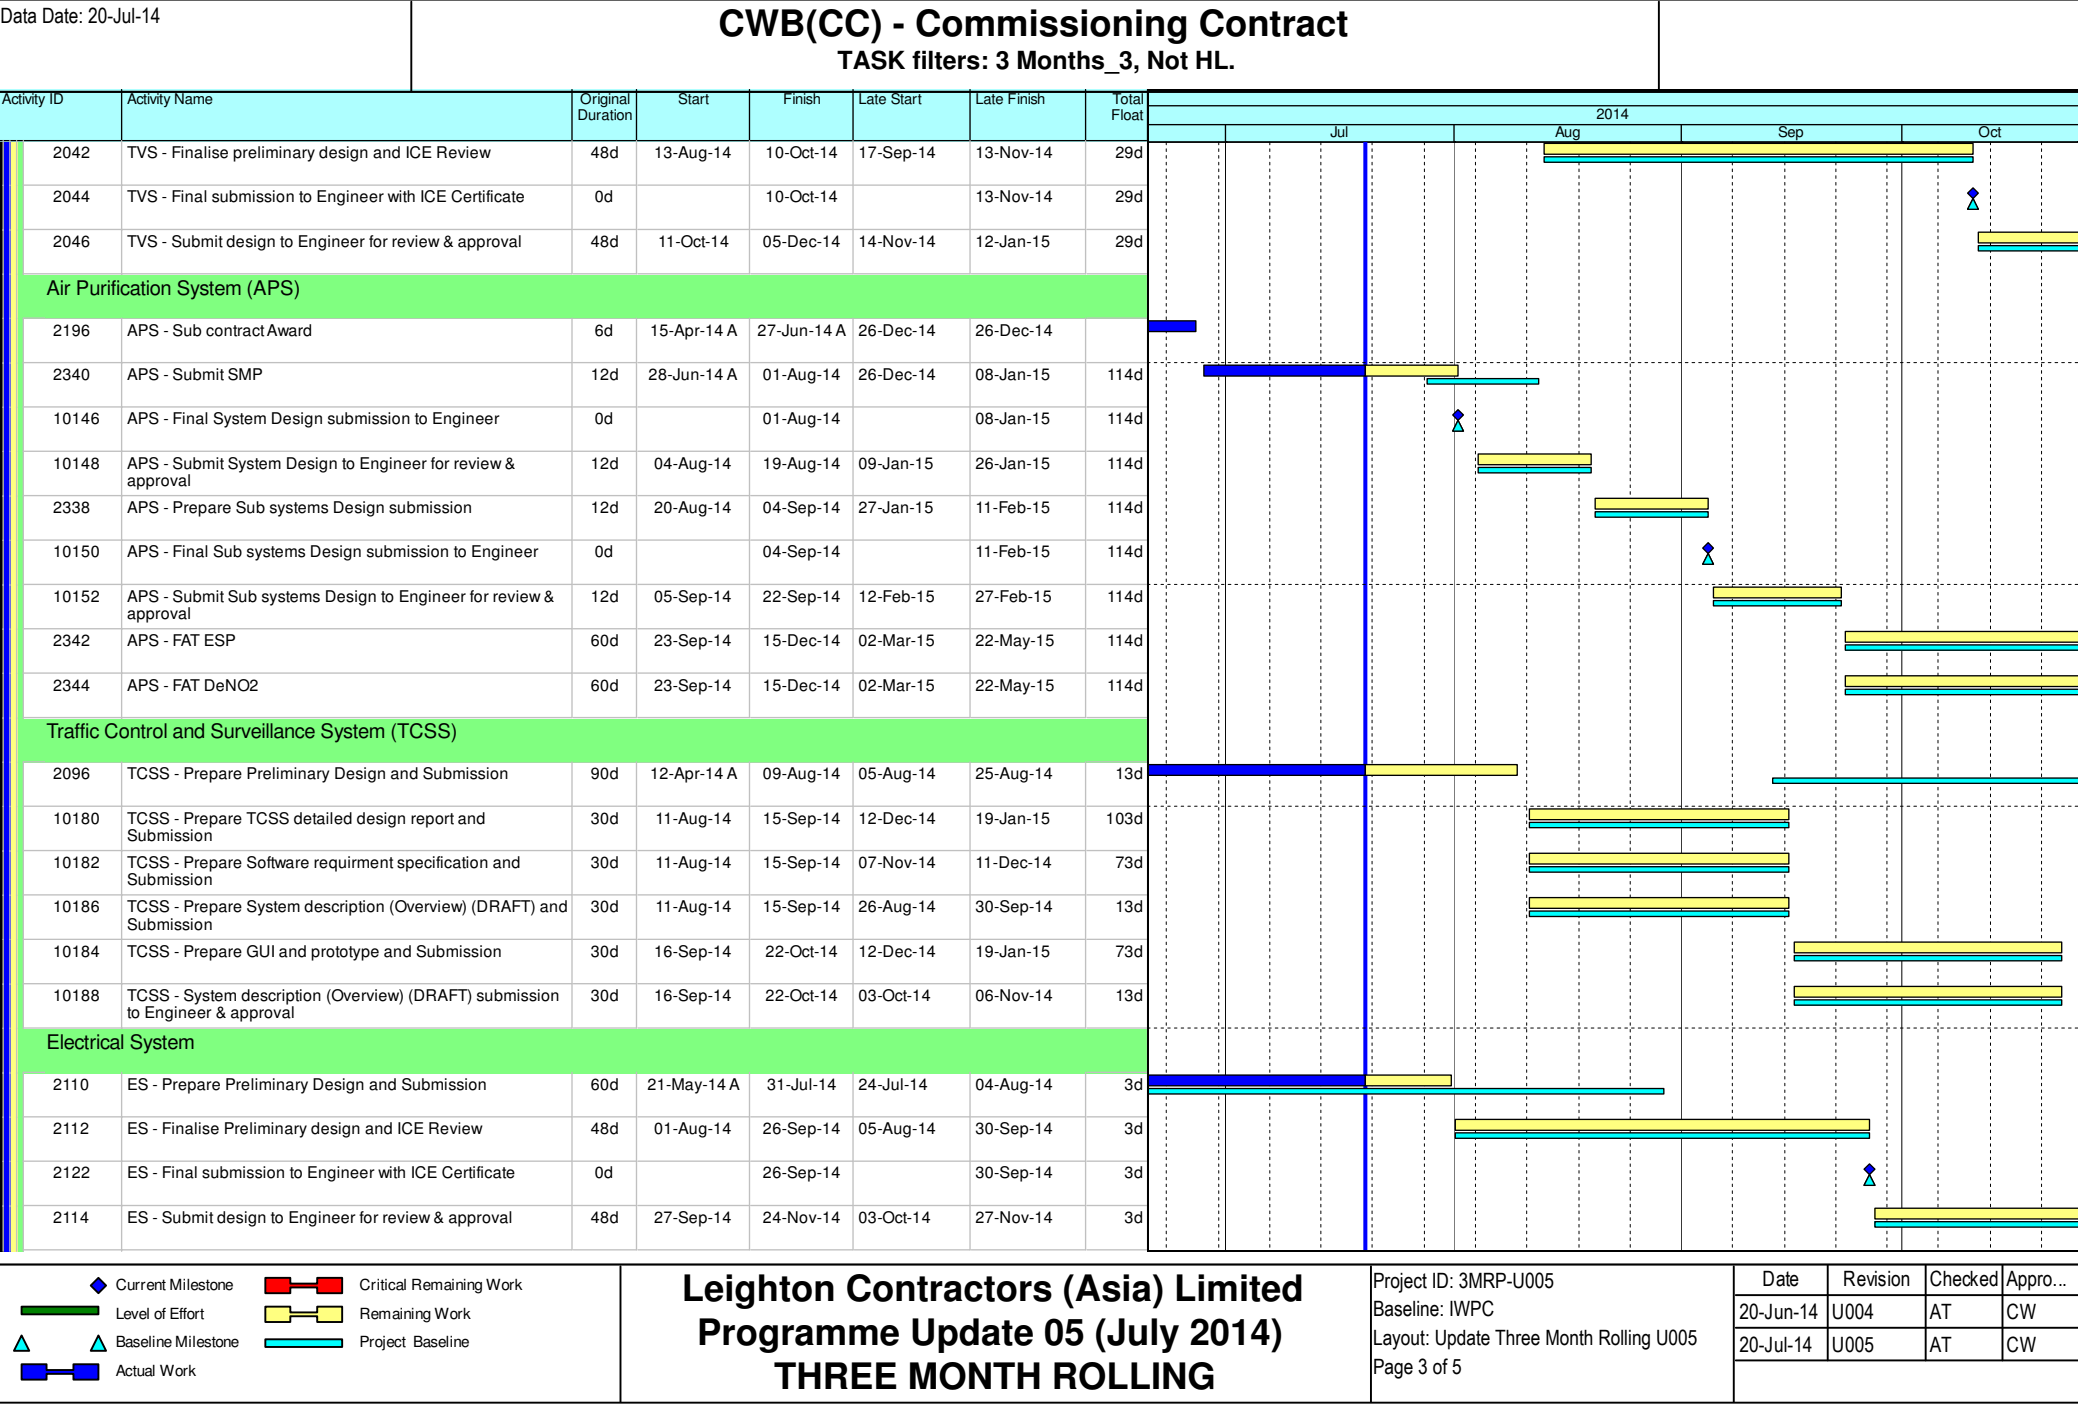


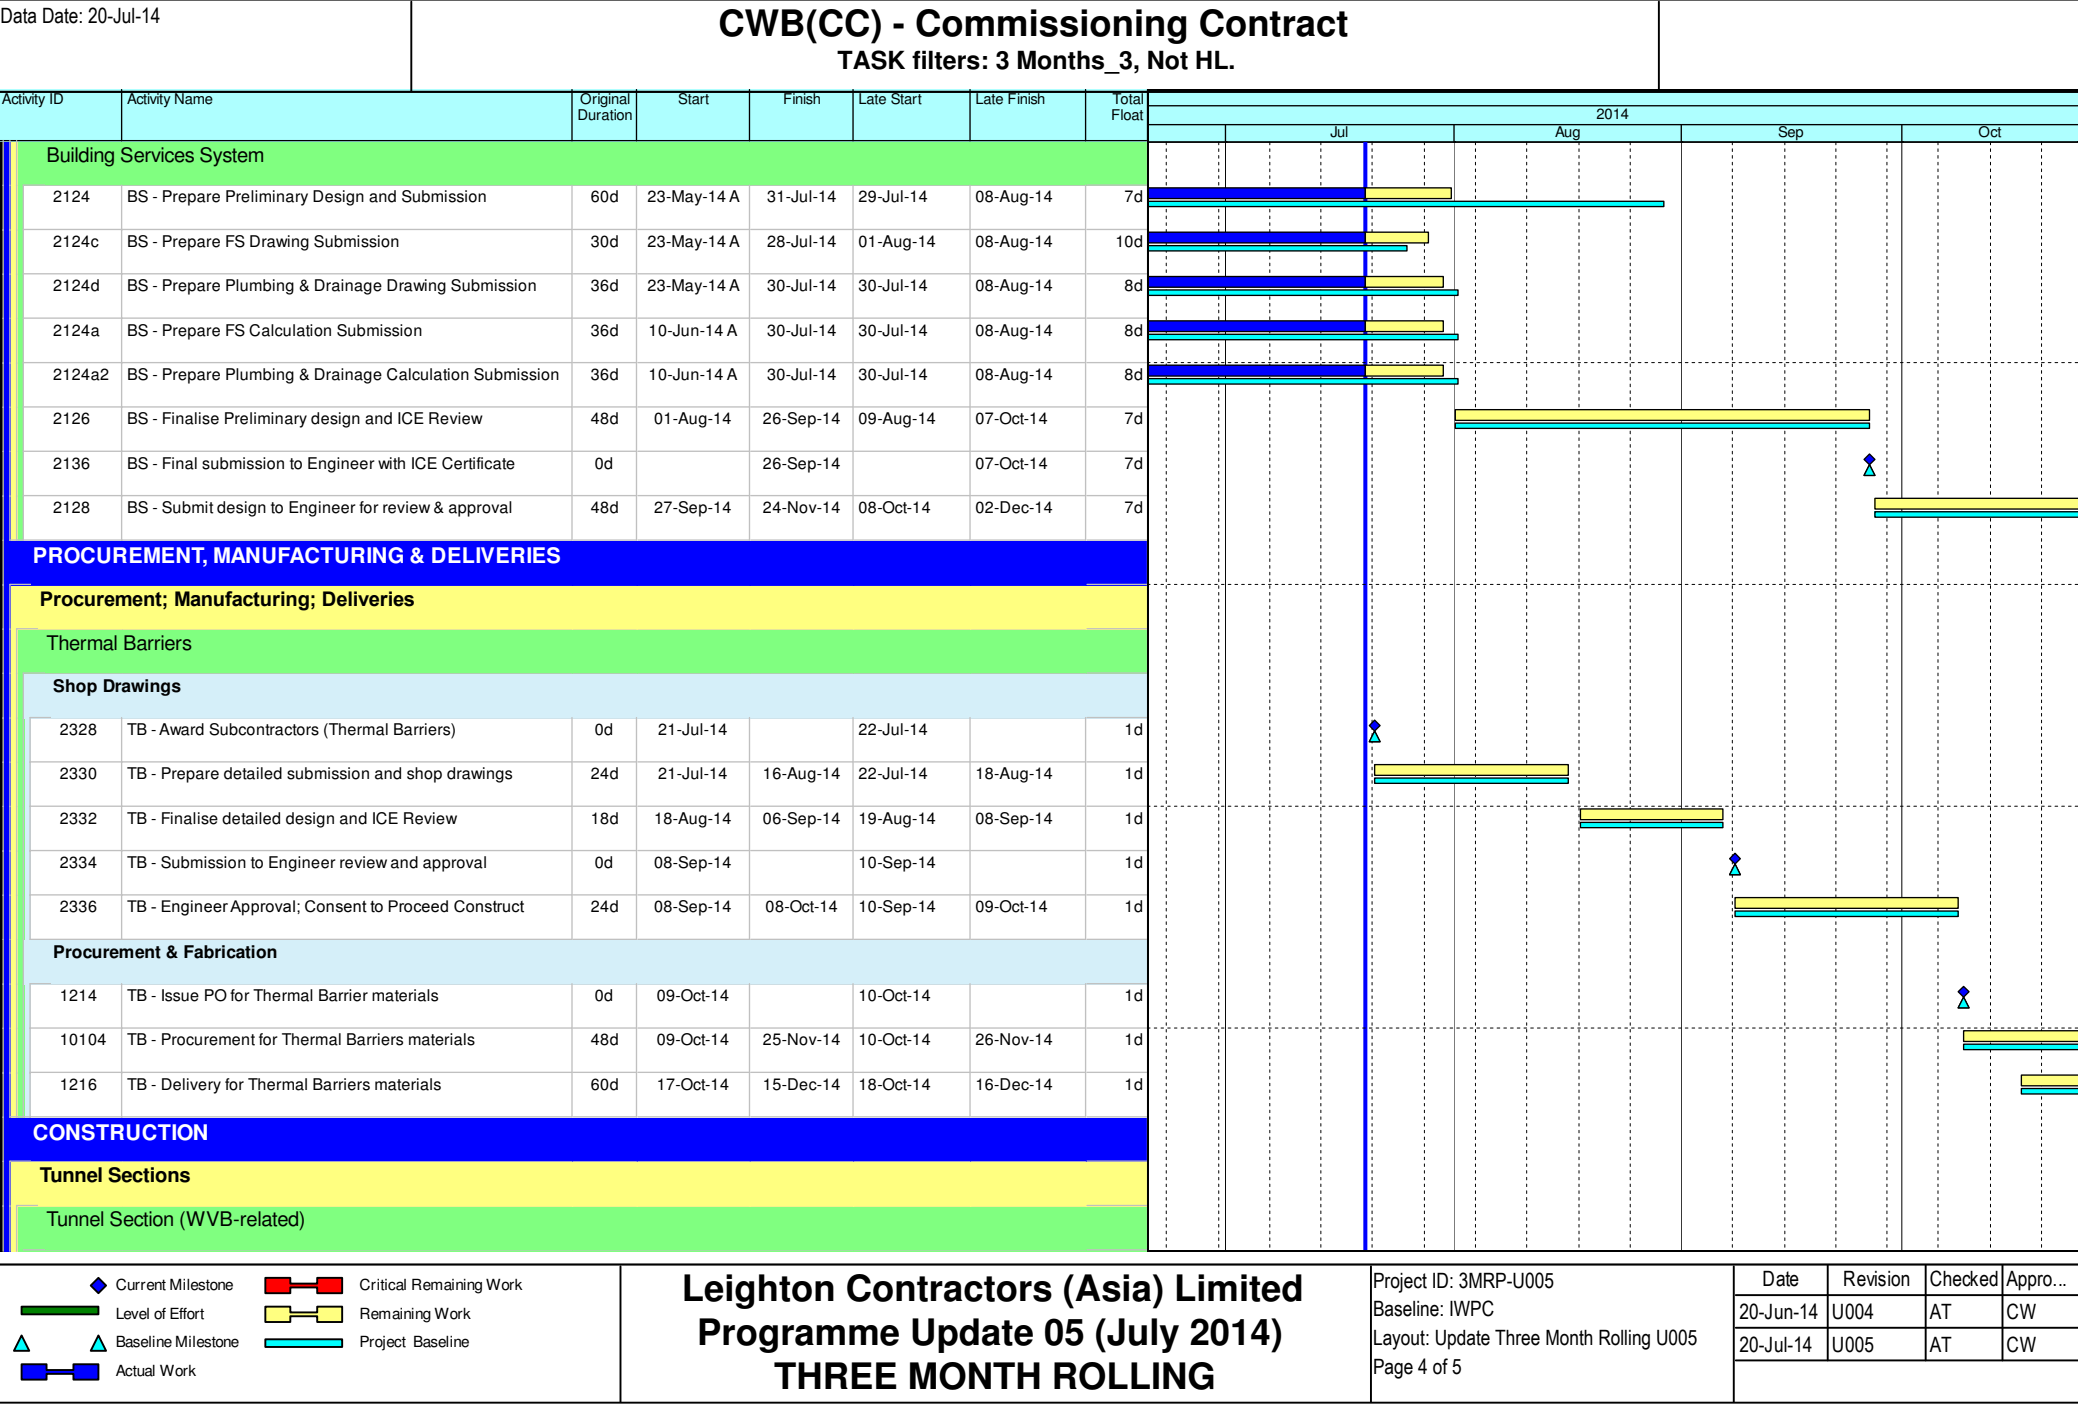



Activity ID	Activity Name	Original Duration	Start	Finish	Late Start	Late Finish	Total Float	2014											
								Jul			Aug			Sep			Oct		
Portion III [CH1800 to CH2600]																			
4918	Possession of Portion III	0d	28-Jun-14 A		01-Nov-14			◆			▲								
4920	III - Initial Site Survey	12d	21-Jul-14	02-Aug-14	01-Nov-14	14-Nov-14	86d												
Westbound																			
4922	III(WB) - Mobilisation & Setup	12d	04-Aug-14	16-Aug-14	15-Nov-14	28-Nov-14	86d												

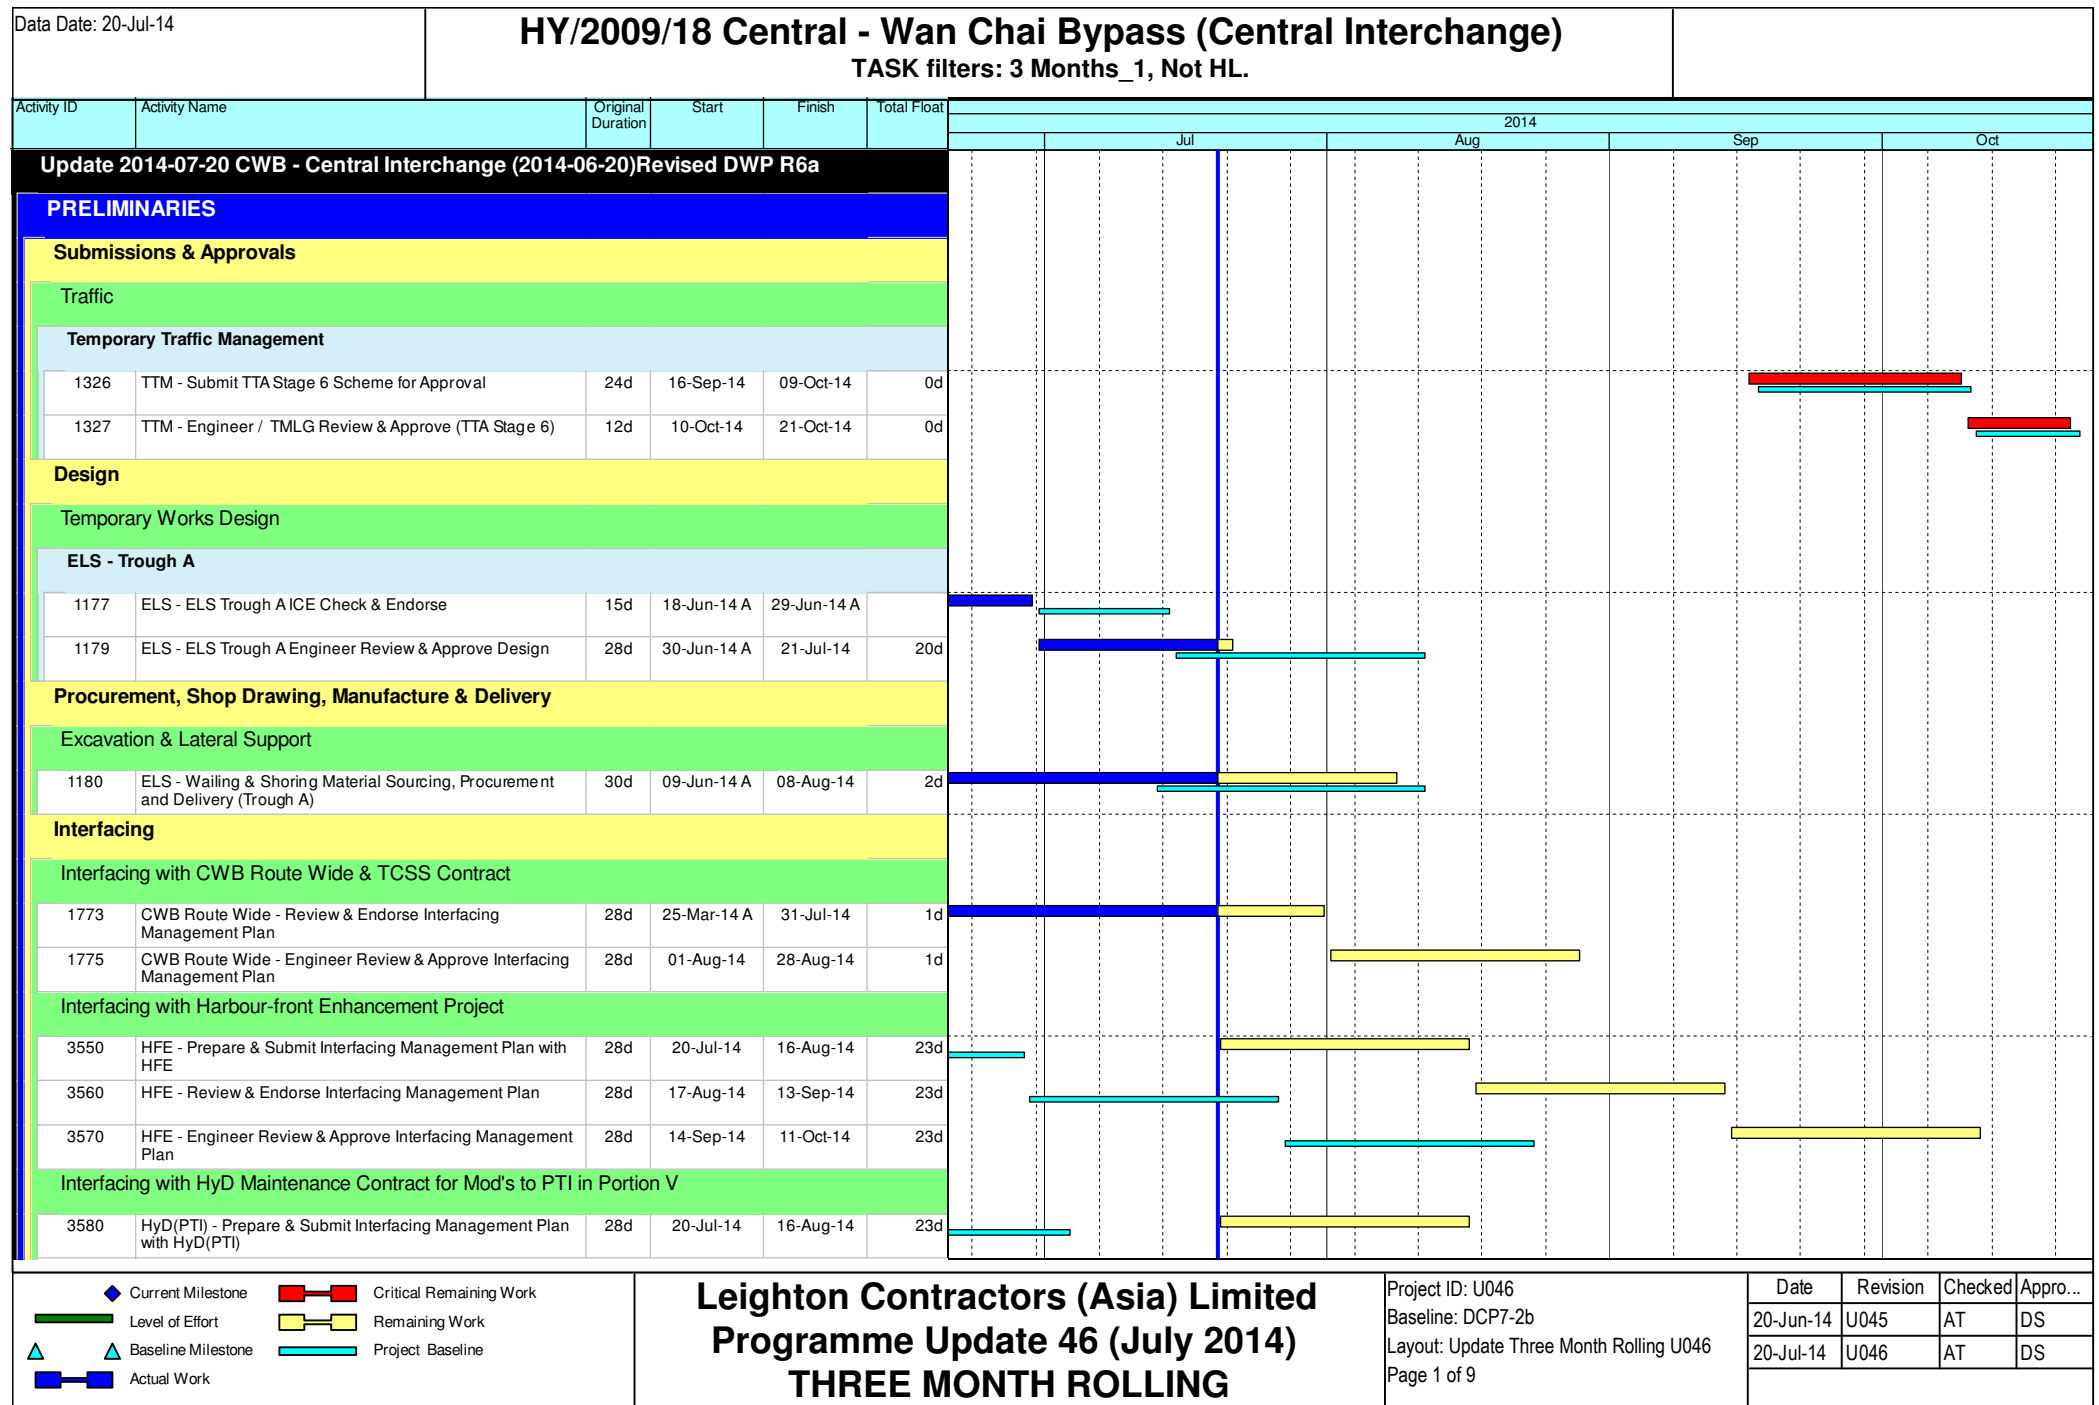


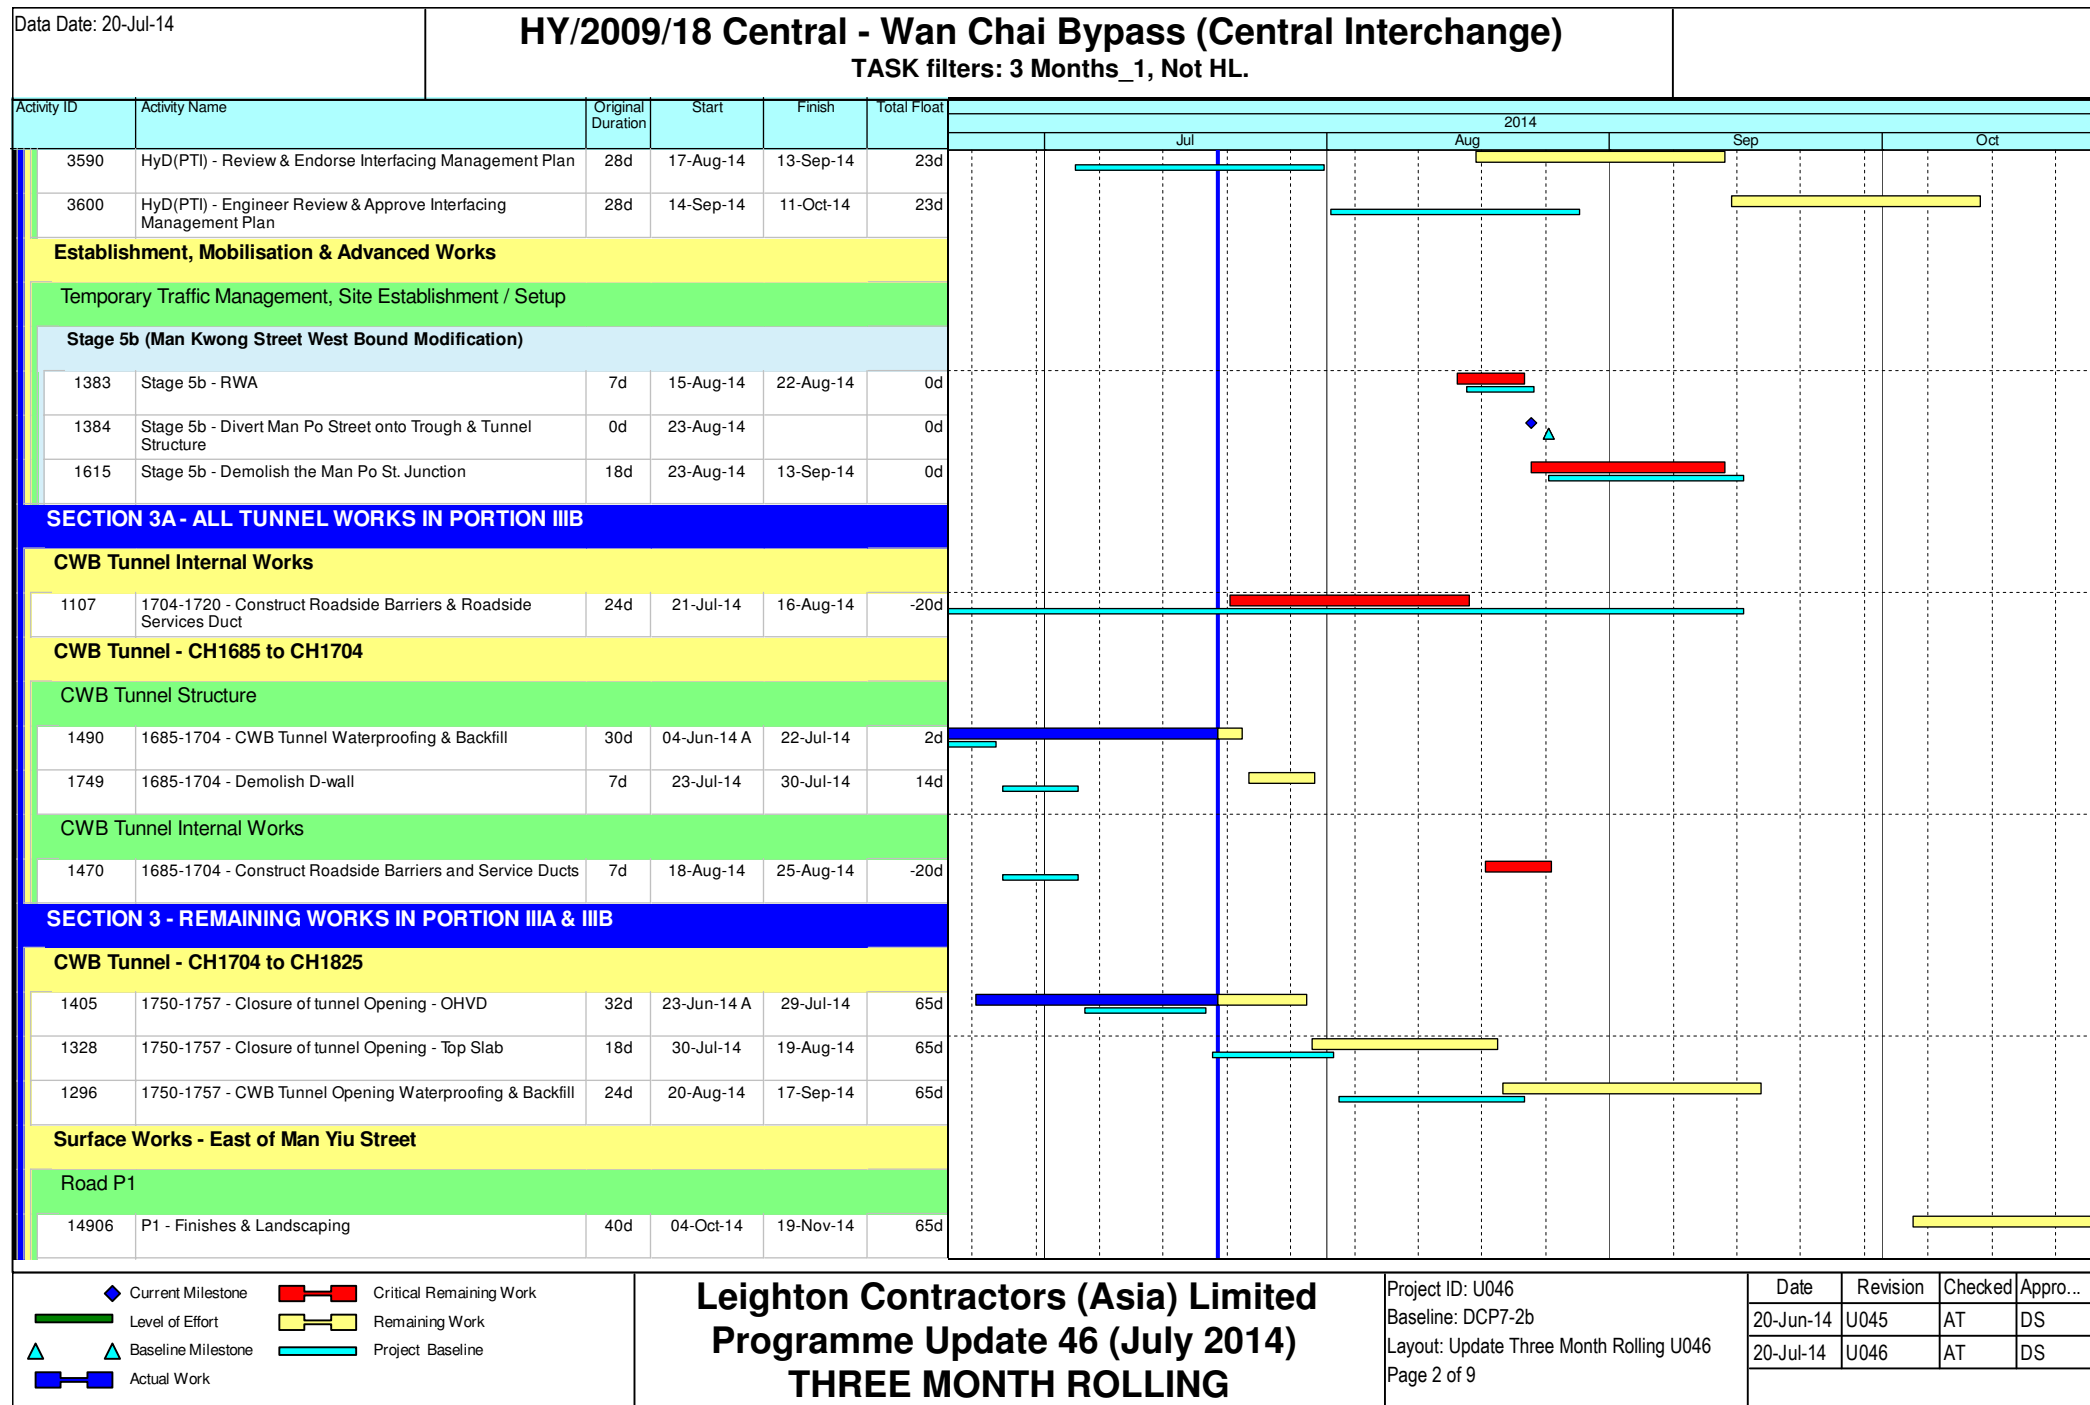


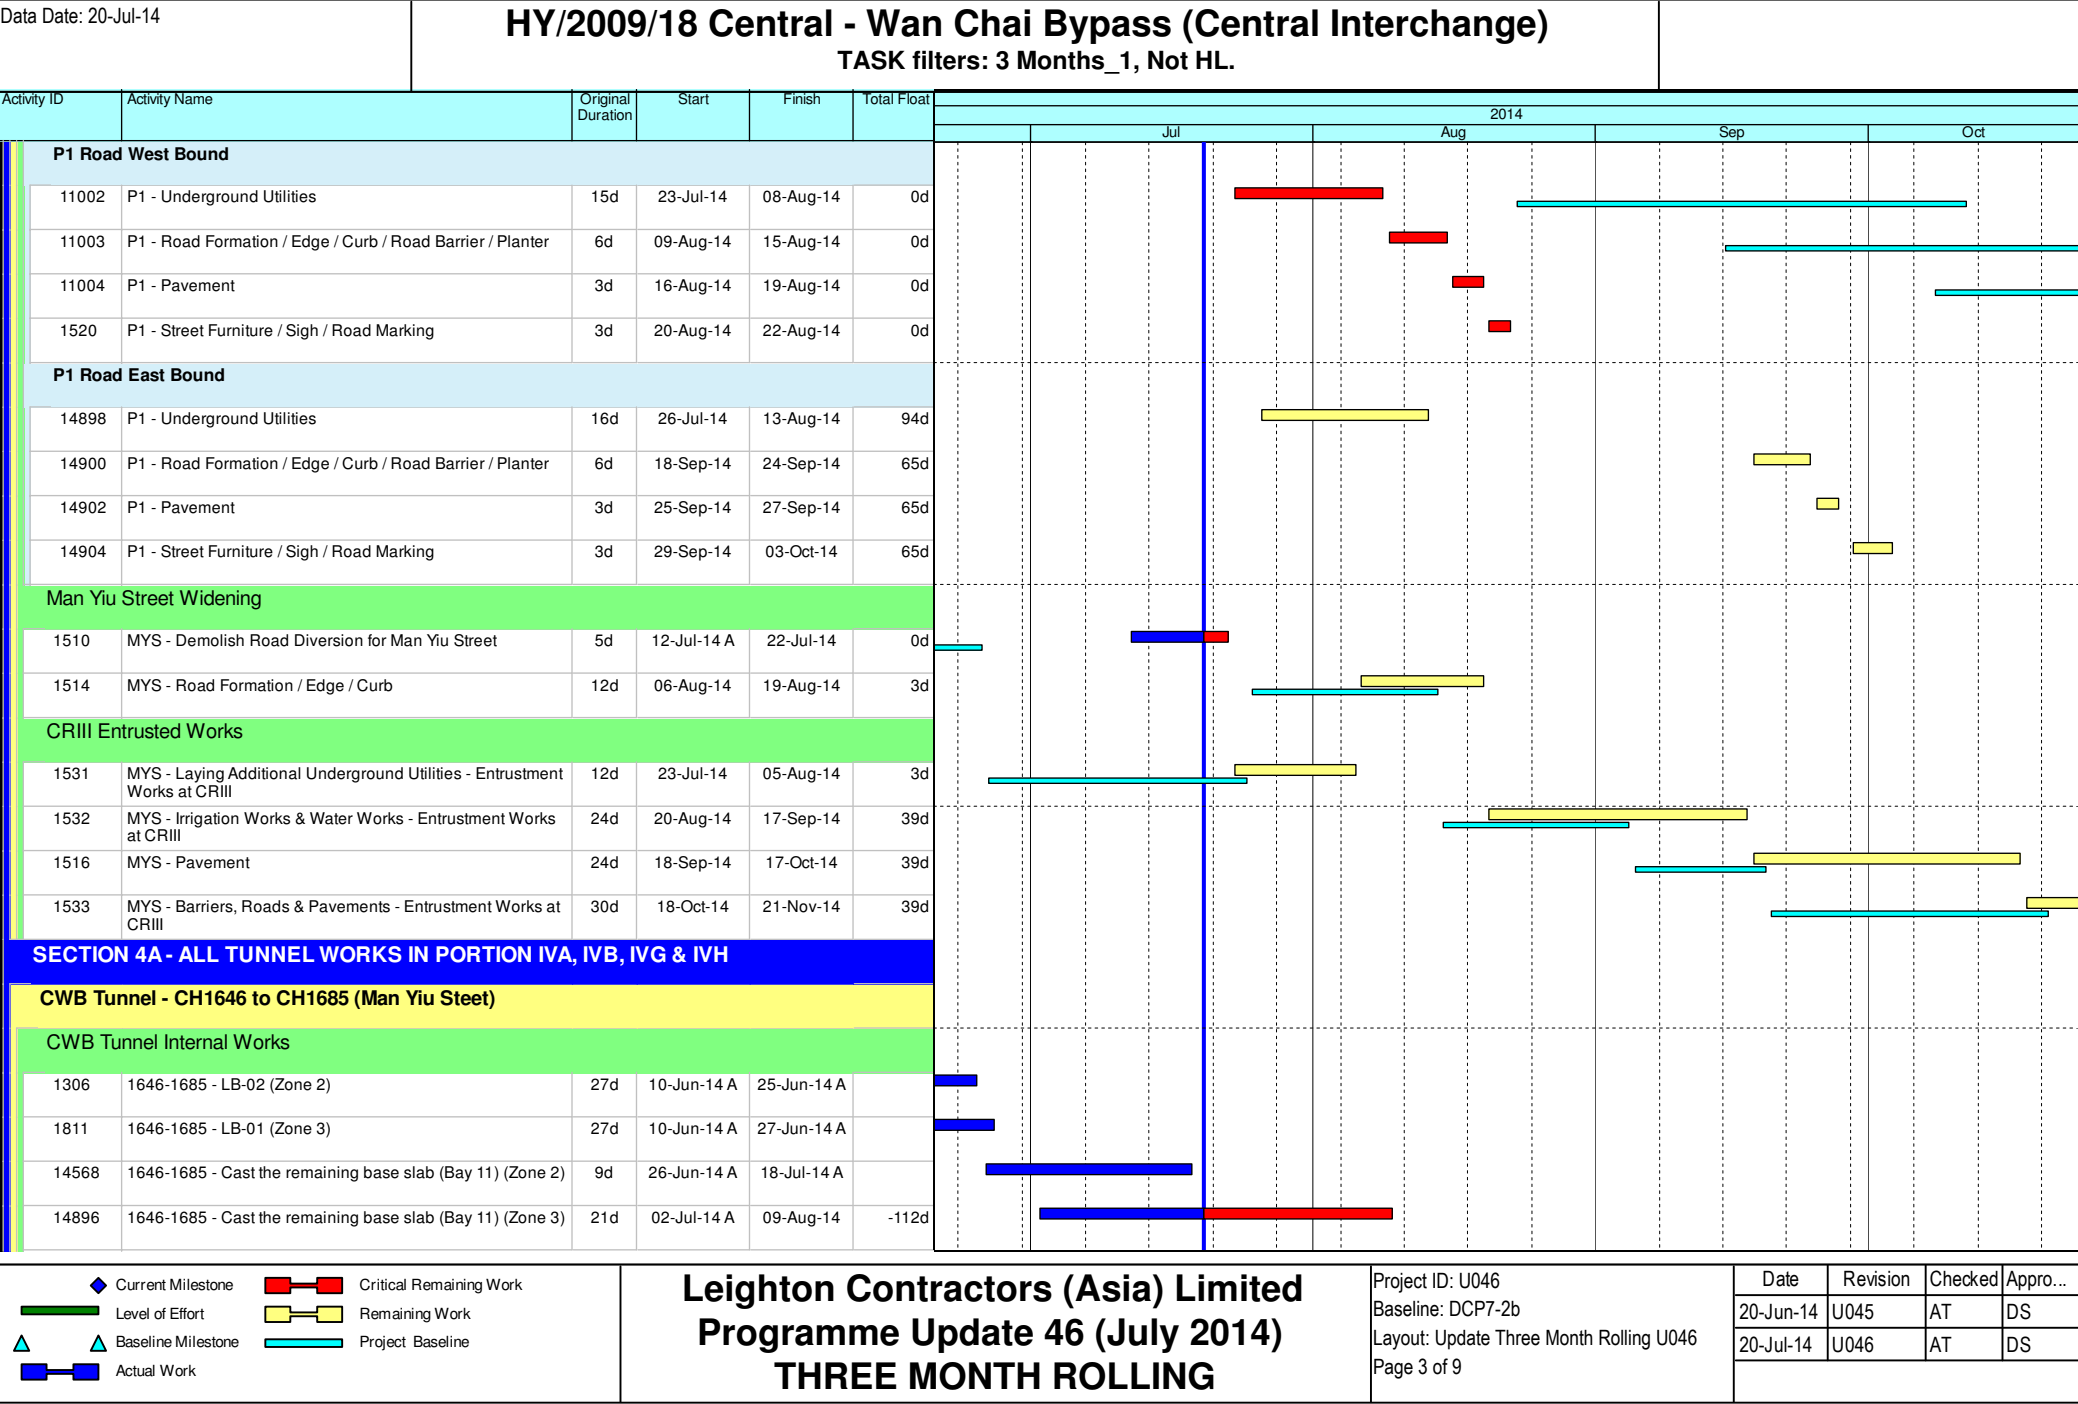


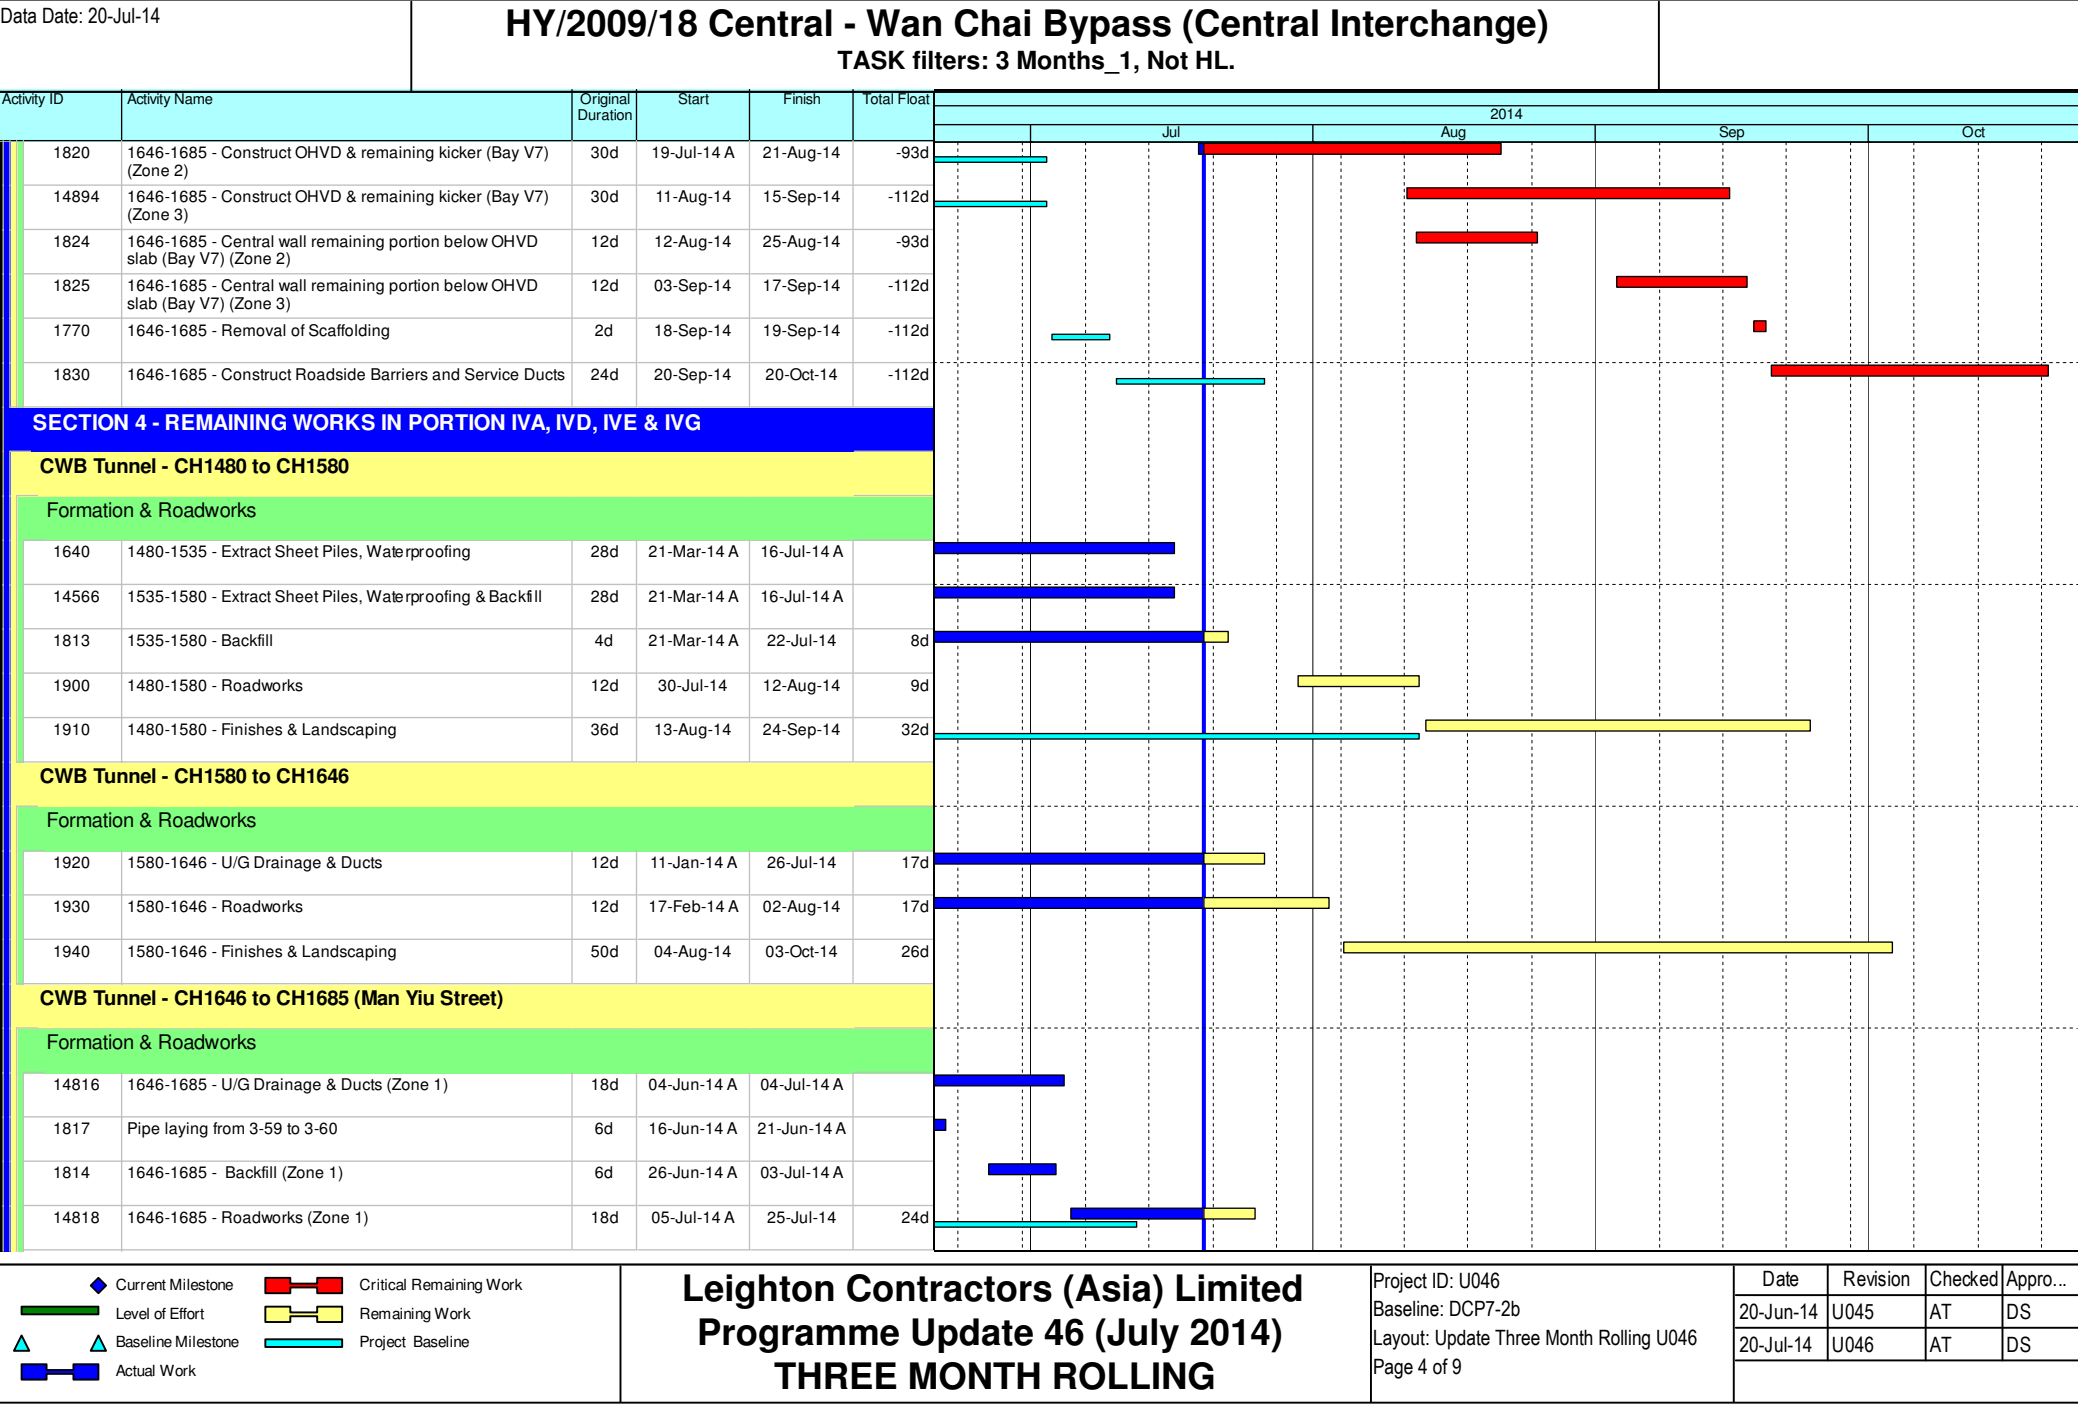

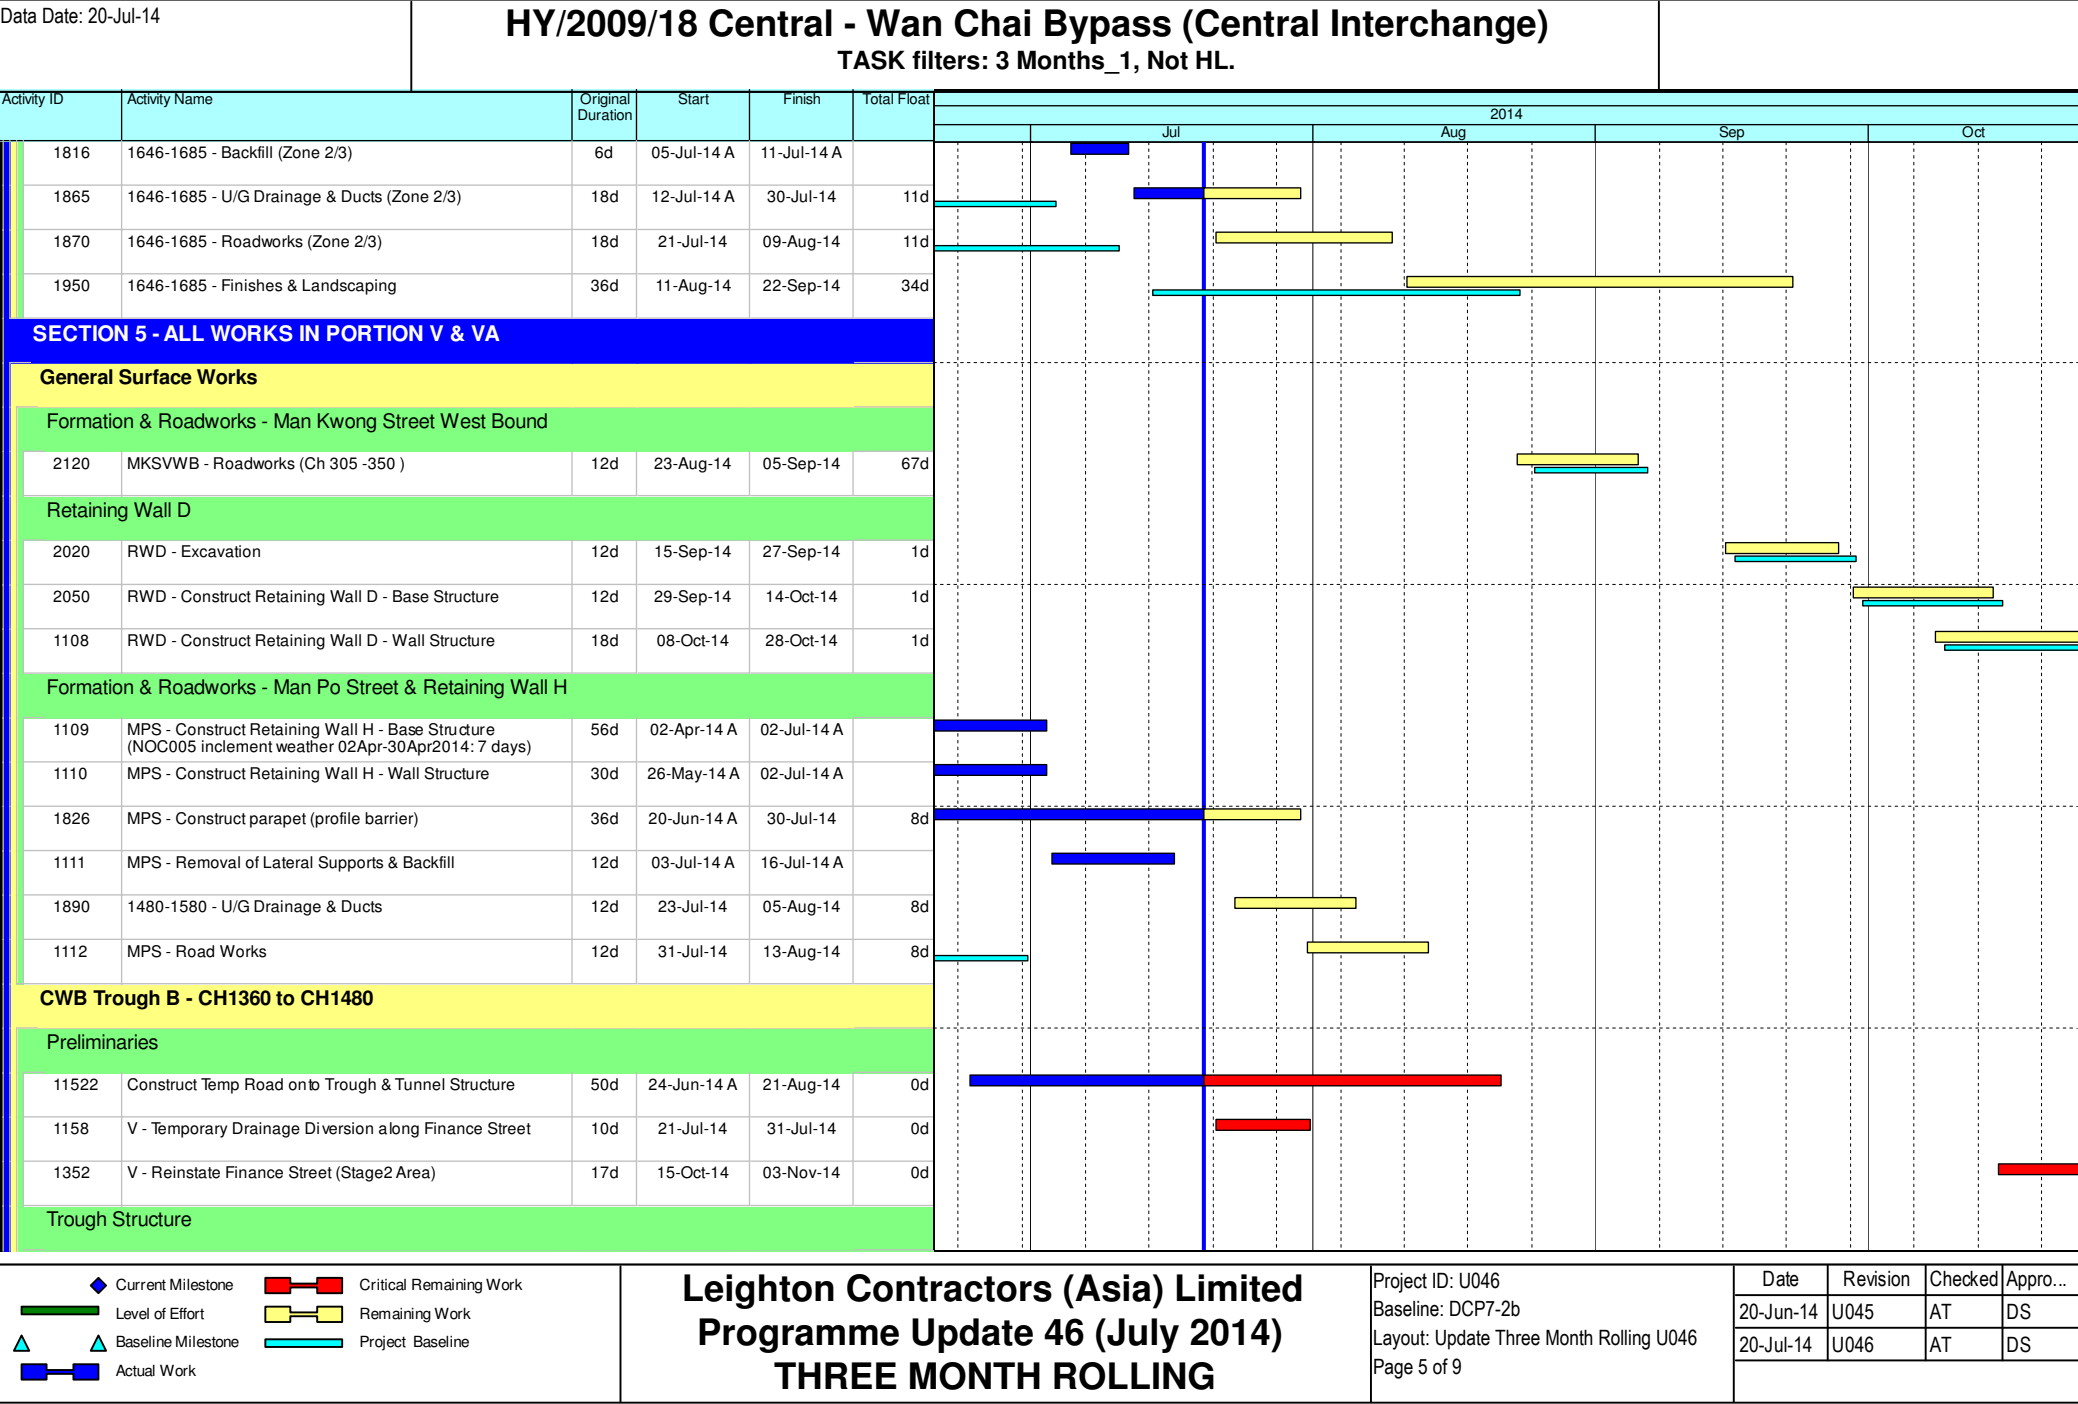

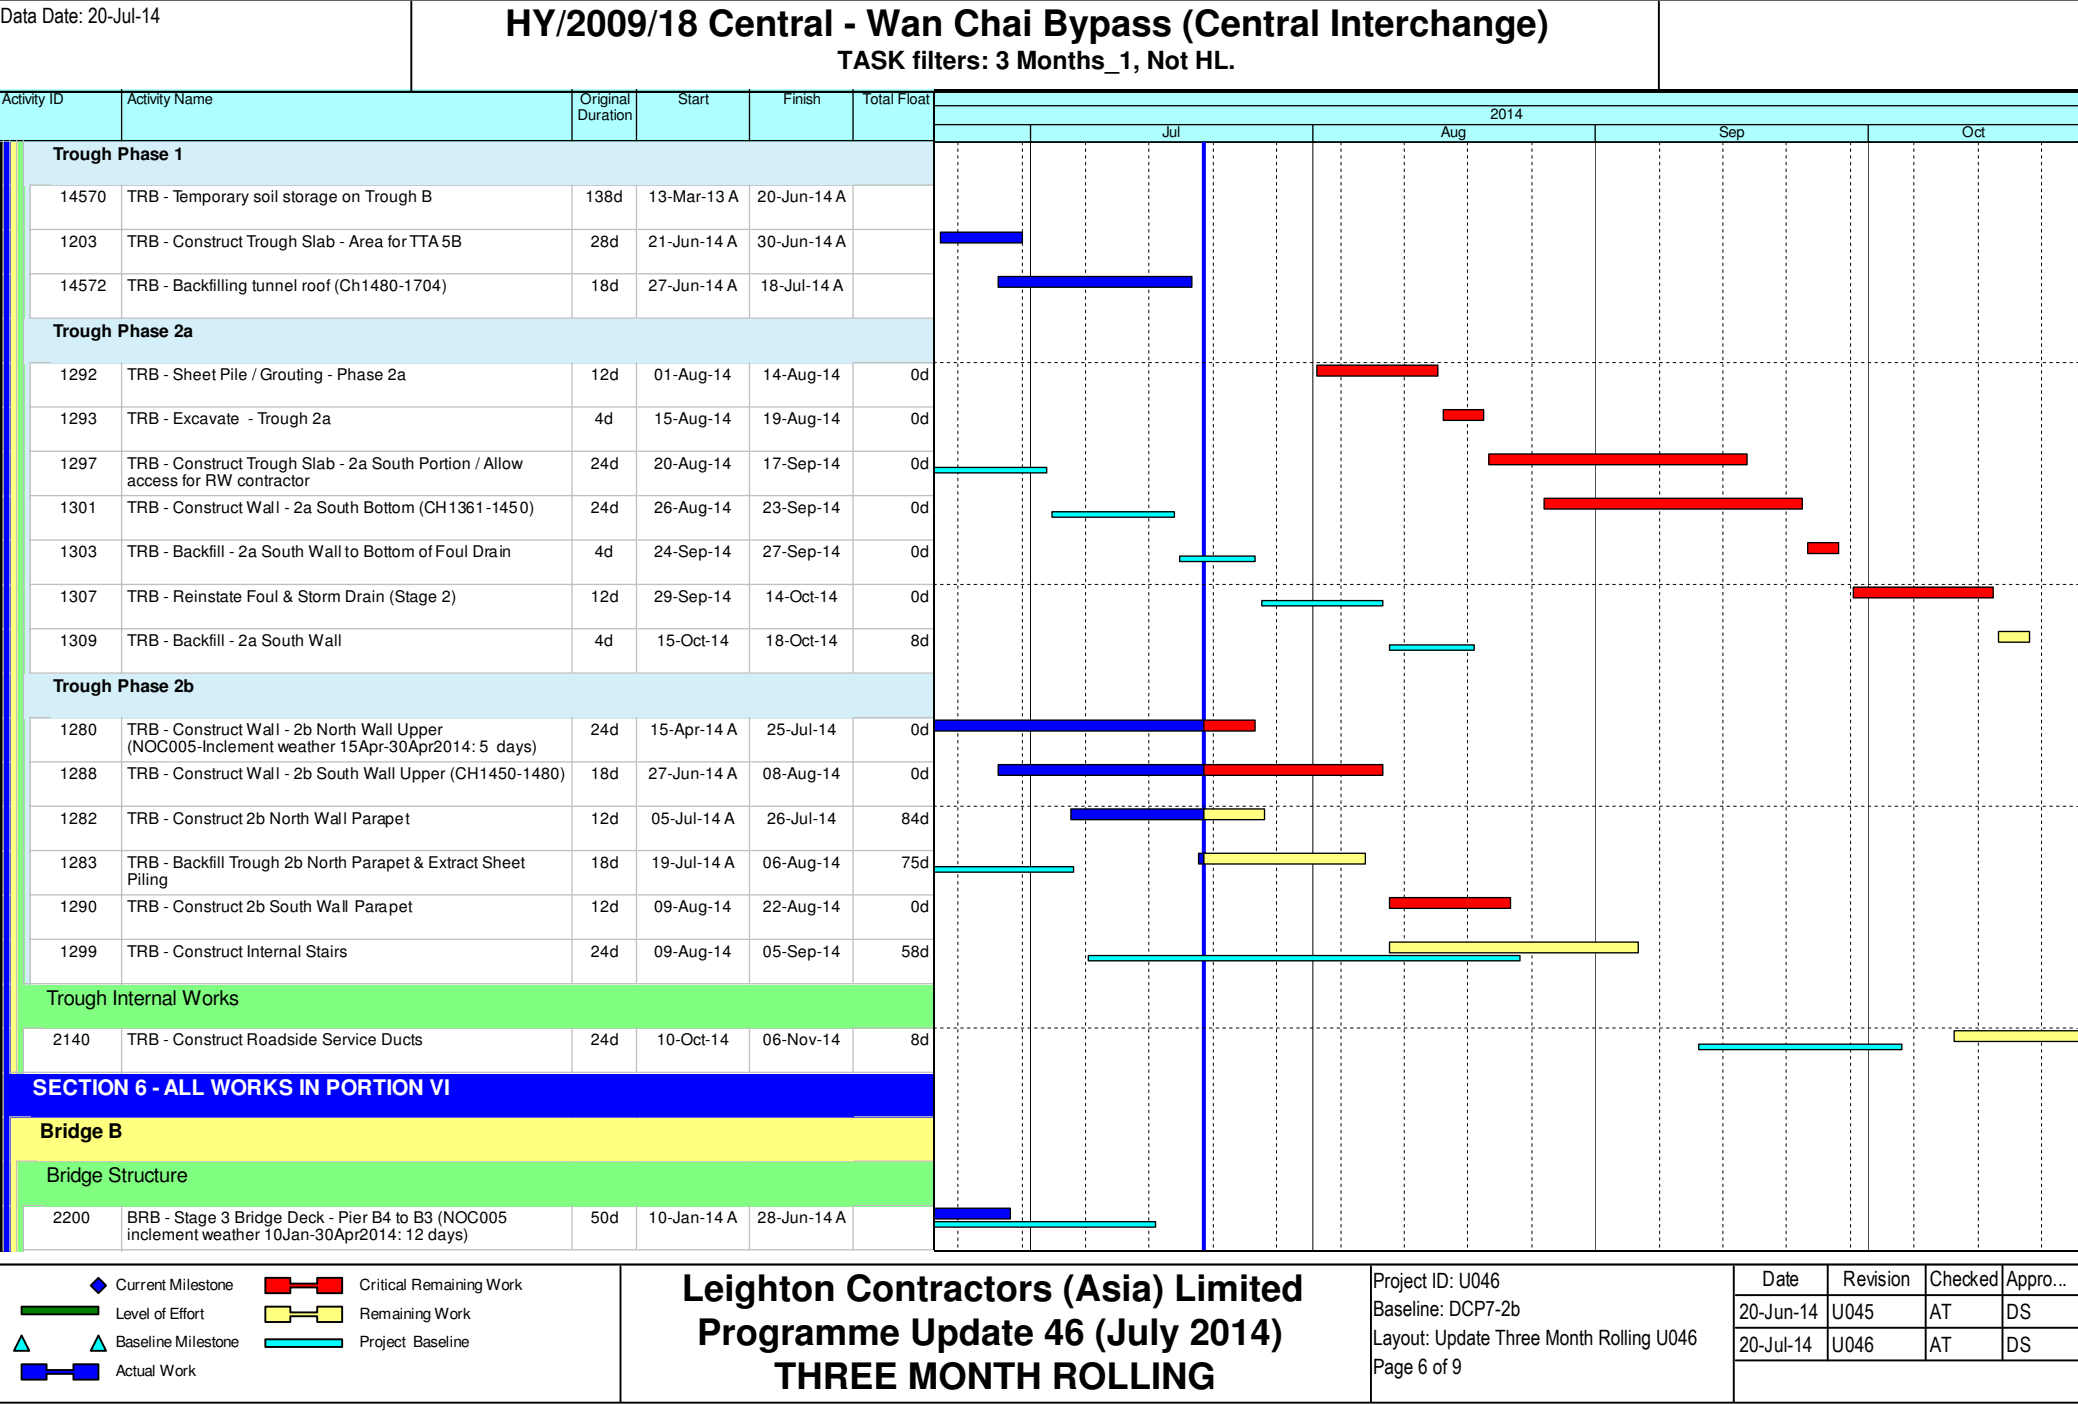


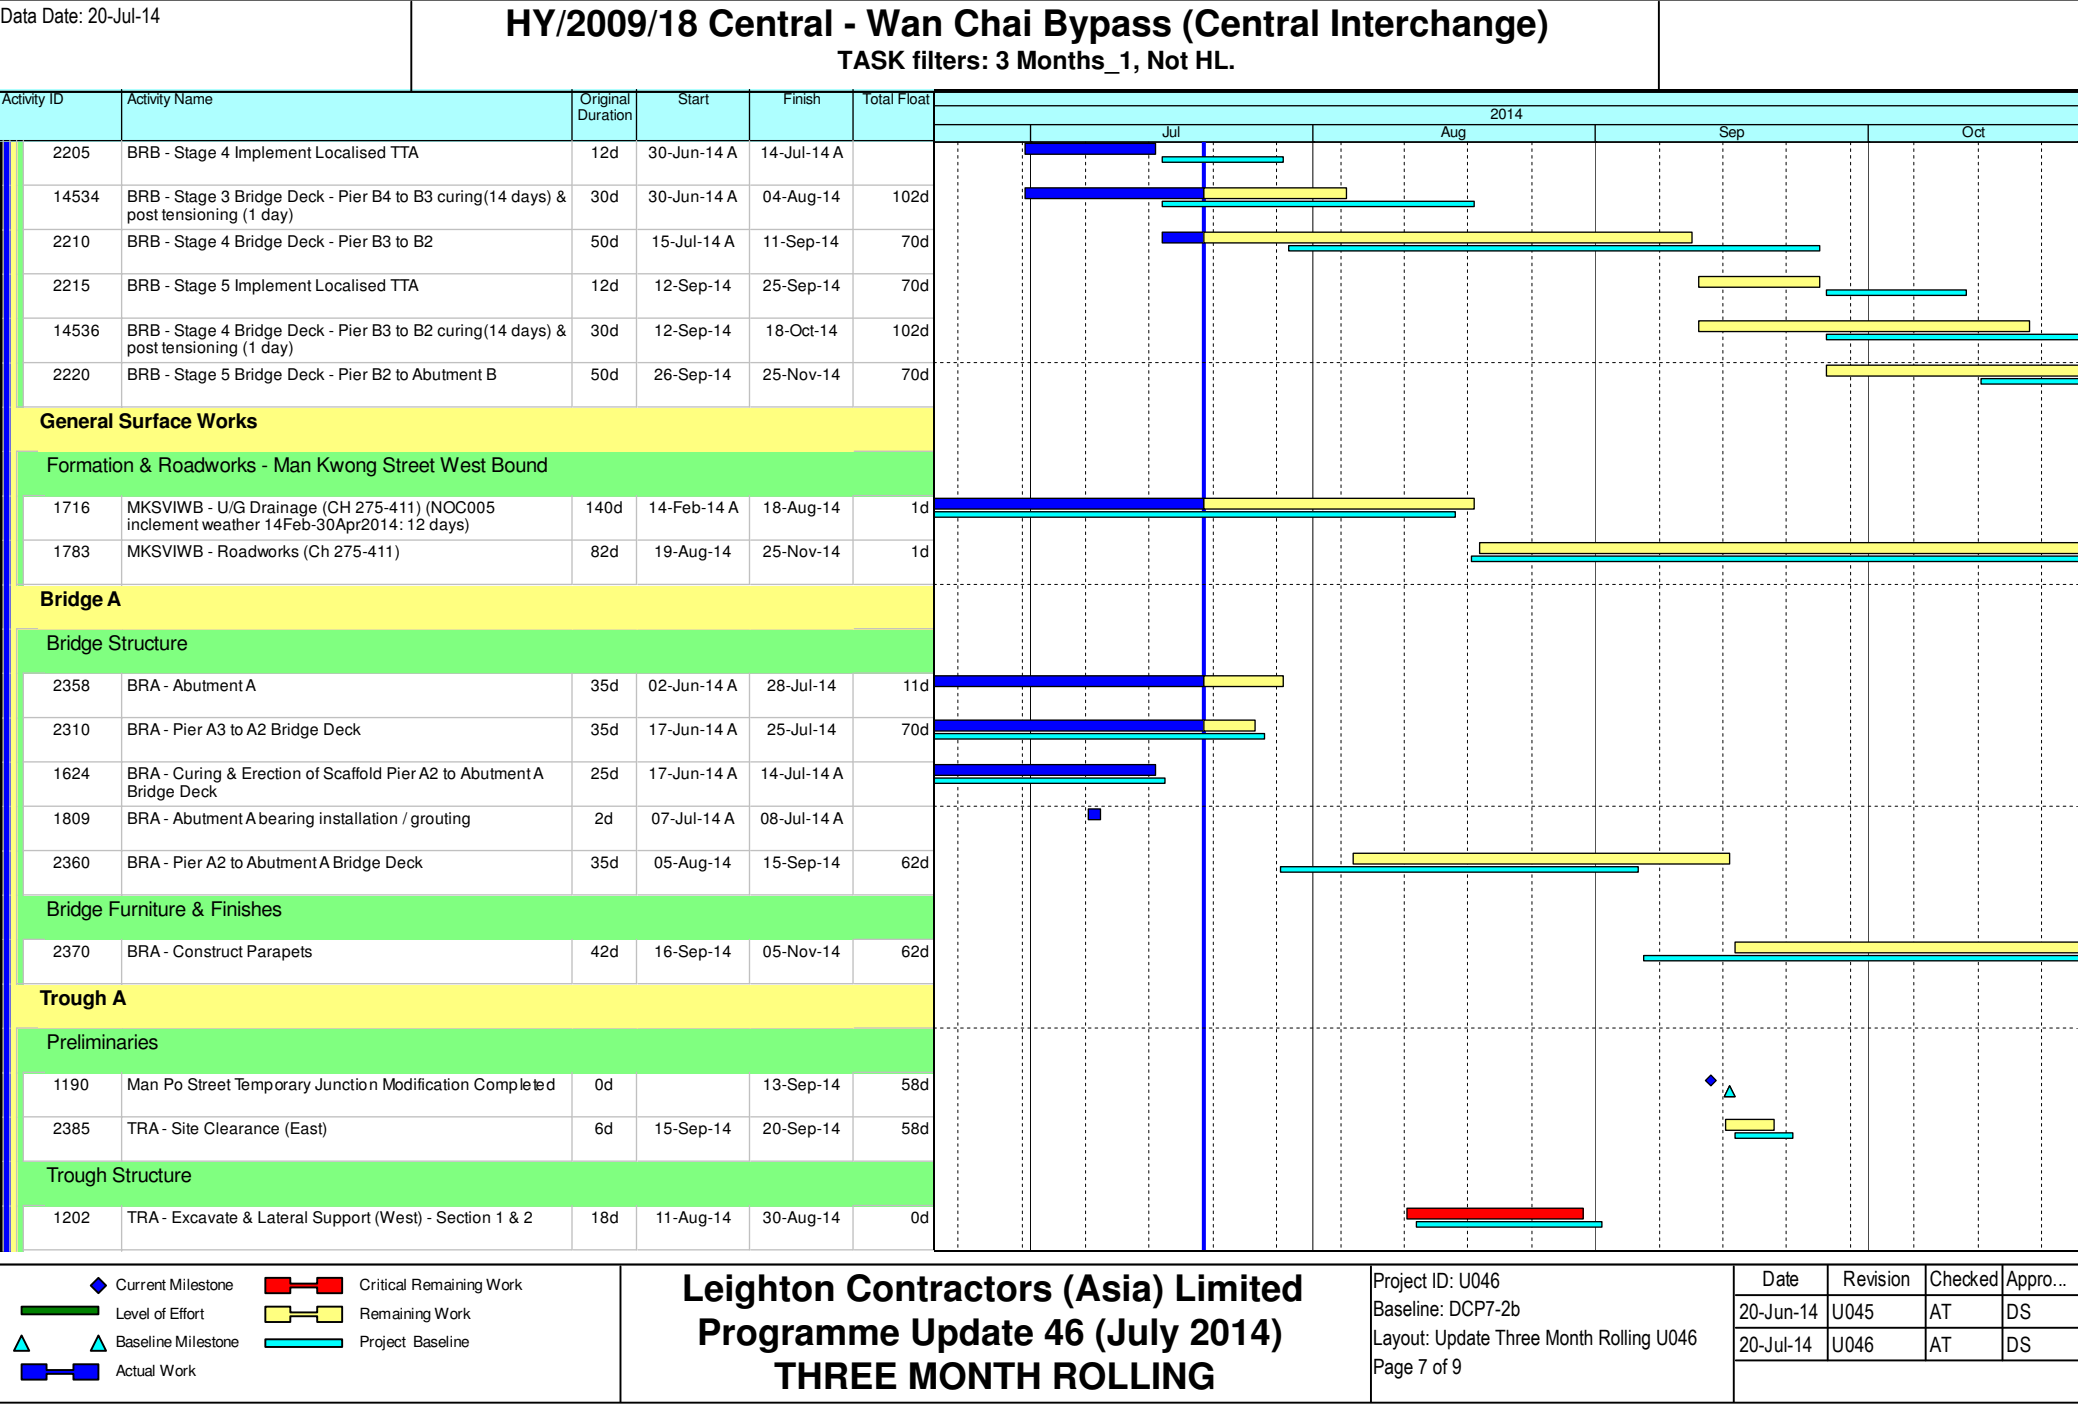

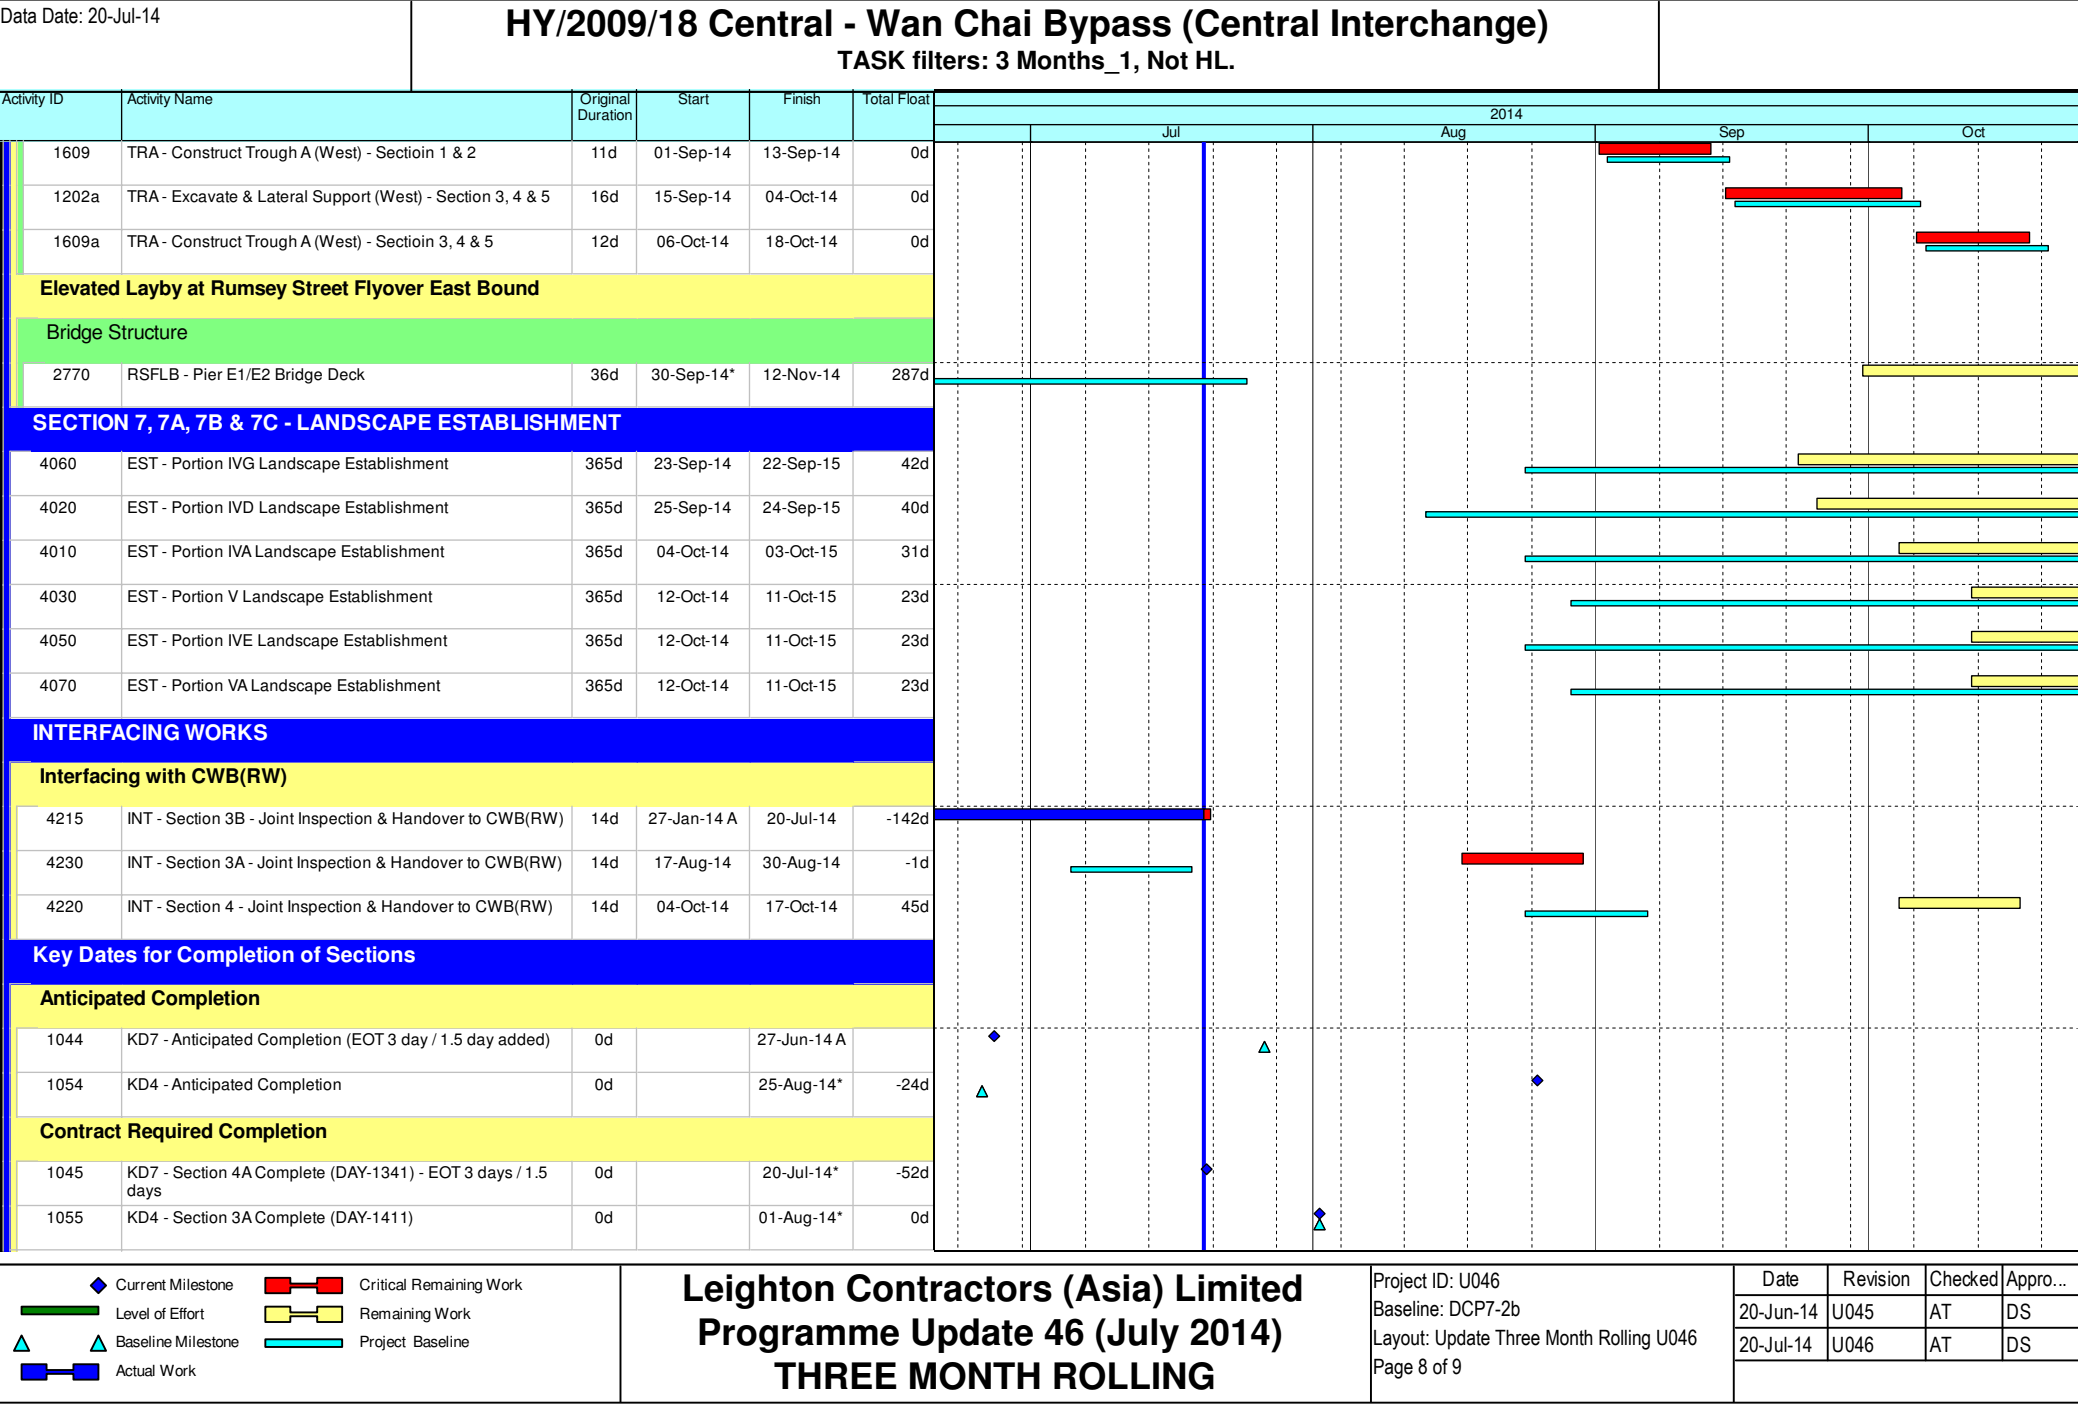

SR8_DWP_1407_Jul_14					SR8 - Layout for 3MRP_201407					Appendix C.5							
Activity ID		Activity Name		Original Duration	Start	Finish	2014										
							Jul		Aug		Sep		Oct		Nov		
HY/2010/08: CWB-SR8 Three Months Rolling Programme_updated up to 20140720																	
Works in TS3																	
TS3 East & West Reclamation Works																	
TS3E - Reclamation (Advance Works)																	
TS3E.MW.1150	C15 - Move TS3(E) vessels (Phase III Mooring)	45	02-Jul-14 A	15-Aug-14	C15 - Move TS3(E) vessels (Phase III Mooring)												
TS3E.MW.1110A	TS3E South - Water Intake Diversion	18	04-Sep-14	25-Sep-14	TS3E South - Water Intake Diversion												
TS3E.MW.1180	TS3 East - Handover to D-wall	0		19-Oct-14	TS3 East - Handover to D-wall												
TS3E.MW.1160	TS3 East - General Fill (Stage 1)	24	26-Sep-14	19-Oct-14	TS3 East - General Fill (Stage 1)												
TS3E.MW.1170	TS3 East - General Fill (Stage 2)	26	20-Oct-14	18-Nov-14													
TS3E - South																	
TS3E.MW.1085A	TS3E South - Dredging Works (Type 1 & 2) Before Removal of all Vessels	4	20-Jul-14	23-Jul-14	TS3E South - Dredging Works (Type 1 & 2) Before Removal of all Vessels												
TS3E.MW.1085	Remove All Vessels at Southern Portion	0		24-Jul-14*	Remove All Vessels at Southern Portion												
TS3E.MW.1080	TS3E South - Dredging Works (Type 3)	20	06-Jun-14 A	26-Jul-14	TS3E South - Dredging Works (Type 3)												
TS3E.MW.1080A	TS3E South - Dredging Works (Type 3) - HIS	1	27-Jul-14	27-Jul-14	TS3E South - Dredging Works (Type 3) - HIS												
TS3E.MW.1085E	TS3E South - Dredging Works (Type 1 & 2) after Removal of all Vessels	28	24-Jul-14	20-Aug-14	TS3E South - Dredging Works (Type 1 & 2) after Removal of all Vessels												
TS3E.MW.1085C	TS3E South - Dredging Works (Type 1 & 2) - HIS	1	21-Aug-14	21-Aug-14	TS3E South - Dredging Works (Type 1 & 2) - HIS												
TS3E.MW.1086	Inspection of Founding	1	22-Aug-14	22-Aug-14	Inspection of Founding												
TS3E.MW.1090	TS3E South - Rockfill	20	13-Aug-14	01-Sep-14	TS3E South - Rockfill												
TS3E.MW.1090A	TS3E South - Levelling of Rock Fill	4	02-Sep-14	05-Sep-14	TS3E South - Levelling of Rock Fill												
TS3E.MW.1100	TS3E South - Seawall Block Installation	25	06-Sep-14	30-Sep-14	TS3E South - Seawall Block Installation												
TS3E - North (Remaining)																	
TS3E.MW.N.100	Rockfill & Levelling - Phase 1	10	20-Jul-14	29-Jul-14	Rockfill & Levelling - Phase 1												
TS3E.MW.N.101	Rockfill & Levelling - Phase 2	8	02-Sep-14	09-Sep-14	Rockfill & Levelling - Phase 2												
TS3E.MW.N.102	Levelling (TS3E North)	4	10-Sep-14	13-Sep-14	Levelling (TS3E North)												
TS3E.MW.N.104	TS3E North to Bay 14 - Seawall Block Installation	25	14-Sep-14	08-Oct-14	TS3E North to Bay 14 - Seawall Block Installation												
Works in SR8 (Open Cut Method)																	
SR8 - Cofferdam & Cut & Cover Tunnel Works																	
SR8 East Bound - (Seaside to Victoria Road / IEC Central Divider)																	
TTA Stage 0 - East Bound																	
Stage 1B - East Bound (Seaside) (Ref. DRG. No.CDD/SR8/082)																	
SR8.EB.1230	Carry-out Stage 1B Pipe Piling works	24	21-May-14 A	28-Jul-14	Carry-out Stage 1B Pipe Piling works												
SR8.EB.1250	Install King Post for Traffic Deck (3 nos.)	16	28-Jul-14	15-Aug-14	Install King Post for Traffic Deck (3 nos.)												
SR8.EB.1255	Carry-out Stage 1B TAM Grout + Jet Grouting (12nos)	22	28-Jul-14	22-Aug-14	Carry-out Stage 1B TAM Grout + Jet Grouting (12nos)												
SR8.EB.1260	Construct Traffic Deck and Temporary Road	18	15-Aug-14	05-Sep-14	Construct Traffic Deck and Temporary Road												
SR8.EB.1270	Install Temporary Traffic Directional Signs for TTA Stage 1	1	04-Sep-14	05-Sep-14	Install Temporary Traffic Directional Signs for TTA Stage 1												
TTA Stage 1 - East Bound																	
Stage 2 - East Bound (Ref. DRG. No.CDD/SR8/083)																	
SR8.EB.1310	Implement TTA Stage 1 - Traffic Diversion at East Bound (DRG Ref. 4843/011/021E)	0	07-Sep-14		Implement TTA Stage 1 - Traffic Diversion at East Bound (DRG Ref. 4843/011/021E)												
SR8.EB.1315	Excavate Trench and Expose underground utilities (Carriage way)	6	08-Sep-14	15-Sep-14	Excavate Trench and Expose underground utilities (Carriage way)												
SR8.EB.1320	Divert Gas Main to pre-laid Gas Main Pipe at Planter Area Gas Main Trough	18	16-Sep-14	08-Oct-14	Divert Gas Main to pre-laid Gas Main Pipe at Planter Area Gas Main Trough												
SR8.EB.1325	Protect and Shift HV 22kv Cable on carriage way (as required)	18	16-Sep-14	08-Oct-14	Protect and Shift HV 22kv Cable on carriage way (as required)												
SR8.EB.1327	Cut and By pass Drainage to the next (existing) collection point (MH)	18	16-Sep-14	08-Oct-14	Cut and By pass Drainage to the next (existing) collection point (MH)												
SR8.EB.1330	Carry out pre-boring work for stage 2 sheet pile	14	09-Oct-14	24-Oct-14	Carry out pre-boring work for stage 2 sheet pile												
SR8.EB.1340	Stage 2 - Sheet Pile Work	18	18-Oct-14	07-Nov-14													
SR8 West Bound - Ch. 369.000 to 495.000 (Victoria Road / IEC Central Divider)																	
TTA Stage 1 - West Bound																	
Stage 2A - West Bound (Ref. DRG. No.CDD/SR8/086)																	
SR8.WB.2020	Carry out Stage 2A Sheet Pile Work	17	07-Jul-14 A	31-Jul-14	Carry out Stage 2A Sheet Pile Work												
SR8.WB.2130	Pre-treatment Grouting	10	10-Jul-14 A	31-Jul-14	Pre-treatment Grouting												
SR8.WB.2030	Carry out Stage 2A Pipe Piling Work	42	01-Aug-14	19-Sep-14	Carry out Stage 2A Pipe Piling Work												
SR8.WB.2050	Trim Down Sheet Pile / Pipe Pile and construct Gas Main Trough	8	20-Sep-14	29-Sep-14	Trim Down Sheet Pile / Pipe Pile and construct Gas Main Trough												
SR8.WB.2040	Carry out Stage 2A TAM Grout	11	20-Sep-14	04-Oct-14	Carry out Stage 2A TAM Grout												
SR8.WB.2060	Divert Gas Main to Gas Main Trough	6	30-Sep-14	08-Oct-14	Divert Gas Main to Gas Main Trough												
 中國建築工程(香港)有限公司 CHINA STATE CONSTRUCTION ENGRG. (HONG KONG) LTD.		 Actual Work		Page 1 of 2 Contract No. HY/2010/08: Central - Wanchai Bypass Tunnel +(Slip Road 8 Section) - 3 Months Rolling Progamme										Date	Revision	Checked	Approved
		 Remaining Work												20-Jul-14	Updated to 20th July 2014	DML/WC	
		 Critical Remaining Work															
		 Milestone															

Activity ID	Activity Name	Original Duration	Start	Finish	2014											
					Jul			Aug			Sep			Oct		
SR8.WB.2140	Pipe Tesing	6	09-Oct-14	15-Oct-14												
Stage 2B - West Bound (Ref. DRG. No.CDD/SR8/086)																
SR8.WB.2070	Carry out Stage 2B Sheet Pile	4	16-Oct-14	20-Oct-14												
SR8.WB.2080	Carry out Stage 2B Pipe Piling	9	21-Oct-14	30-Oct-14												
SR8 Ch.369.000 to Ch.317.500 - (Inside Victoria Park to Tunnel Portal)																
Stage 4 - SR8 Ch.369.000 to Ch317.500 (Tunnel Portal) (Ref. DRG. No.CDD/SR8/087)																
SR8.VP.4010	Carry Out Stage 4 Sheet Pile Works	90	13-Mar-14 A	07-Aug-14												
SR8.VP.4020	Carry Out Stage 4 Pipe Piling Works	145	08-Aug-14	30-Jan-15												
SR8 Ch 317.500 to Ch 210.000 - U-Structure & Slab (Victoria Park)																
Excavation and Lateral Support																
SR8_2230	ELS - Excavation to formation level + Lateral Support	96	13-Jun-14 A	16-Mar-15												
Tsing Fung St - RW & Subway Extension & Toe Wall at Hing Fat St																
Ret. Wall & TF Subway Extension (Portion V)																
Retaining Wall at Tsing Fung Street (Portion V)																
VP_1235	TFS New Ret. Wall -sheet pile (400 m2)	12	19-Jun-14 A	26-Jul-14												
VP_1240	TFS New Ret. Wall - excavation	42	28-Jul-14	15-Sep-14												
VP_1260	TFS New Ret. Wall - base slab	42	20-Aug-14	10-Oct-14												
VP_1290	TFS New Ret. Wall - wall stem + Railing	60	11-Oct-14	19-Dec-14												
Retaining Wall + Toe Wall at Hing Fat Street																
Tree Transplanting at Portion VIII (Tree Zone 20) (6 trees)																
VP_1130	Site Possession Portion VIII (486d) (Slope along Hing fat St)	0	21-Jul-14													
VP_1700	Preparation and Site Hoarding	36	21-Jul-14	30-Aug-14												
VP_1140.01	Transplanting <300mm dia trees (3months, 4nos) - Stage 1 root pruning	25	01-Sep-14	30-Sep-14												
VP_1140.02	Transplanting <300mm dia trees (3months, 4nos) - Stage 2 root pruning	25	03-Oct-14	31-Oct-14												
Works in Victoria Park																
Re-Provisioning Works																
Bowling Green Office																
BGO - Construction Works																
VP_1180.01	BGO - Base Slab	24	29-Apr-14 A	26-Jul-14												
VP_1180.03	BGO - Roof Slab + Plinths + Parapet	7	22-Jul-14	29-Jul-14												
VP_1180.02	BGO - Walls	7	28-Jul-14	04-Aug-14												
VP_1180.04	BGO - Roof Slab Waterproofing + Screeding	12	30-Jul-14	12-Aug-14												
VP_1190	BGO - ABWF	52	11-Aug-14	13-Oct-14												
VP_1220	BGO - E&M Works	28	12-Sep-14	16-Oct-14												
VP_1250	BGO - T&C	4	17-Oct-14	21-Oct-14												
VP_1260.10	Submit Form 501 to FSD (Application for Inspection)	1	22-Oct-14	22-Oct-14												
VP_1250.40	Statutory Inspections by Other Authorities (EMSD, WSD, ASD)	55	22-Oct-14	24-Dec-14												
VP_1260.20	FSD Inspection & Certification	55	23-Oct-14	27-Dec-14												
Tree Transplanting at Portion XIV (Victoria Park Open Space)																
VP_1040	Tree Transplanting & Upkeep at Portion XIV	348	16-Oct-13 A	15-Dec-14												
Mooring Components Upkeep (CBTS and ATS)																
MAR_1000	Mooring Upkeep at Portion III (3) - CBTS	574	15-May-14 A	09-Dec-15												
MAR_2000	Mooring Upkeep at Portion XIX(19) & XX(20) - ATS (if instructed by Engineer)	1399	21-Mar-13 A	17-Jan-17												
MAR_3020	Mooring Upkeep at Portion X(10) & XVI(16) - CBTS	979	15-May-14 A	17-Jan-17												
Works for Public Works Regional Laboratory (North Lantau)																
Maintenance and Upkeep of New PWRL (Portion XVII)																
PWRL_1050	Maintenance/ Upkeep of New PWRL	1301	19-Jul-13 A	20-Nov-17												

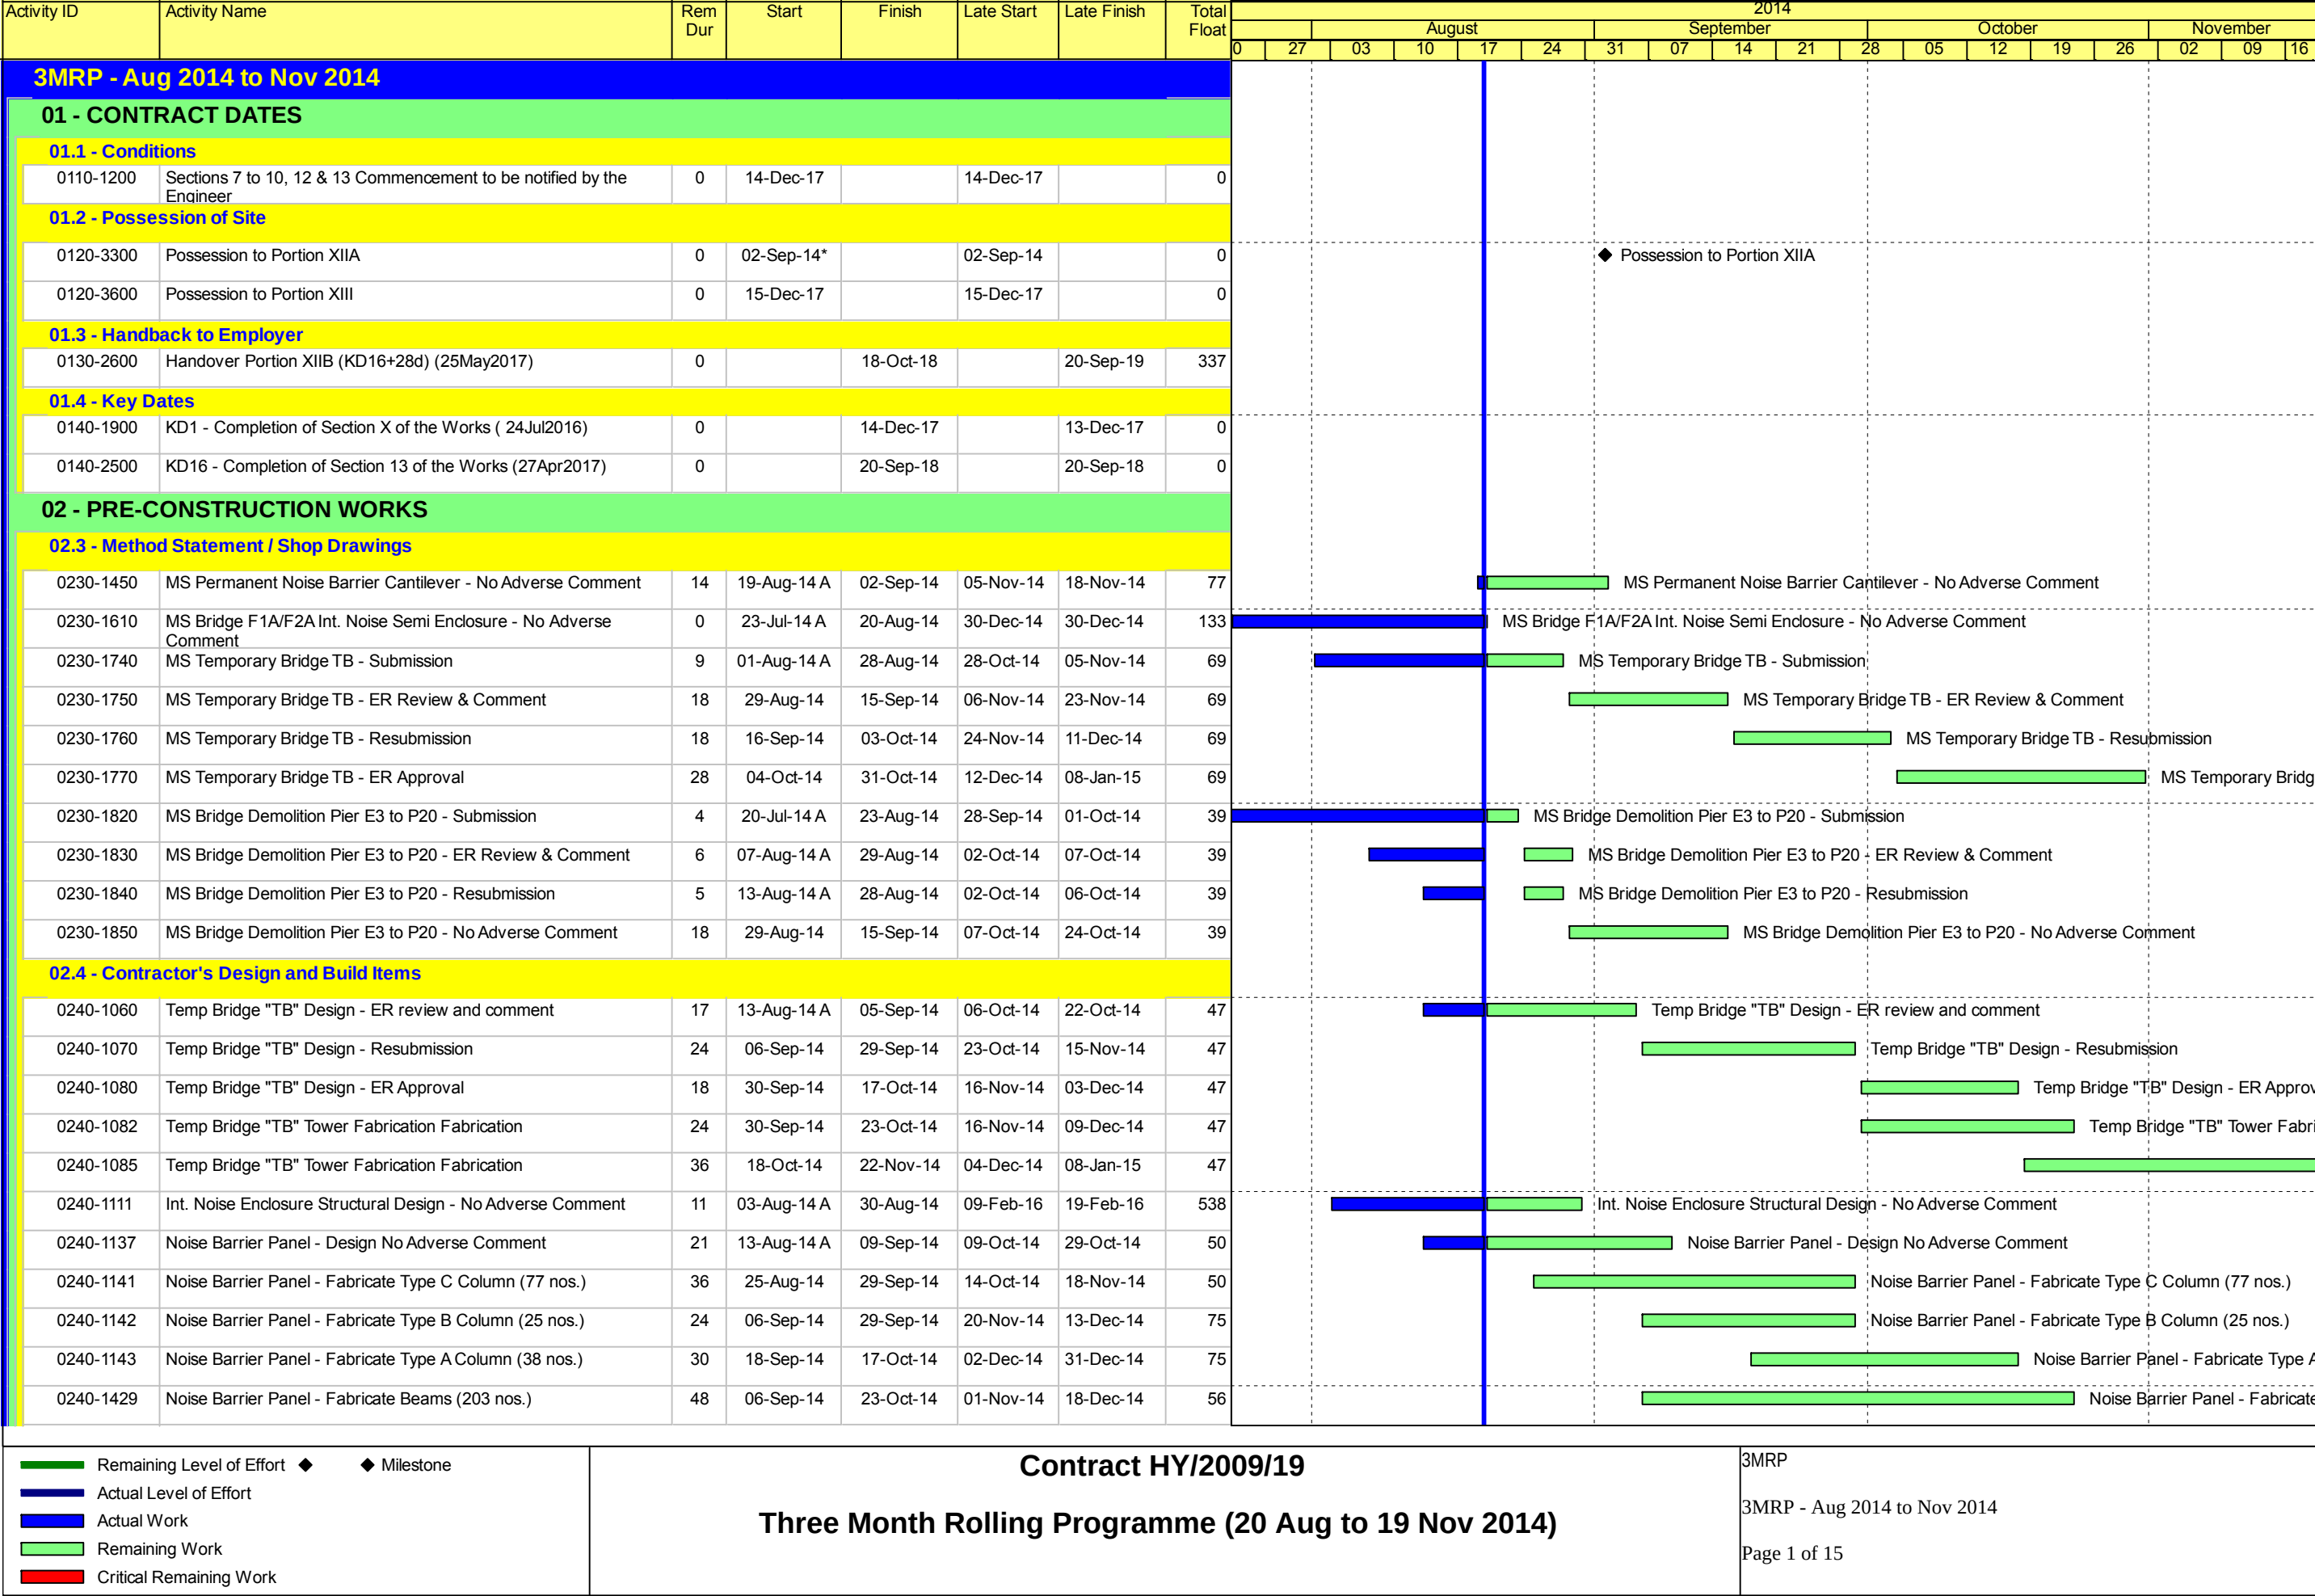

Activity ID		Activity Name	Rem Dur	Start	Finish	Late Start	Late Finish	Total Float	2014																		
									August					September				October				November					
									0	27	03	10	17	24	31	07	14	21	28	05	12	19	26	02	09	16	
02.5 - Bridge Segment/Beam Off-site Precasting																											
0250-1720.11	Precast Beam Bridge C1 1718-C	2	25-Jul-14 A	21-Aug-14	25-Aug-14	27-Aug-14		5	Precast Beam Bridge C1 1718-C																		
0250-1720.12	Precast Beam Bridge C1 1718-D	18	22-Aug-14	08-Sep-14	27-Aug-14	14-Sep-14		5	Precast Beam Bridge C1 1718-D																		
0250-1720.13	Precast Beam Bridge C1 1819-E	18	09-Sep-14	26-Sep-14	14-Sep-14	02-Oct-14		5	Precast Beam Bridge C1 1819-E																		
0250-1720.14	Precast Beam Bridge C1 1819-F	18	27-Sep-14	14-Oct-14	02-Oct-14	20-Oct-14		5	Precast Beam Bridge C1 1819-F																		
0250-1720.15	Precast Beam Bridge C1 1920-A	19	15-Oct-14	02-Nov-14	20-Oct-14	07-Nov-14		5	Precast Beam Bridge C1 1920-A																		
0250-1720.16	Precast Beam Bridge C1 1920-B	18	02-Nov-14	20-Nov-14	08-Nov-14	25-Nov-14		5	Precast Beam Bridge C1 1920-B																		
0250-1720.18	Precast Beam Bridge C1 2021-B	18	27-Sep-14	14-Oct-14	03-Oct-14	20-Oct-14		6	Precast Beam Bridge C1 2021-B																		
0250-1720.19	Precast Beam Bridge C1 2021-C	18	15-Oct-14	01-Nov-14	21-Oct-14	07-Nov-14		6	Precast Beam Bridge C1 2021-C																		
0250-1720.20	Precast Beam Bridge C1 2122-A	18	02-Nov-14	19-Nov-14	08-Nov-14	25-Nov-14		6	Precast Beam Bridge C1 2122-A																		
0250-1720.22	Precast Beam Bridge C1 2122-C	18	27-Sep-14	14-Oct-14	03-Oct-14	20-Oct-14		6	Precast Beam Bridge C1 2122-C																		
0250-1720.23	Precast Beam Bridge C1 2122-D	18	15-Oct-14	01-Nov-14	21-Oct-14	07-Nov-14		6	Precast Beam Bridge C1 2122-D																		
0250-1720.25	Precast Beam Bridge C1 2122-E	18	02-Nov-14	19-Nov-14	08-Nov-14	25-Nov-14		6	Precast Beam Bridge C1 2122-E																		
0250-1980	Bridg C5 Abut D12 E-span Segment Off-site Casting (6 nos.)	9	10-Aug-14 A	29-Aug-14	31-Jan-15	09-Feb-15		165	Bridg C5 Abut D12 E-span Segment Off-site Casting (6 nos.)																		
0250-1990	Bridg C3 Pier 27 T-span Segment Off-site Casting (11 nos.)	27	20-Sep-14	16-Oct-14	09-Mar-15	04-Apr-15		170	Bridg C3 Pier 27 T-span Segment Off-site Casting (11 nos.)																		
0250-2000	Bridg C3 Pier 26 T-span Segment Off-site Casting (13 nos.)	31	09-Aug-14 A	19-Sep-14	06-Feb-15	08-Mar-15		170	Bridg C3 Pier 26 T-span Segment Off-site Casting (13 nos.)																		
0250-2010	Bridg C3 Pier 28 End-span Segment Off-site Casting (6 nos.)	19	29-Aug-14	17-Sep-14	10-Feb-15	28-Feb-15		165	Bridg C3 Pier 28 End-span Segment Off-site Casting (6 nos.)																		
0250-2020	Bridg C3 Pier 25 End-span Segment Off-site Casting (5 nos.)	16	17-Sep-14	03-Oct-14	01-Mar-15	16-Mar-15		165	Bridg C3 Pier 25 End-span Segment Off-site Casting (5 nos.)																		
0250-2030	Bridg C2 Pier 24 T-span Segment Off-site Casting (11 nos.)	27	25-Sep-14	22-Oct-14	09-Mar-15	04-Apr-15		165	Bridg C2 Pier 24 T-span Segment Off-site Casting (11 nos.)																		
0250-2040	Bridg C2 Pier 23 T-span Segment Off-site Casting (13 nos.)	31	22-Oct-14	22-Nov-14	05-Apr-15	05-May-15		165	Bridg C2 Pier 23 T-span Segment Off-site Casting (13 nos.)																		
0250-2050	Bridg C2 Pier 25 End-span Segment Off-site Casting (6 nos.)	19	03-Oct-14	22-Oct-14	17-Mar-15	04-Apr-15		165	Bridg C2 Pier 25 End-span Segment Off-site Casting (6 nos.)																		
0250-2060	Bridg C2 Pier 22 End-span Segment Off-site Casting (5 nos.)	16	22-Oct-14	07-Nov-14	20-Apr-15	05-May-15		180	Bridg C2 Pier 22 End-span Segment Off-site Casting (5 nos.)																		
0250-2090	Bridg F1C Abut D12 End-span Segment Off-site Casting (7 nos.)	22	07-Nov-14	29-Nov-14	15-May-15	05-Jun-15		189	Bridg F1C Abut D12 End-span Segment Off-site Casting (7 nos.)																		
03 - PRELIMINARY WORKS																											
03.3 - Interface Works																											
0330-1350	Erect Special Hoarding at Portion IV and V	36	03-Oct-14*	13-Nov-14	21-Aug-15	05-Oct-15		266	Erect Special Hoarding at Portion IV and V																		
05 - SECTION 2 & 2A OF THE WORKS																											
05.1 - Cut & Cover Tunnel Ch 4855-4932 (APS Footprint)																											
05.1.2 - ELS																											
0512-1179	Lower Water Level to -21.0mPD (Pump Test)	0	20-Jul-14 A	28-Jul-14 A	20-Aug-14	20-Aug-14			Lower Water Level to -21.0mPD (Pump Test)																		
0512-1182	Lev 7A (-20.0mPD) S1-S3 Excav (5544m3)	0	24-Jul-14 A	06-Aug-14 A	20-Aug-14	20-Aug-14			Lev 7A (-20.0mPD) S1-S3 Excav (5544m3)																		
0512-1187.1	Lev 7A (-20.0mPD) S1-S3 ELS (8 nos)	0	26-Jul-14 A	12-Aug-14 A	20-Aug-14	20-Aug-14			Lev 7A (-20.0mPD) S1-S3 ELS (8 nos)																		
0512-1189.1	Lower Water Level to -29.5mPD (Pump Test)	0	28-Jul-14 A	19-Aug-14 A	20-Aug-14	20-Aug-14			Lower Water Level to -29.5mPD (Pump Test)																		
0512-1200.1	Lev 8 (-28.5mPD) Excav + Blinding (ZONE B)	3	15-Jul-14 A	23-Aug-14	21-Aug-14	24-Aug-14		2	Lev 8 (-28.5mPD) Excav + Blinding (ZONE B)																		
0512-1200.2	Lev 8 (-28.5mPD) Excav + Blinding (ZONE A)	9	13-Aug-14 A	28-Aug-14	20-Aug-14	28-Aug-14		0	Lev 8 (-28.5mPD) Excav + Blinding (ZONE A)																		

Remaining Level of Effort

Actual Level of Effort

Actual Work

Remaining Work

Critical Remaining Work

◆

Milestone


Contract HY/2009/19

Three Month Rolling Programme (20 Aug to 19 Nov 2014)

3MRP

3MRP - Aug 2014 to Nov 2014

Page 2 of 15

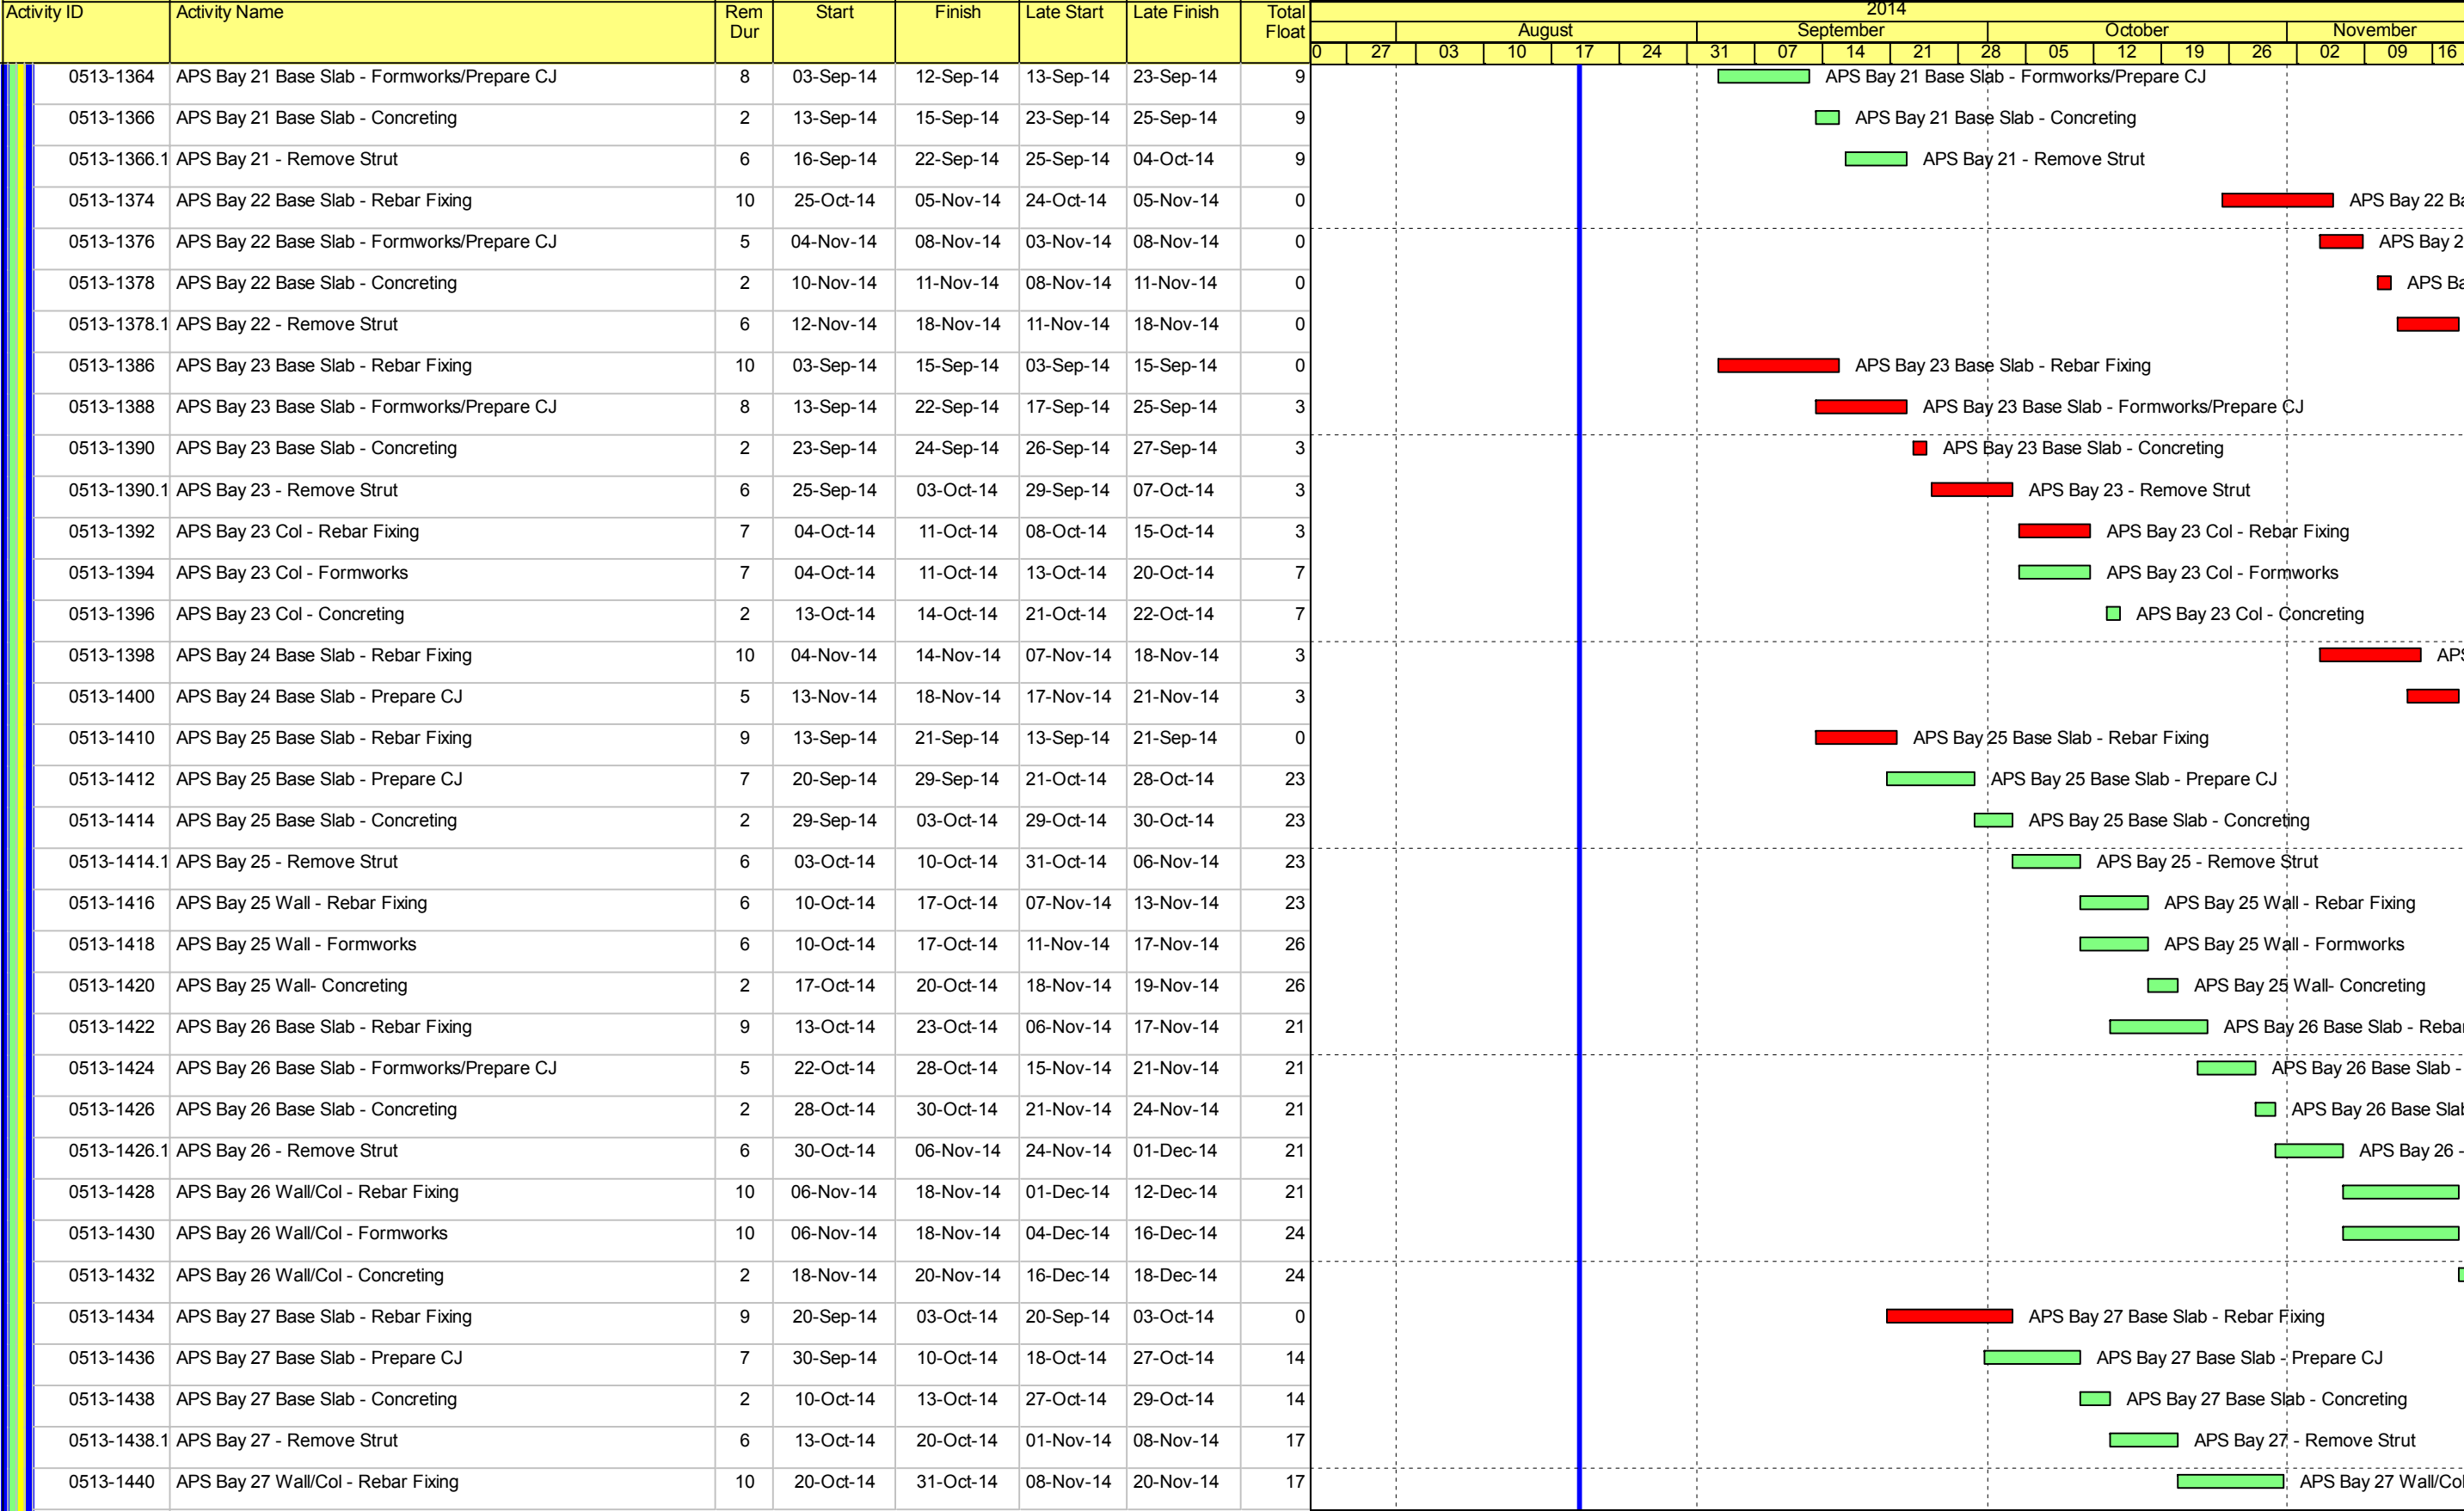

- Remaining Level of Effort
- Actual Level of Effort
- Actual Work
- Remaining Work
- Critical Remaining Work
- Milestone

Contract HY/2009/19

Three Month Rolling Programme (20 Aug to 19 Nov 2014)

3MRP

3MRP - Aug 2014 to Nov 2014

Page 4 of 15

Activity ID		Activity Name	Rem Dur	Start	Finish	Late Start	Late Finish	Total Float	2014																								
									August						September						October						November						
									0	27	03	10	17	24	31	07	14	21	28	05	12	19	26	02	09	16							
	0513-1442	APS Bay 27 Wall/Col - Formworks	10	20-Oct-14	31-Oct-14	12-Nov-14	24-Nov-14	20																									
	0513-1444	APS Bay 27 Wall/Col - Concreting	2	31-Oct-14	03-Nov-14	24-Nov-14	26-Nov-14	20																									
	0513-1445	APS Bay 28 Base Slab - Rebar Fixing	9	22-Oct-14	01-Nov-14	29-Oct-14	08-Nov-14	6																									
	0513-1446	APS Bay 28 Base Slab - Formworks/Prepare CJ	5	31-Oct-14	06-Nov-14	07-Nov-14	13-Nov-14	6																									
	0513-1447	APS Bay 28 Base Slab - Concreting	2	06-Nov-14	08-Nov-14	13-Nov-14	15-Nov-14	6																									
	0513-1448	APS Bay 28 - Remove Strut	6	08-Nov-14	15-Nov-14	15-Nov-14	22-Nov-14	6																									
	0513-1449	APS Bay 28 Wall - Rebar Fixing	6	15-Nov-14	22-Nov-14	22-Nov-14	29-Nov-14	6																									
	0513-1450	APS Bay 28 Wall - Formworks	6	15-Nov-14	22-Nov-14	22-Nov-14	29-Nov-14	6																									
	0513-1451	APS Bay 29 Base Slab - Rebar Fixing	9	30-Sep-14	13-Oct-14	30-Sep-14	13-Oct-14	0																									
	0513-1452	APS Bay 29 Base Slab - Formworks/Prepare CJ	7	11-Oct-14	20-Oct-14	11-Oct-14	20-Oct-14	0																									
	0513-1453	APS Bay 29 Base Slab - Concreting	2	20-Oct-14	22-Oct-14	20-Oct-14	22-Oct-14	0																									
	0513-1454	APS Bay 29 - Remove Strut	6	22-Oct-14	29-Oct-14	25-Oct-14	01-Nov-14	3																									
	0513-1455	APS Bay 29 Wall/Col - Rebar Fixing	10	29-Oct-14	10-Nov-14	01-Nov-14	13-Nov-14	3																									
	0513-1456	APS Bay 29 Wall/Col - Formworks	10	29-Oct-14	10-Nov-14	01-Nov-14	13-Nov-14	3																									
	0513-1457	APS Bay 29 Wall/Col - Concreting	2	10-Nov-14	12-Nov-14	13-Nov-14	15-Nov-14	3																									
	0513-1458	APS Bay 30 Base Slab - Rebar Fixing	9	22-Oct-14	01-Nov-14	22-Oct-14	01-Nov-14	0																									
	0513-1459	APS Bay 30 Base Slab - Prepare CJ	5	31-Oct-14	06-Nov-14	31-Oct-14	06-Nov-14	0																									
	0513-1460	APS Bay 30 Base Slab - Concreting	2	06-Nov-14	08-Nov-14	06-Nov-14	08-Nov-14	0																									
	0513-1461	APS Bay 30 - Remove Strut	6	08-Nov-14	15-Nov-14	08-Nov-14	15-Nov-14	0																									
	0513-1462	APS Bay 30 Wall - Rebar Fixing	6	15-Nov-14	22-Nov-14	15-Nov-14	22-Nov-14	0																									
	0513-1463	APS Bay 30 Wall - Formworks	6	15-Nov-14	22-Nov-14	19-Nov-14	26-Nov-14	3																									
	0513-1464	APS Bay 31 Base Slab - Rebar Fixing	8	31-Aug-14	07-Sep-14	03-Oct-14	10-Oct-14	33																									
	0513-1465	APS Bay 31 Base Slab - Prepare CJ	8	08-Sep-14	17-Sep-14	10-Oct-14	20-Oct-14	26																									
	0513-1466	APS Bay 31 Base Slab - Concreting	2	18-Sep-14	19-Sep-14	20-Oct-14	22-Oct-14	26																									
	0513-1467	APS Bay 31 - Remove Strut	6	20-Sep-14	26-Sep-14	25-Oct-14	01-Nov-14	29																									
	0513-1468	APS Bay 31 Wall/Col - Rebar Fixing	8	27-Sep-14	08-Oct-14	01-Nov-14	11-Nov-14	29																									
	0513-1469	APS Bay 31 Wall/Col - Formworks	8	27-Sep-14	08-Oct-14	01-Nov-14	11-Nov-14	29																									
	0513-1470	APS Bay 31 Wall/Col- Concreting	2	09-Oct-14	10-Oct-14	11-Nov-14	13-Nov-14	29																									
	05.1.4 - Tunnel Structure																																
	0514-1446	Tunnel Bay 14 Base Slab - Rebar Fixing	9	21-Oct-14	30-Oct-14	06-Dec-14	17-Dec-14	41																									
0514-1448	Tunnel Bay 14 Base Slab - Prepare CJ	6	28-Oct-14	03-Nov-14	13-Dec-14	20-Dec-14	41																										
0514-1482	Tunnel Bay 14 Base Slab - Concreting	2	04-Nov-14	05-Nov-14	20-Dec-14	23-Dec-14	41																										
0514-1483	Tunnel Bay 14 Centre Wall - Remove Strut	6	06-Nov-14	12-Nov-14	23-Dec-14	31-Dec-14	41																										
0514-1484	Tunnel Bay 14 Centre Wall - Rebar Fixing	8	13-Nov-14	21-Nov-14	31-Dec-14	10-Jan-15	41																										
0514-1502	Tunnel Bay 15 Base Slab - Rebar Fixing	9	25-Sep-14	07-Oct-14	27-Sep-14	09-Oct-14	2																										

Remaining Level of Effort

 Milestone

Actual Level of Effort

Actual Work

Remaining Work

Critical Remaining Work

Contract HY/2009/19

Three Month Rolling Programme (20 Aug to 19 Nov 2014)

3MRP

3MRP - Aug 2014 to Nov 2014

Page 5 of 15

Activity ID	Activity Name	Rem Dur	Start	Finish	Late Start	Late Finish	Total Float	2014																	
								August						September						October					
								0	27	03	10	17	24	31	07	14	21	28	05	12	19	26	02	09	16
0514-1504	Tunnel Bay 15 Base Slab - Formwork/Prepare CJ	9	04-Oct-14	14-Oct-14	07-Oct-14	16-Oct-14	2																		
0514-1506	Tunnel Bay 15 Base Slab - Concreting	2	18-Oct-14	20-Oct-14	21-Oct-14	22-Oct-14	2																		
0514-1507	Tunnel Bay 15 Centre Wall - Remove Strut	6	21-Oct-14	27-Oct-14	06-Dec-14	13-Dec-14	41																		
0514-1508	Tunnel Bay 15 Centre Wall - Rebar Fixing	6	28-Oct-14	03-Nov-14	13-Dec-14	20-Dec-14	41																		
0514-1510	Tunnel Bay 15 Centre Wall - Formwork	6	04-Nov-14	10-Nov-14	20-Dec-14	29-Dec-14	41																		
0514-1512	Tunnel Bay 15 Centre Wall - Concreting	2	11-Nov-14	12-Nov-14	29-Dec-14	31-Dec-14	41																		
0514-1514	Tunnel Bay 15 OHVD - Falsework/Formwork	12	07-Nov-14	20-Nov-14	02-Jan-15	16-Jan-15	47																		
0514-1526	Tunnel Bay 16 Base Slab - Rebar Fixing	9	21-Oct-14	29-Oct-14	23-Oct-14	31-Oct-14	2																		
0514-1528	Tunnel Bay 16 Base Slab - Prepare CJ	6	27-Oct-14	01-Nov-14	28-Oct-14	04-Nov-14	2																		
0514-1530	Tunnel Bay 16 Base Slab - Concreting	2	03-Nov-14	04-Nov-14	04-Nov-14	06-Nov-14	2																		
0514-1531	Tunnel Bay 16 Centre Wall - Remove Strut	6	05-Nov-14	11-Nov-14	23-Dec-14	31-Dec-14	42																		
0514-1532	Tunnel Bay 16 Centre Wall - Rebar Fixing	6	13-Nov-14	19-Nov-14	31-Dec-14	08-Jan-15	41																		
0514-1550	Tunnel Bay 17 Base Slab - Falsework/Formwork	8	20-Oct-14	28-Oct-14	28-Oct-14	06-Nov-14	8																		
0514-1552	Tunnel Bay 17 Base Slab - Rebar Fixing	10	05-Nov-14	15-Nov-14	06-Nov-14	18-Nov-14	2																		
0514-1554	Tunnel Bay 17 Base Slab - Formwork/Prepare CJ	8	14-Nov-14	22-Nov-14	15-Nov-14	25-Nov-14	2																		
0514-1575	Tunnel Bay 18 Base Slab - Falsework/Formwork	17	31-Oct-14	19-Nov-14	07-Nov-14	27-Nov-14	7																		
0514-1589	Tunnel Bay 19 Base Slab - Falsework/Formwork	8	04-Oct-14	13-Oct-14	29-Oct-14	07-Nov-14	22																		
0514-1590	Tunnel Bay 19 Base Slab - Rebar Fixing	10	14-Oct-14	24-Oct-14	07-Nov-14	19-Nov-14	22																		
0514-1591	Tunnel Bay 19 Base Slab - Formwork/Prepare CJ	8	23-Oct-14	31-Oct-14	17-Nov-14	26-Nov-14	22																		
0514-1592	Tunnel Bay 19 Base Slab - Concreting	2	03-Nov-14	04-Nov-14	27-Nov-14	29-Nov-14	22																		
0514-1593	Tunnel Bay 19 Centre Wall - Remove Strut	6	05-Nov-14	11-Nov-14	22-Dec-14	30-Dec-14	41																		
0514-1604	Tunnel Bay 20 Base Slab - Falsework/Formwork	8	18-Nov-14	26-Nov-14	28-Nov-14	08-Dec-14	10																		
0514-1632	Tunnel Bay 21 Base Slab - Falsework/Formwork	8	23-Sep-14	03-Oct-14	04-Oct-14	14-Oct-14	9																		
0514-1634	Tunnel Bay 21 Base Slab - Rebar Fixing	10	04-Oct-14	15-Oct-14	14-Oct-14	25-Oct-14	9																		
0514-1636	Tunnel Bay 21 Base Slab - Formwork/Prepare CJ	8	14-Oct-14	22-Oct-14	23-Oct-14	01-Nov-14	9																		
0514-1638	Tunnel Bay 21 Base Slab - Concreting	2	23-Oct-14	24-Oct-14	01-Nov-14	04-Nov-14	9																		
0514-1640	Tunnel Bay 21 Centre Wall - Remove Strut	6	25-Oct-14	31-Oct-14	04-Nov-14	11-Nov-14	9																		
0514-1688	Tunnel Bay 23 Base Slab - Falsework/Formwork	8	10-Oct-14	18-Oct-14	14-Oct-14	22-Oct-14	3																		
0514-1690	Tunnel Bay 23 Base Slab - Rebar Fixing	10	20-Oct-14	30-Oct-14	23-Oct-14	03-Nov-14	3																		
0514-1692	Tunnel Bay 23 Base Slab - Formwork/Prepare CJ	8	29-Oct-14	06-Nov-14	01-Nov-14	10-Nov-14	3																		
0514-1694	Tunnel Bay 23 Base Slab - Concreting	2	07-Nov-14	08-Nov-14	11-Nov-14	12-Nov-14	3																		
0514-1696	Tunnel Bay 23 Centre Wall - Remove Strut	7	10-Nov-14	17-Nov-14	26-Dec-14	03-Jan-15	39																		
0514-1744	Tunnel Bay 25 Base Slab - Falsework/Formwork	7	15-Oct-14	23-Oct-14	12-Nov-14	19-Nov-14	23																		
0514-1746	Tunnel Bay 25 Base Slab - Rebar Fixing	8	23-Oct-14	01-Nov-14	20-Nov-14	28-Nov-14	23																		
0514-1748	Tunnel Bay 25 Base Slab - Formwork/Prepare CJ	8	01-Nov-14	11-Nov-14	29-Nov-14	08-Dec-14	23																		
Remaining Level of Effort Actual Level of Effort Actual Work Remaining Work Critical Remaining Work		Contract HY/2009/19 Three Month Rolling Programme (20 Aug to 19 Nov 2014)																3MRP		3MRP - Aug 2014 to Nov 2014				Page 6 of 15	

[illegible]

[illegible]

Activity ID	Activity Name	Rem Dur	Start	Finish	Late Start	Late Finish	Total Float	2014																								
								August						September						October				November								
								0	27	03	10	17	24	31	07	14	21	28	05	12	19	26	02	09	16							
	1013-1704	Bridge D1 Parapet North D1-N01 to D1-N10 Prefab Rebar Install	0	30-Jul-14 A	11-Aug-14 A	30-Aug-14	30-Aug-14		Bridge D1 Parapet North D1-N01 to D1-N10 Prefab Rebar Install																							
	1013-1708	Bridge D1 Parapet North D1-N09 to D1-N10 - Concreting (F5)	5	18-Aug-14 A	25-Aug-14	21-Sep-14	25-Sep-14	31	Bridge D1 Parapet North D1-N09 to D1-N10 - Concreting (F5)																							
	1013-1715	Bridge D1 Deck Waterproofing	3	13-Sep-14	15-Sep-14	13-Sep-14	16-Sep-14	1	Bridge D1 Deck Waterproofing																							
	1013-1716	Bridge D1 Bitumin Paving Works	5	16-Sep-14	20-Sep-14	16-Sep-14	21-Sep-14	1	Bridge D1 Bitumin Paving Works																							
	1013-1882	Bridge D1 Road Lighting	2	04-Sep-14	05-Sep-14	25-Sep-14	27-Sep-14	18	Bridge D1 Road Lighting																							
	1013-1883	Bridge D1 Parapet Railing	2	04-Sep-14	05-Sep-14	25-Sep-14	27-Sep-14	18	Bridge D1 Parapet Railing																							
	1013-1892	Bridge D1 MJ at Pier D1 and D4	3	02-Sep-14*	04-Sep-14	12-Sep-14	16-Sep-14	9	Bridge D1 MJ at Pier D1 and D4																							
	1013-1933	Bridge D1 Parapet North D1-N01 to D1-N08 - Concreting (F3)	8	07-Aug-14 A	27-Aug-14	08-Sep-14	16-Sep-14	20	Bridge D1 Parapet North D1-N01 to D1-N08 - Concreting (F3)																							
	1013-1983	Bridge D1 Parapet South D1-S01 to D1-S06 - Concreting (F4)	7	06-Aug-14 A	26-Aug-14	19-Sep-14	25-Sep-14	30	Bridge D1 Parapet South D1-S01 to D1-S06 - Concreting (F4)																							
	Bridge F1A																															
	1013-1265	Bridge F1A Deck Waterproofing	3	08-Sep-14	11-Sep-14	13-Sep-14	16-Sep-14	5	Bridge F1A Deck Waterproofing																							
	1013-1265	Bridge F1A - Seal Deck Opening + Waterproofing Preparation	3	18-Aug-14 A	22-Aug-14	10-Sep-14	13-Sep-14	22	Bridge F1A - Seal Deck Opening + Waterproofing Preparation																							
	1013-1266	Bridge F1A Bitumin Paving Works	5	14-Sep-14	18-Sep-14	16-Sep-14	21-Sep-14	3	Bridge F1A Bitumin Paving Works																							
	1013-1866	Bridge F1A Int. Double Noise Encl. Install Columns (North)	16	16-Aug-14 A	06-Sep-14	13-Sep-14	04-Oct-14	21	Bridge F1A Int. Double Noise Encl. Install Columns (North)																							
	1013-1867	Bridge F1A Int. Double Noise Encl. Install Columns (South)	12	25-Aug-14	06-Sep-14	29-Aug-14	13-Sep-14	5	Bridge F1A Int. Double Noise Encl. Install Columns (South)																							
	1013-1868	Bridge F1A Int. Double Noise Encl. Install Beams	12	01-Sep-14	15-Sep-14	13-Sep-14	27-Sep-14	11	Bridge F1A Int. Double Noise Encl. Install Beams																							
	1013-1872	Bridge F1A Road Lighting	3	27-Aug-14	29-Aug-14	12-Sep-14	16-Sep-14	14	Bridge F1A Road Lighting																							
	1013-1873	Bridge F1A Parapet Railing	3	27-Aug-14	29-Aug-14	06-Sep-14	11-Sep-14	10	Bridge F1A Parapet Railing																							
	1013-1887	Bridge F1A MJ at Pier F3A	3	20-Aug-14*	22-Aug-14	23-Aug-14	26-Aug-14	3	Bridge F1A MJ at Pier F3A																							
	Bridge F2A																															
	1013-1374	Bridge F2A Deck Waterproofing	3	08-Sep-14	11-Sep-14	13-Sep-14	16-Sep-14	5	Bridge F2A Deck Waterproofing																							
	1013-1374	Bridge F2A - Seal Deck Opening + Waterproofing Preparation	3	18-Aug-14 A	22-Aug-14	10-Sep-14	13-Sep-14	22	Bridge F2A - Seal Deck Opening + Waterproofing Preparation																							
	1013-1375	Bridge F2A Bitumin Paving Works	5	14-Sep-14*	18-Sep-14	16-Sep-14	21-Sep-14	3	Bridge F2A Bitumin Paving Works																							
	1013-1376	Bridge F2A Int. Double Noise Encl. Install Columns (North)	0	02-Jul-14 A	15-Aug-14 A	29-Aug-14	29-Aug-14		Bridge F2A Int. Double Noise Encl. Install Columns (North)																							
	1013-1377	Bridge F2A Int. Double Noise Encl. Install Columns (South)	4	07-Jul-14 A	23-Aug-14	25-Aug-14	29-Aug-14	5	Bridge F2A Int. Double Noise Encl. Install Columns (South)																							
	1013-1378	Bridge F2A Int. Double Noise Encl. Install Beams	5	29-Jul-14 A	25-Aug-14	01-Sep-14	06-Sep-14	11	Bridge F2A Int. Double Noise Encl. Install Beams																							
	1013-1874	Bridge F2A Road Lighting	2	25-Aug-14	26-Aug-14	16-Sep-14	17-Sep-14	18	Bridge F2A Road Lighting																							
	1013-1875	Bridge F2A Parapet Railing	2	25-Aug-14*	26-Aug-14	04-Sep-14	06-Sep-14	10	Bridge F2A Parapet Railing																							
	1013-1888	Bridge F2A MJ at Pier F5	6	01-Sep-14*	08-Sep-14	01-Sep-14	08-Sep-14	0	Bridge F2A MJ at Pier F5																							
	Bridge F3A																															
	1013-1428	Bridge F3A Deck Waterproofing	3	07-Sep-14	09-Sep-14	15-Sep-14	17-Sep-14	8	Bridge F3A Deck Waterproofing																							
	1013-1429	Bridge F3A - Seal Deck Opening + Waterproofing Preparation	3	18-Aug-14 A	22-Aug-14	12-Sep-14	14-Sep-14	23	Bridge F3A - Seal Deck Opening + Waterproofing Preparation																							
1013-1430	Bridge F3A Bitumin Paving Works	3	10-Sep-14	12-Sep-14	18-Sep-14	20-Sep-14	7	Bridge F3A Bitumin Paving Works																								
1013-1889	Bridge F3A MJ at Pier F8	6	25-Aug-14*	30-Aug-14	30-Aug-14	05-Sep-14	5	Bridge F3A MJ at Pier F8																								
Bridge F5/F4																																

Remaining Level of Effort

Actual Level of Effort

Actual Work

Remaining Work

Critical Remaining Work

◆ Milestone

Contract HY/2009/19

Three Month Rolling Programme (20 Aug to 19 Nov 2014)

3MRP

3MRP - Aug 2014 to Nov 2014

Page 10 of 15

Activity ID	Activity Name	Rem Dur	Start	Finish	Late Start	Late Finish	Total Float	2014																	
								August						September				October				November			
								0	27	03	10	17	24	31	07	14	21	28	05	12	19	26	02	09	16
	1013-1441	Bridge F4/F5 - Pier F8 to F10 - Top Slab Concreting	0	29-Jul-14 A	10-Aug-14 A	02-Sep-14	02-Sep-14																		
	1013-1441.	Bridge F4/F5 - Pier F9 to F10 - Longitudinal Stitch/ Tie-in + Concreting	0	17-Aug-14 A	19-Aug-14 A	02-Sep-14	02-Sep-14																		
	1013-1455	Bridge F4 Bitumin Paving Works Pier F11 - F14	3	22-Sep-14	24-Sep-14	24-Sep-14	27-Sep-14	3																	
	1013-1456	Bridge F4/F5 Bitumin Paving Works Pier F8 - F11	3	02-Sep-14	04-Sep-14	16-Sep-14	18-Sep-14	11																	
	1013-2103	Bridge F4/F5 - Pier F8 to F9 - Longitudinal Stitch/ Tie-in + Concreting	3	04-Aug-14 A	22-Aug-14	13-Sep-14	15-Sep-14	24																	
	1013-2160	Bridge F4 - Pier F10 to F11 - Top Slab Formworks	0	26-Jul-14 A	17-Aug-14 A	22-Aug-14	22-Aug-14																		
	1013-2162	Bridge F4 - Pier F11 to F12 - Top Slab Formworks	0	30-Jul-14 A	18-Aug-14 A	23-Aug-14	23-Aug-14																		
	1013-2164	Bridge F4 - Pier F12 to F13 - Top Slab Formworks	4	10-Aug-14 A	23-Aug-14	23-Aug-14	27-Aug-14	3																	
	1013-2166	Bridge F4 - Pier F13 to F14 - Top Slab Formworks	3	13-Aug-14 A	22-Aug-14	23-Aug-14	26-Aug-14	3																	
	1013-2168	Bridge F4 - Pier F14 to F15 - Top Slab Formworks	0	09-Aug-14 A	19-Aug-14 A	23-Aug-14	23-Aug-14																		
	1013-2172	Bridge F4 - Pier F10 to F11 - Top Slab Concreting	0	06-Aug-14 A	07-Aug-14 A	22-Aug-14	22-Aug-14																		
	1013-2172.	Bridge F4 - Pier F10 to F11 - Longitudinal Stitch Tie-in - Concreting	1	20-Aug-14	20-Aug-14	02-Sep-14	02-Sep-14	11																	
	1013-2172.	Bridge F4 - Pier F11 to F12 - Top Slab Rebar Fixing + Stitch Tie in	0	12-Aug-14 A	20-Aug-14	22-Aug-14	22-Aug-14	3																	
	1013-2172.	Bridge F4 - Pier F11 to F12 - Top Slab Concreting	1	20-Aug-14	20-Aug-14	06-Sep-14	06-Sep-14	15																	
	1013-2172.	Bridge F4 - Pier F11 to F12 - Longitudinal Stitch Tie-in - Concreting	1	21-Aug-14	21-Aug-14	08-Sep-14	08-Sep-14	15																	
	1013-2172.	Bridge F4 - Pier F12 to F13 - Top Slab Rebar Fixing + Stitch Tie in	4	15-Aug-14 A	23-Aug-14	22-Aug-14	27-Aug-14	3																	
	1013-2172.	Bridge F4 - Pier F12 to F13 - Top Slab Concreting	1	25-Aug-14	25-Aug-14	08-Sep-14	08-Sep-14	12																	
	1013-2172.	Bridge F4 - Pier F12 to F13 - Longitudinal Stitch Tie-in - Concreting	1	26-Aug-14	26-Aug-14	10-Sep-14	10-Sep-14	12																	
	1013-2172.	Bridge F4 - Pier F13 to F14 - Top Slab Rebar Fixing + Stitch Tie in	13	20-Aug-14	03-Sep-14	22-Aug-14	06-Sep-14	3																	
	1013-2172.	Bridge F4 - Pier F13 to F14 - Top Slab Concreting	1	06-Sep-14	06-Sep-14	10-Sep-14	11-Sep-14	3																	
	1013-2172.	Bridge F4 - Pier F13 to F14 - Longitudinal Stitch Tie-in - Concreting	1	08-Sep-14	08-Sep-14	11-Sep-14	12-Sep-14	3																	
	1013-2172.	Bridge F4/F5 MJ at Pier F9	4	20-Aug-14	23-Aug-14	11-Sep-14	15-Sep-14	18																	
	1013-2172.	Bridge F4 MJ at Pier F10	3	21-Aug-14	23-Aug-14	03-Sep-14	05-Sep-14	11																	
	1013-2172.	Bridge F4 MJ at Pier F11	3	22-Aug-14	25-Aug-14	10-Sep-14	12-Sep-14	15																	
	1013-2172.	Bridge F4 MJ at Pier F12	3	27-Aug-14	29-Aug-14	11-Sep-14	13-Sep-14	12																	
	1013-2172.	Bridge F4 MJ at Pier F13	3	10-Sep-14	12-Sep-14	12-Sep-14	16-Sep-14	3																	
	1013-2172.	Bridge F4 MJ at Pier F14	3	10-Sep-14	12-Sep-14	12-Sep-14	16-Sep-14	3																	
All E/B Bridges (Common)																									
	1013-1710	Permanent Noise Barrier Type C1 E/B Bridge Ch 1059-1362 (304m)	36	29-Sep-14	12-Nov-14	18-Nov-14	31-Dec-14	41																	
	1013-1720	Permanent Noise Barrier Type B1 E/B Bridge Ch 962-1059 (132m)	24	29-Oct-14	26-Nov-14	16-Dec-14	15-Jan-15	41																	
	1013-1730	Permanent Noise Barrier Type A1 E/B Bridge Ch 826-962 (136m)	24	12-Nov-14	10-Dec-14	31-Dec-14	29-Jan-15	41																	
	1013-1735	Noise Barrier Mock-up	18	18-Sep-14	11-Oct-14	07-Nov-14	28-Nov-14	41																	
	1013-1826	E/B Bridge Install. Temp. Hydrant (Landside)	4	16-Sep-14*	19-Sep-14	17-Sep-14	20-Sep-14	1																	
10.1.4 - Bridge E / Hing Fat Slip Road																									
Pier Construction																									

Activity ID	Activity Name	Rem Dur	Start	Finish	Late Start	Late Finish	Total Float	2014																
								August						September				October				November		
								0	27	03	10	17	24	31	07	14	21	28	05	12	19	26	02	09
1022-1820	Construct Int. Single Noise Encl. Bridge C5 (75m)	28	15-Feb-16	17-Mar-16	19-Feb-16	23-Mar-16	5																	
Bridge F1C																								
1022-1270	Bridge F1C - Segment Launching from Abutment D12 (7 nos)	8	08-Dec-15	16-Dec-15	07-Dec-15	16-Dec-15	0																	
Bridge C3																								
1022-1670	Bridge C3 Deck Road Surfacing & Marking	9	08-Jun-16	18-Jun-16	24-Jun-16	06-Jul-16	14																	
Bridge C2																								
1022-1770	Bridge C2 Deck Road Surfacing & Marking	9	30-Jun-16	11-Jul-16	06-Jul-16	16-Jul-16	5																	
Bridge C1																								
1022-1810	Bridge C1 Deck Road Surfacing & Marking	3	18-Jul-16	20-Jul-16	16-Jul-16	20-Jul-16	0																	
1022-1880	Bridge C1 Construct Parapet/Profile Barrier (seaside) Pier 17-20 (79m)	24	19-Nov-16	16-Dec-16	02-Jun-17	30-Jun-17	161																	
1022-1890	Construct Int. Single Noise Encl. Pier 17-20 (79m) Stage 2a (3 lane traf.)	24	17-Dec-16	13-Jan-17	30-Jun-17	29-Jul-17	161																	
1022-1900	Construct Int. Single Noise Encl. Pier 17-20 (79m) Stage 3a (2 lane traf.)	24	14-Jan-17	13-Feb-17	29-Jul-17	26-Aug-17	161																	
All W/B Bridges (Common)																								
1022-1910	Fresh Water Main 150DI at W/B Bridge Deck	60	15-Aug-16	26-Oct-16	06-Sep-16	18-Nov-16	20																	
1022-1920	Wing Slab W/B Pier 21 - Pier 43 (615/15m, 6 sets @ 10d cycle)	60	01-Aug-16	12-Oct-16	30-Jul-16	12-Oct-16	0																	
10.3 - Middle Bridge (Bridge F)																								
10.3.1 - Pier Construction																								
Abutment D12																								
1031-1052	Abut D12 (Approach Ramp Area) - Excavation	3	21-Jul-14 A	22-Aug-14	26-Jan-15	28-Jan-15	131																	
1031-1054	Abut D12 (Approach Ramp Area) - Pile Trimming	8	15-Aug-14 A	28-Aug-14	20-Jan-15	28-Jan-15	126																	
1031-1056	Abut D12 (Approach Ramp Area) - Concrete Part 1 of 3	12	29-Aug-14	12-Sep-14	29-Jan-15	11-Feb-15	126																	
1031-1057	Abut D12 (Approach Ramp Area) - Concrete Part 2 of 3	12	13-Sep-14	26-Sep-14	12-Feb-15	28-Feb-15	126																	
1031-1058	Abut D12 (Approach Ramp Area) - Concrete Part 3 of 3	12	27-Sep-14	13-Oct-14*	02-Mar-15	14-Mar-15	126																	
10.3.2 - Bridge Construction																								
Bridge F1B1																								
1032-1270	Bridge F1B1 Segment Launching from Abutment D12 (5 nos)	5	03-Aug-17	08-Aug-17	02-Aug-17	08-Aug-17	0																	
1032-1280	Bridge F1B1 Segment Launching from Pier F1B1 (13 nos)	7	26-Jul-17	02-Aug-17	25-Jul-17	02-Aug-17	0																	
1032-1290	Bridge F1B1 Segment Launching from Pier F2B1 (11 nos)	7	09-Aug-17	16-Aug-17	08-Aug-17	16-Aug-17	0																	
1032-1300	Bridge F1B1 Segment Launching from Pier F3B1 (7 nos)	6	17-Aug-17	23-Aug-17	16-Aug-17	23-Aug-17	0																	
1032-1330	Bridge F1B1 Stitching at midspan between Pier F2B1 and F3B1	3	24-Aug-17	26-Aug-17	23-Aug-17	26-Aug-17	0																	
1032-1340	Bridge F1B1 Permanent Stressing	6	04-Sep-17	09-Sep-17	02-Sep-17	09-Sep-17	0																	
All Middle Bridge F (Common)																								
1032-1360	Bridge F TCSS/E&M Ducts and Supports (F1B1, F1B2, F2B, F3B)	24	11-Sep-17	10-Oct-17	16-Sep-17	17-Oct-17	6																	
1032-1380	Bridge F Deck Road Surfacing & Marking (F1B1, F1B2, F2B, F3B)	12	03-Oct-17	17-Oct-17	13-Oct-17	27-Oct-17	9																	
10.4 - Bridge Deck Demolition																								
10.4.2 - Existing E/B Bridge																								
1031-1058.1	Demolish Beam - Existing Hing Fat St Slip Rd Pier E3 to Pier 20 (9 Beam)	12	27-Sep-14	13-Oct-14	24-Oct-14	07-Nov-14	22																	

- Remaining Level of Effort
- Actual Level of Effort
- Actual Work
- Remaining Work
- Critical Remaining Work
- Milestone

Contract HY/2009/19

Three Month Rolling Programme (20 Aug to 19 Nov 2014)

3MRP

3MRP - Aug 2014 to Nov 2014

Page 13 of 15

Activity ID		Activity Name	Rem Dur	Start	Finish	Late Start	Late Finish	Total Float	2014																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																				
									August						September						October						November																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																		
									0	27	03	10	17	24	31	07	14	21	28	05	12	19	26	02	09	16																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																			
	1031-1058.2	Demolish Pier + Crosshead - Existing Hing Fat Slip Rd Pier 19 to 20	7	07-Oct-14	14-Oct-14	31-Oct-14	08-Nov-14	22																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																					

Activity ID	Activity Name	Rem Dur	Start	Finish	Late Start	Late Finish	Total Float	2014																	
								August						September				October				November			
								0	27	03	10	17	24	31	07	14	21	28	05	12	19	26	02	09	16
10.6 - Tunnel Approach Ramp																									
10.6.1 - Approach Ramp (Excluding Portion IIB)																									
Bored Piles																									
1061-1970	Bored Pile Ramp - BM31	0	05-Aug-14 A	19-Aug-14 A	06-Dec-14	06-Dec-14		Bored Pile Ramp - BM31																	
1061-1980	Bored Pile Ramp - BN25	4	07-Aug-14 A	23-Aug-14	06-Dec-14	10-Dec-14	90	Bored Pile Ramp - BN25																	
1061-2000	Bored Pile Ramp - BM12	0	30-Jul-14 A	15-Aug-14 A	19-Sep-14	19-Sep-14		Bored Pile Ramp - BM12																	
1061-2010	Bored Pile Ramp - BM11	15	20-Aug-14	05-Sep-14	09-Oct-14	25-Oct-14	40	Bored Pile Ramp - BM11																	
1061-2020	Bored Pile Ramp - BM16	15	17-Aug-14 A	05-Sep-14	19-Sep-14	08-Oct-14	25	Bored Pile Ramp - BM16																	
1061-2030	Bored Pile Ramp - BM17	15	06-Sep-14	24-Sep-14	09-Oct-14	25-Oct-14	25	Bored Pile Ramp - BM17																	
1061-2040	Bored Pile Ramp - BM18	15	25-Sep-14	14-Oct-14	27-Oct-14	12-Nov-14	25	Bored Pile Ramp - BM18																	
1061-2050	Bored Pile Ramp - BM09	0	15-Jul-14 A	29-Jul-14 A	20-Sep-19	20-Sep-19		Bored Pile Ramp - BM09																	
1061-2060	Bored Pile Ramp - BN32	15	20-Aug-14	06-Sep-14	01-Sep-14	19-Sep-14	10	Bored Pile Ramp - BN32																	
1061-2070	Bored Pile Ramp - BN34	14	19-Aug-14 A	24-Sep-14	19-Sep-14	08-Oct-14	10	Bored Pile Ramp - BN34																	
1061-2080	Bored Pile Ramp - BN33	15	24-Sep-14	14-Oct-14	09-Oct-14	25-Oct-14	10	Bored Pile Ramp - BN33																	
1061-2090	Bored Pile Ramp - BN35	15	14-Oct-14	31-Oct-14	27-Oct-14	12-Nov-14	10	Bored Pile Ramp - BN35																	
1061-2100	Bored Pile Ramp - BM08	15	31-Oct-14	18-Nov-14*	13-Nov-14	29-Nov-14	10	Bored Pile Ramp - BM08																	
1061-2110	Bored Pile Ramp - BM07	15	18-Nov-14	05-Dec-14	11-Dec-14	29-Dec-14	19	Bored Pile Ramp - BM07																	
1061-2150	Bored Pile Ramp - BS18	15	11-Aug-14 A	05-Sep-14	11-Dec-14	29-Dec-14	94	Bored Pile Ramp - BS18																	
1061-2151	Bored Pile Ramp - BM25	15	20-Aug-14	05-Sep-14	11-Dec-14	29-Dec-14	94	Bored Pile Ramp - BM25																	
A2440	Bored Pile Ramp - BM23	0	31-Jul-14 A	16-Aug-14 A	30-Dec-14	30-Dec-14		Bored Pile Ramp - BM23																	
A2450	Bored Pile Ramp - P29-3	0	10-Jul-14 A	01-Aug-14 A	30-Dec-14	30-Dec-14		Bored Pile Ramp - P29-3																	
10.7 - Section X - Miscellaneous Works																									
10.7.1 - TTM Stages																									
1071-1010	TTM Stage 2A - TTM Enabling Works + Trial Run	6	20-Sep-14	26-Sep-14	21-Sep-14	27-Sep-14	1	TTM Stage 2A - TTM Enabling Works + Trial Run																	
1071-1020	TTM Stage 2A - Hing Fat Slip Road Divert to New E/B Bridge through 'TA'	0		27-Sep-14*		27-Sep-14	1	TTM Stage 2A - Hing Fat Slip Road Divert to New E/B Bridge through 'TA'																	
1071-1100	TTM Stage 3A - Divert W/B 3 lanes traffic from old E/B to new W/B Bridge	0		20-Jul-16		20-Jul-16	0																		
1071-1120	TTM Stage 3B - Divert W/B 4th lane traffic from old E/B to new W/B Bridge	0		18-Nov-16		18-Nov-16	0																		
13 - SECTION 13 OF THE WORKS																									
13.2 - Roadworks																									
1320-1000	Demolition of Ex. Rumsey St Flyover EB at XIII	120	21-Dec-17	21-May-18	21-Dec-17	21-May-18	0																		
1320-1100	Roadwork & Modification at Portion XIII	83	21-May-18	28-Aug-18	21-May-18	28-Aug-18	0																		